



Customer Complaint Notification — e-coat appearance / corrosion protection

Complaint no.	C-OEMN-2026-0327	Date issued	2026-09-23
Supplier	Componentes Arga S.L.	Supplier code	ARGA
Supplier part no.	AR-1009	OEM drawing no.	ON-118870 rev. B (fictitious)
Special characteristic	E-coat thickness (SC)	Quantity NOK (confirmed)	60
Supplier lot (label)	L26250-AR1009-01	Suspect qty delivered	1,580 pcs
Supplier delivery notes	AL-26-00562 — 790 pcs, shipped 2026-09-13 AL-26-00563 — 790 pcs, shipped 2026-09-16	Detected at	OEM Norte cooling module line, incoming audit and paint lab
Part description	Low-temperature radiator bracket	Repeat indicator	POSSIBLE — e-coat porosity complaint on this part no. in 2024 (our ref. C-OEMN-2024-0163)

1. Problem description

Incoming audit on 2026-09-22 found **pores and craters in the e-coat** of low-temperature radiator brackets from lot **L26250-AR1009-01**. After sorting the parts available at the cooling module line, **60 parts** are NOK. The craters are round, Ø 0.3–1.0 mm, some down to bare metal.

Observation (OEM Norte paint lab, report LAB-ON-26-4502)	Result
Location of craters	Along the MIG seam on the rear face and within ± 5 mm of it; 0 craters on flat areas outside that band
E-coat thickness, flat areas (5 points, 10 parts)	19–23 µm (requirement 18–25 µm)
E-coat thickness at crater rim	4–8 µm
EDX at crater centre (3 craters)	Si, Mn and O detected (glassy residue); P and Zn not detected
Adhesion (cross-cut) on flat areas	Gt 0 — conform
Neutral salt spray 480 h	Started 2026-09-22 on 5 parts; result pending (expected 2026-10-12)


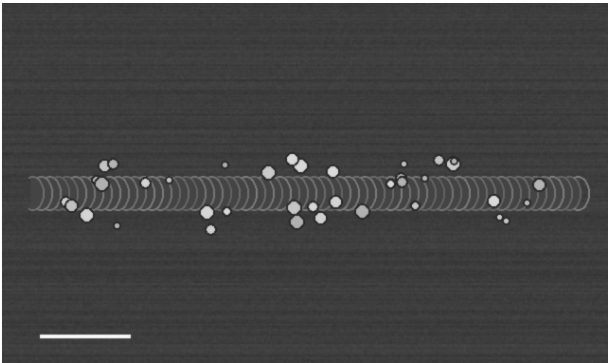


Fig. 1 — Rear face of a NOK part: craters next to the MIG seam (scale bar 10 mm).

rear face — MIG seam and ± 5 mm band (dashed)

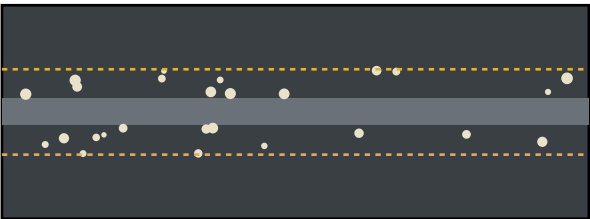

flat areas outside the band: no craters found

Fig. 2 — Distribution of the craters found on 10 NOK parts (schematic).

2. Customer remark

This looks like a repeat of the e-coat porosity problem we had on this part number in 2024 (our ref. C-OEMN-2024-0163). Please confirm whether it is a recurrence and the effectiveness of the actions taken at that time.

3. Requirements to the supplier

1. **Containment within 24 h** (due 2026-09-24): block all suspect stock at the supplier and in transit, sort OEM Norte stock through your resident team or a third party, and confirm the suspect scope from your own traceability (production lots, material lots and delivery notes), not only from the lot on the label. Certified parts must carry a clean-point label.



- 2. **8D report within 10 working days** (due 2026-10-07) using the **OEM Norte 8D Report v3** (form OEMN-SQ-8D rev. 3). D1–D4 must be uploaded to the supplier portal before the due date; the report must be signed by the supplier's Quality Manager.
- 3. Include the salt spray result in D6 when available. Re-coating of complained parts is not approved.
- 4. Sorting, line disruption and administration costs will be handled according to the Supplier Quality Agreement.

4. Customer contact

Contact	M. Ruiz	Role	Supplier Quality Engineer
Phone	+34 948 000 312	E-mail	m.ruiz@oem-norte.example