


X-Ray Spot Repeatability Tools Application Guide

Revision History

[illegible]


Application Procedure

1. Go to the directory path below to access the X-ray Spot log file folder.
C:\Program Files\AXI System\v810\5.0\log\calib\XraySpot

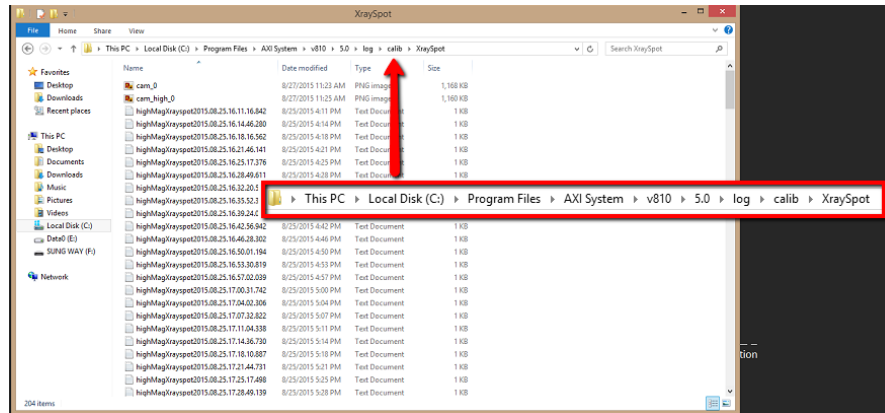


2. Sort all the files in the folder according to "Type". Delete all the files except the 4 png files as in figure below.

Remarks: Delete all the files ensure only the latest data is used for data generation.

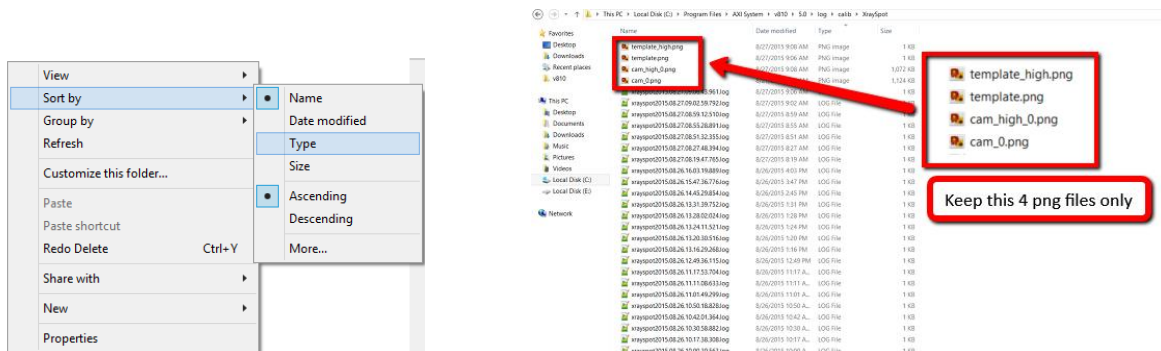


3. Go to v810 GUI "Service Tab", Key in "30" in the loop count tab.

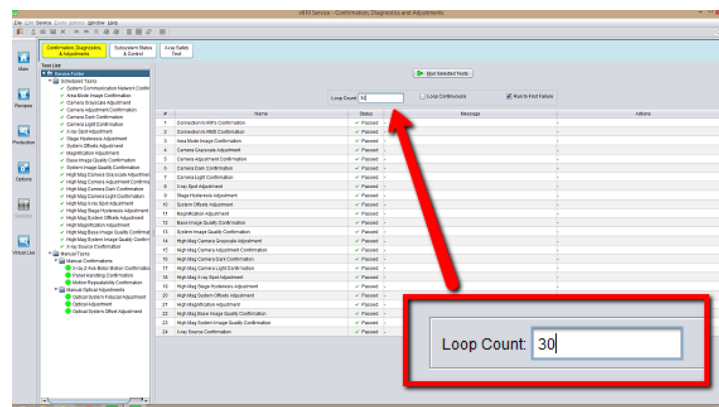


- Right click on the "Schedule Task", and select "Loop 30 times".


Remarks: This step is to running the CD&A task by 30 times for repeatability data collection.

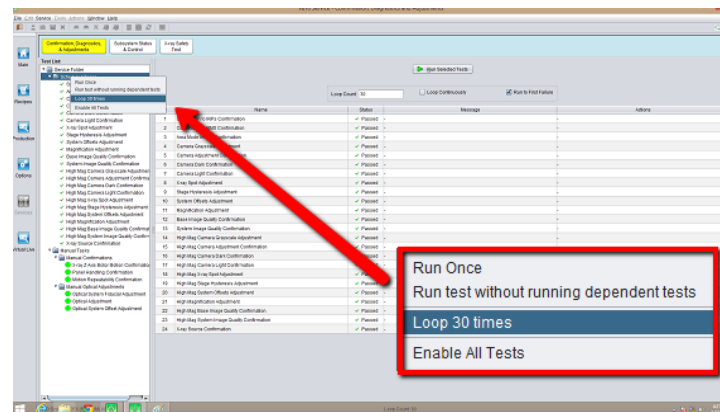


- After the CD&A looping completed, Copy and Paste the " X-ray Spot Repeatability Tools.zip " at Desktop. Unzip the zip file.
- Double click to run the " X-ray Spot Repeatability Tools.exe " in the folder.

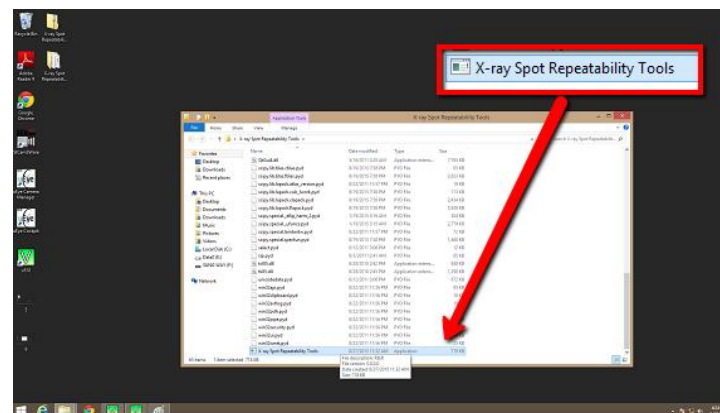


- A window as below will prompt out during the data generation.

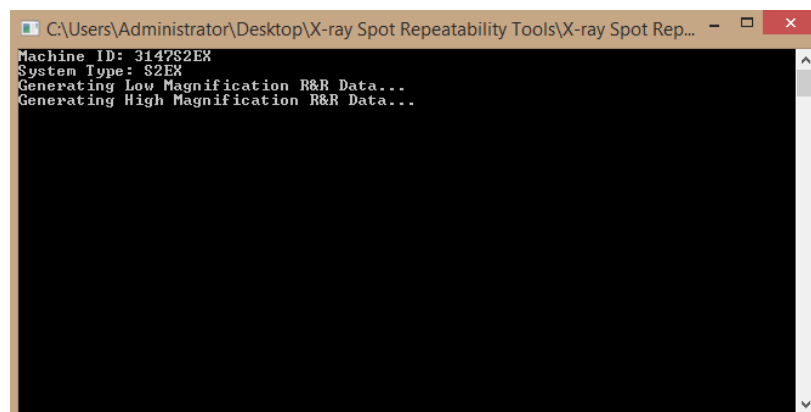


8. Press any key to exit the window after the data generation is completed.

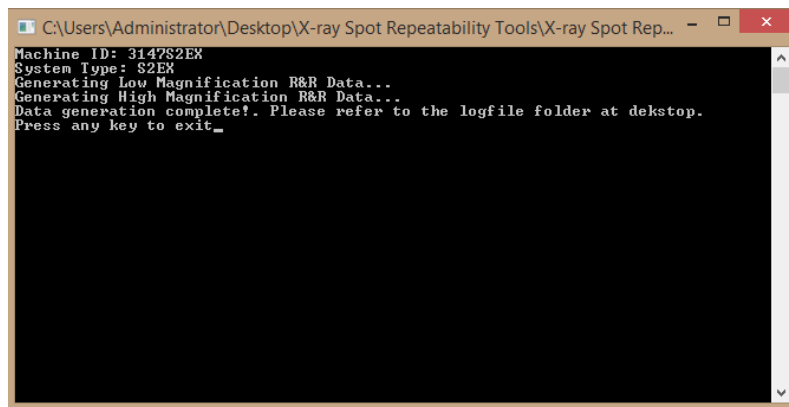


9. A folder as format below will be generated at the desktop.
Remarks: The format of the folder is "RnR_Model_SerialNo" eg. "RnR_S2EX_3147S2EX".

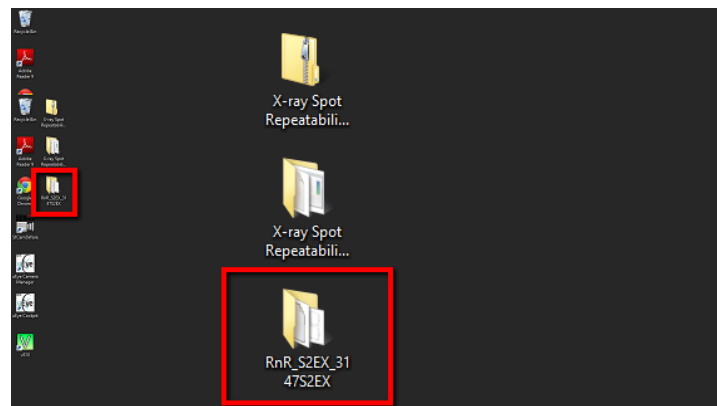

10. Go into the folder and there are 4 files (including 1 chart and 1 log file for each magnification) generated.

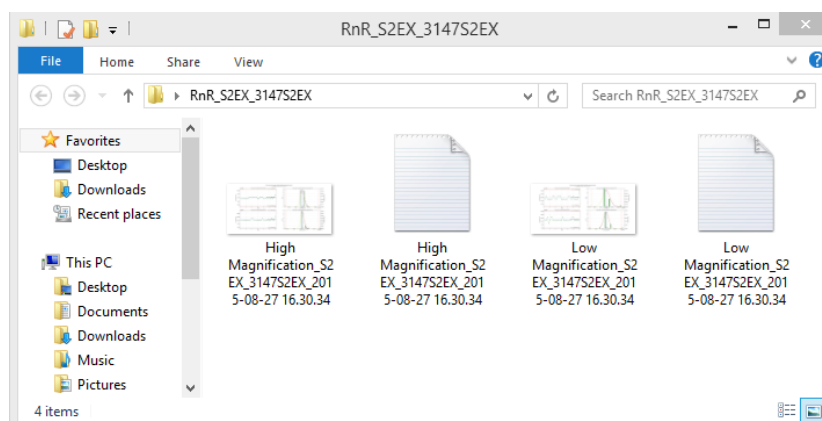

- Remarks: Each magnification will have one analysis chart.



Standard Deviation, Mean, USL, LSL, Cp, Cpk
(5237.0475142647565, 586805200.0, 586805200.0, 586755200.0, 3.182454736427295, 3.182454736427295)