

	Work Instruction	Doc. Revision	00
	AXI V810 X Axis Kollmorgen Module Removal & Replacement	Effective Date	2 Oct 2016

This procedure is applicable to below models:

V810 STD	☒	S1	☒	S2
V810 XXL	☒	S1	☒	S2
V810 S2EX	☒			
V810 Mini	☒			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	2 Oct 2016	First Release	ONG KEAN SHENG

	Work Instruction	Doc. Revision	00
	AXI V810 X Axis Kollmorgen Module Removal & Replacement	Effective Date	2 Oct 2016

Content

X Axis Kollmorgen Removal.....	3
X Axis Kollmorgen Replacement.....	7

	Work Instruction	Doc. Revision	00
	AXI V810 X Axis Kollmorgen Module Removal & Replacement	Effective Date	2 Oct 2016

X Axis Kollmorgen Removal

1. Unload board from machine if any
2. Close X ray Source at Operator Console
3. Close SSCA
4. Identify X axis Kollmorgen (PN,4XASP-A170)location by refer below Figure 1.

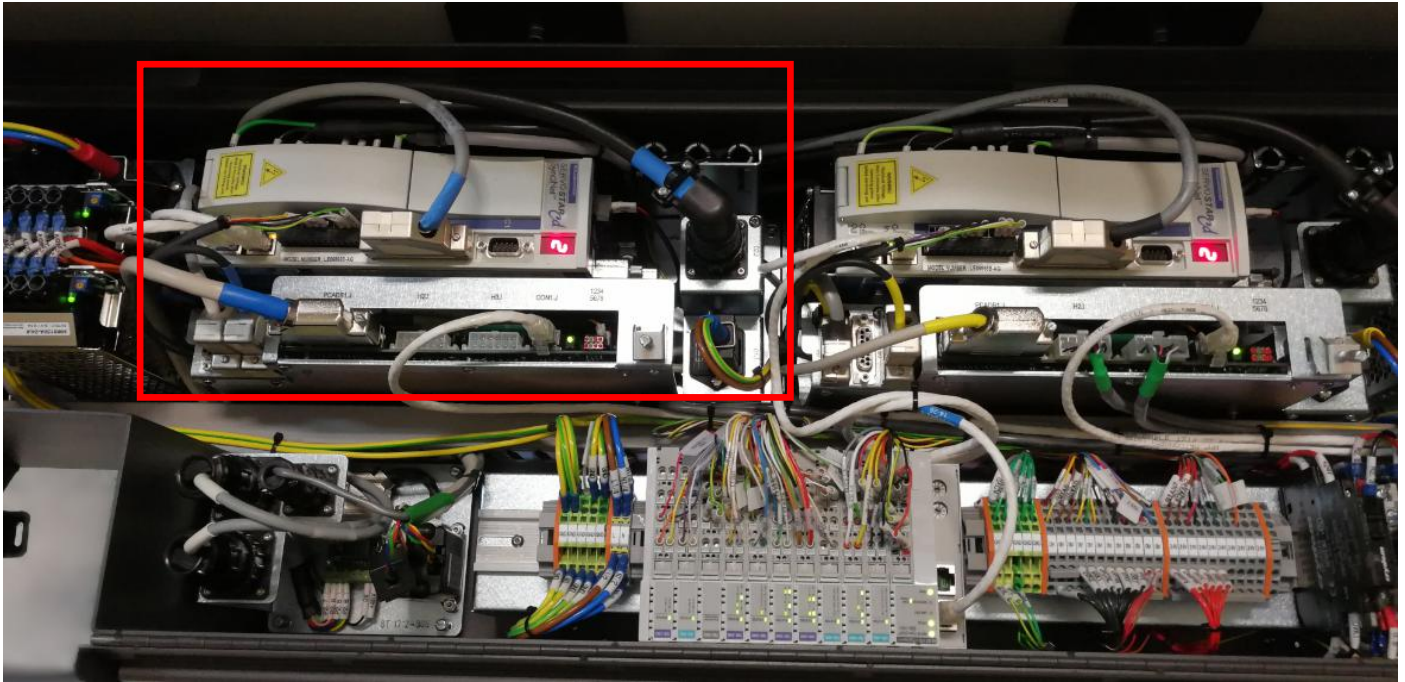


Figure 1

5. Disconnect Power Connector from 01J as below Figure 2.

Remarks :

If Kollmorgen is equipped with Vertical Type Power Connector, Retaining Clip will require to remove in advance

If Kollmorgen is equipped with Horizontal Type Power Connector, may unplug directly

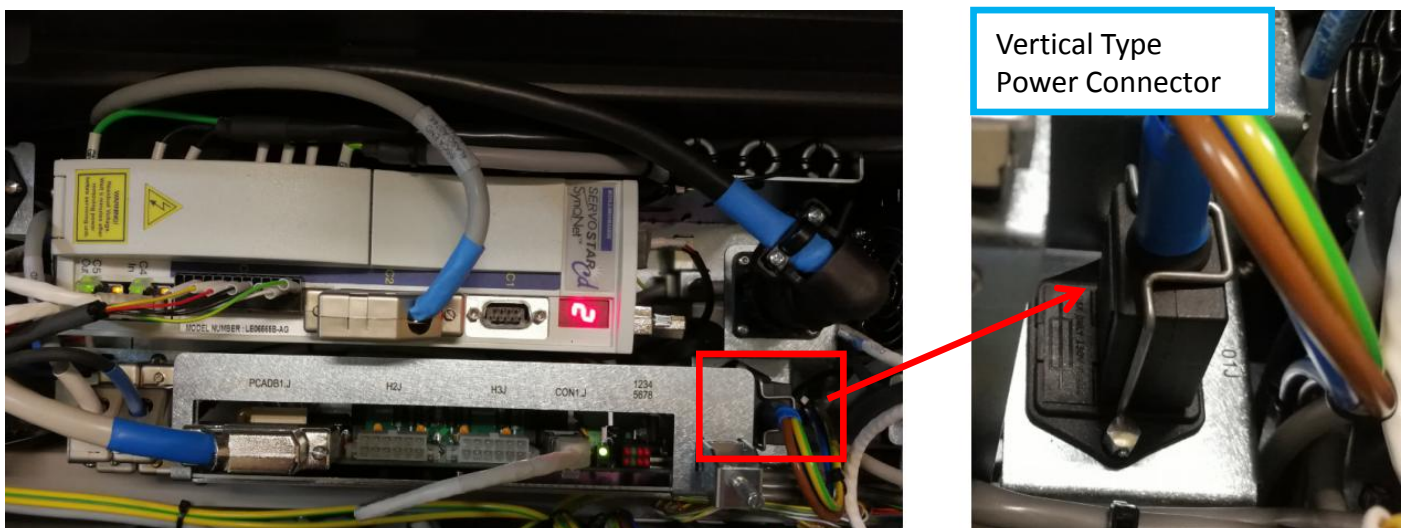


Figure 2

	Work Instruction	Doc. Revision	00
	AXI V810 X Axis Kollmorgen Module Removal & Replacement	Effective Date	2 Oct 2016

6. Disconnect X-Axis Motor Power Cable as Figure 3.

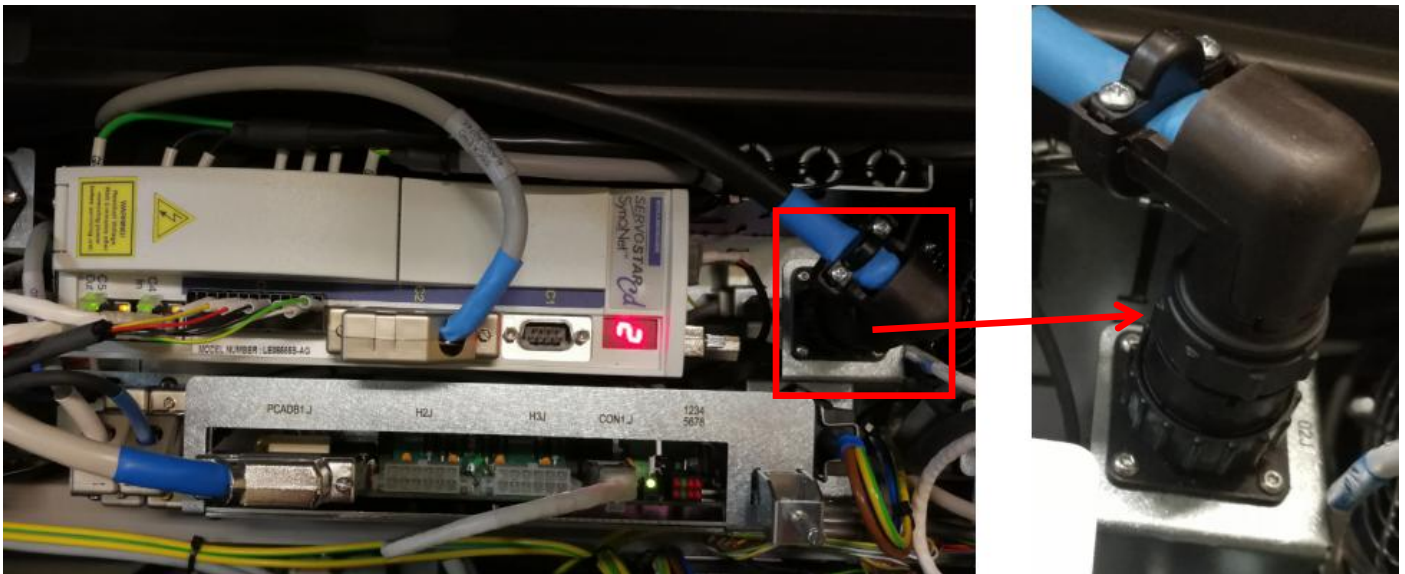


Figure 3

7. Disconnect X-Axis Motor Rotary Cable as Figure 4

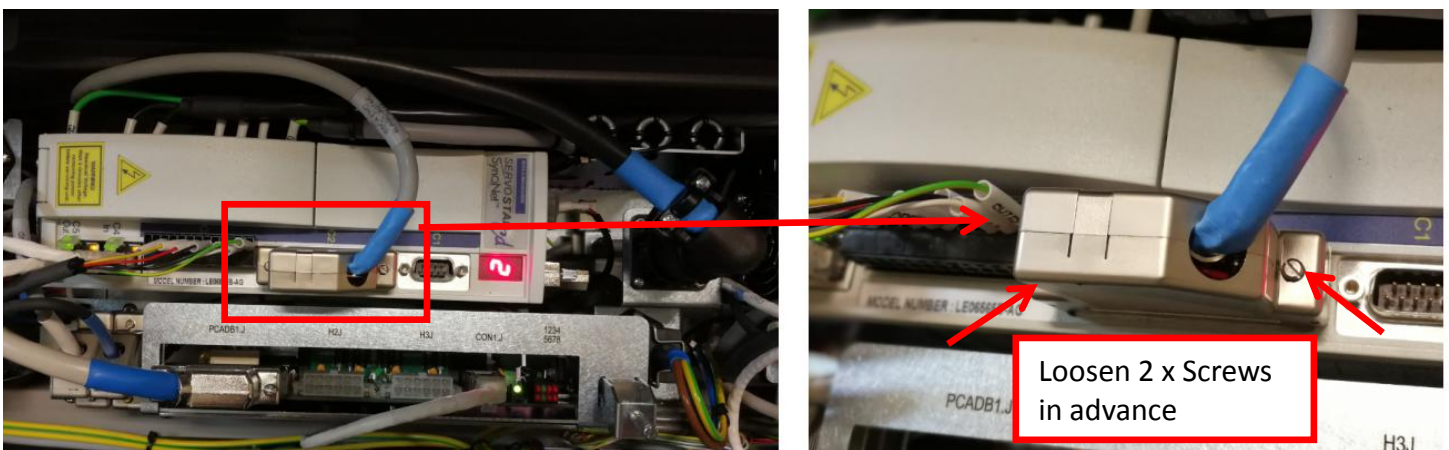


Figure 4

8. Disconnect 2 x Cat 5 Cable from C5 Out & C4 In as below Figure 5.

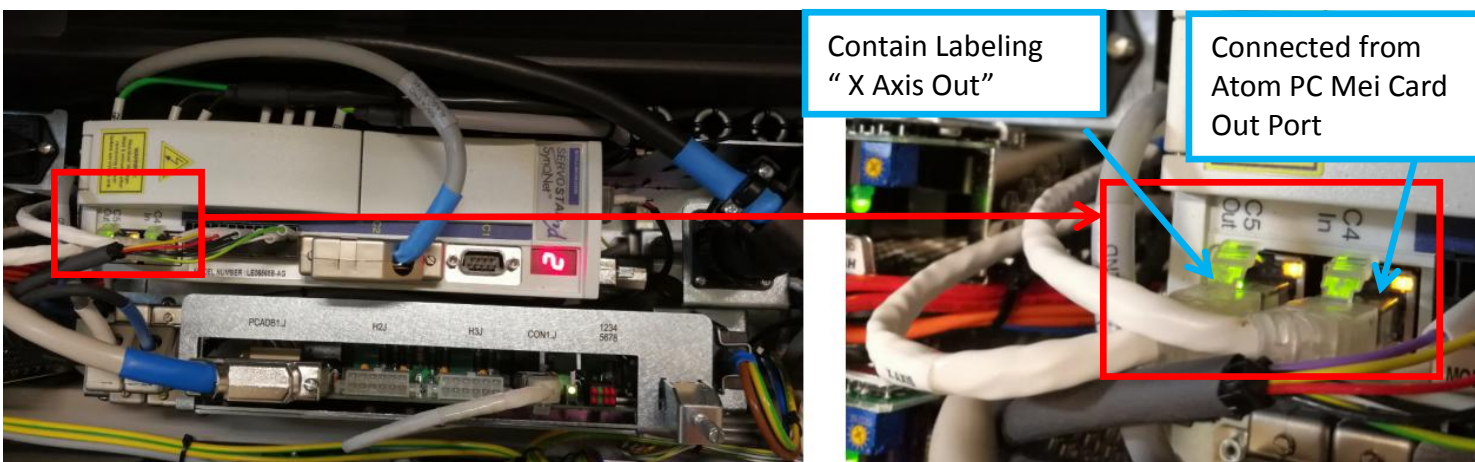


Figure 5

	Work Instruction	Doc. Revision	00
	AXI V810 X Axis Kollmorgen Module Removal & Replacement	Effective Date	2 Oct 2016

9. Disconnect 2 x Connector (24VDC & 5 VDC) from 03J & 04J as Figure 6.

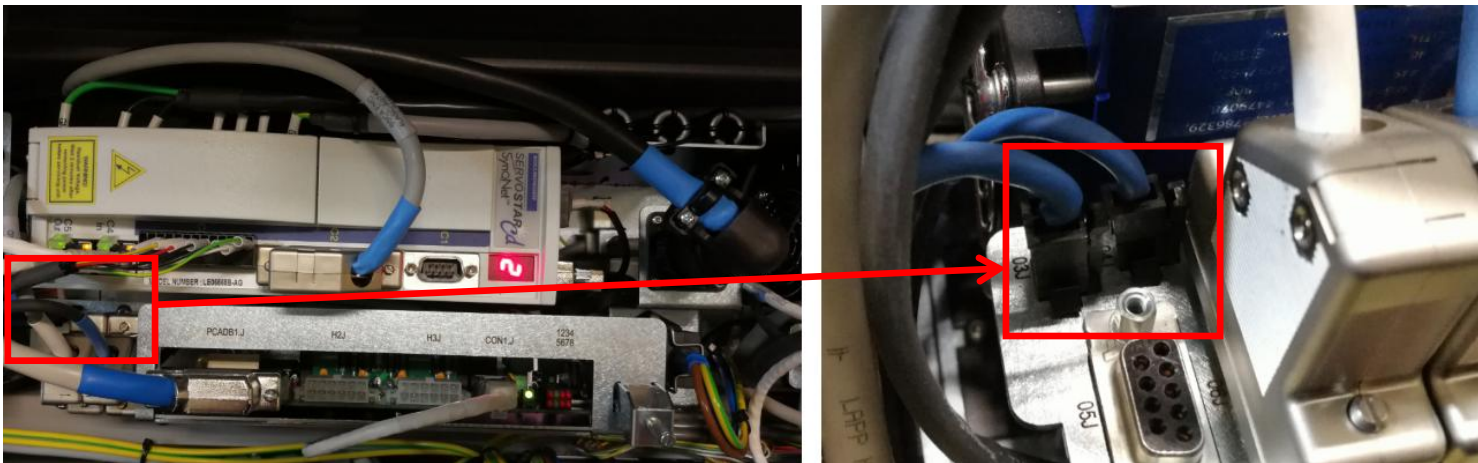


Figure 6

10. Disconnect X axis encoder & AWA Home Sensor connector from 07J & 06J as Figure 7

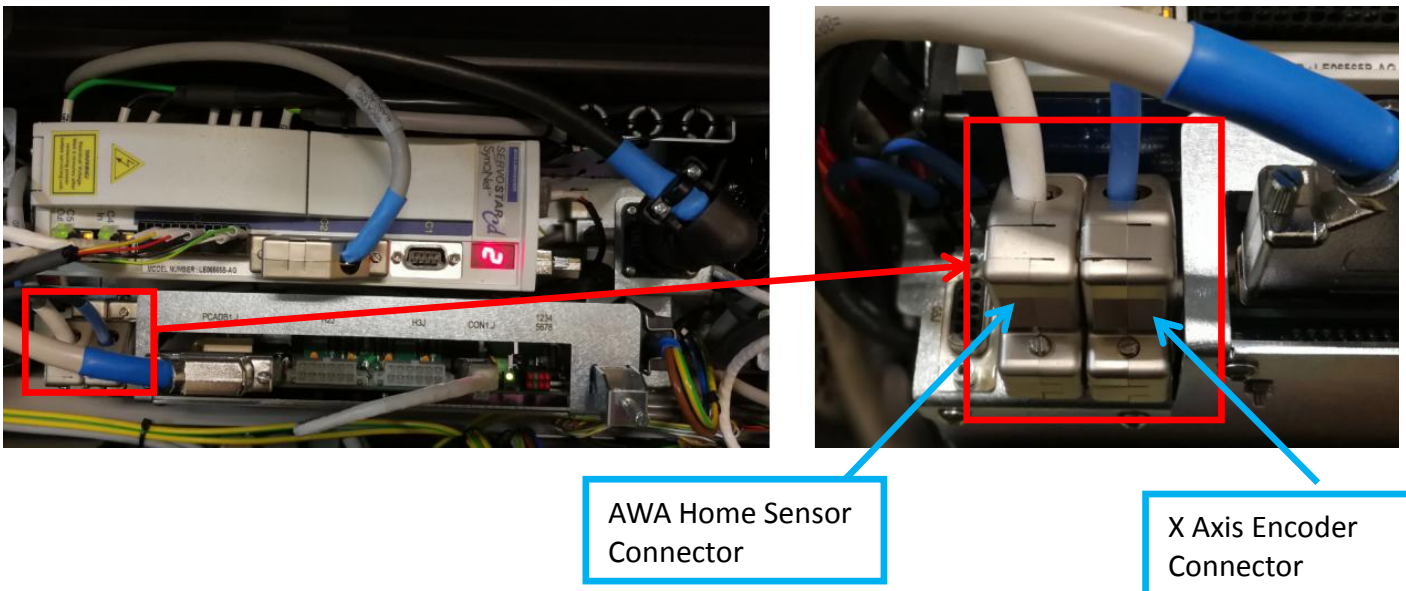


Figure 7

11. Disconnect Stepper Motor Driver connector from PCAADB1J as Figure 8

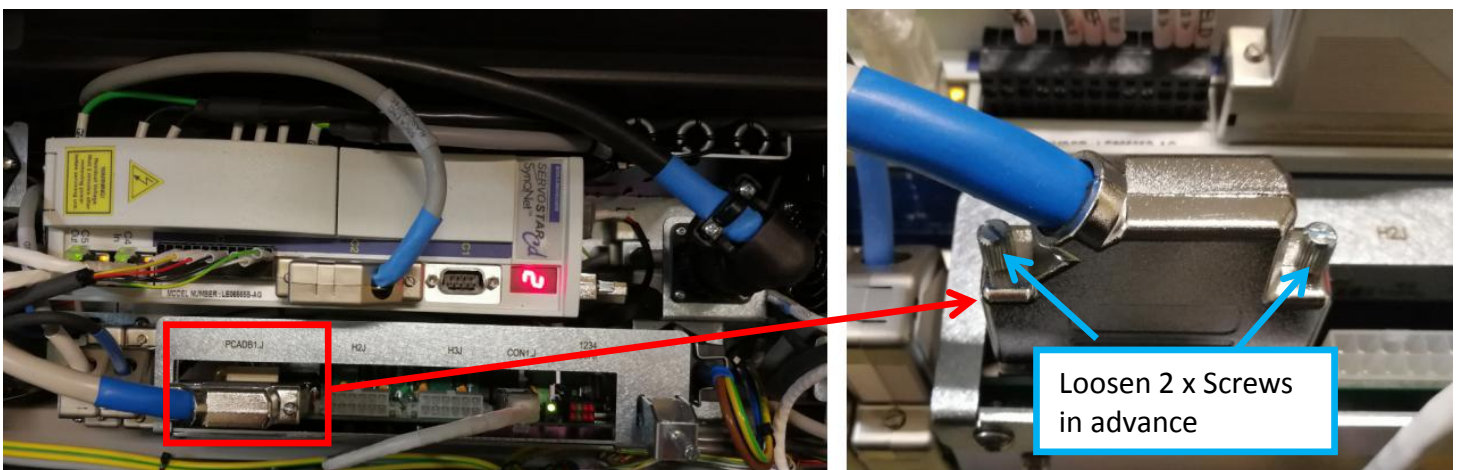


Figure 8

	Work Instruction	Doc. Revision	00
	AXI V810 X Axis Kollmorgen Module Removal & Replacement	Effective Date	2 Oct 2016

12. Disconnect X axis Interlock Cat5 Cable from CON1J as Figure 9.

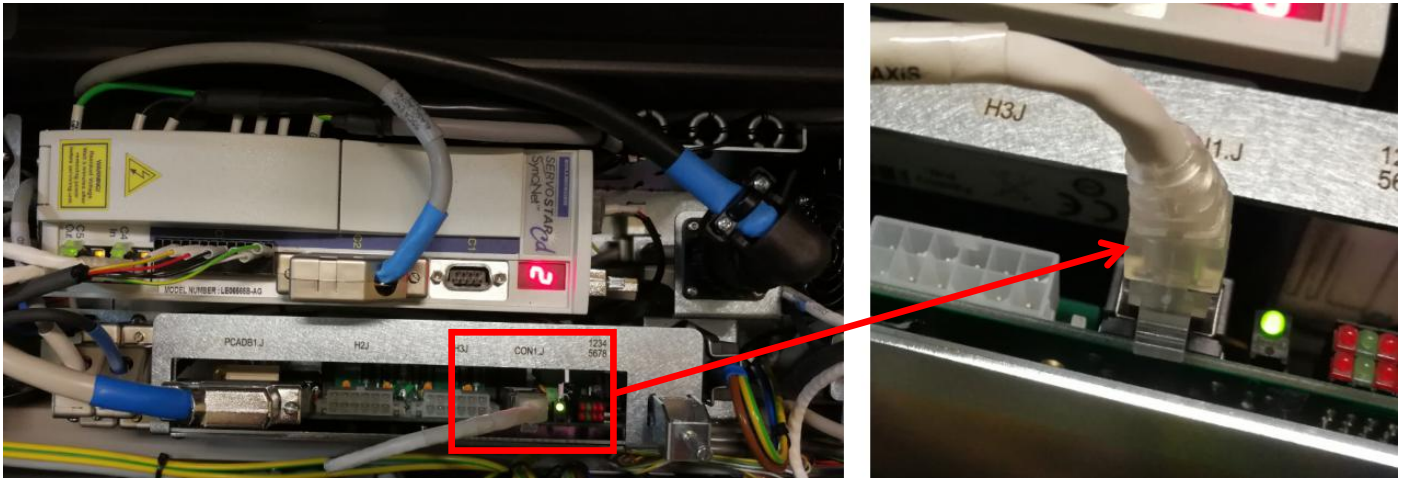


Figure 9

13. Loosen 4 x Screws at Kollmorgen Module Support base as Figure 10.



Figure 10

14. Gently remove entire X Axis Kollmorgen module from SSCA

X Axis Kollmorgen Replacement

15. May refer to below table for replacement step

Model	Machine SN	Referring Step
V810 Std S1/S2	MY10133156 & BELOW	Step 16~41
V810 XXL S1/S2	MY13138020 & BELOW	Step 16~41
V810 S2EX	MY10133156S2EX & BELOW	Step 16~41
V810 Std S1/S2	MY10133157 & ONWARD	Step 27~41
V810 XXL S1/S2	MY13138021 & ONWARD	Step 27~41
V810 S2EX	MY10133157 & ONWARD	Step 27~41

16. Identify Horizontal Type Power Connector where remove at Step 5. Loosen Philip screws at Horizontal Type of Power Connector as Figure 11

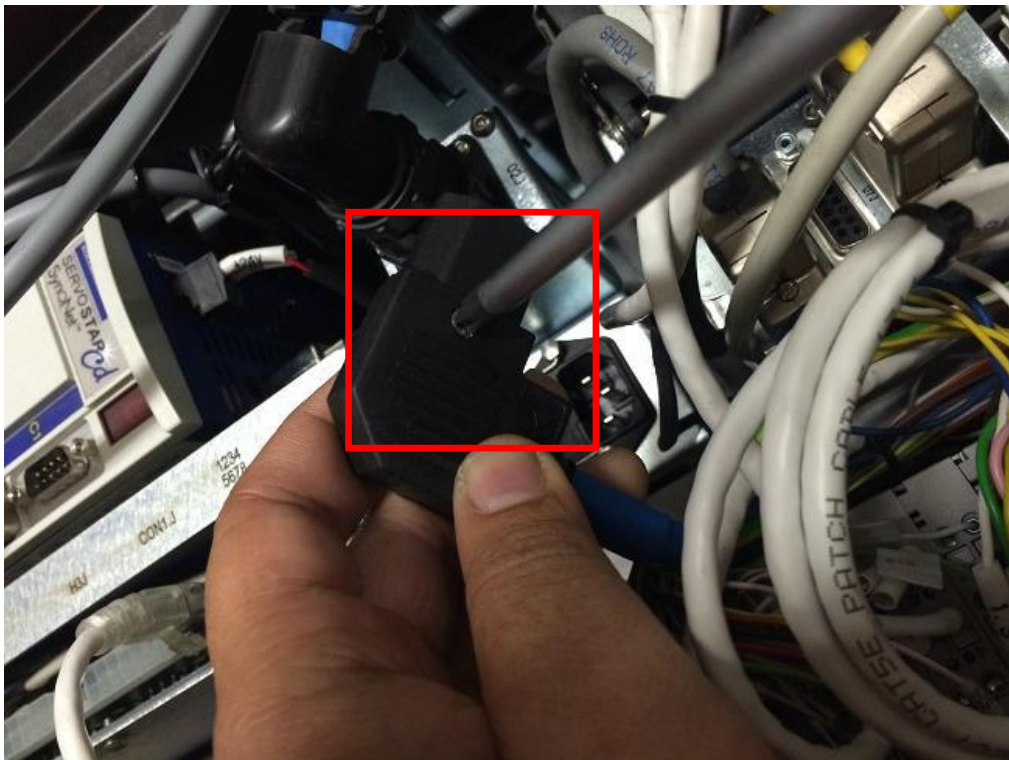


Figure 11

	Work Instruction	Doc. Revision	00
	AXI V810 X Axis Kollmorgen Module Removal & Replacement	Effective Date	2 Oct 2016

17. Open up insulator cover & identify Life(L),Ground(G) & Neutral(N) as Figure 12.

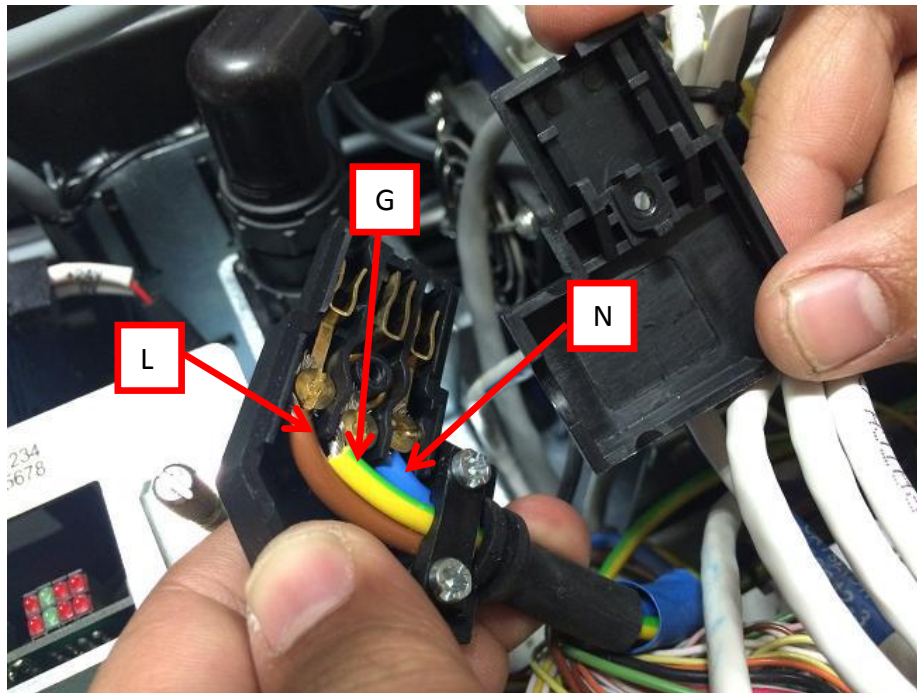


Figure 12

18. Loosen 3 x Flat Head Screw Terminal as Figure 13



Figure 13

	Work Instruction	Doc. Revision	00
	AXI V810 X Axis Kollmorgen Module Removal & Replacement	Effective Date	2 Oct 2016

19. Loosen 2 x Philip screws and remove cable clamp as Figure 14

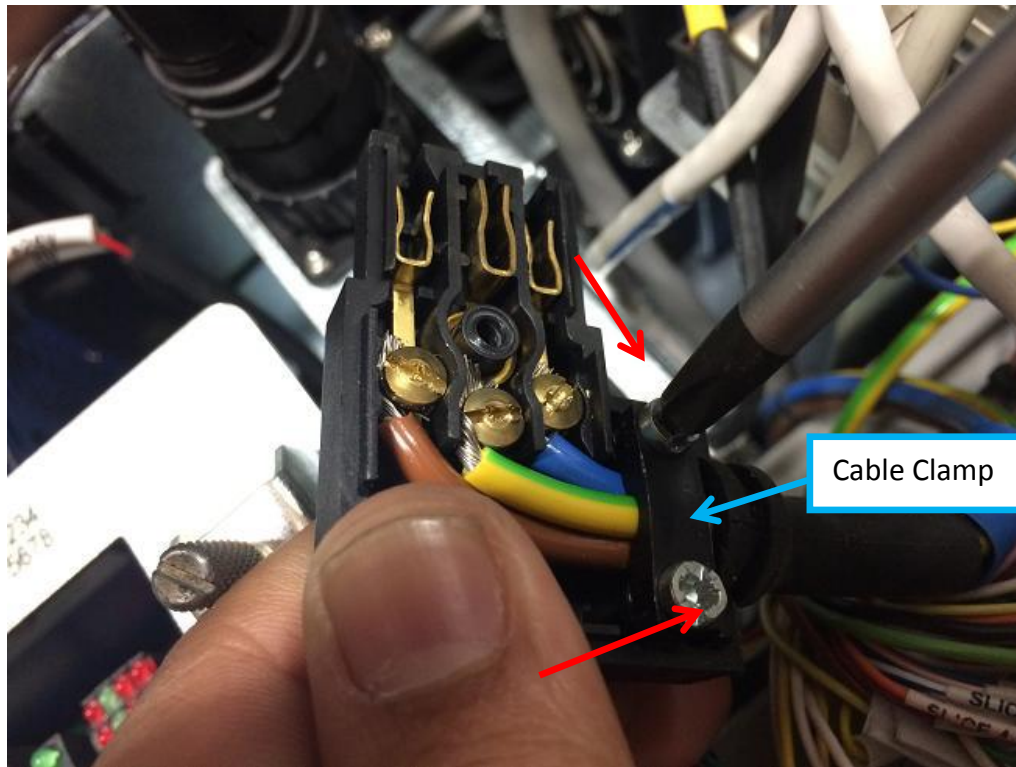


Figure 14

20. Remove 3 x Wire Cores from Horizontal Type Power Connector as Figure 15.

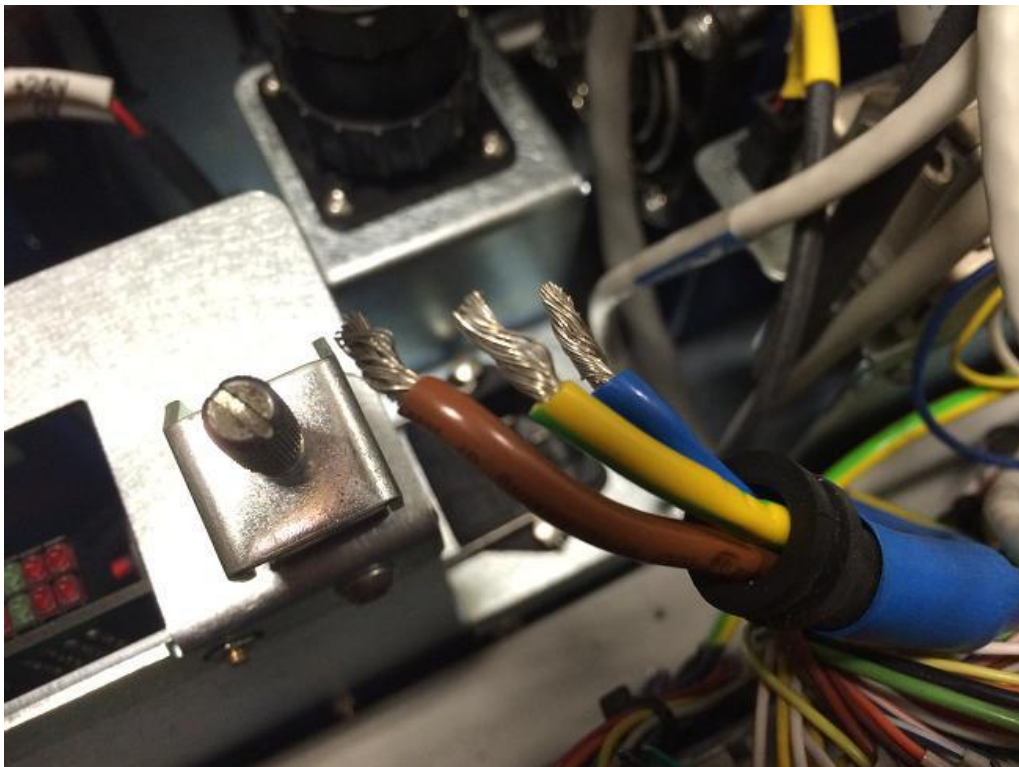


Figure 15

	Work Instruction	Doc. Revision	00
	AXI V810 X Axis Kollmorgen Module Removal & Replacement	Effective Date	2 Oct 2016

21. Gently Cut Brown(Life),Green/Yellow(Ground) & Blue(Neutral) into equivalent length. Strip away cable jacket by Cable Stripper.

Remarks : Caution on cable cutting length to avoid insufficient cable length

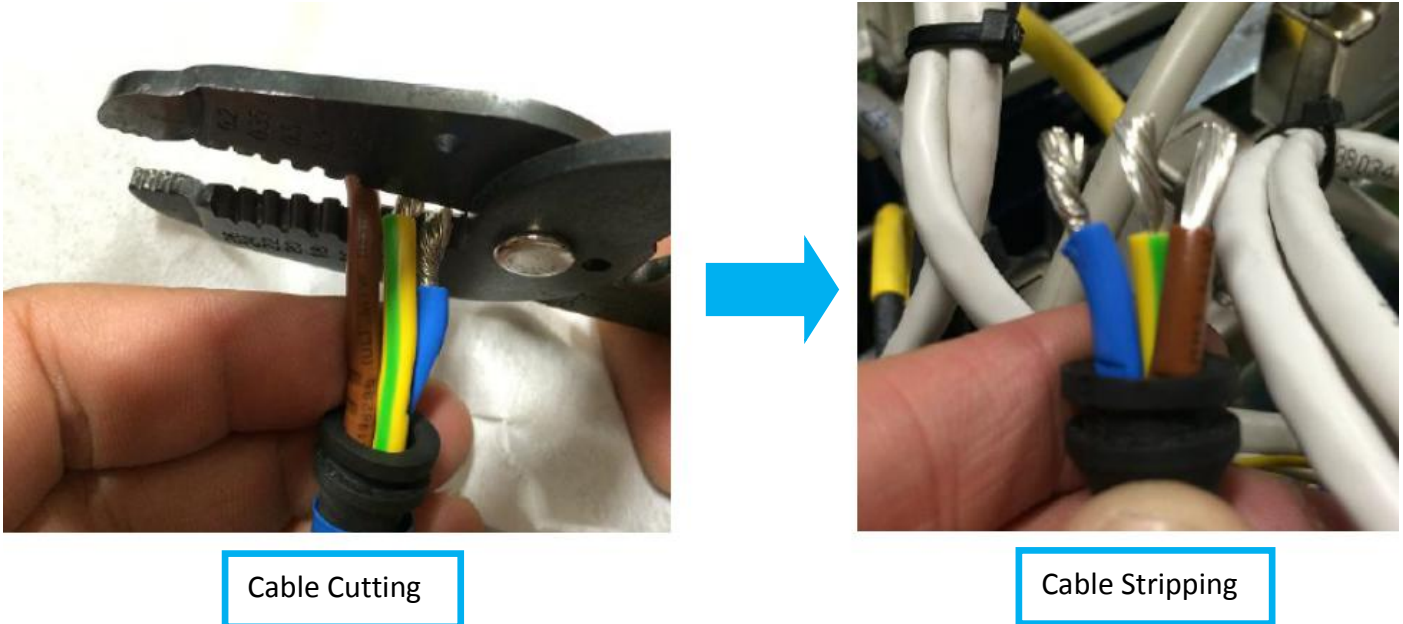


Figure 16

22. Unplug Vertical Type Power Connector from Kollmorgen Module as below Figure 17.

Remarks : Each Kollmorgen Spare Module (4XASP-A170) will equipped with 1 x vertical connector.

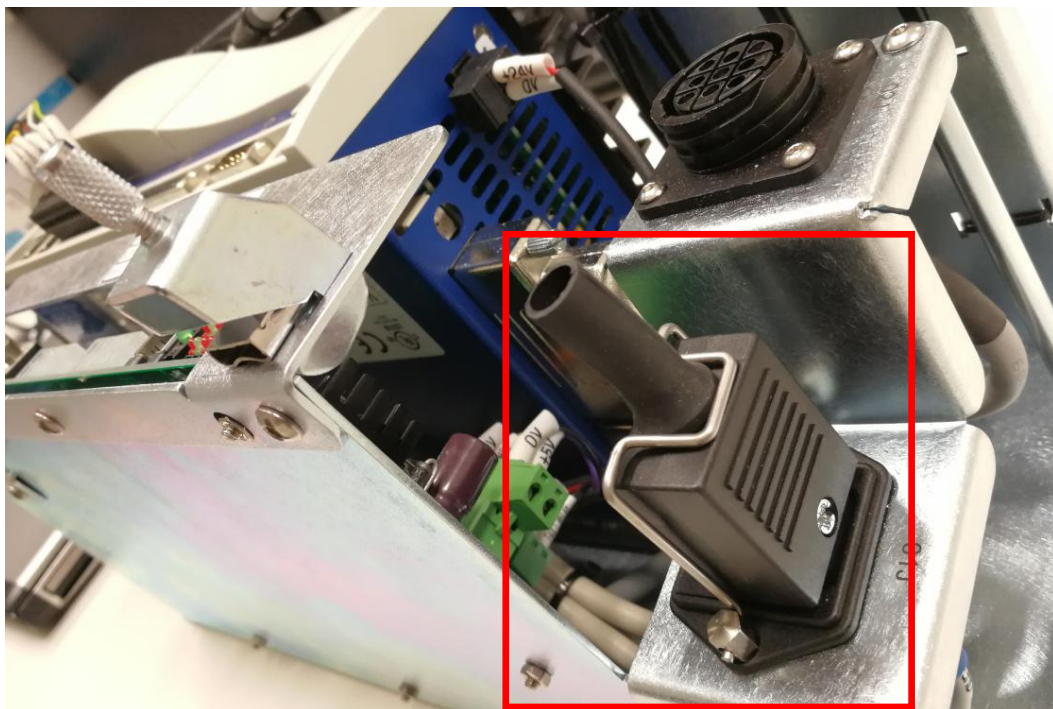


Figure 17

	Work Instruction	Doc. Revision	00
	AXI V810 X Axis Kollmorgen Module Removal & Replacement	Effective Date	2 Oct 2016

23. Open Insulator Cover from Vertical Type Power Connector as below Figure 18. Loosen 2 x Screws on the cable clamp & remove accordingly.

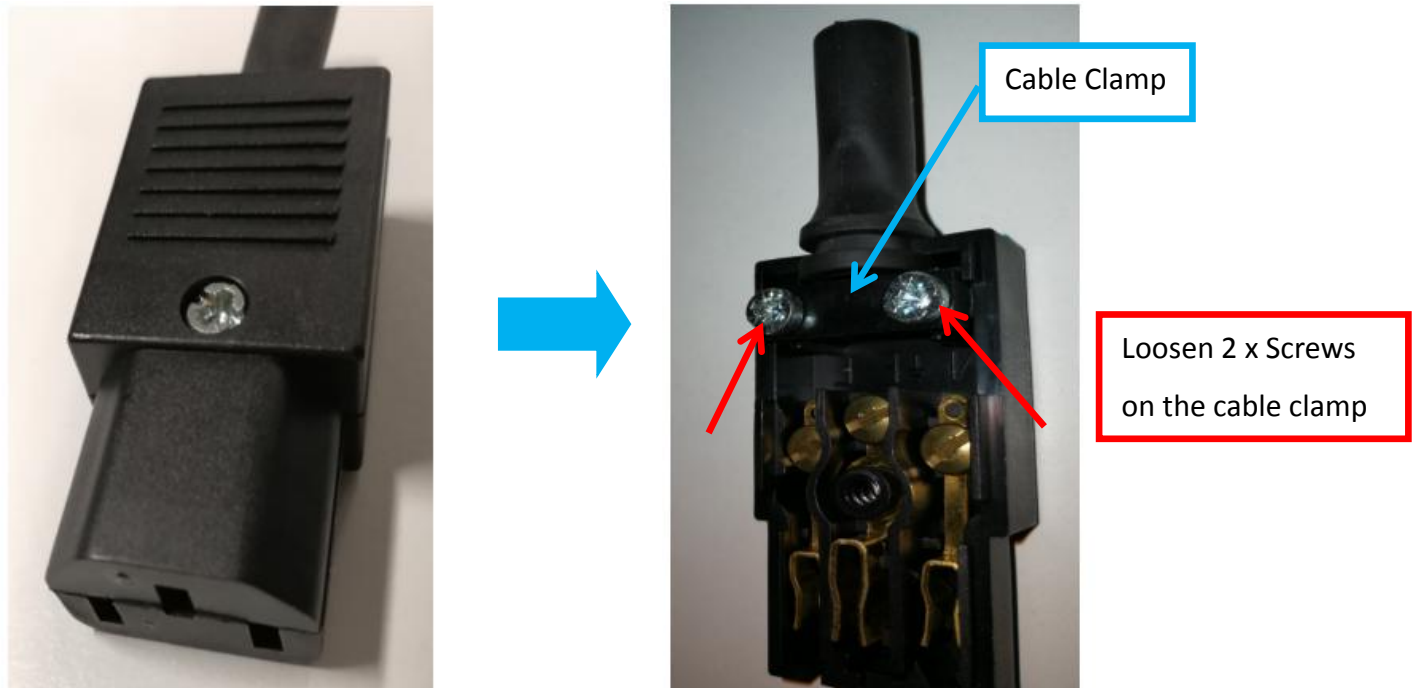


Figure 18

24. Identify the terminal for Life(L), Ground(G) & Neutral & assemble all three cables into respective screw terminals. May refer to below Figure 19.

Remarks : Sleeve Ring which include with Vertical Type Power Connector will not require for assembly.


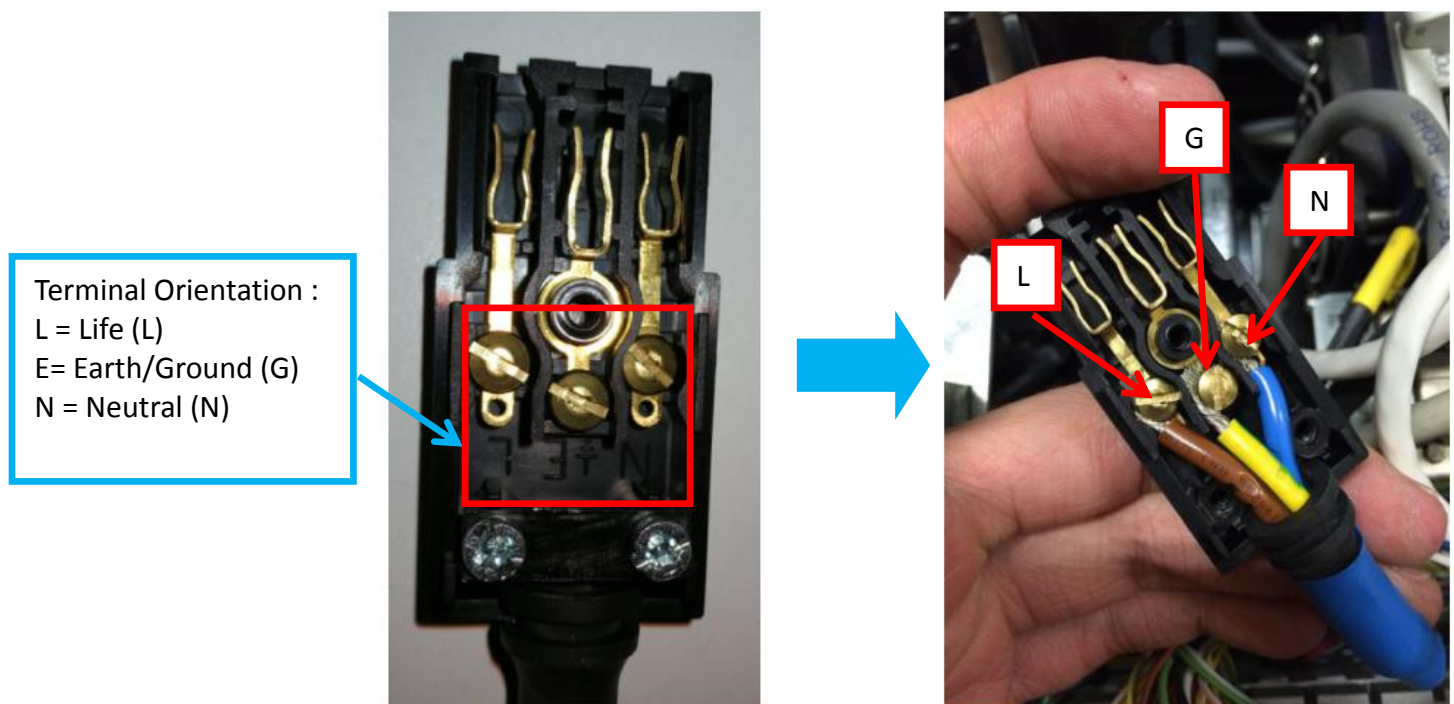



Figure 19

	Work Instruction	Doc. Revision	00
	AXI V810 X Axis Kollmorgen Module Removal & Replacement	Effective Date	2 Oct 2016

25. Gently position sleeve ring where attach with existing power cable into slot as Figure 20. Assemble cable clamp by tighten 2 x Philip screws as Figure 20.

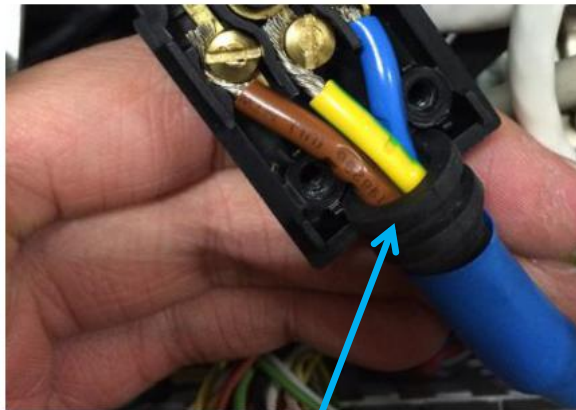

Sleeve ring sit firmly in the slot

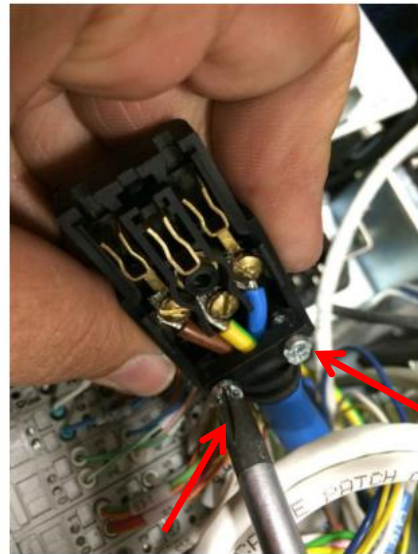

Tighten 2 x Philip screws

Figure 20

26. Assemble the Insulator Cover at Vertical Type Power Connector as Figure 21.

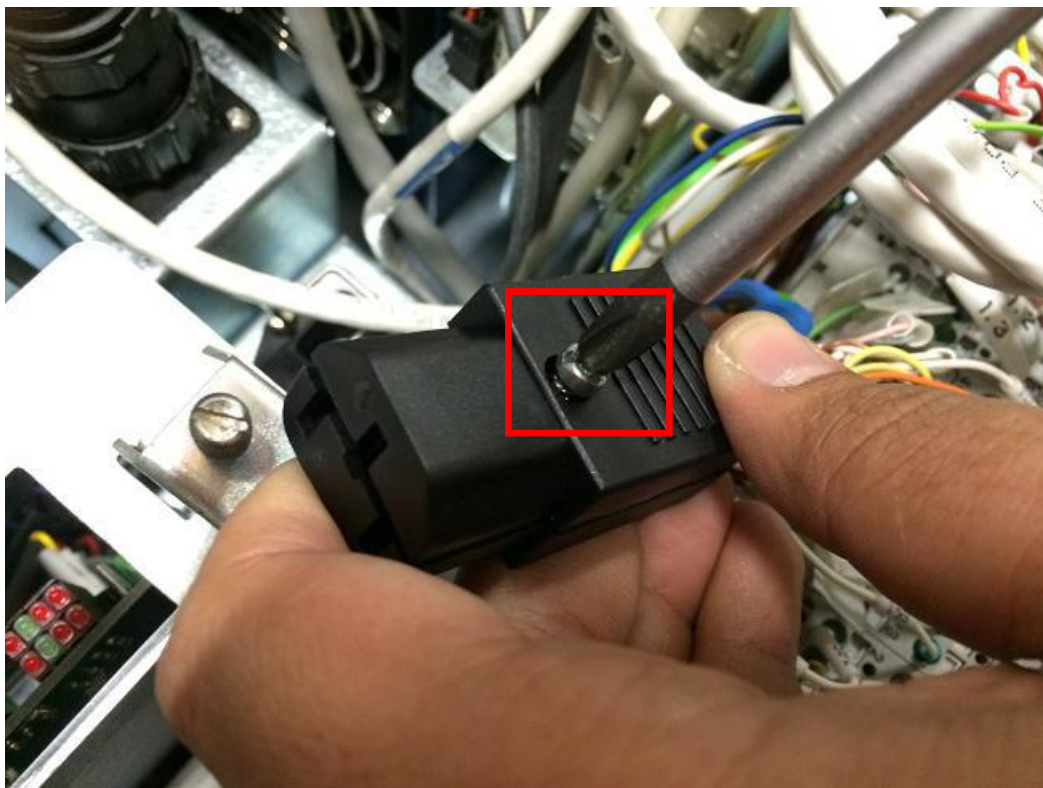


Figure 21

	Work Instruction	Doc. Revision	00
	AXI V810 X Axis Kollmorgen Module Removal & Replacement	Effective Date	2 Oct 2016

27. Gently slot X-Axis Kollmorgen (Pn, 4XASP-A170) into SSCA. Tighten 4 x Screws at Kollmorgen Module Support base as Figure 22.



Figure 22

28. Connect X axis Interlock Cat5 Cable at CON1J as Figure 23 .

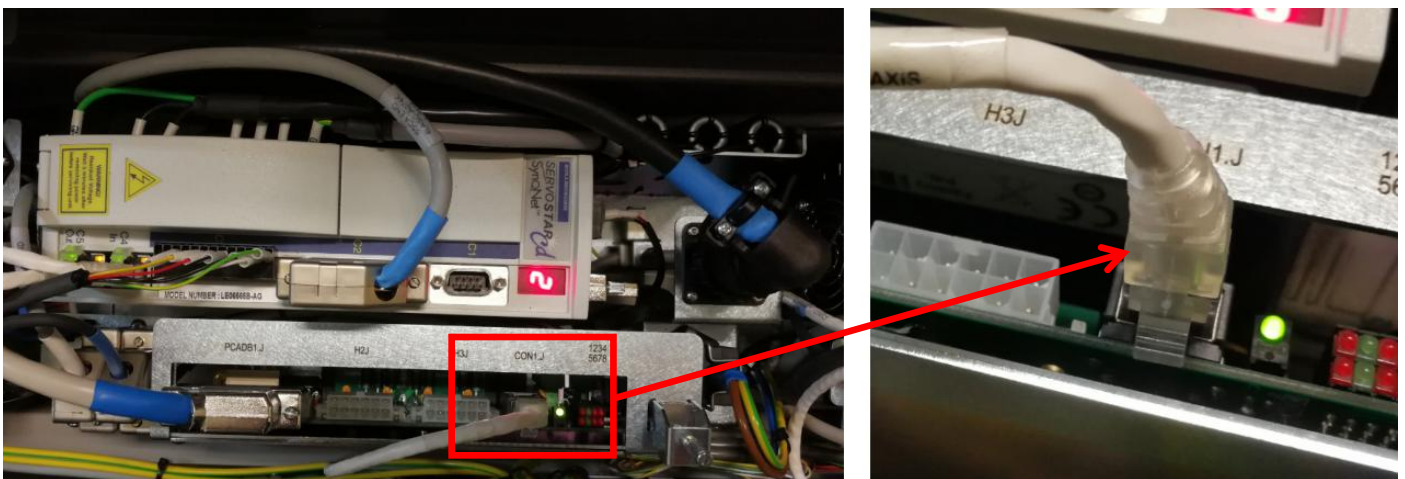


Figure 23

29. Connect Stepper Motor Driver connector at PCAADB1J as Figure 24

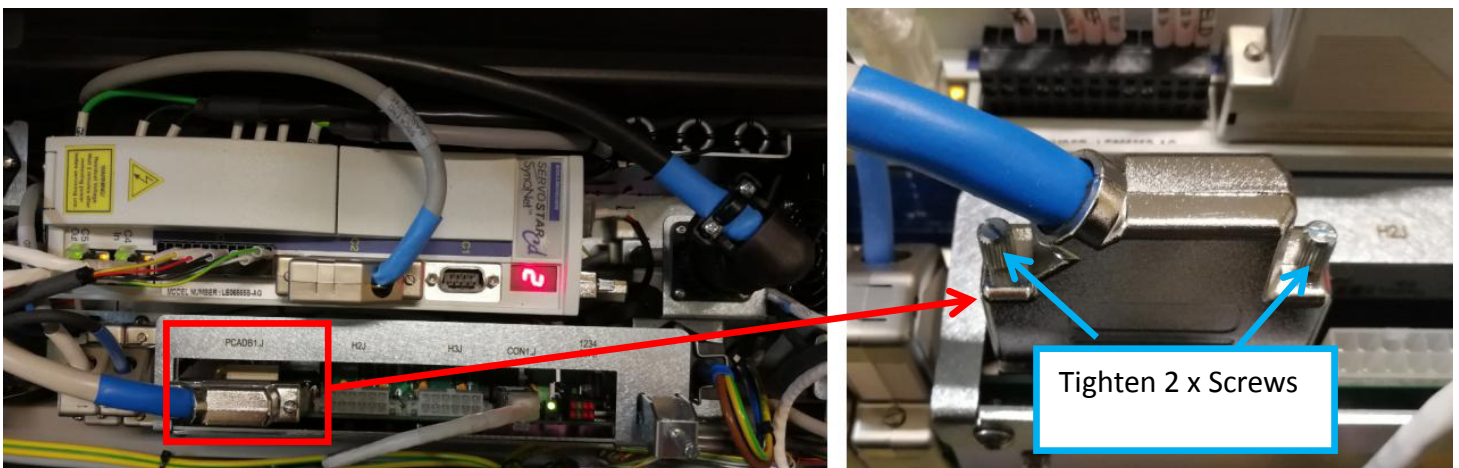


Figure 24

	Work Instruction	Doc. Revision	00
	AXI V810 X Axis Kollmorgen Module Removal & Replacement	Effective Date	2 Oct 2016

30. Connect X axis encoder & AWA Home Sensor connector at 07J & 06J as Figure 25

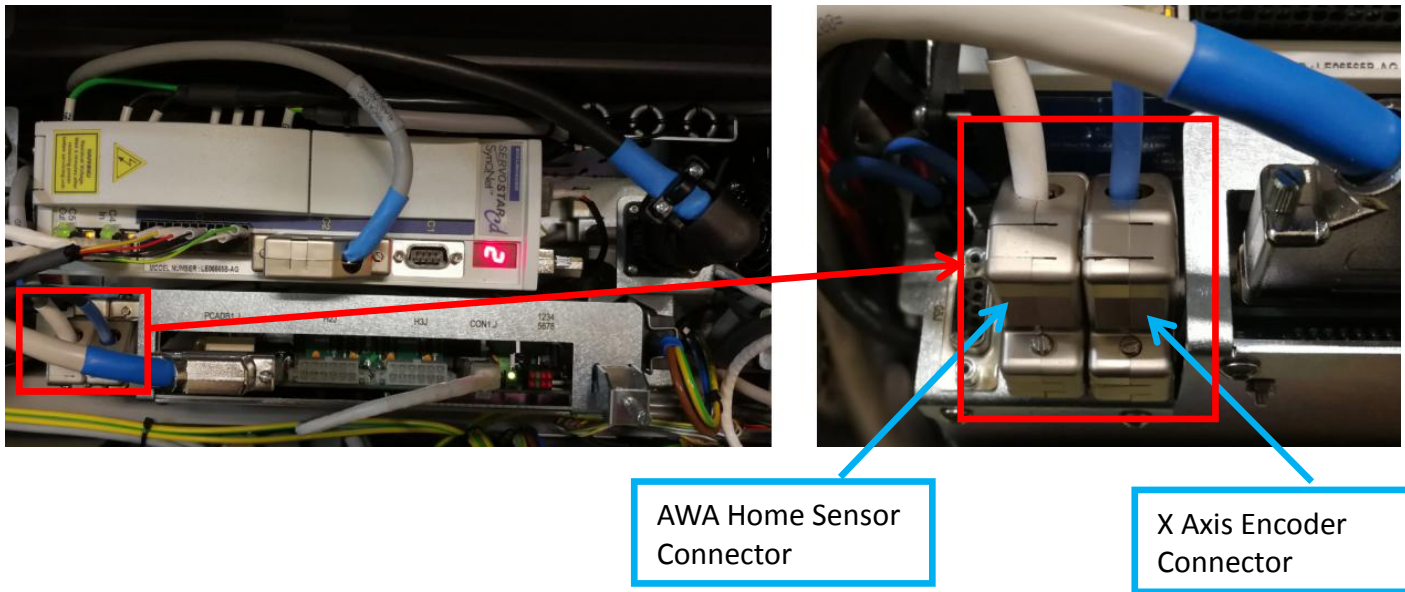


Figure 25

31. Connect 2 x Connector (24VDC & 5 VDC) at 03J & 04J as Figure 26.

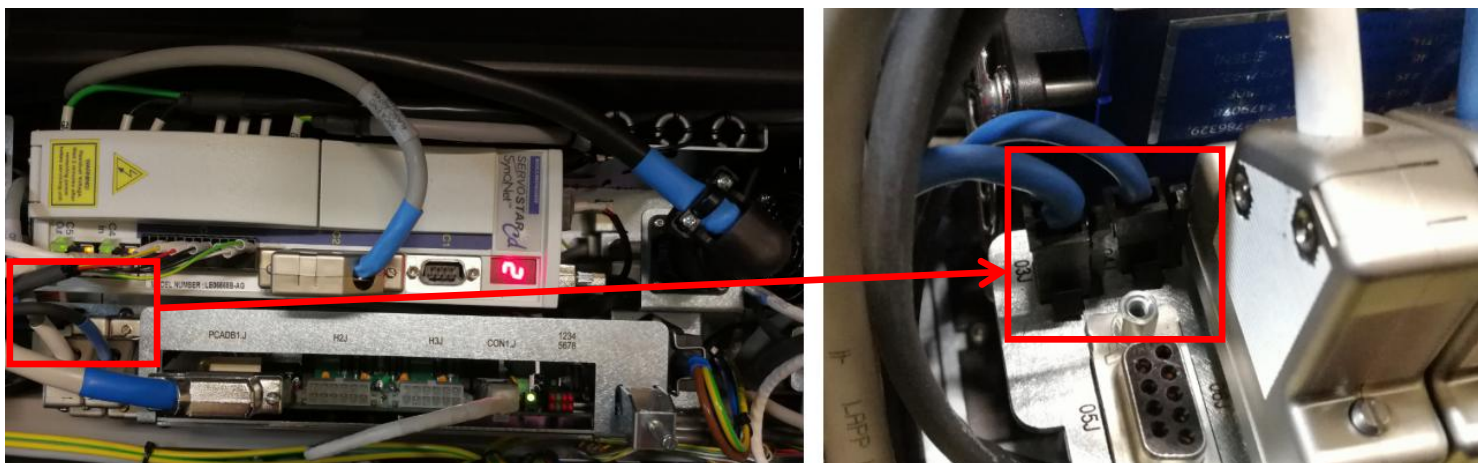


Figure 26

32. Connect 2 x Cat 5 Cable from C5 Out & C4 In as below Figure 27.



Figure 27

	Work Instruction	Doc. Revision	00
	AXI V810 X Axis Kollmorgen Module Removal & Replacement	Effective Date	2 Oct 2016

33. Connect X-Axis Motor Rotary Cable as Figure 28

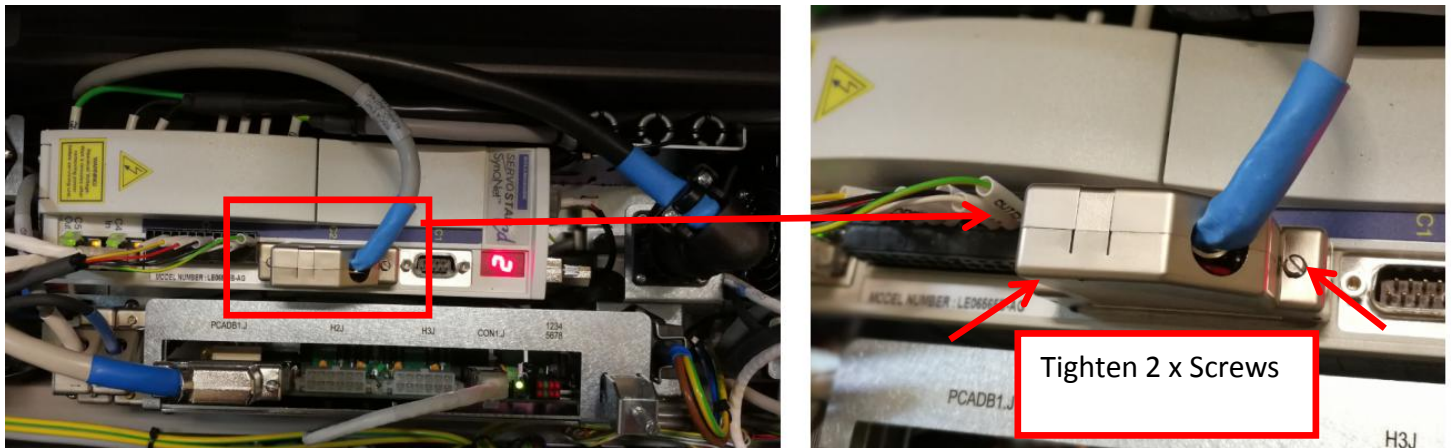


Figure 28

34. Connect X-Axis Motor Power Cable as Figure 29.

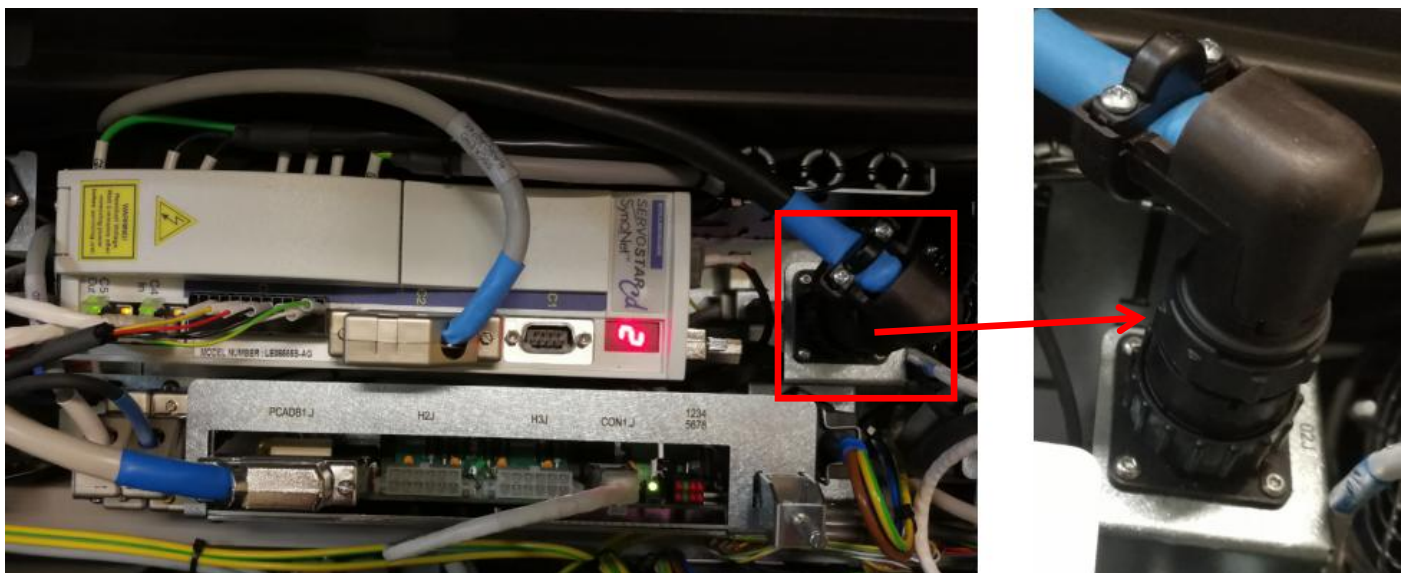


Figure 29

35. Connect Power Connector at 01J as below Figure 30.

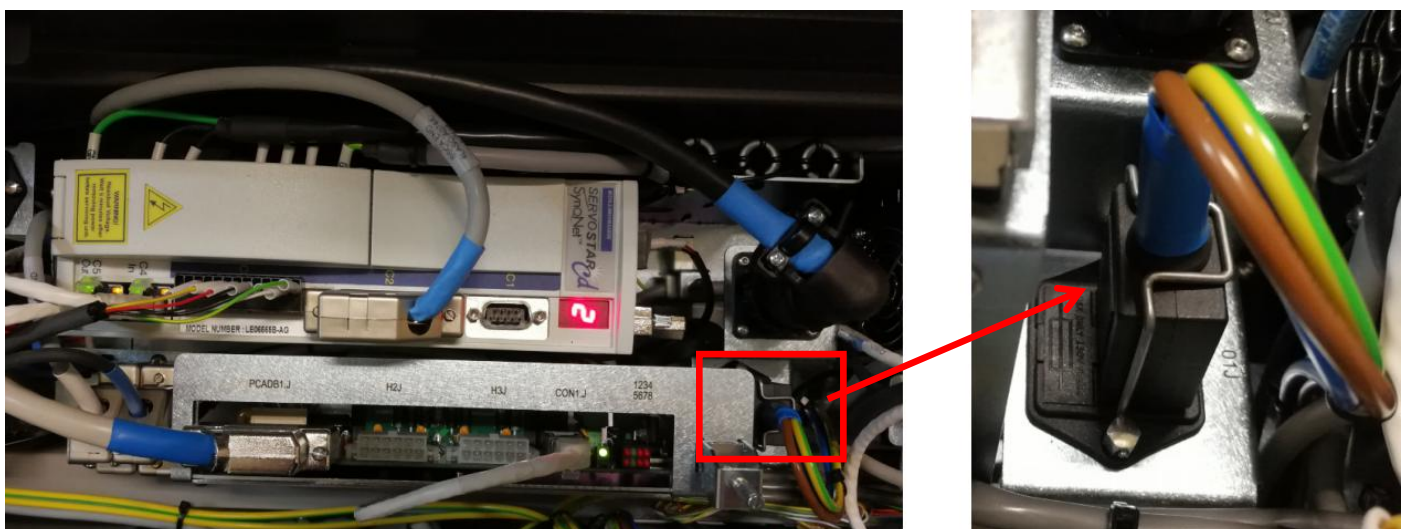


Figure 30

	Work Instruction	Doc. Revision	00
	AXI V810 X Axis Kollmorgen Module Removal & Replacement	Effective Date	2 Oct 2016

36. Turn On SSCA
37. Intialize at Digital IO Page
38. Perform “ Upgrade Firmware” at Motion Control tab
39. Intialize at Motion Control tab
40. Turn on X ray Source at Operator Console Panel
41. Run 1 Loop of CD & A.