

	Work Instruction	Doc. Revision	01
	AXI V810 X ray 3G Camera Replacement Procedure	Effective Date	20 Oct 2017

This procedure is applicable to below models:

V810 STD	☒	S1	☒	S2
V810 XXL	☒	S1	☒	S2
V810 S2EX	☒			
V810 Mini	☐			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	2 Oct 2016	First Release	ONG KEAN SHENG
01	20 Oct 2017	Content Update	MUHAMMED SHAMEEM

	Work Instruction	Doc. Revision	01
	AXI V810 X ray 3G Camera Replacement Procedure	Effective Date	20 Oct 2017

Content

Tools Requirement.....	3
Material.....	3
Failure Identification.....	4
X Ray Camera Removal & Replacement Procedure.....	5

	Work Instruction	Doc. Revision	01
	AXI V810 X ray 3G Camera Replacement Procedure	Effective Date	20 Oct 2017

Tools Requirement

- Phillips screw driver / Allen Key
- Camera tools (PN : 2350-0010)



Figure 1 Camera Tool

Material

X ray camera (PN : 2350-0063/2210-0062)

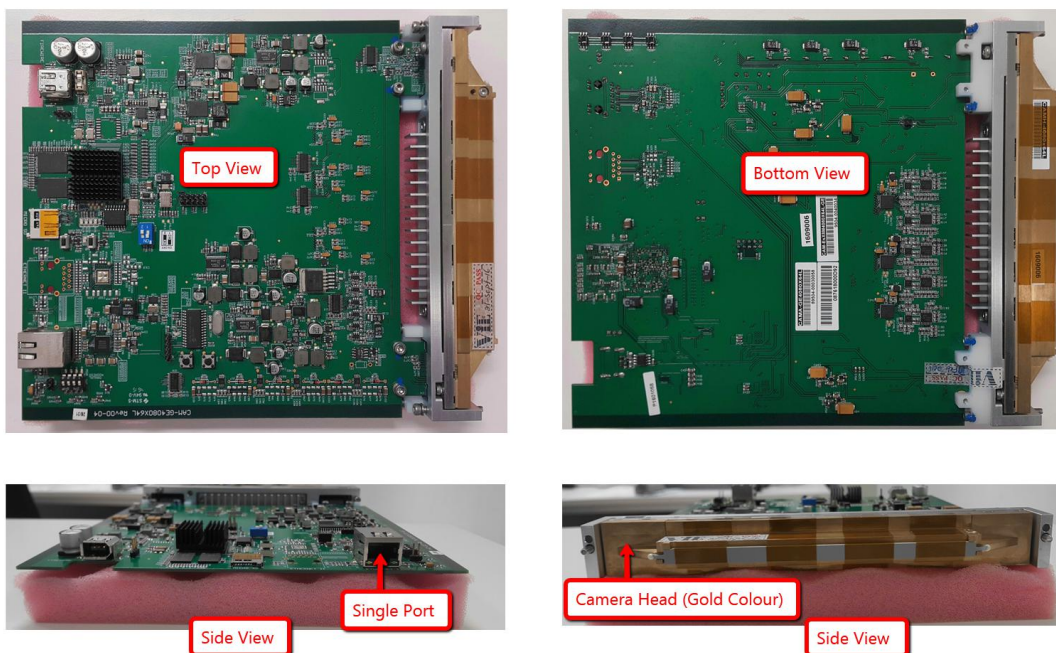


Figure 2 3G Camera (Single Port) ,PN : 2350-0063


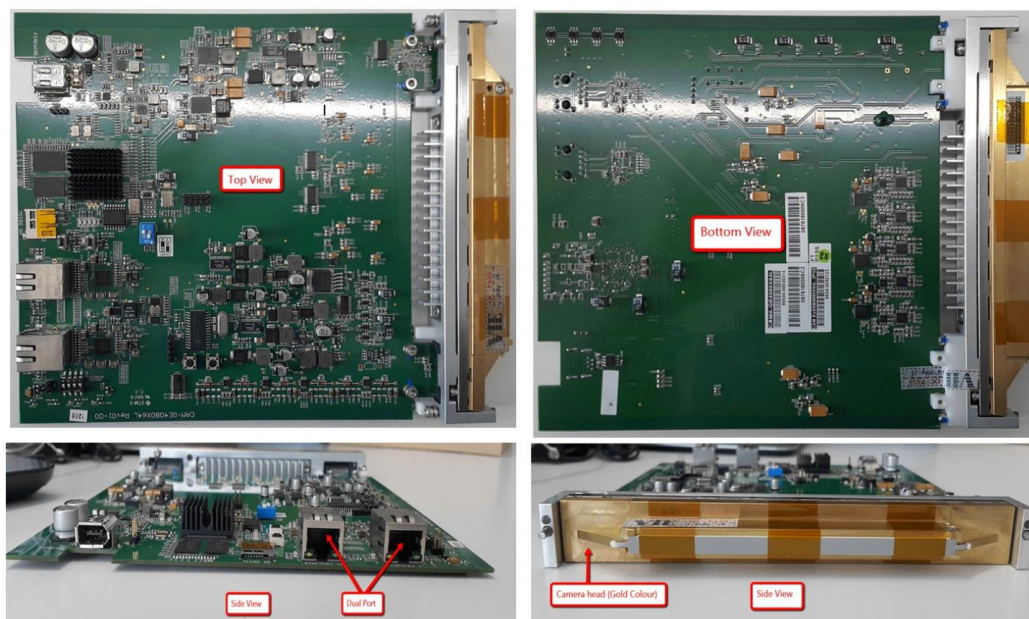


Figure 3 3G Camera (Dual Port), PN : 2210-0062

	Work Instruction	Doc. Revision	01
	AXI V810 X ray 3G Camera Replacement Procedure	Effective Date	20 Oct 2017

Failure Identification

1. Go to "C:\Program Files\AXI System\v810\REV\ \log\confirm\areaModelImage.
2. Delete all entire .png file only except log file as below Figure 4

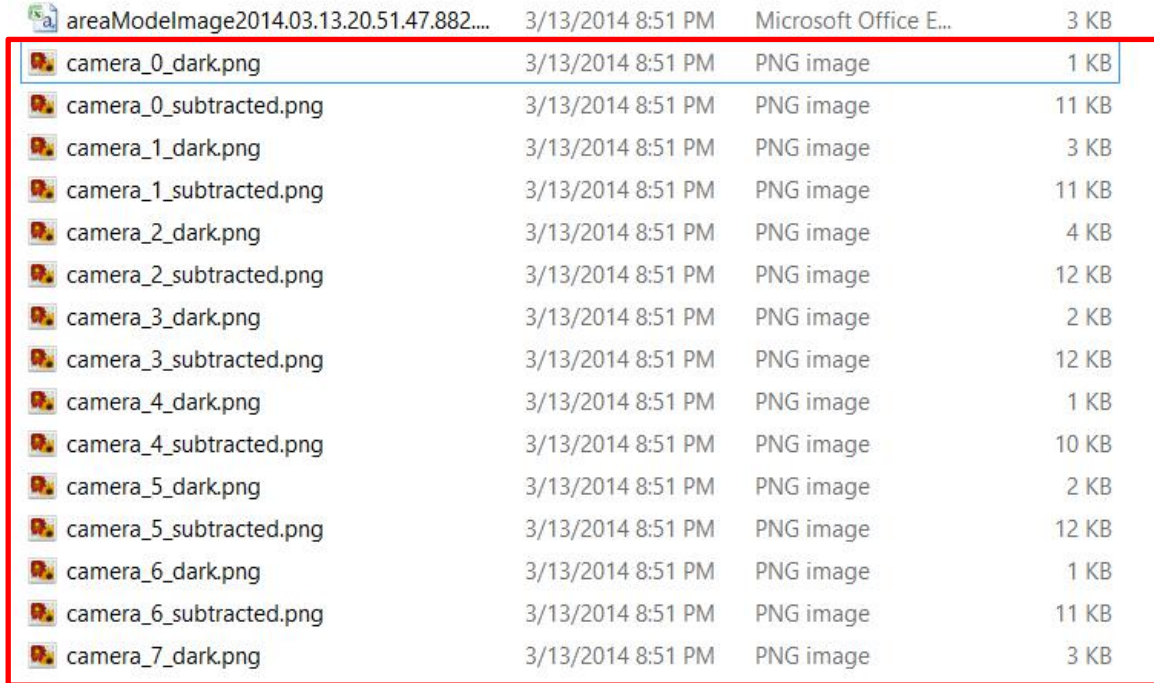

areaModelImage2014.03.13.20.51.47.882....	3/13/2014 8:51 PM	Microsoft Office E...	3 KB
camera_0_dark.png	3/13/2014 8:51 PM	PNG image	1 KB
camera_0_subtracted.png	3/13/2014 8:51 PM	PNG image	11 KB
camera_1_dark.png	3/13/2014 8:51 PM	PNG image	3 KB
camera_1_subtracted.png	3/13/2014 8:51 PM	PNG image	11 KB
camera_2_dark.png	3/13/2014 8:51 PM	PNG image	4 KB
camera_2_subtracted.png	3/13/2014 8:51 PM	PNG image	12 KB
camera_3_dark.png	3/13/2014 8:51 PM	PNG image	2 KB
camera_3_subtracted.png	3/13/2014 8:51 PM	PNG image	12 KB
camera_4_dark.png	3/13/2014 8:51 PM	PNG image	1 KB
camera_4_subtracted.png	3/13/2014 8:51 PM	PNG image	10 KB
camera_5_dark.png	3/13/2014 8:51 PM	PNG image	2 KB
camera_5_subtracted.png	3/13/2014 8:51 PM	PNG image	12 KB
camera_6_dark.png	3/13/2014 8:51 PM	PNG image	1 KB
camera_6_subtracted.png	3/13/2014 8:51 PM	PNG image	11 KB
camera_7_dark.png	3/13/2014 8:51 PM	PNG image	3 KB

Figure 4 PNG File Delete

3. Open Config Folder by refer to below table :

Model	Path
Strd Series One & Series 2	C:\Program Files\AXI System\v810\5.0\config
XXL Series One & Series 2	C:\Program Files\AXI System\v810\5.0\XXLconfig
S2EX	C:\Program Files\AXI System\v810\5.0\s2exconfig

Table 1

4. Choose "Software config" and double click to open.
5. Change as " saveAllConfirmationImages=True"
6. Run one loop of CD & A.

	Work Instruction	Doc. Revision	01
	AXI V810 X ray 3G Camera Replacement Procedure	Effective Date	20 Oct 2017

- Go to area mode image confirmation folder from "C:\Program Files\AXI System\v810\REV\
\log\confirm\areaModelImage" and check the camera segment picture from camera 0 ~ camera 14.

Notes: If bad segment picture is resulting during checking, may refer to Section X ray Camera Removal & Replacement Procedure



Figure 5 Good Camera Segment




Figure 6 Bad Camera Segment

X Ray Camera Removal & Replacement Procedure

- Turn off X-Ray source
- Turn off Trigger Board Switch as below Figure 7

Remarks : The switch is located behind Power Distribution Unit (PDU)

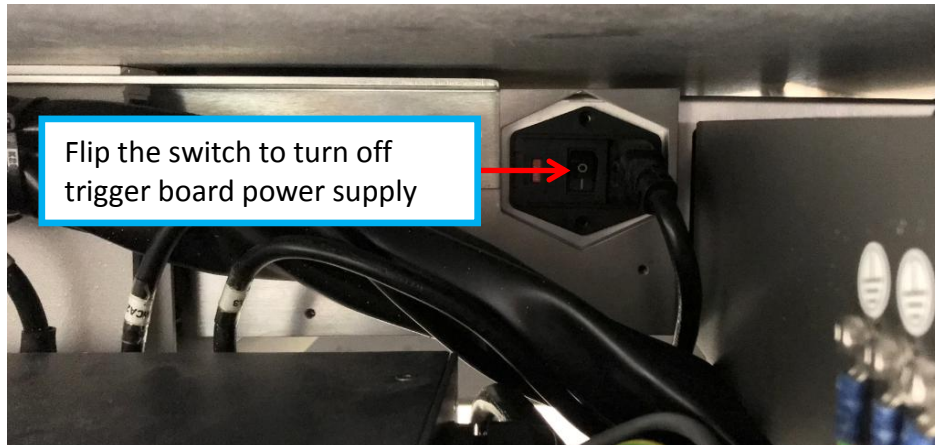


Figure 7 Tigger Board Switch

- Unscrew 2 thumb screws that secure the camera enclosure as below Figure 8



Figure 8 Camera Enclosure Thumb Screws

	Work Instruction	Doc. Revision	01
	AXI V810 X ray 3G Camera Replacement Procedure	Effective Date	20 Oct 2017

4. Slide the two doors of the camera array shield to open the camera enclosure as Figure 9



Figure 9 Camera Array Opening

Disconnect the camera triggering cable (Firewire cable) and network cable from the defective X ray camera as below Figure 10


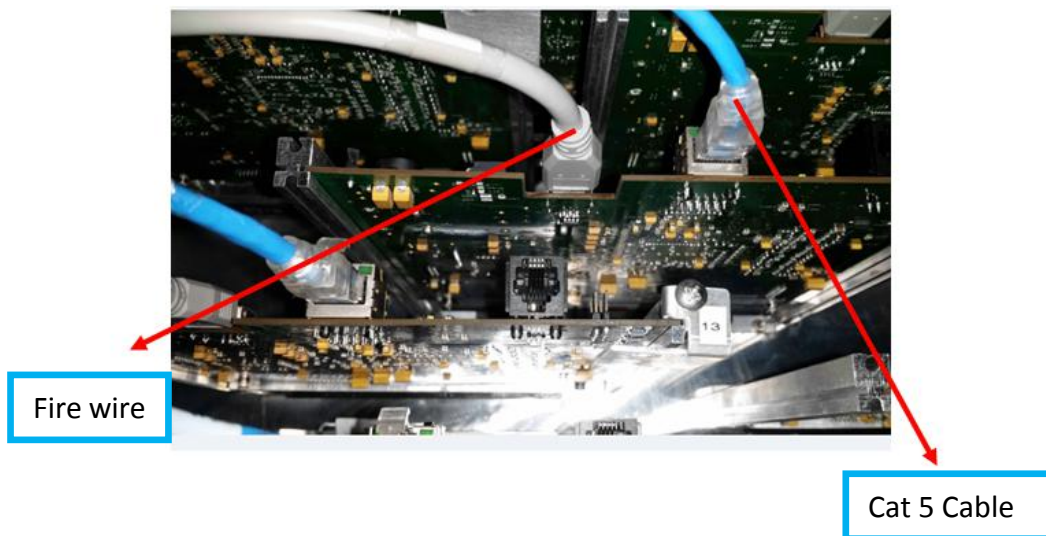



Figure 10 Fire Wire & Cat 5 Cable Removal

	Work Instruction AXI V810 X ray 3G Camera Replacement Procedure	Doc. Revision Effective Date	01 20 Oct 2017
---	--	--	--

5. Use camera tools (2350-0010) to remove 2 x camera mounting screws as below Figure 11

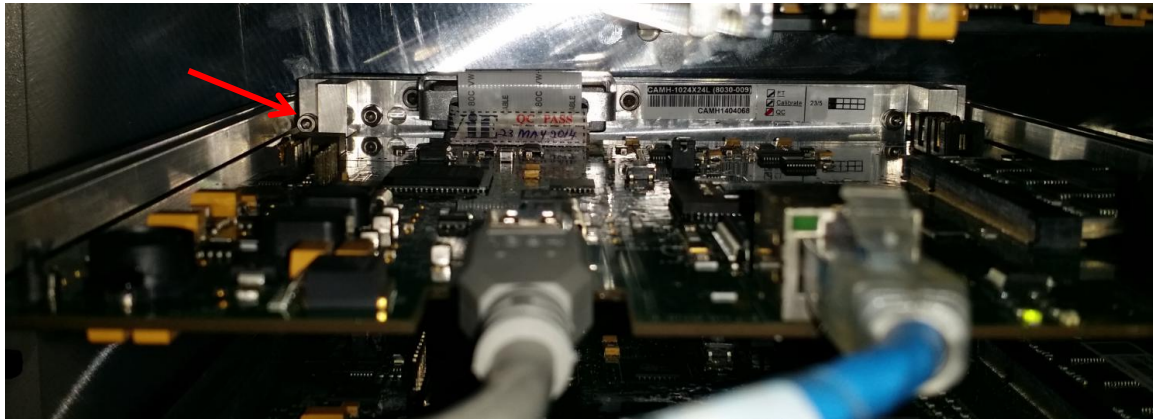

Left view mounting screw

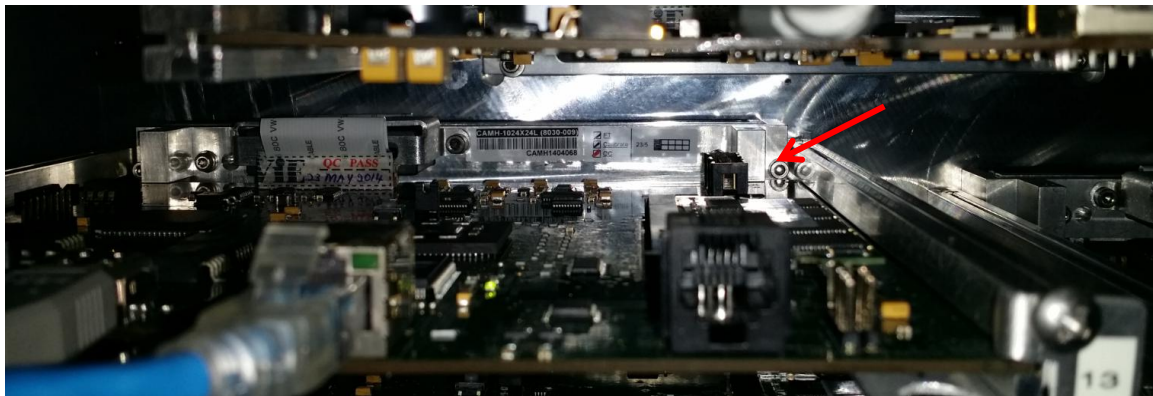

Right view mounting screw

Figure 11 Left & Right Mounting Screws

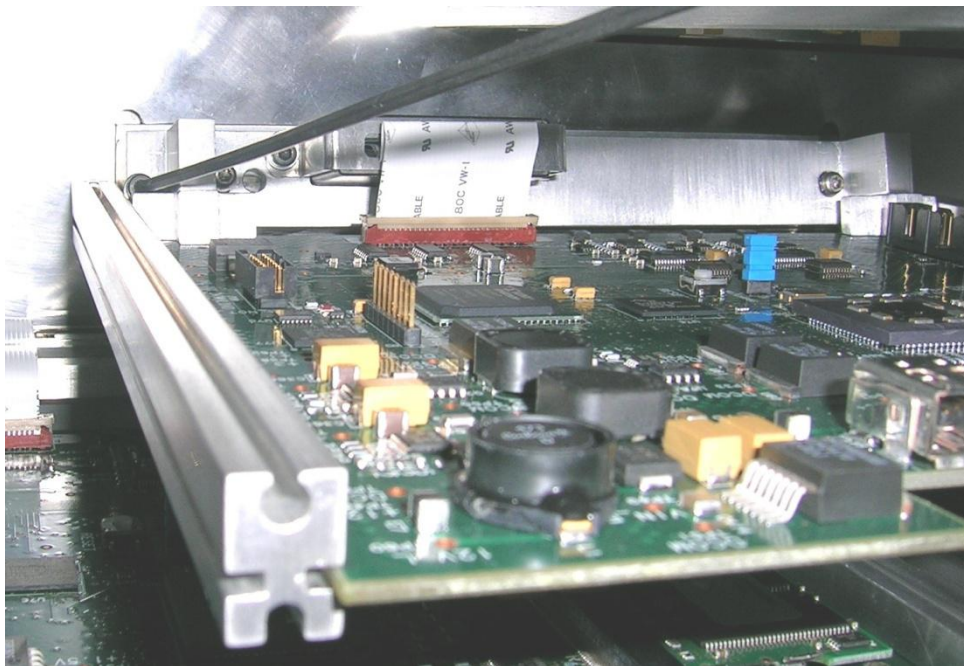


Figure 12 Camera removal (Reference Picture Only)

6. Remove the X ray camera from the slides

	Work Instruction	Doc. Revision	01
	AXI V810 X ray 3G Camera Replacement Procedure	Effective Date	20 Oct 2017

7. Prepare 1 x 3G Camera (PN : 2350-0063/2210-0062) as below Figure 13 & 14

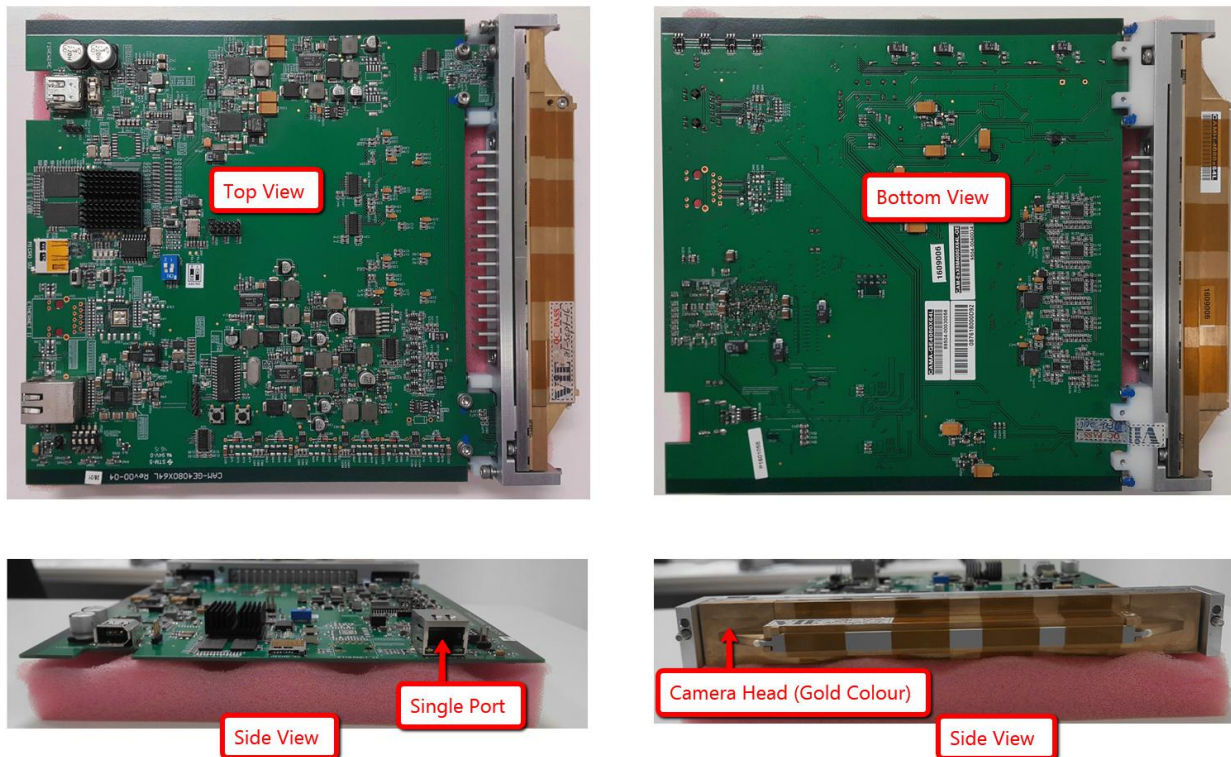


Figure 13 3G Camera (Single Port) ,PN : 2350-0063

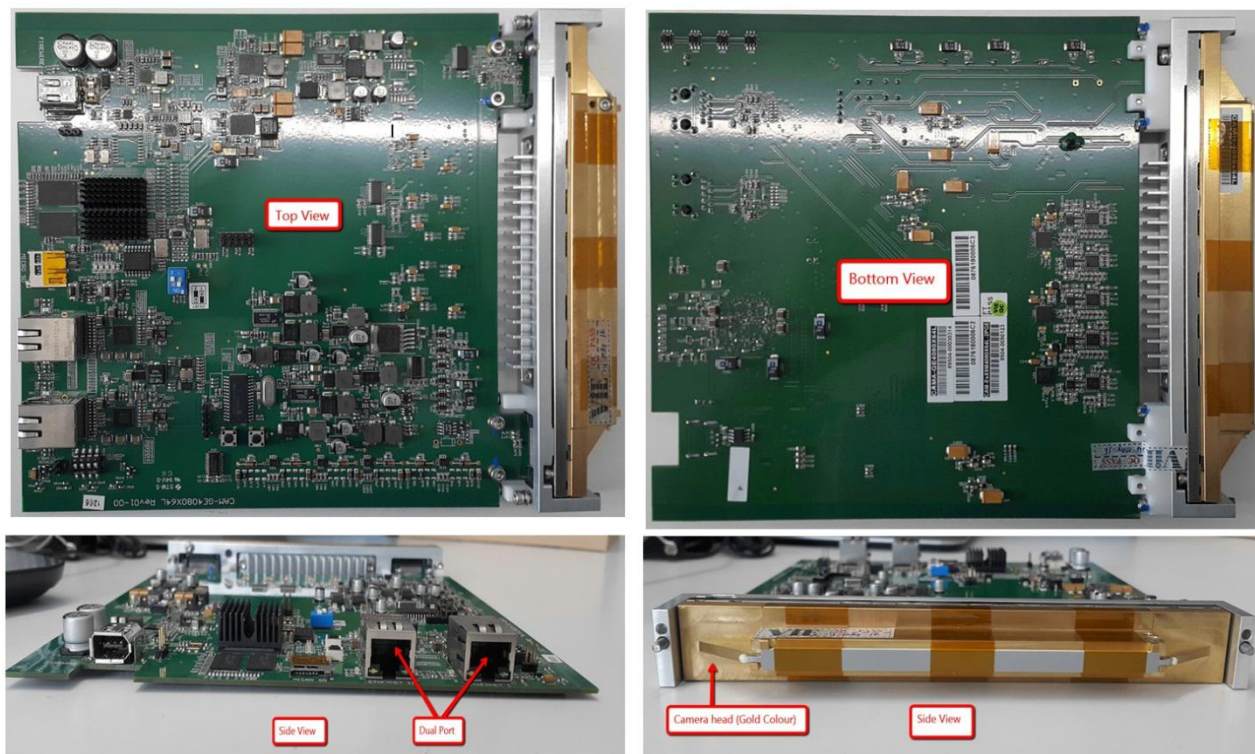


Figure 14 3G Camera (Dual Port), PN : 2210-0062

	Work Instruction AXI V810 X ray 3G Camera Replacement Procedure	Doc. Revision Effective Date	01 20 Oct 2017
---	--	--	--

8. Visual check JP6 Jumper where require to be plugged as below Figure 15

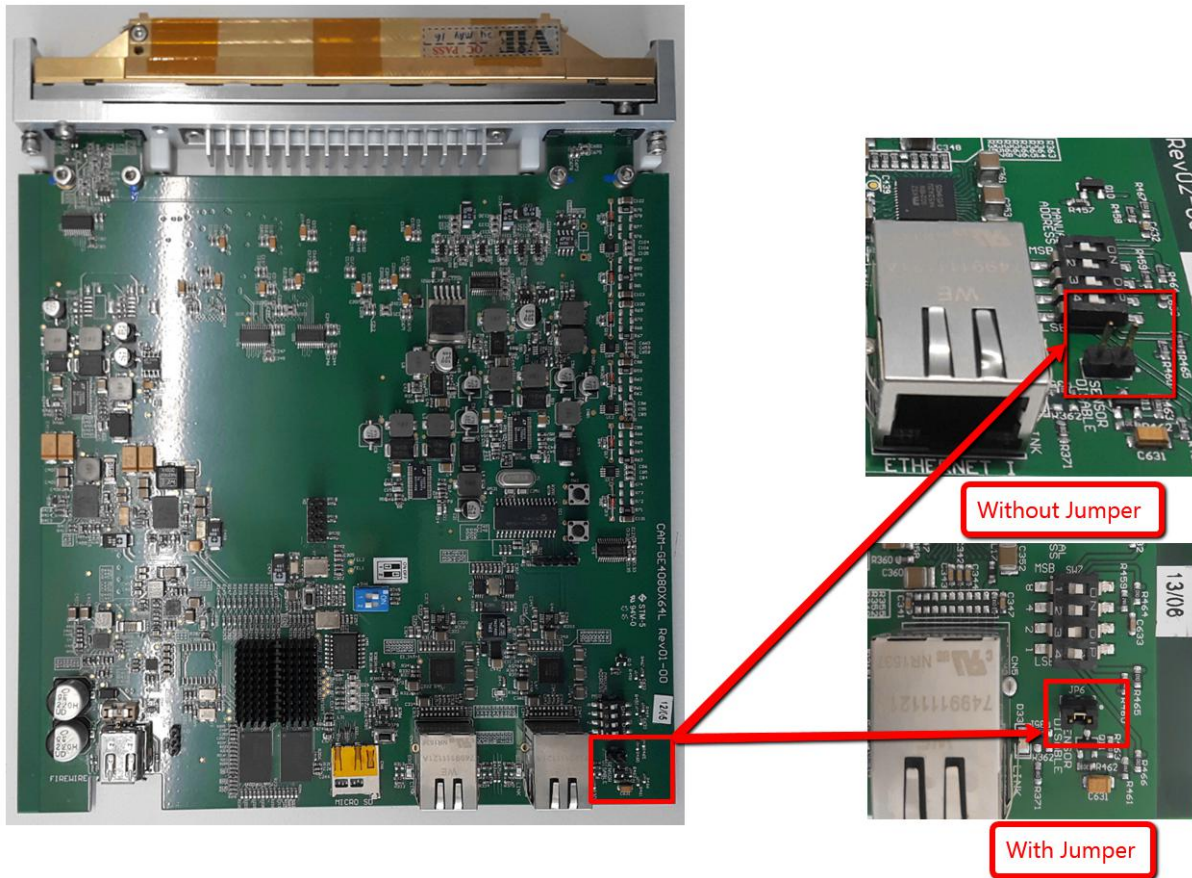


Figure 15 Jumper Slot JP6

9. Manually configure DIP Switch to respective Camera ID by refer to Table 2

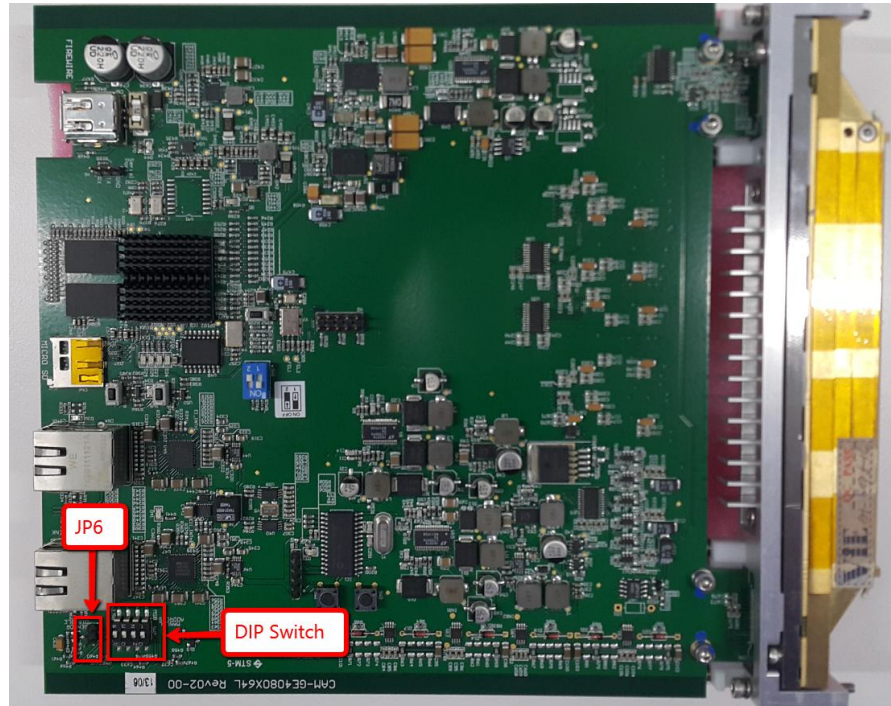
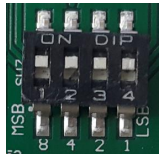
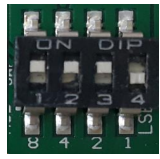
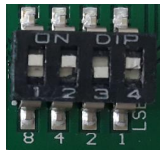
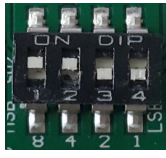
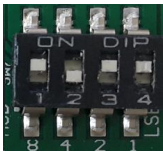
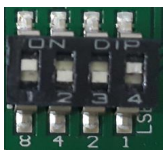



Figure 16 DIP Switch Location


Camera	ON DIP				
0					
	1	2	3	4	
1					
	1	2	3	4	
2					
	1	2	3	4	
3					
	1	2	3	4	


Camera	ON DIP				
4					
	1	2	3	4	

Camera	ON DIP				
5					
	1	2	3	4	

Camera	ON DIP				
6					
	1	2	3	4	

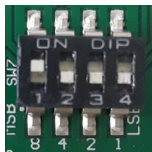Camera	ON DIP				
7					
	1	2	3	4	

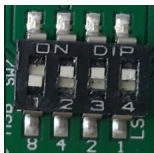Camera	ON DIP				
8					
	1	2	3	4	

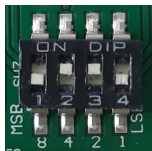Camera	ON DIP				
9					
	1	2	3	4	

Camera	ON DIP				
10					
	1	2	3	4	

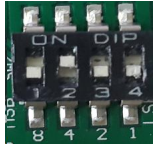
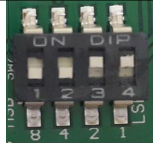
Camera	ON DIP				
11					
	1	2	3	4	
12					
	1	2	3	4	
13					
	1	2	3	4	

Table 2

10. Gently slide X ray Camera into particular Slider Slot by refer to below orientation May refer to Figure

17

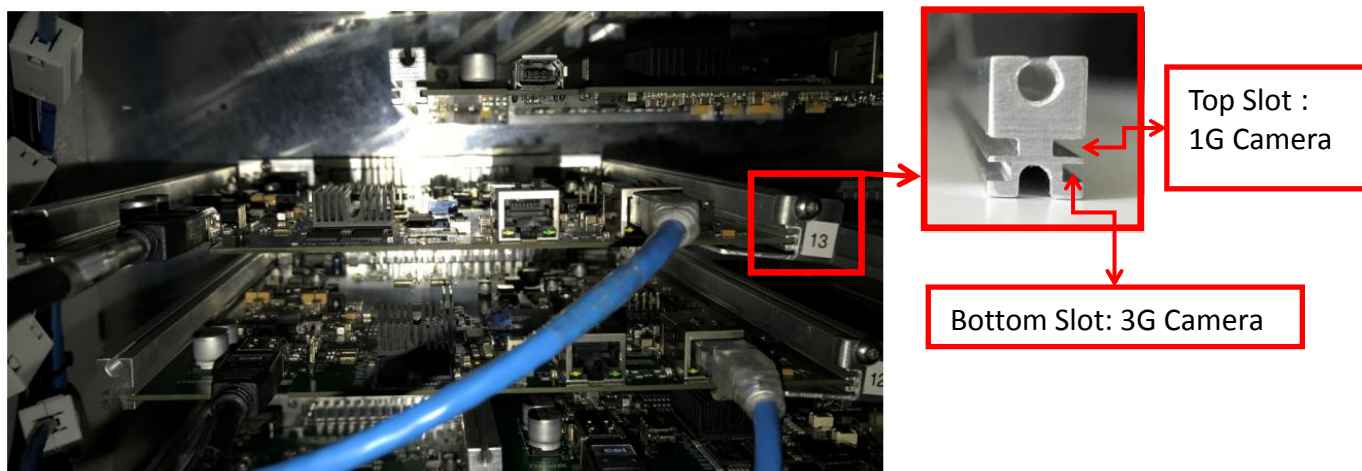


Figure 17 3G Camera Slider Slot

Remarks : Caution on camera PCA `s component upon sliding

11. Tighten 2 x Camera mounting screws.
12. Turn on trigger board switch and wait 10 seconds
13. Open Command Prompt

14. Type "Ping 192.168.128.128.XX" (May refer to below camera IP table for applying appropriate camera IP for particular camera) and check any return result as Figure 18

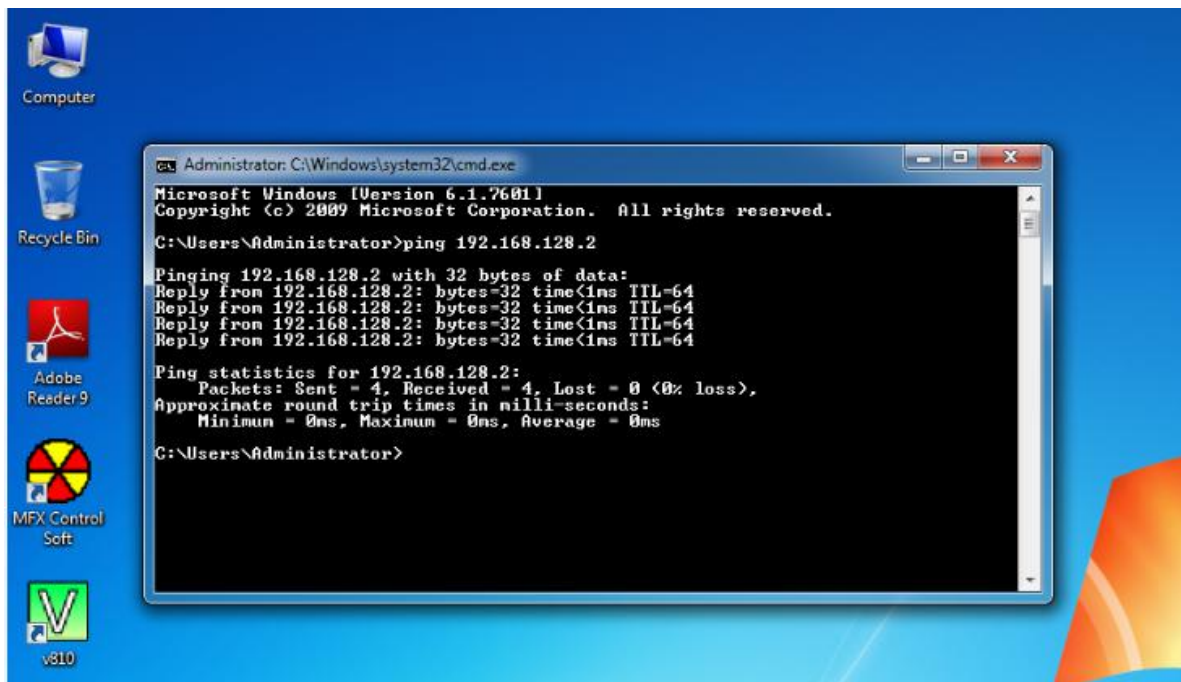


Figure 18 Command Prompt Ping Test

Camera ID	Camera IP
0	192.168.128.14
1	192.168.128.1
2	192.168.128.2
3	192.168.128.3
4	192.168.128.4
5	192.168.128.5
6	192.168.128.6
7	192.168.128.7
8	192.168.128.8
9	192.168.128.9
10	192.168.128.10
11	192.168.128.11
12	192.168.128.12
13	192.168.128.13

Table 3

15. Close the camera enclosure.
16. Tighten 2 x thumb screws

	Work Instruction	Doc. Revision	01
	AXI V810 X ray 3G Camera Replacement Procedure	Effective Date	20 Oct 2017

17. Click “ Upgrade firmware” at X ray Camera Tab (Under Service Mode) as below Figure 19

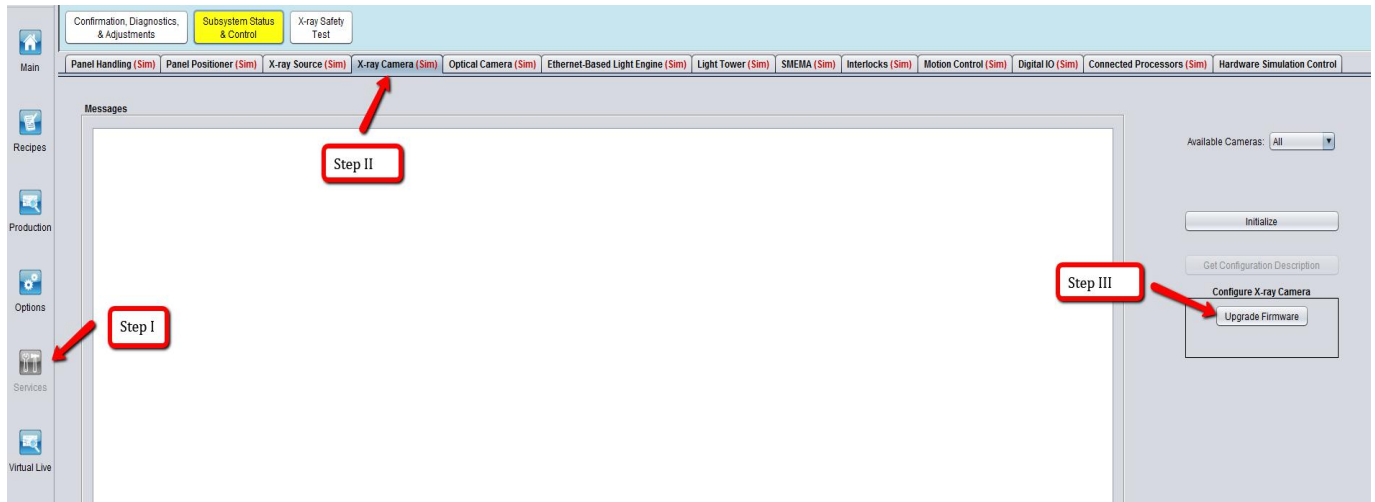


Figure 19 Camera Firmware Upgrade

18. Click “ Initialize” at X ray Camera Tab

19. Turn on X-ray

20. Run 1 loop CD & A