

	Work Instruction	Doc. Revision	01
	AXI V810 Machine Shut Down Procedure	Effective Date	2 Oct 2016

This procedure is applicable to below models:

V810 STD	☒	S1	☒	S2
V810 XXL	☒	S1	☒	S2
V810 S2EX	☒			
V810 Mini	☐			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	20 Apr 2015	First Release	CHIN CHEE YAN
01	2 Oct 2016	Template Changes & Content Update	ONG KEAN SHENG

1. To perform V810/V810 XXL system shutdown, kindly unload panel from the system if remain any panel at the stage.

1.1 Go to “Main” tab, “Action” tab at top panel and select “Unload Panel”.

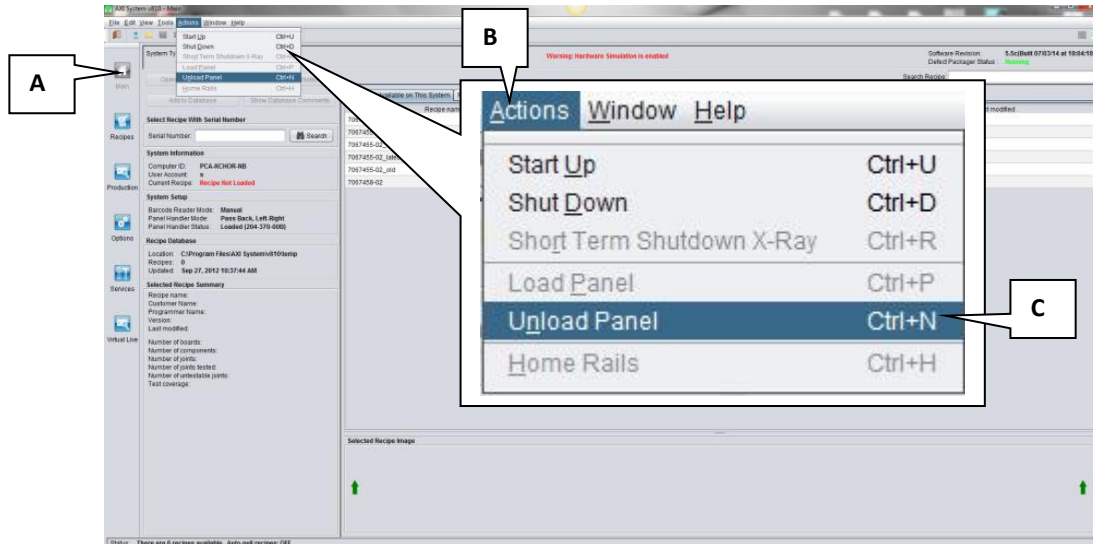


Figure 1 V810 Interface

2. After board unloaded from stage,

2.1 Select “Shut Down” at “Actions” tab.

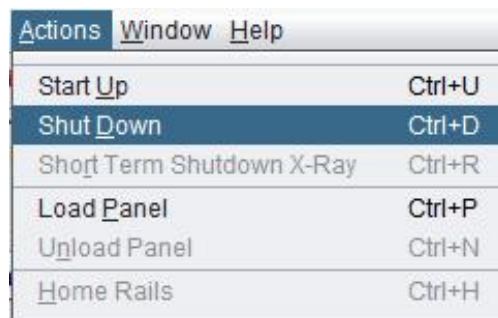


Figure 2 V810 Interface

3. Then close the V810 GUI.

3.1 Go to File tab and select “Exit”



Figure 3 V810 Interface

	Work Instruction	Doc. Revision	01
	AXI V810 Machine Shut Down Procedure	Effective Date	2 Oct 2016

4. Switch off the SSCA power, shown as below image.

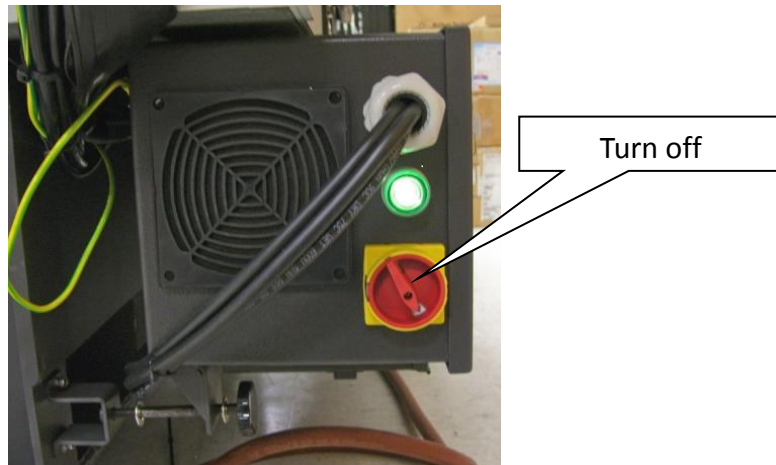


Figure 4 SSCA

Note: User must Remote Desktop to IRP Server and ATOM PC to perform shutdown before system completely turn OFF Power.

5. Below table shown IRP servers and ATOM PC IP address

Series Type	Computer Devices	IP	User Account	Password
Series 1	IRP0	192.168.128.240/241	Administrator	Please!
	IRP1	192.168.128.242/243		
	IRP2	192.168.128.244/245		
	IRP3	192.168.128.246/247		
	Atom PC (RMS)	10.1.1.55		
Series 2	Atom PC (RMS)	192.168.128.70		

Table 1

Series 1, each IRP Server configured with 2 IP address, use either 1 IP address to log-in each IRP devices.

- 5.1.** Launch Remote Desktop application at Master Computer (Below is the sample login into Atom PC).



Figure 5 Remote desktop connection

	Work Instruction	Doc. Revision	01
	AXI V810 Machine Shut Down Procedure	Effective Date	2 Oct 2016

5.2. Security certification window will prompt, click “Yes” continue remote session.



Figure 6 Remote desktop connection

5.3. Open “CMD” window at Start icon tray.

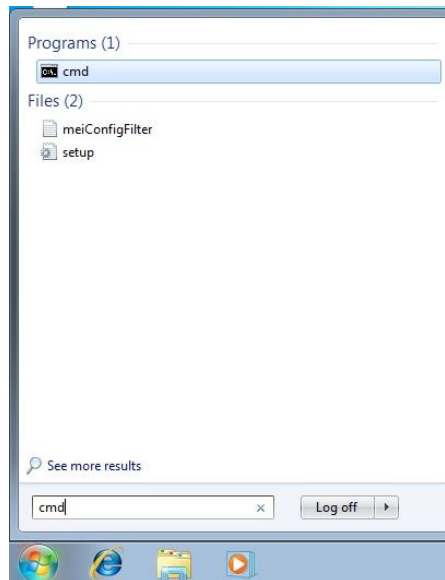


Figure 7

5.4. Key-in command “shutdown -s” then press “Enter”, Dialog will prompt showing “Windows will shut down in less than a minute”.

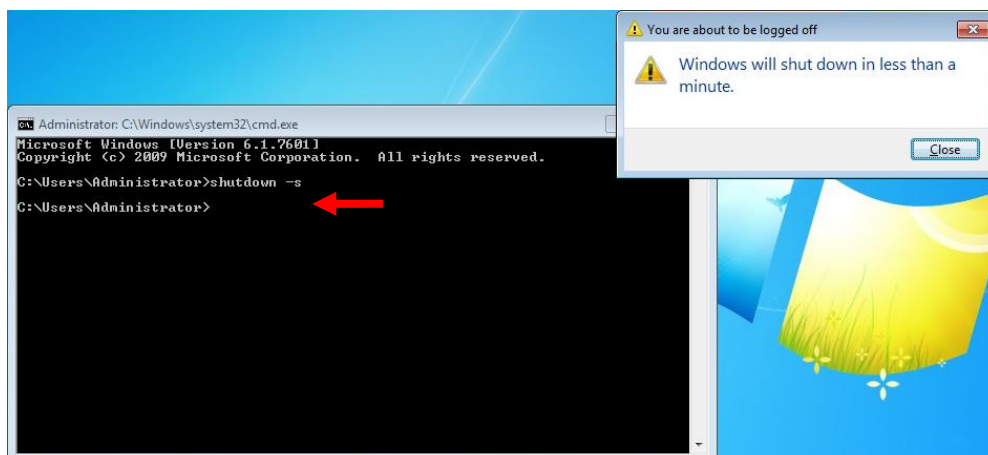


Figure 8 CMD

	Work Instruction	Doc. Revision	01
	AXI V810 Machine Shut Down Procedure	Effective Date	2 Oct 2016

- 5.5. Repeat step 5.1 ~ 5.4 to shut down balance computer devices which shown at table 1.
6. Shut down V810 Master Computer Windows Operating System as normal PC shut down.
7. Switch OFF “Safety Power Switch (A)” and “Main Incoming Power (B)” at the Power Distribution Unit (PDU) located at right rear of the X-Ray cabinet base frame.

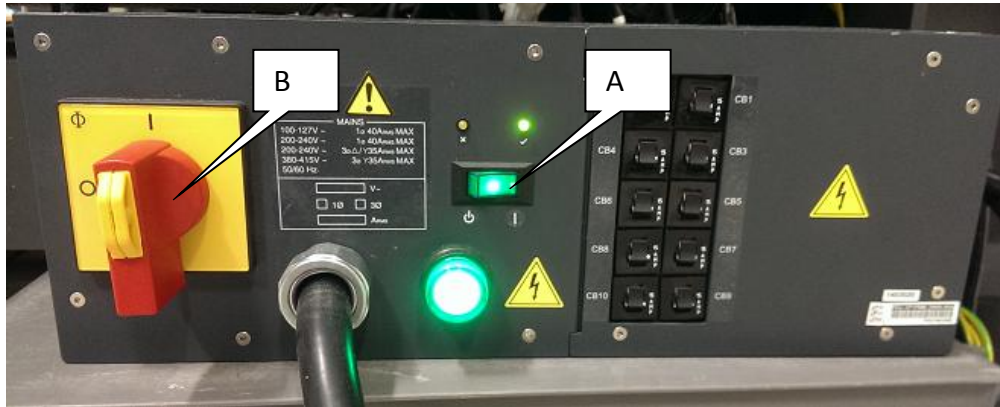


Figure 9

8. Turn off main power and air supply input.