

	Work Instruction	Doc. Revision	00
	AXI V810 STD Outer Barrier Cylinder Removal & Replacement Procedure	Effective Date	2 Oct 2016

This procedure is applicable to below models:

V810 STD	☒	S1	☒	S2
V810 XXL	☐	S1	☐	S2
V810 S2EX	☐			
V810 Mini	☐			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	2 Oct 2016	First Release	ONG KEAN SHENG

	Work Instruction	Doc. Revision	00
	AXI V810 STD Outer Barrier Cylinder Removal & Replacement Procedure	Effective Date	2 Oct 2016

Content

STD Outer Barrier Cylinder Removal.....	3
STD Outer Barrier Cylinder Replacement.....	9

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 STD Outer Barrier Cylinder Removal & Replacement Procedure	Effective Date	2 Oct 2016

STD Outer Barrier Cylinder Removal

1. Close X ray Source at Operator Console
2. Close SSCA
3. Remove 4 x Tamper Proof screws as below Figure 1



Figure 1

4. Disconnect 4 x Connector as below Figure 2

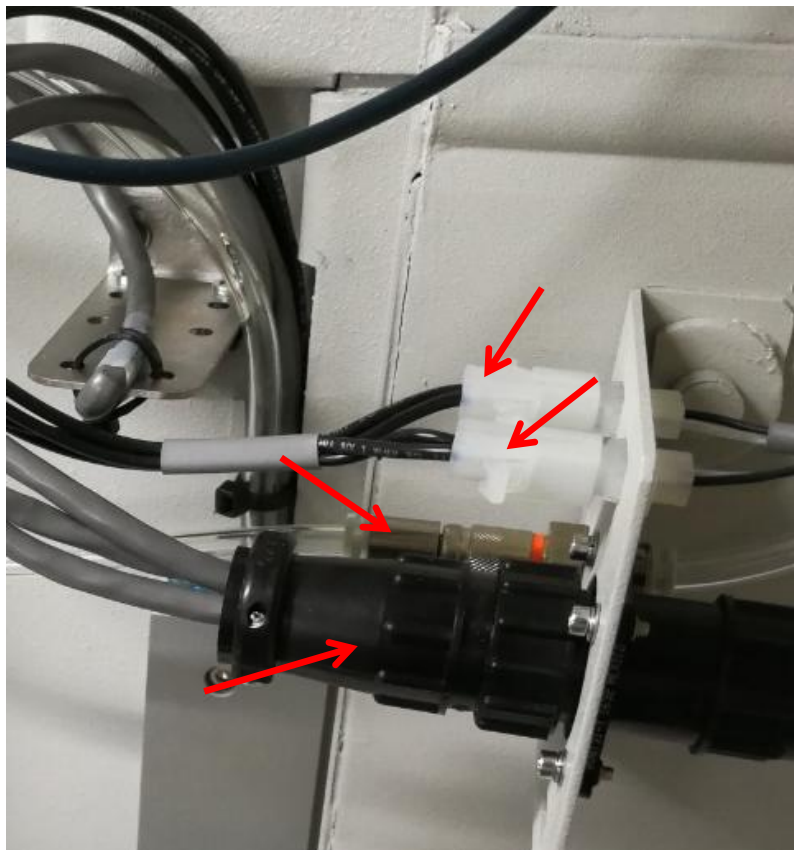


Figure 2

5. Gently open outer barrier

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 STD Outer Barrier Cylinder Removal & Replacement Procedure	Effective Date	2 Oct 2016

6. Remove 2 x Tubing from Outer Barrier Speed Controller as Figure 3

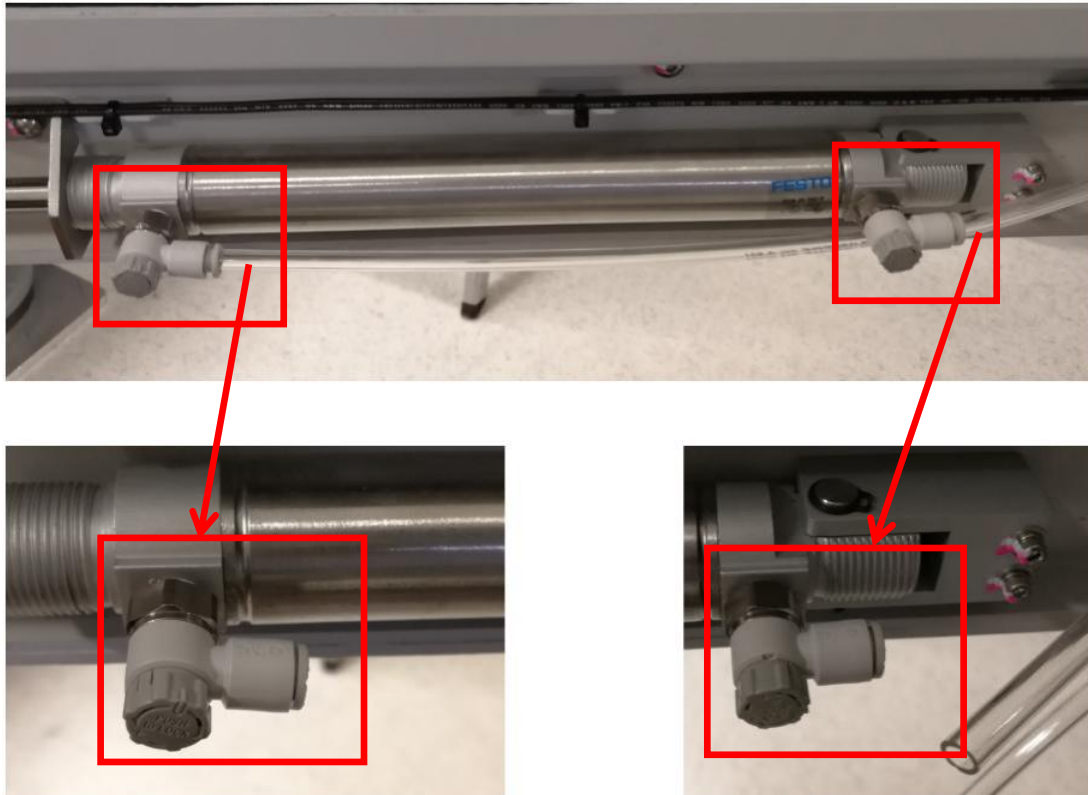


Figure 3

7. Loosen 2 x Screws & Remove Front Cylinder Holder as Figure 4

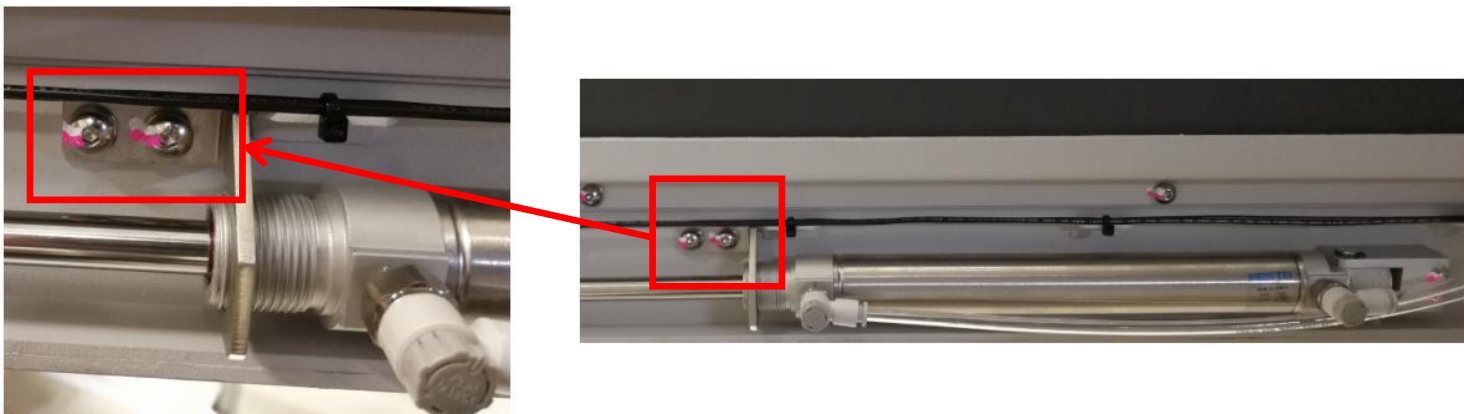


Figure 4

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 STD Outer Barrier Cylinder Removal & Replacement Procedure	Effective Date	2 Oct 2016

8. Loosen 2 x Screws & remove Rear Cylinder Holder as Figure 5

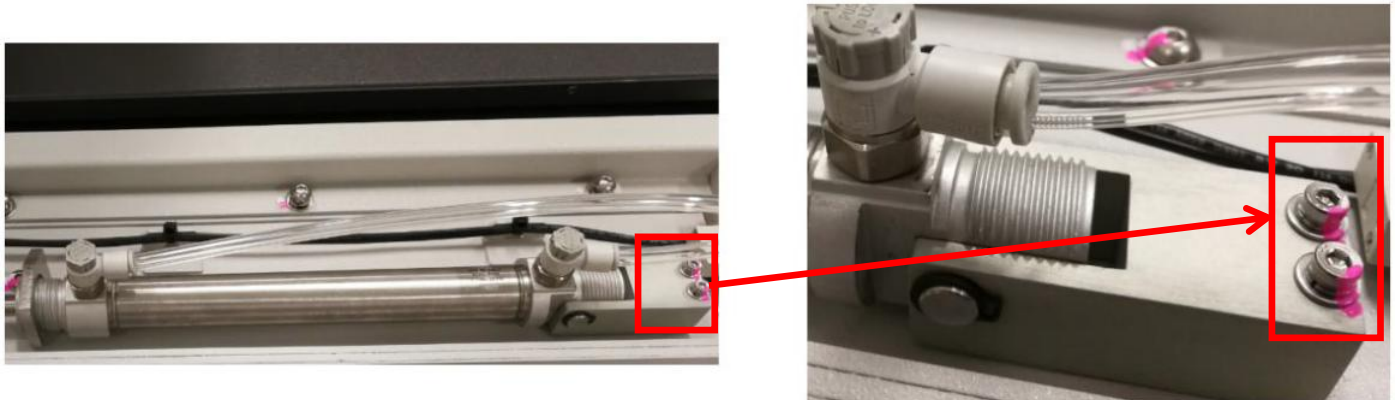


Figure 5

9. Fully retract outer barrier cylinder
 10. By using C-Clip Plier ,open 1 x C-Clip from dowel pin as Figure 6

Remarks : Do not dispose C-Clip as this would require for re-use purpose

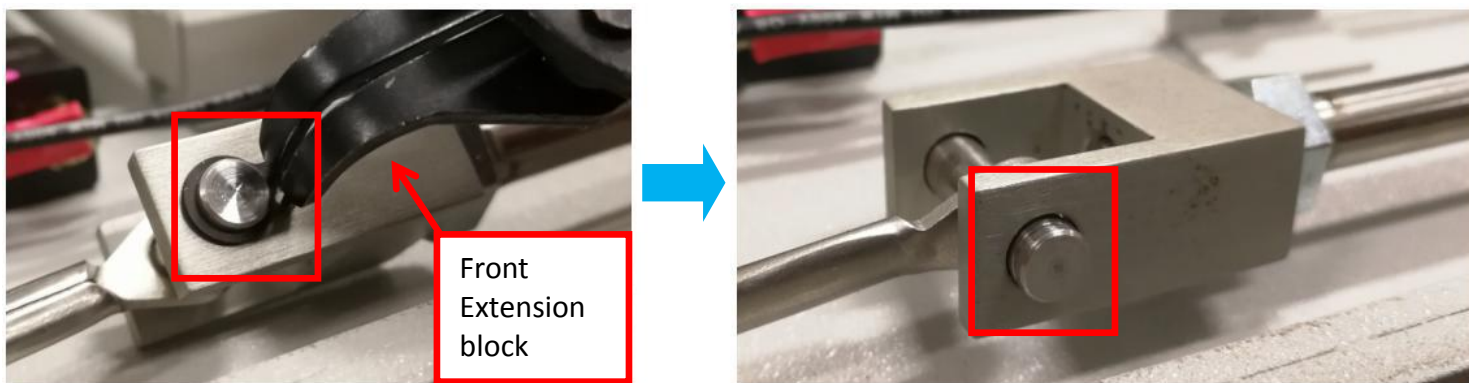


Figure 6

	Work Instruction	Doc. Revision	00
	AXI V810 STD Outer Barrier Cylinder Removal & Replacement Procedure	Effective Date	2 Oct 2016

11. Twist the Front Extension Block and gently push out the dowel pin as Figure 7.

(Remarks : Remain half way of dowel pin in extension block)

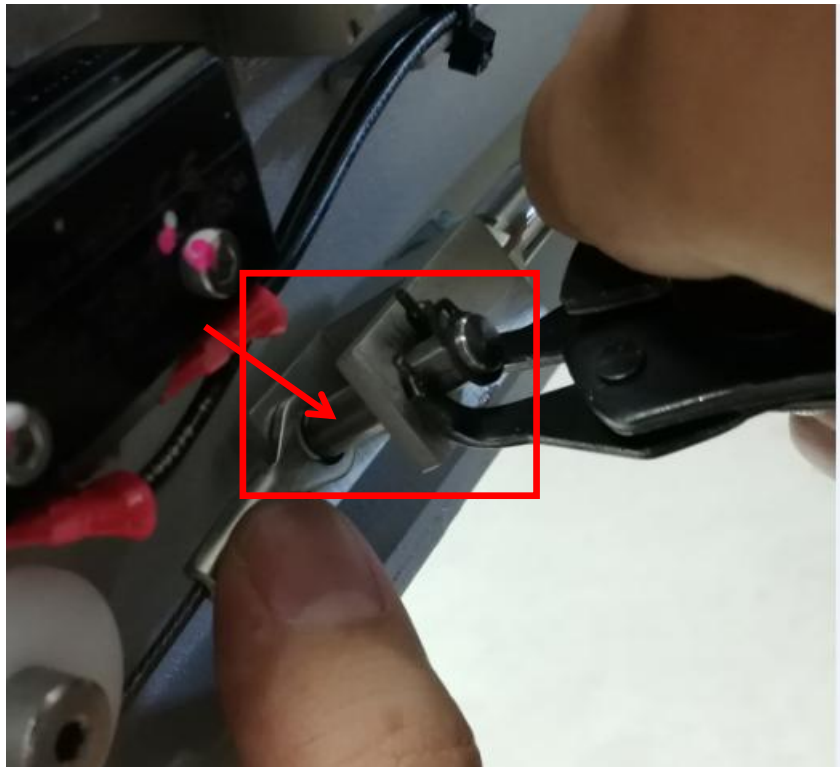


Figure 7

12. Gently remove Sava cable from dowel pin as Figure 8

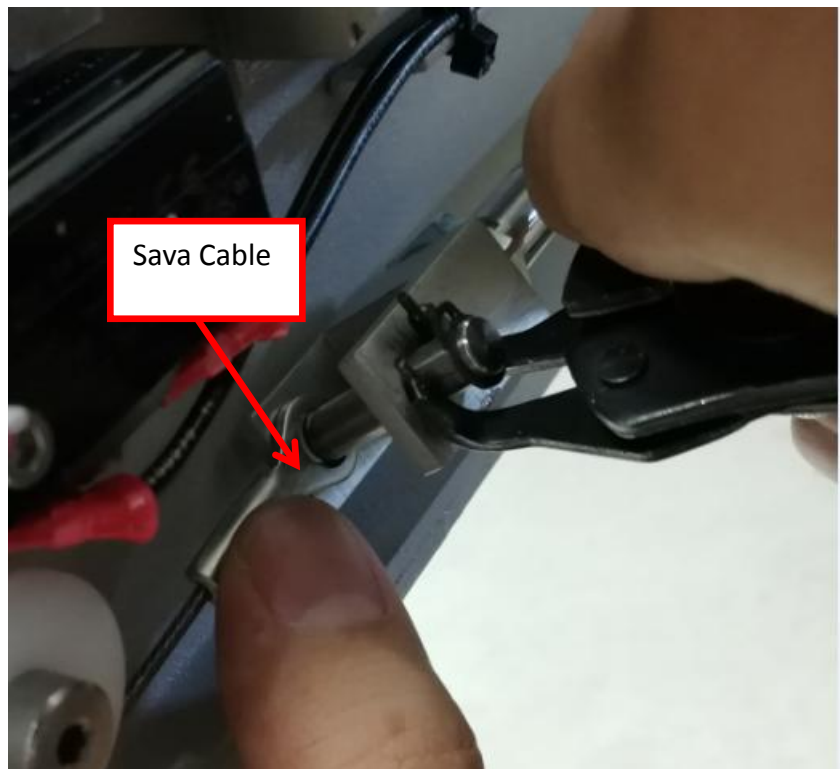


Figure 8

ViTrox 	Work Instruction	Doc. Revision	00
	AXI V810 STD Outer Barrier Cylinder Removal & Replacement Procedure	Effective Date	2 Oct 2016

13. Remove entire outer barrier cylinder and position at visible location as Figure 9



Figure 9

14. Remove 2 x Outer Barrier Speed Controllers as Figure 10

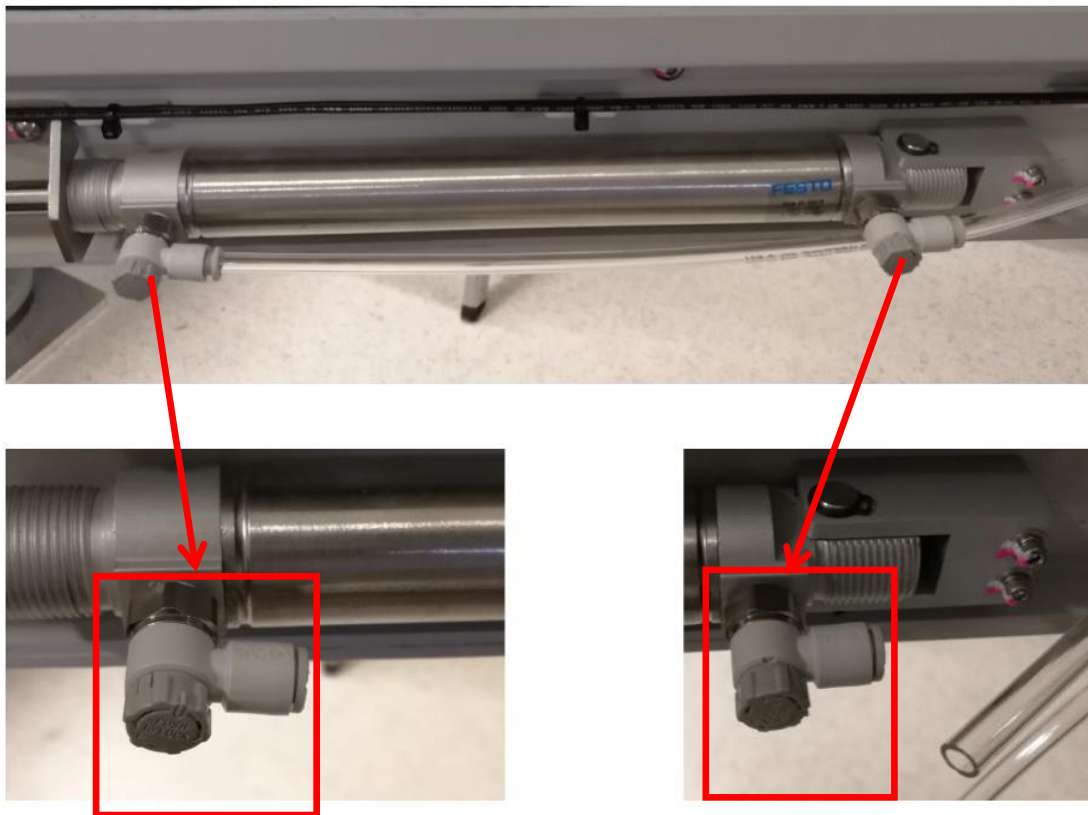


Figure 10

15. Gently remove another C-Clip at Front Extension Block as Figure 11

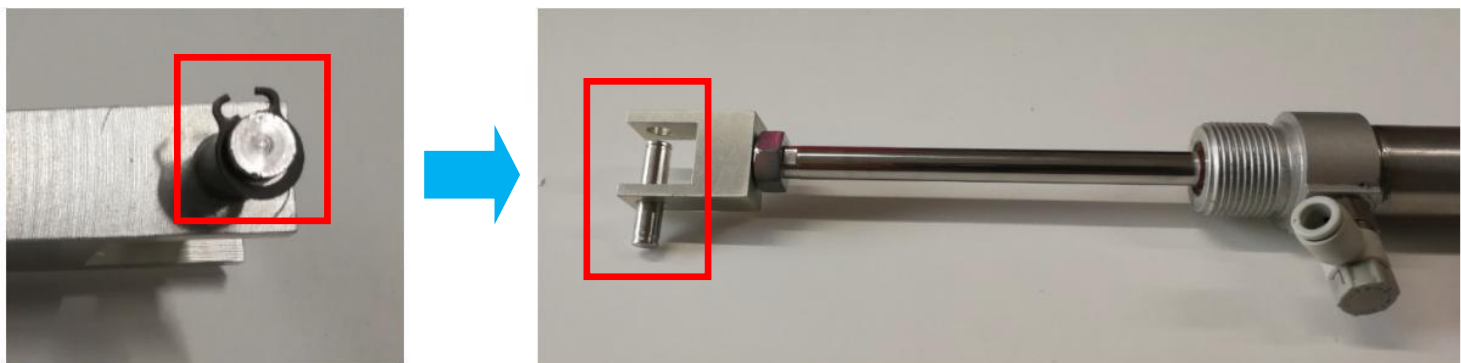


Figure 11

	Work Instruction	Doc. Revision	00
	AXI V810 STD Outer Barrier Cylinder Removal & Replacement Procedure	Effective Date	2 Oct 2016

16. Remove Nut & Front Extension Block (With Dowel Pin) as Figure 12

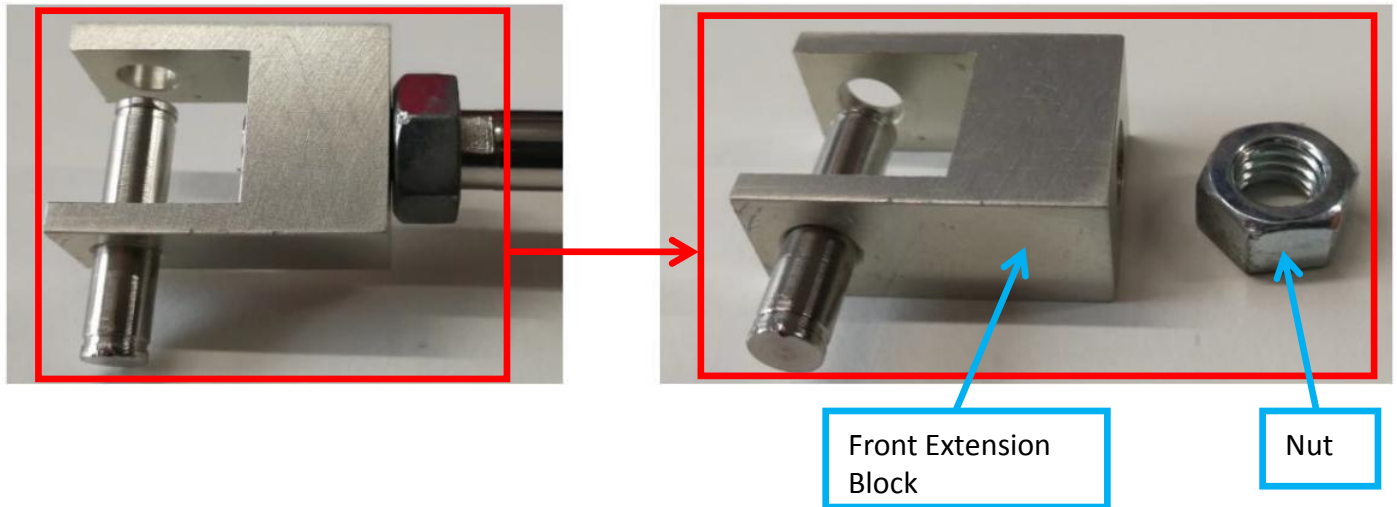


Figure 12

17. Remove 1 x C-Clip at Rear Cylinder Holder as Figure 12. Position C-Clip at visible location.

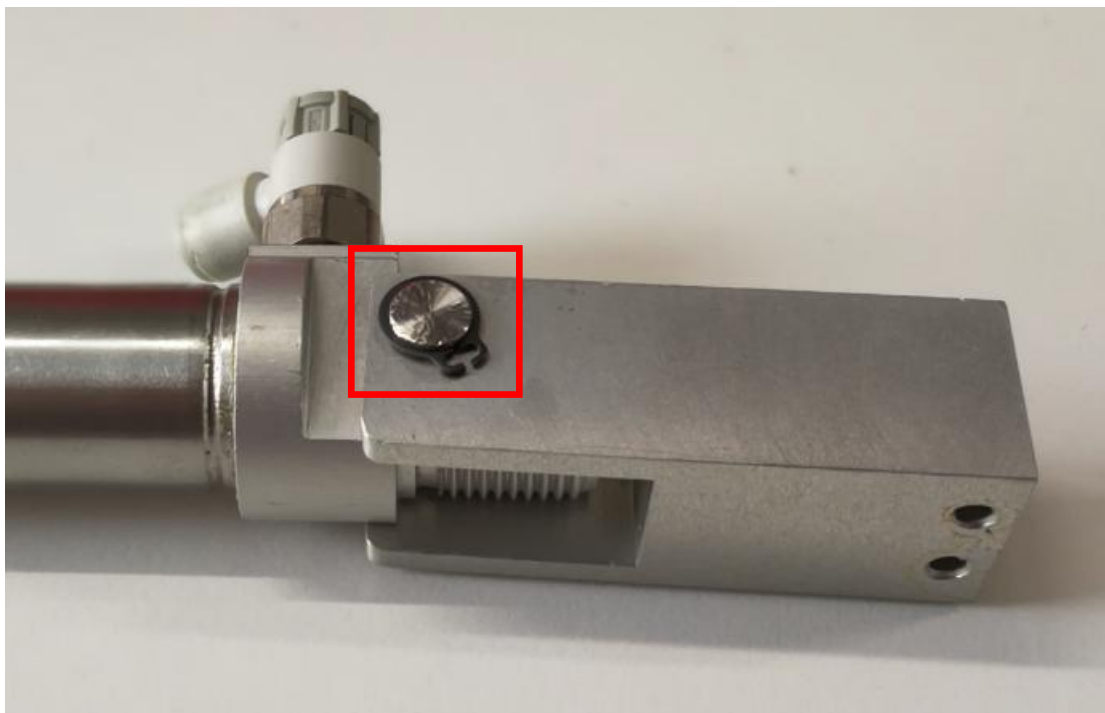


Figure 13

	Work Instruction	Doc. Revision	00
	AXI V810 STD Outer Barrier Cylinder Removal & Replacement Procedure	Effective Date	2 Oct 2016

18. Gently push out the Dowel Pin from Rear Cylinder Holder as Figure 13. Remove dowel pin & Rear Cylinder Holder as Figure 14

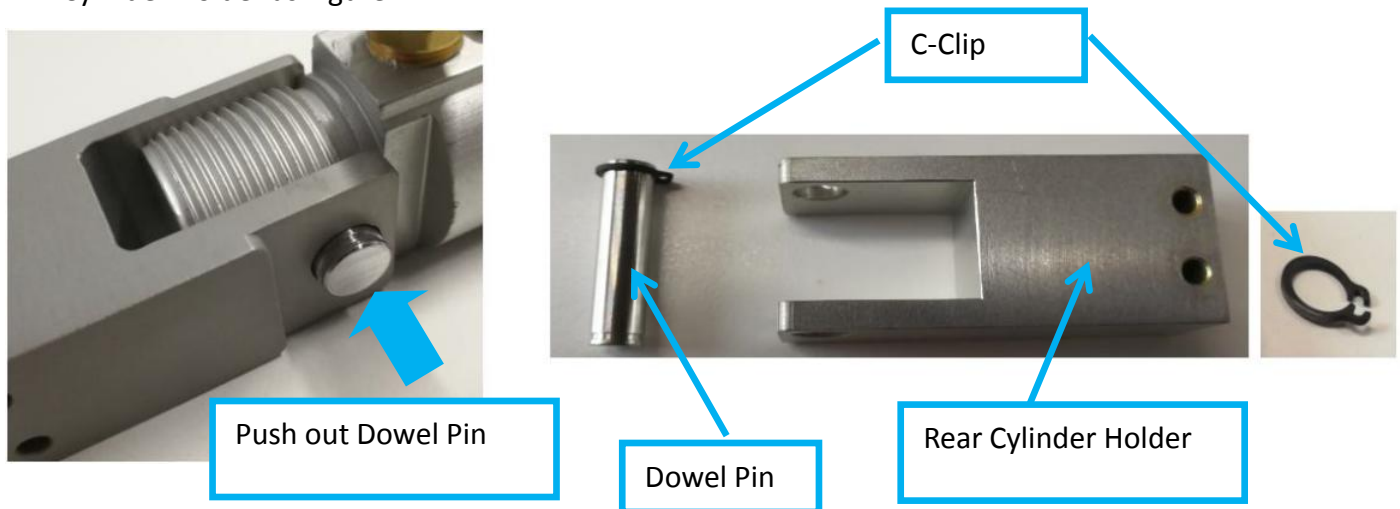


Figure 14

STD Outer Barrier Cylinder Replacement

19. Prepare New Std Outer Barrier Cylinder (PN, 2810-0042)
20. Assemble Rear Cylinder Holder & Dowel pin into New Outer barrier cylinder. May refer to below Figure 15

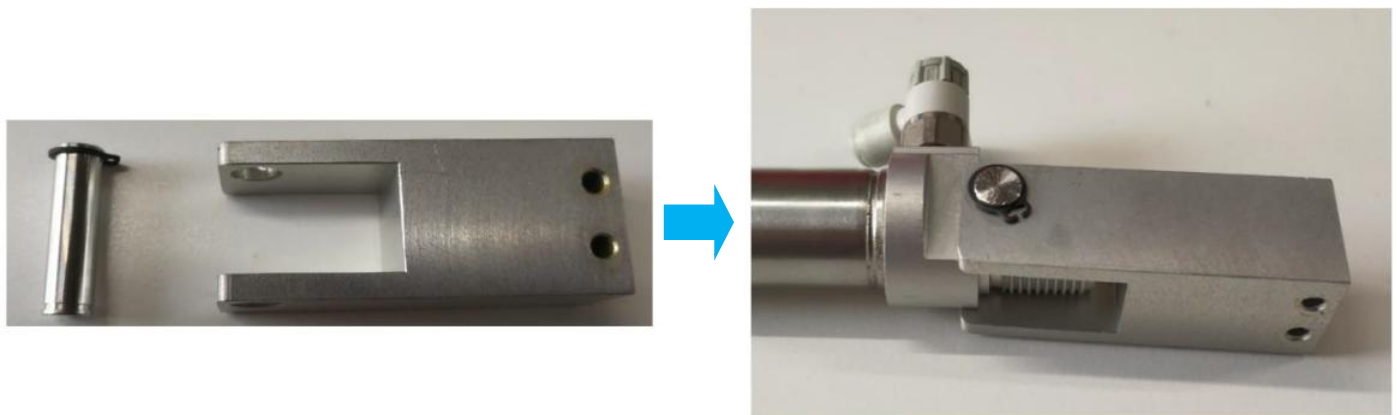


Figure 15

Special remarks : C-Clip require to slot firmly within the dowel pin step.



Figure 16

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 STD Outer Barrier Cylinder Removal & Replacement Procedure	Effective Date	2 Oct 2016

21. Twist the Rear Cylinder Holder & assemble C-Clip at other side of Dowel Pin as Figure 17

Special remarks : If C-Clip had worn out, may inquire new parts (PN, 2770-0092) for further replacement.

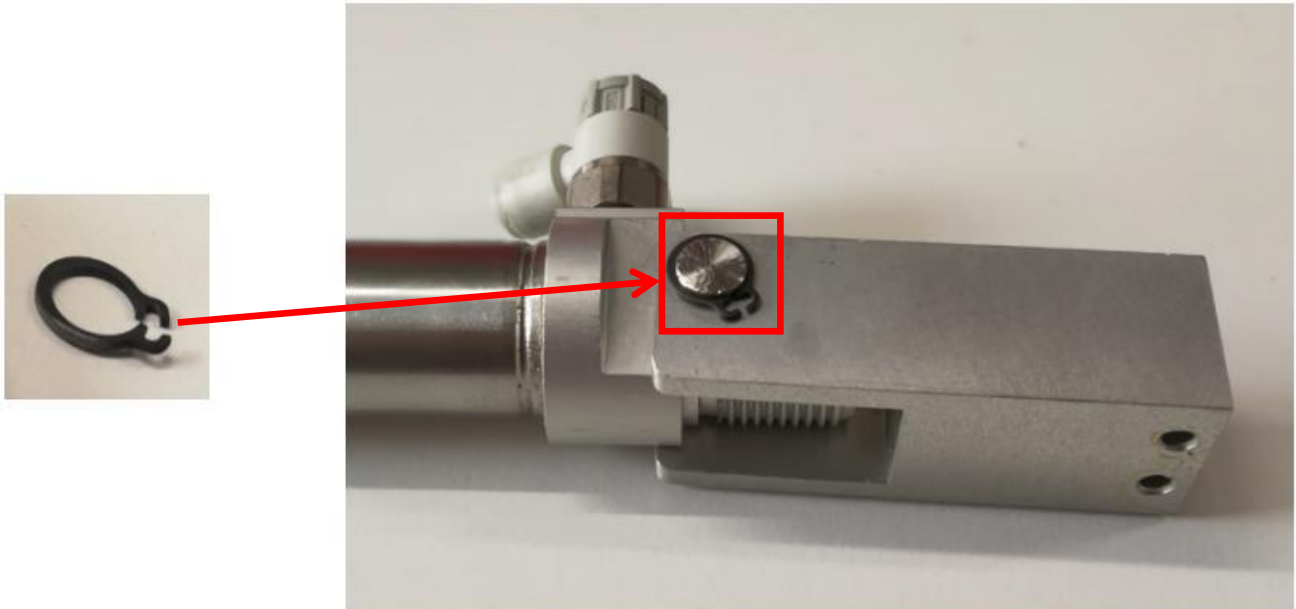


Figure 17

22. Assemble Nut & Front Extension Block (With Dowel Pin) at Outer Barrier Cylinder as Figure 18

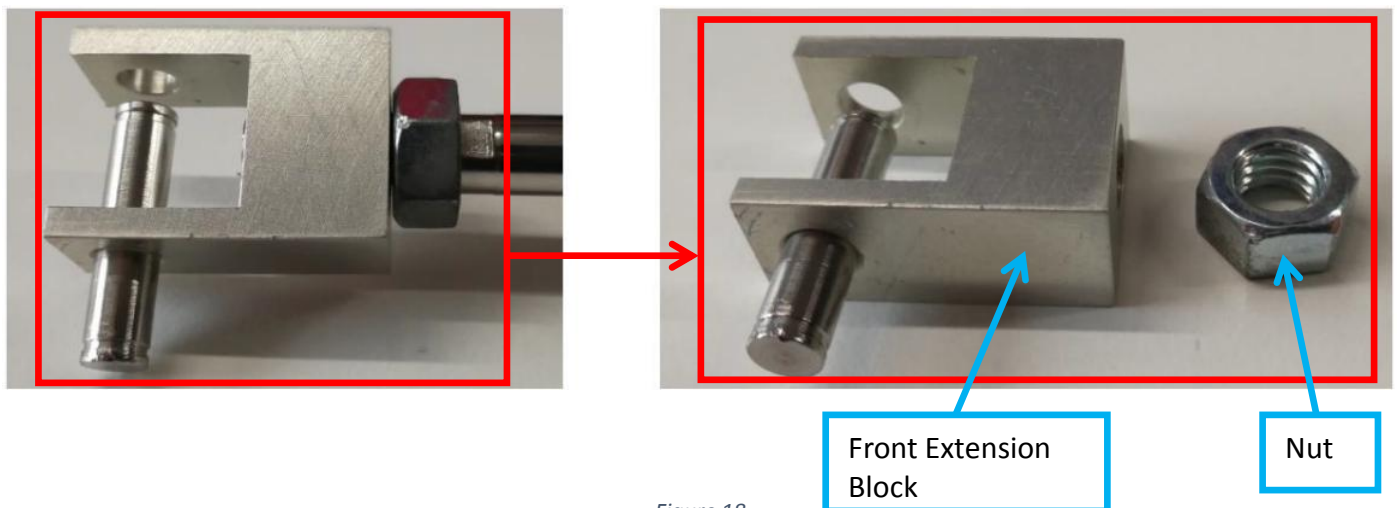


Figure 18

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 STD Outer Barrier Cylinder Removal & Replacement Procedure	Effective Date	2 Oct 2016

23. Assemble 2 x Outer Barrier Speed Controllers as Figure 19

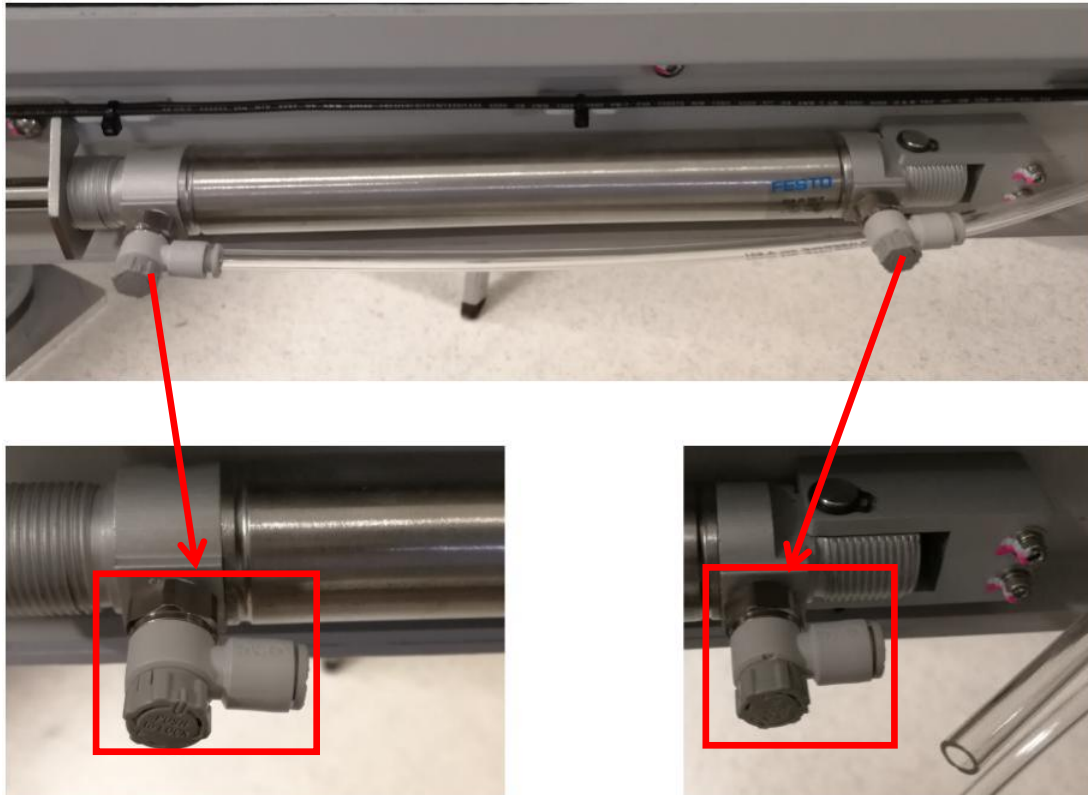


Figure 19

24. Gently slot Sava cable into dowel pin where attach with Front Extension Block as Figure 20

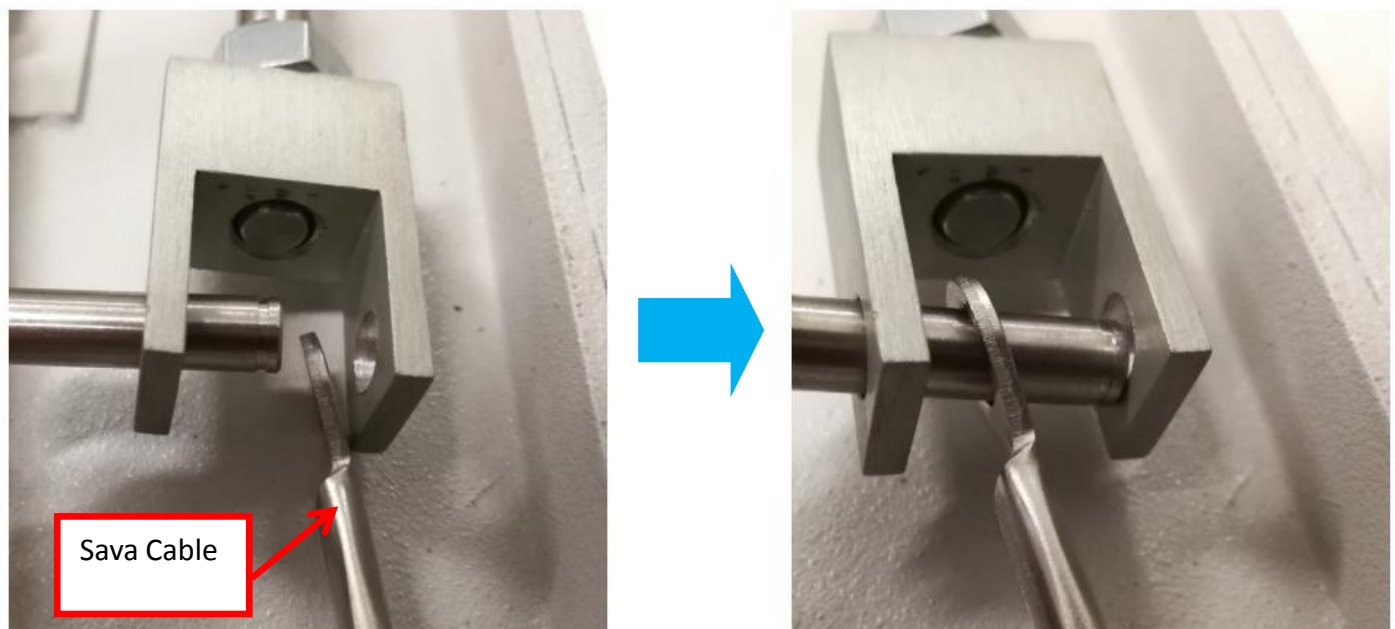


Figure 20

	Work Instruction	Doc. Revision	00
	AXI V810 STD Outer Barrier Cylinder Removal & Replacement Procedure	Effective Date	2 Oct 2016

25. Push the dowel pin through Front Extension Block as below Figure 21

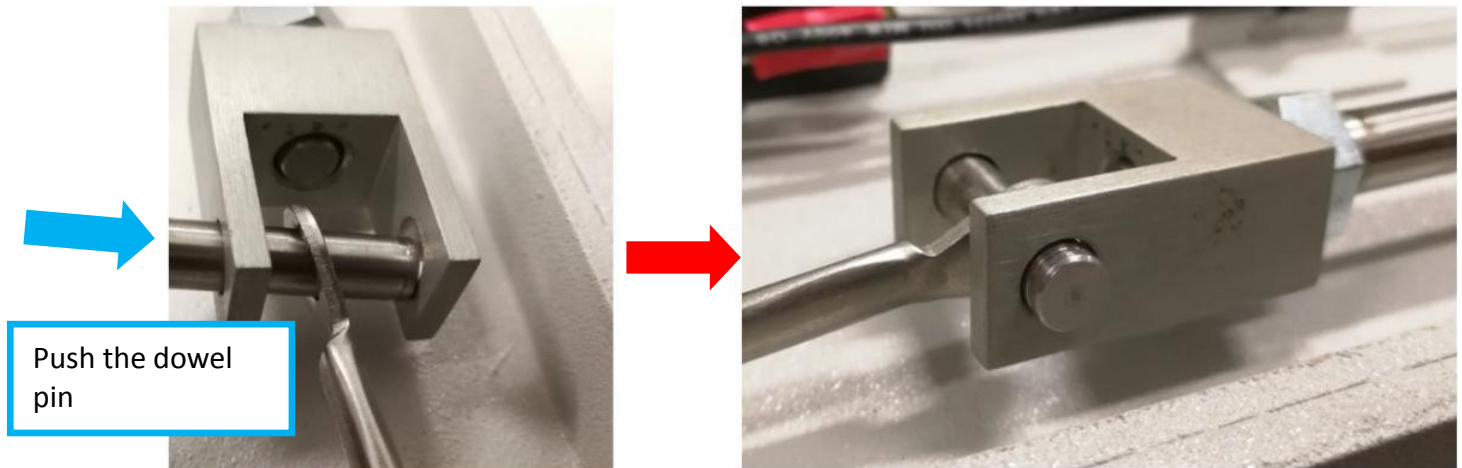


Figure 21

26. By using C-Clip Plier ,slot 2 x C-Clip at both side of dowel pin as Figure 22

Special remarks : If C-Clip had worn out, may inquire new parts (PN, 2770-0093) for further replacement.

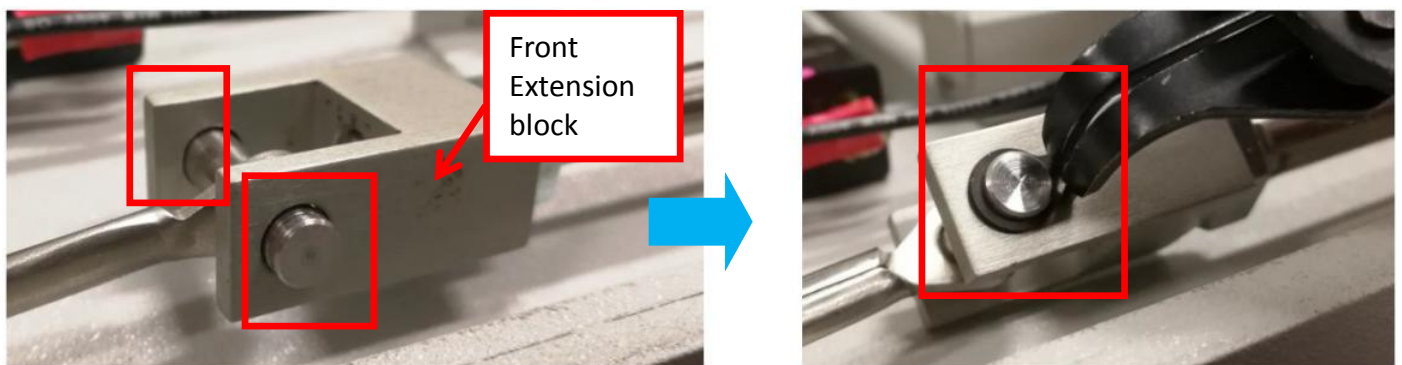


Figure 22

Special remarks : C-Clip require to slot firmly within the Dowel pin step.



Figure 23

27. Assemble Front Cylinder Holder at outer barrier cylinder & tighten 2 x screws as Figure 24

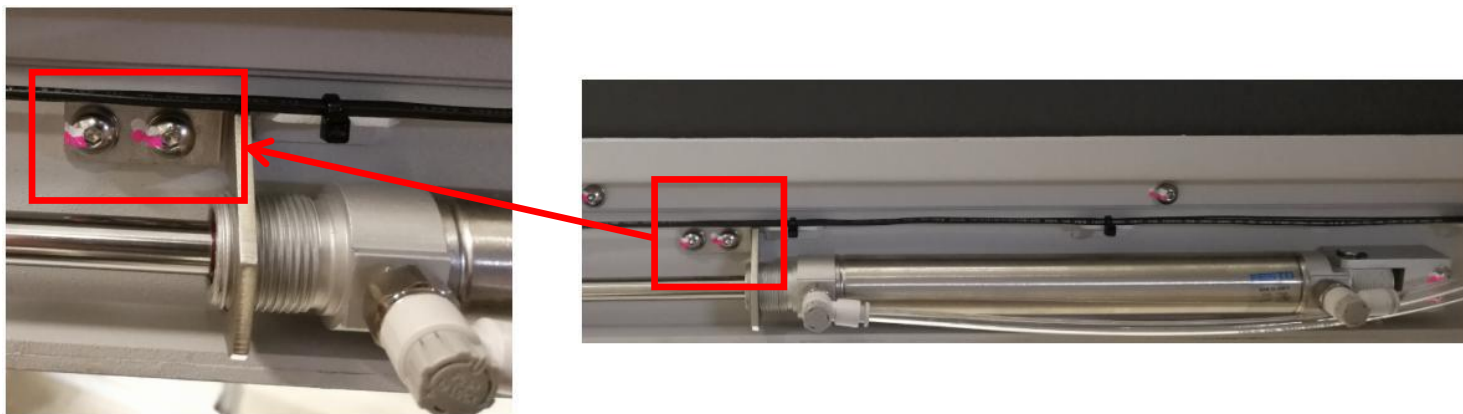


Figure 24

28. Assemble Rear Cylinder Holder at outer barrier cylinder & tighten 2 x screws as Figure 25



Figure 25

29. Plug 2 x Tubing by refer to below orientation.

Orientation	Routing Path
A1-A2	Speed Controller to Outer Barrier Valve
B1-B2	Speed Controller to Outer Barrier Valve

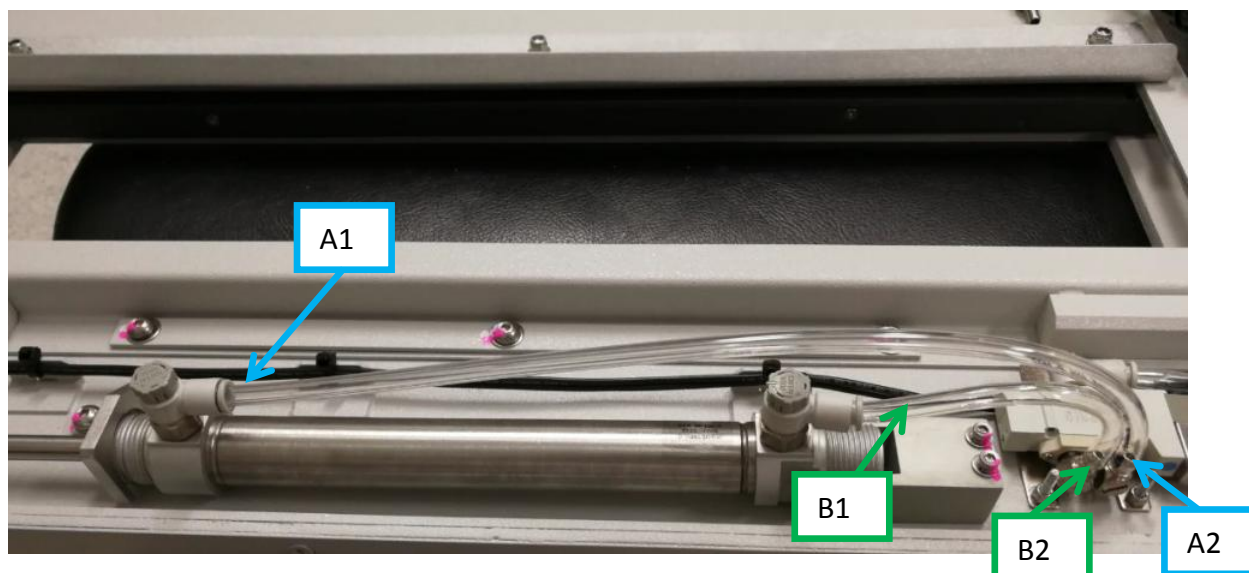


Figure 26

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 STD Outer Barrier Cylinder Removal & Replacement Procedure	Effective Date	2 Oct 2016

30. Assemble Outer Barrier to origin location. Tighten 4 x Tamper proof screws as Figure 1
31. Connect 4 x Connector as Figure 2
32. Turn On SSCA
33. Initialize at Digital IO Tab
34. Open/Close Outer Barrier at Digital IO Page
35. Visual Check Save cable & Inner Gate assembly by refer to below criteria :
 - a) Sava cable -No friction during movement
 - b) Sava cable-No sagging
 - c) Inner gate assembly- No gap upon barrier close/open

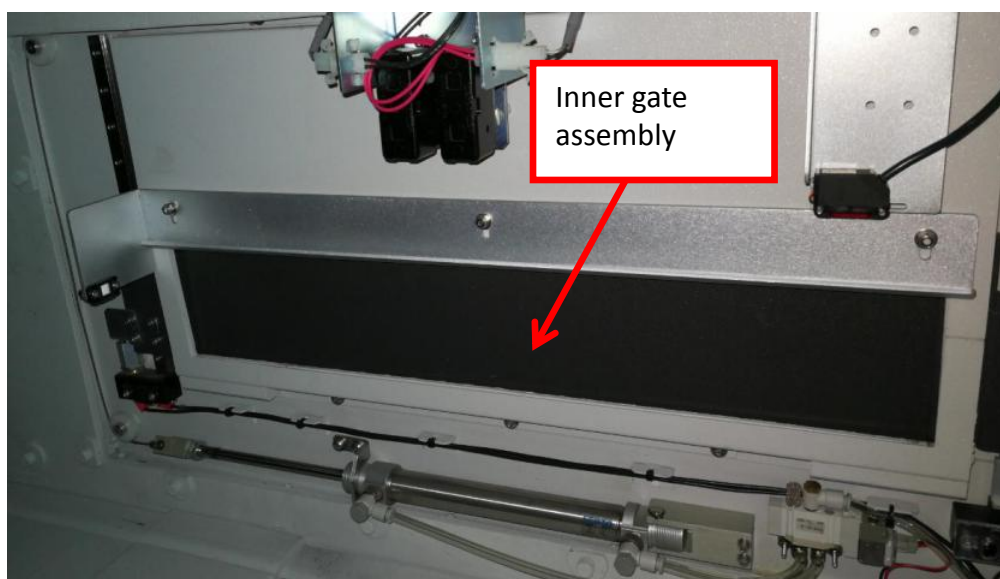


Figure 27

- i. If gap persist, may perform minor adjustment on the Front Extension Block & Nut. May refer to below Figure 28

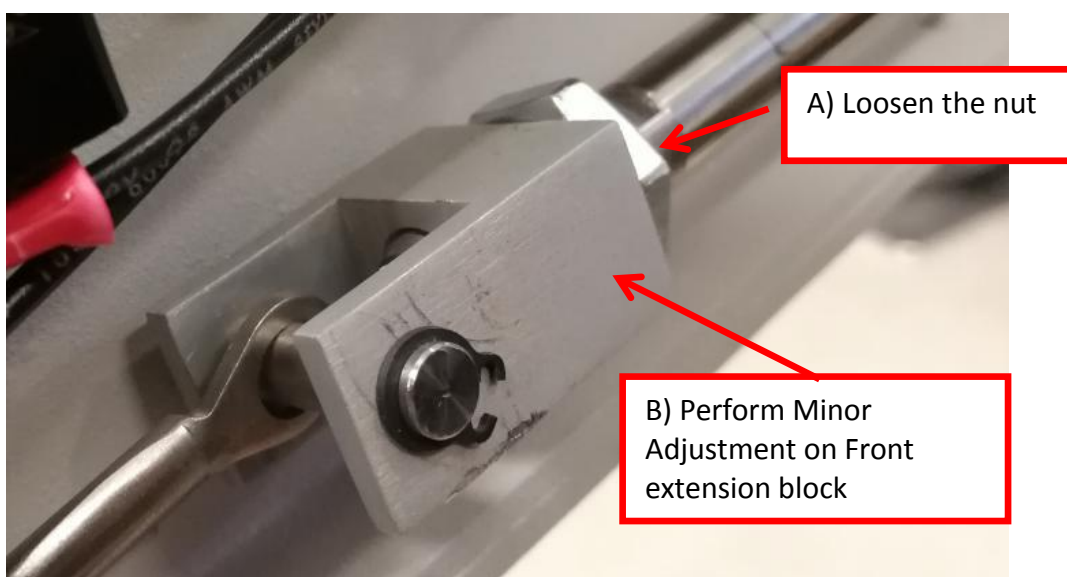


Figure 28

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 STD Outer Barrier Cylinder Removal & Replacement Procedure	Effective Date	2 Oct 2016

36. Perform X ray Survey
37. Open V810 GUI
38. Initialize at Panel handling
39. Open & Close particular Outer barrier .Record down Opening & Closing duration as below Figure 29.

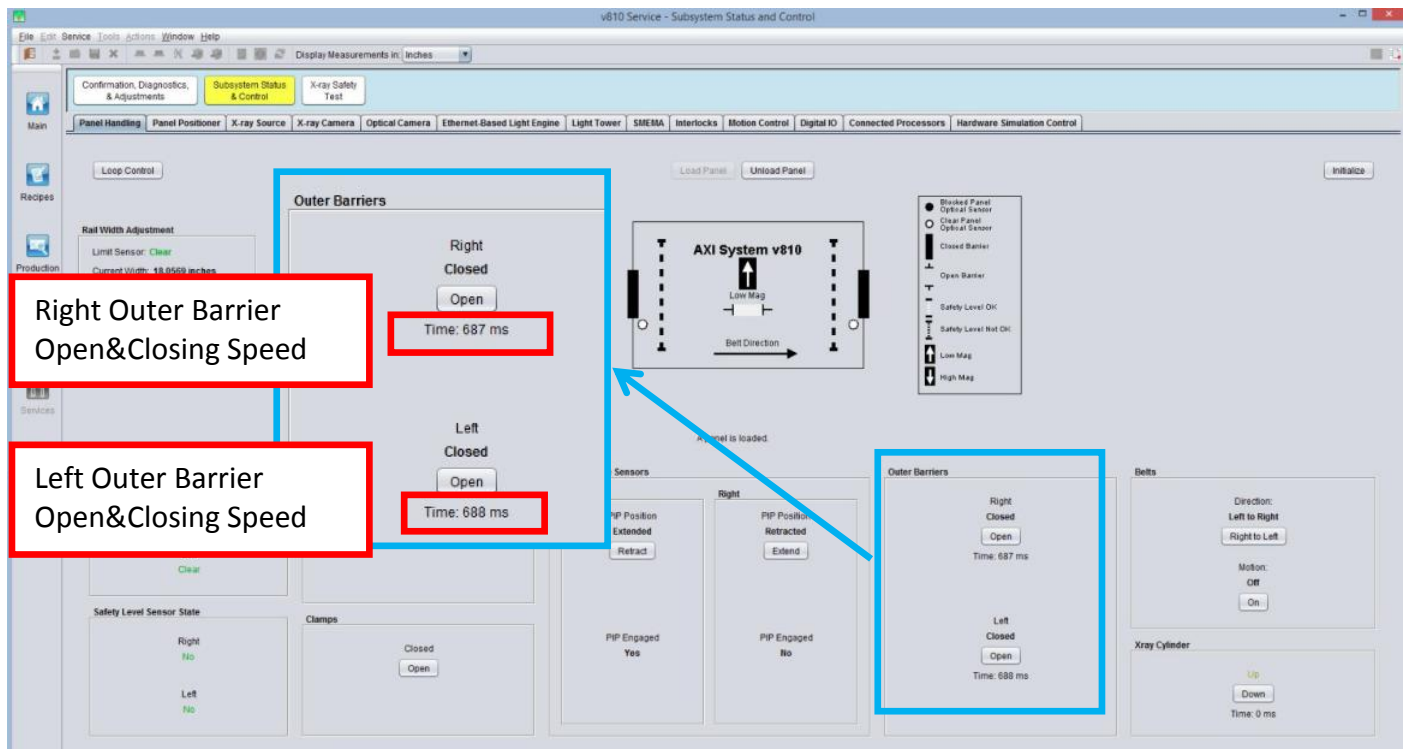


Figure 29

40. Adjust 2 X Speed Controller at Outer Barrier cylinder by refer to below table.

Outer Barrier Status	Outer Barrier Speed
Open	500ms~750ms
Close	500ms~750ms

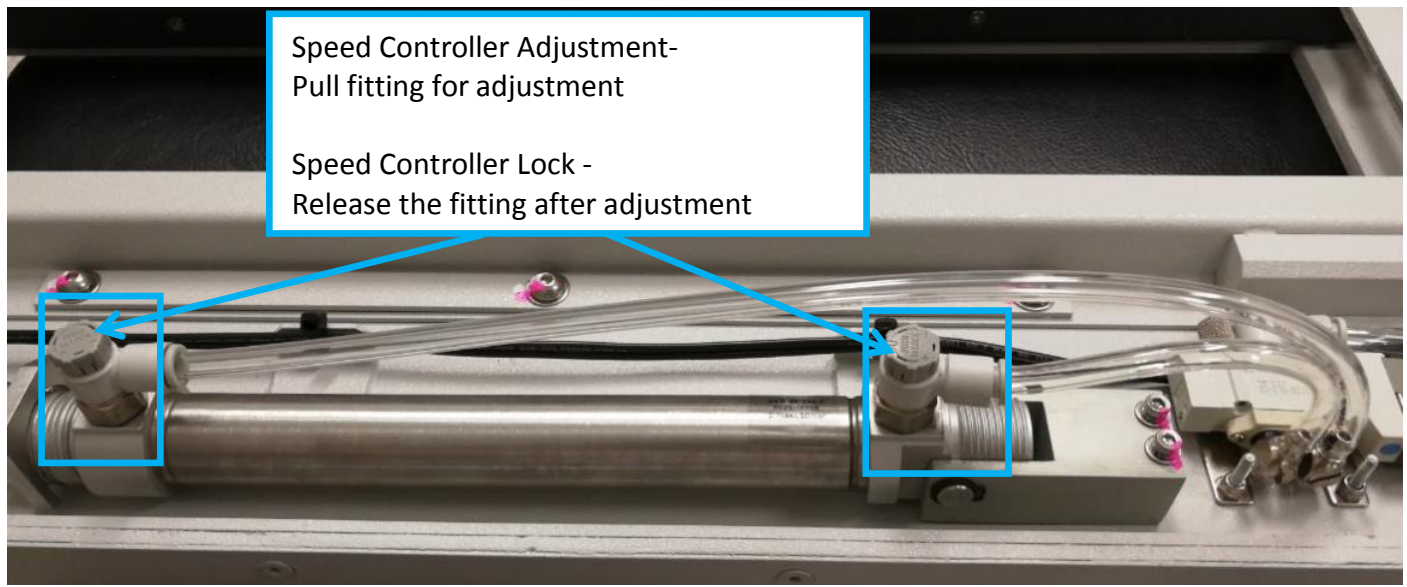


Figure 30

41. Run 1 x Loop of CD &A