

	Work Instruction	Doc. Revision	01
	AXI V810 PIP Board Stop Replacement Procedure	Effective Date	2 Feb 2017

This procedure is applicable to below models:

V810 STD	☐	S1	☐	S2
V810 XXL	☒	S1	☒	S2
V810 S2EX	☐	Optical	☒	Mechanical
V810 Mini	☐			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	15 Jan 2017	First Release	Muhammed Shameem
01	2 Feb 2017	Template Changes & Content Update	ONG KEAN SHENG

	Work Instruction	Doc. Revision	01
	AXI V810 PIP Board Stop Replacement Procedure	Effective Date	2 Feb 2017

Content

PIP Board Stop Removal Procedure.....	3
New PC, Board Stop replacement.....	6

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 PIP Board Stop Replacement Procedure	Effective Date	2 Feb 2017

PIP Board Stop Removal Procedure

1. Loosen SHCS M3x6 (2x) and remove the Mount Flag from PC, Board Stop

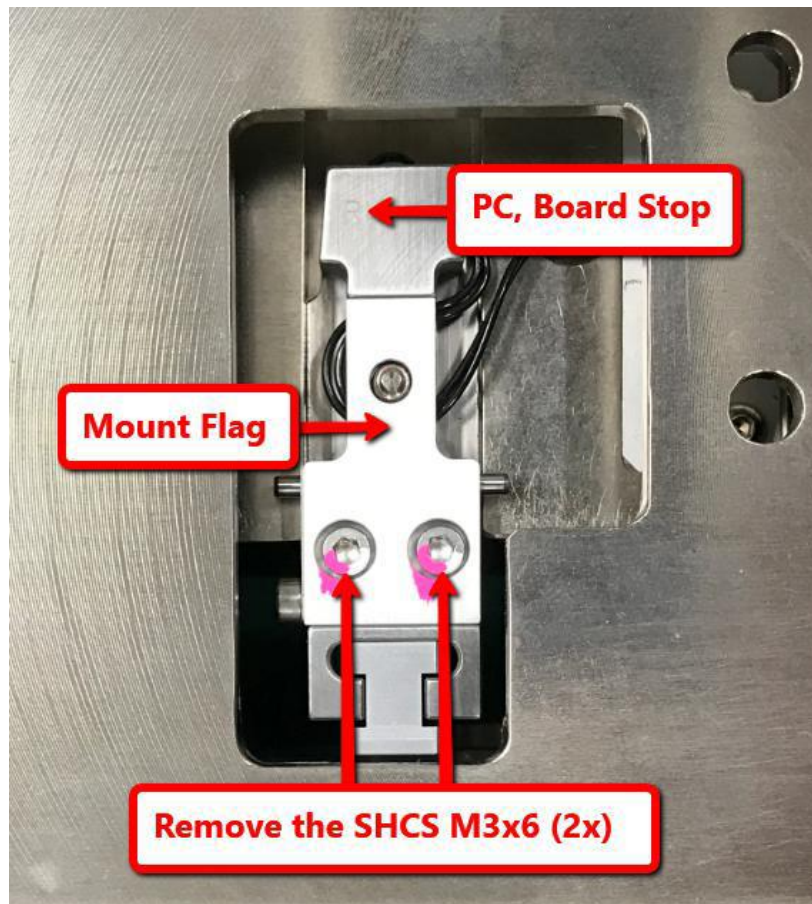


Figure 1 Mount Flag

2. Gently position Mount Flag at visible area as Figure 2.



Figure 2 PIP Sensor Mount Flag

ViTrox 	Work Instruction	Doc. Revision	01
	AXI V810 PIP Board Stop Replacement Procedure	Effective Date	2 Feb 2017

3. Loosen 2 x set screws & remove PIP sensor head from PIP board stop as Figure 3

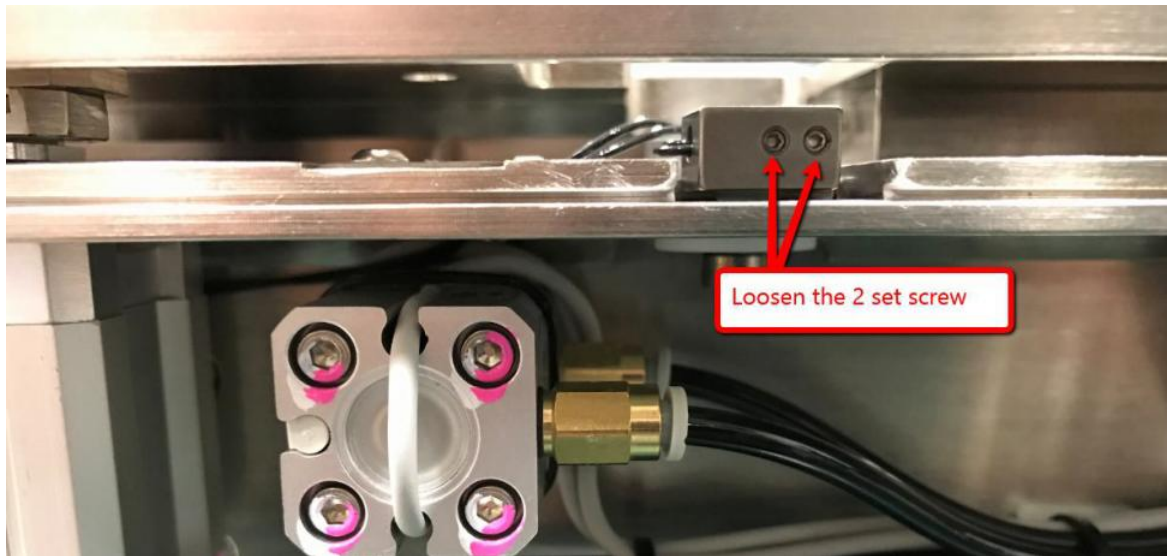


Figure 3 Loosen the 2 set screw

4. Remove PIP sensor head from PC, Board Stop as Figure 4

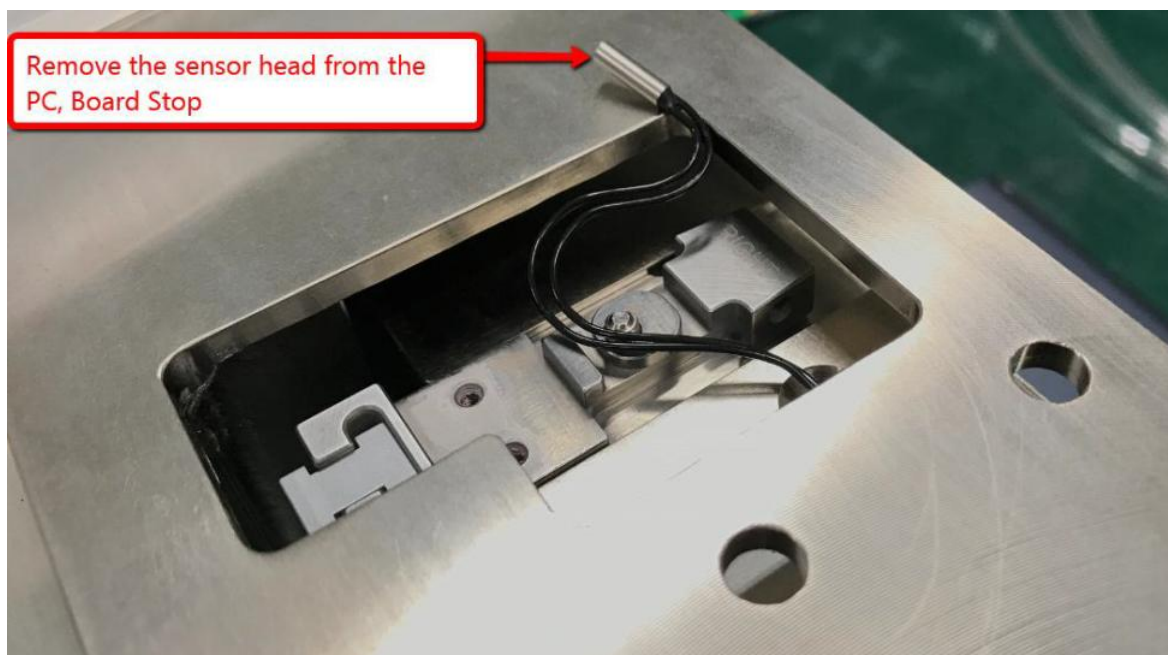


Figure 4 PC, Board Stop

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 PIP Board Stop Replacement Procedure	Effective Date	2 Feb 2017

5. Remove 8-32 thread (Inch Type) PIP Shoulder Screw from PC, Board Stop as Figure 5



Figure 5 Shoulder Screw Removal

6. Gently position XXL Spacer, Curver washer & Shoulder screw at visible area.

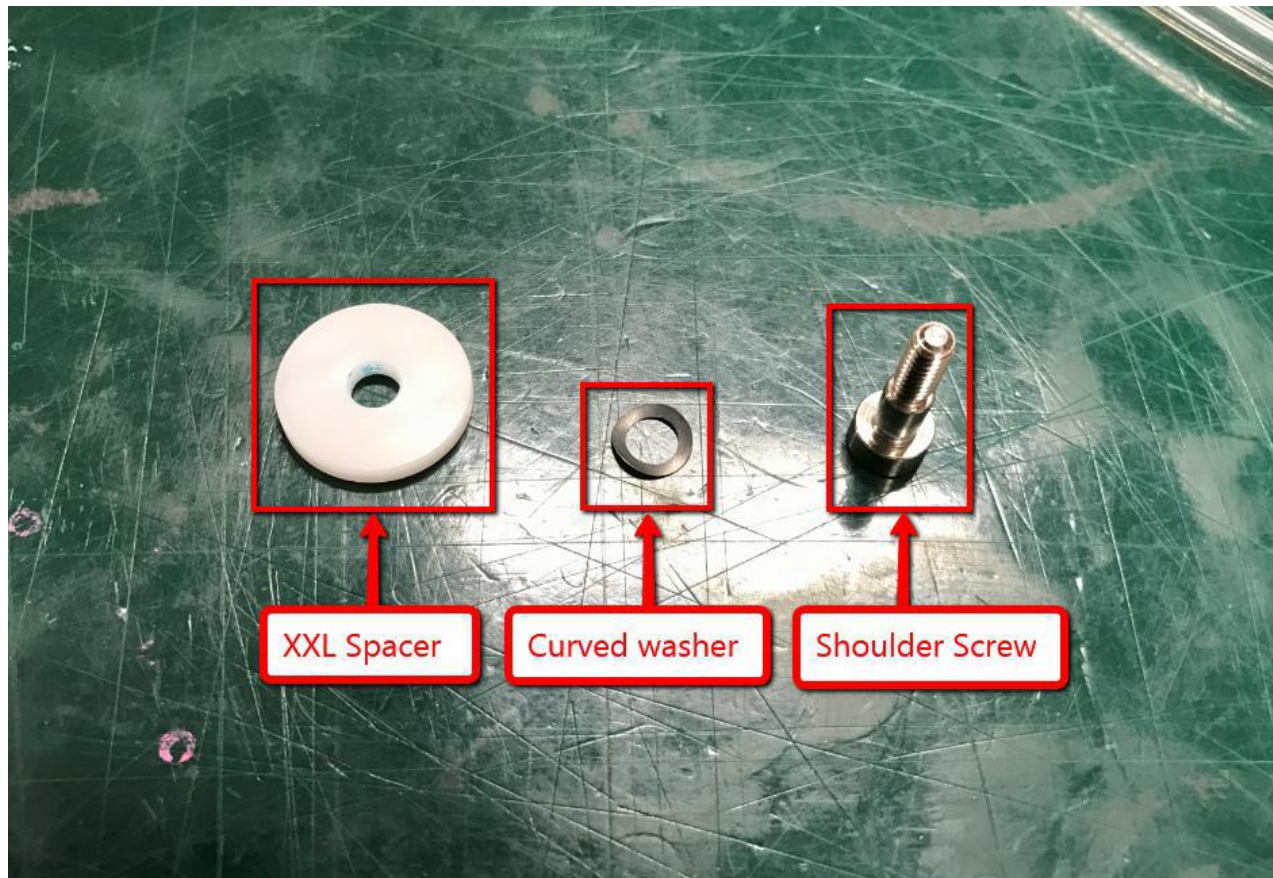


Figure 6 Shoulder Screw

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 PIP Board Stop Replacement Procedure	Effective Date	2 Feb 2017

New PC, Board Stop replacement

1. Prepare identical board stop by refer below PN.May refer Figure 7

For Left PC, Board Stop (Part ID: 4LAXY-136)

For Right PC, Board Stop (Part ID: 4LAXY-137)

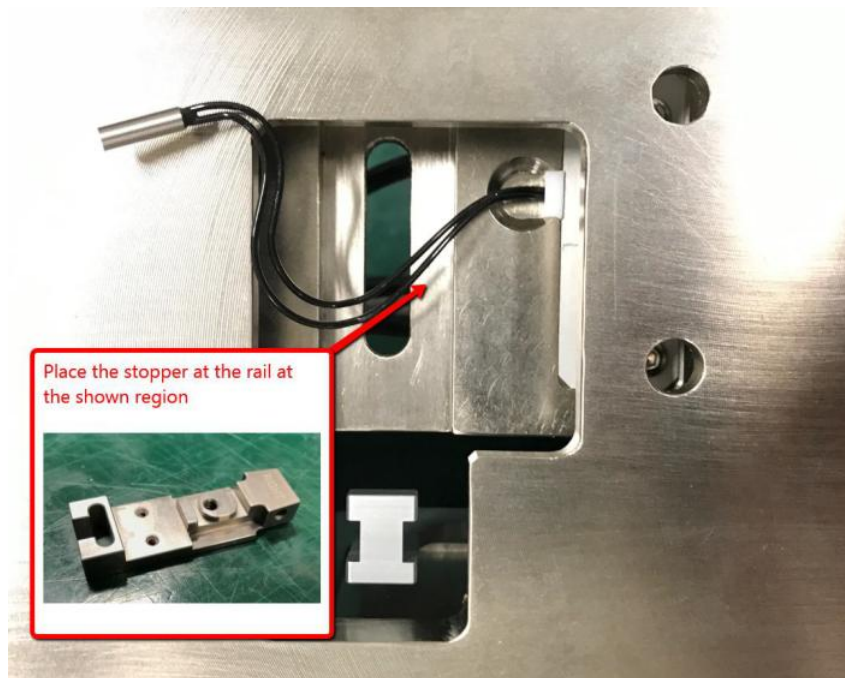


Figure 7 PC, Board Stop

2. Gently slot PC,board stop at Z-Nose as Figure 8

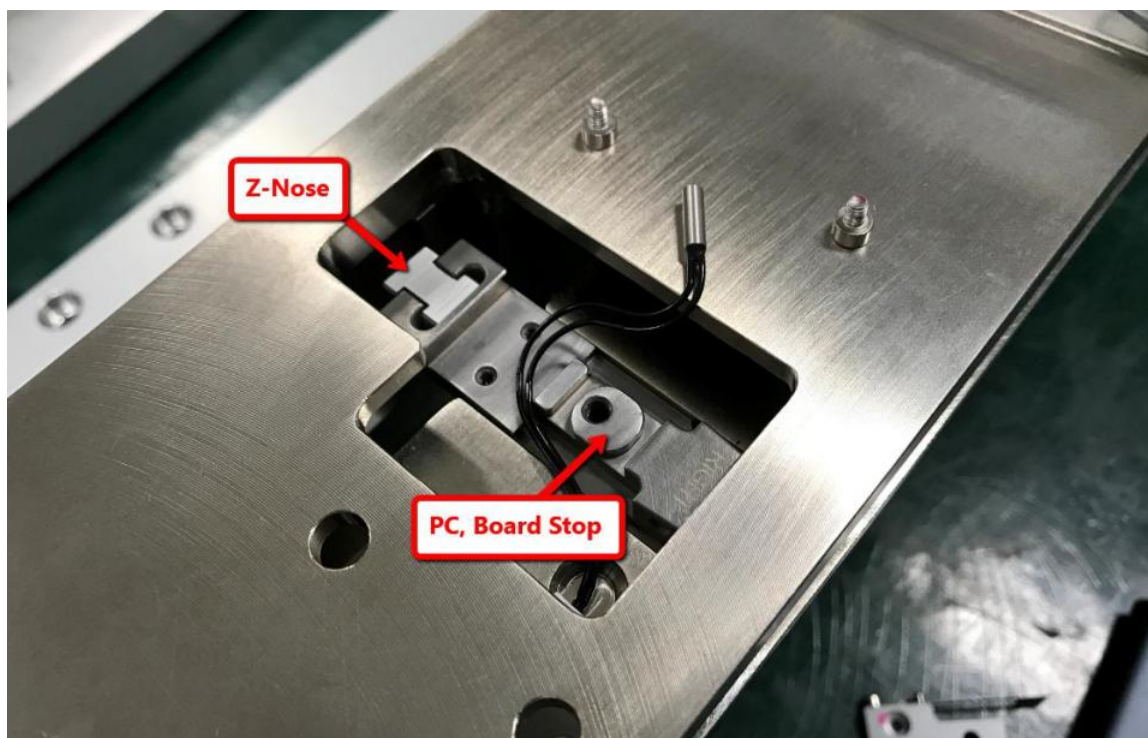


Figure 8 PC, Board Stop

	Work Instruction	Doc. Revision	01
	AXI V810 PIP Board Stop Replacement Procedure	Effective Date	2 Feb 2017

3. Assemble below fastening by refer below sequence. May refer to Figure 9
 - a) Shoulder screw -> Curve Washer -> XXL Spacer

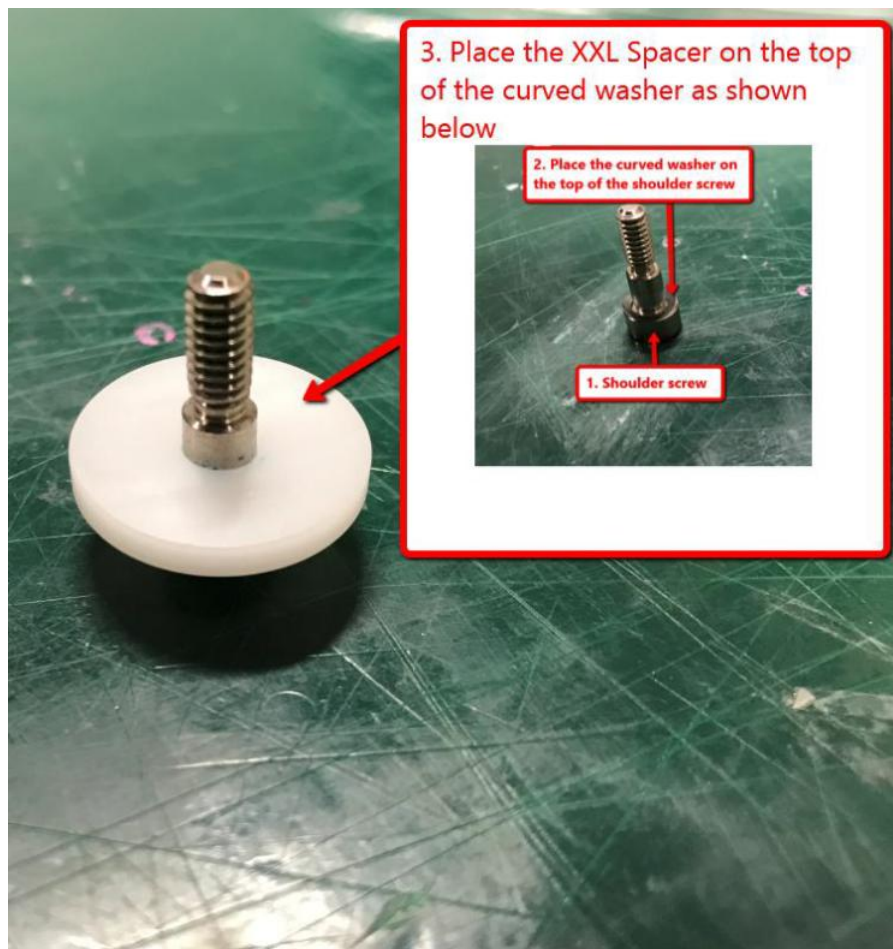


Figure 9 Shoulder Screw

4. Assemble all fastening (Shoulder screw, curve washer & XXL Spacer) into PC, board stop as Figure 10

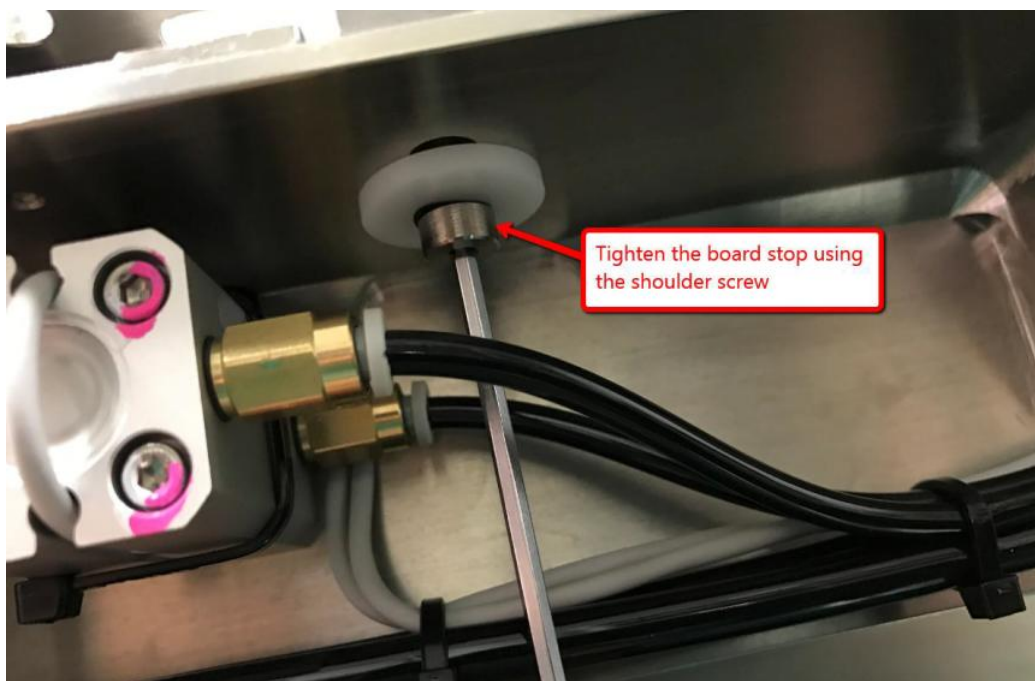


Figure 10 Board Stop

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 PIP Board Stop Replacement Procedure	Effective Date	2 Feb 2017

5. Gently route sensor head into PC, Board as Figure 10

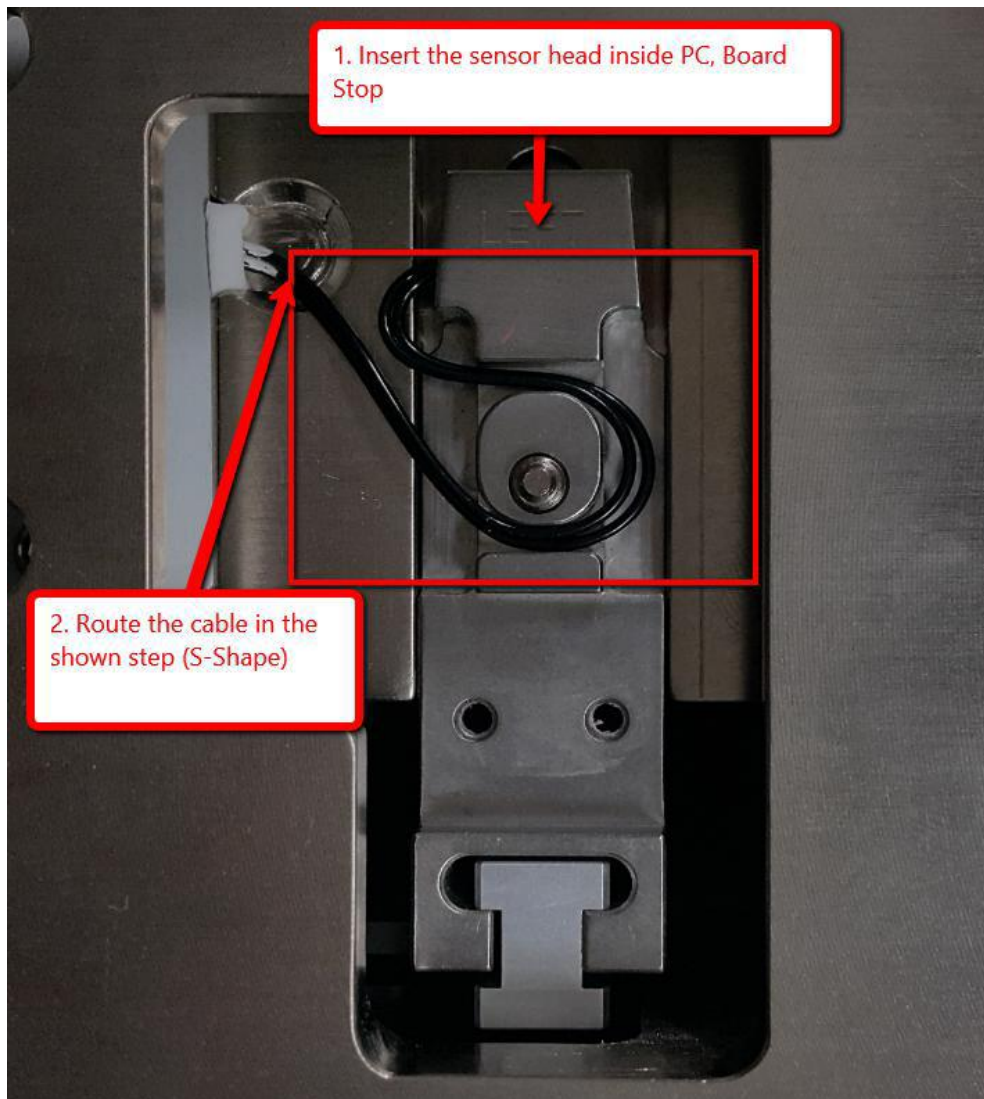


Figure 11 Sensor Head Routing

6. Align the sensor head with board stop. Tighten up 2 x set screws.

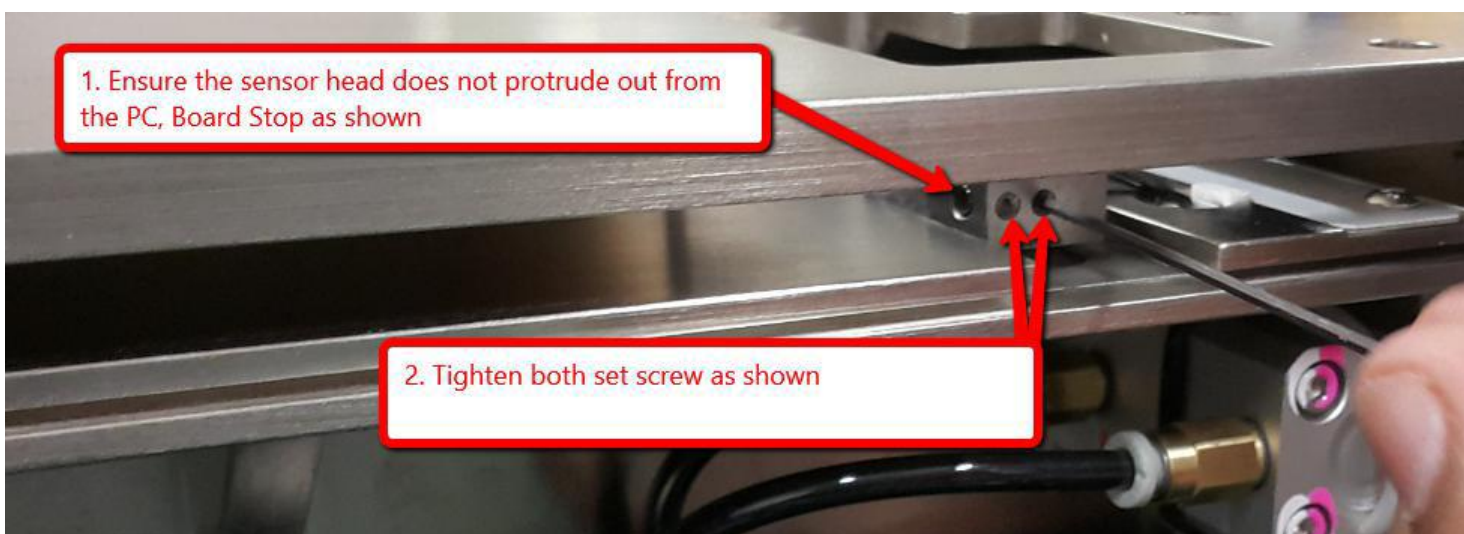


Figure 12 PC, Board Stop

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 PIP Board Stop Replacement Procedure	Effective Date	2 Feb 2017

7. Assemble mount flag on the PC, Board Stop as Figure 13 by refer to below criteria.

- PIP Cable not twisted
- Mount flag stack step not contact with PIP Sensor Cable

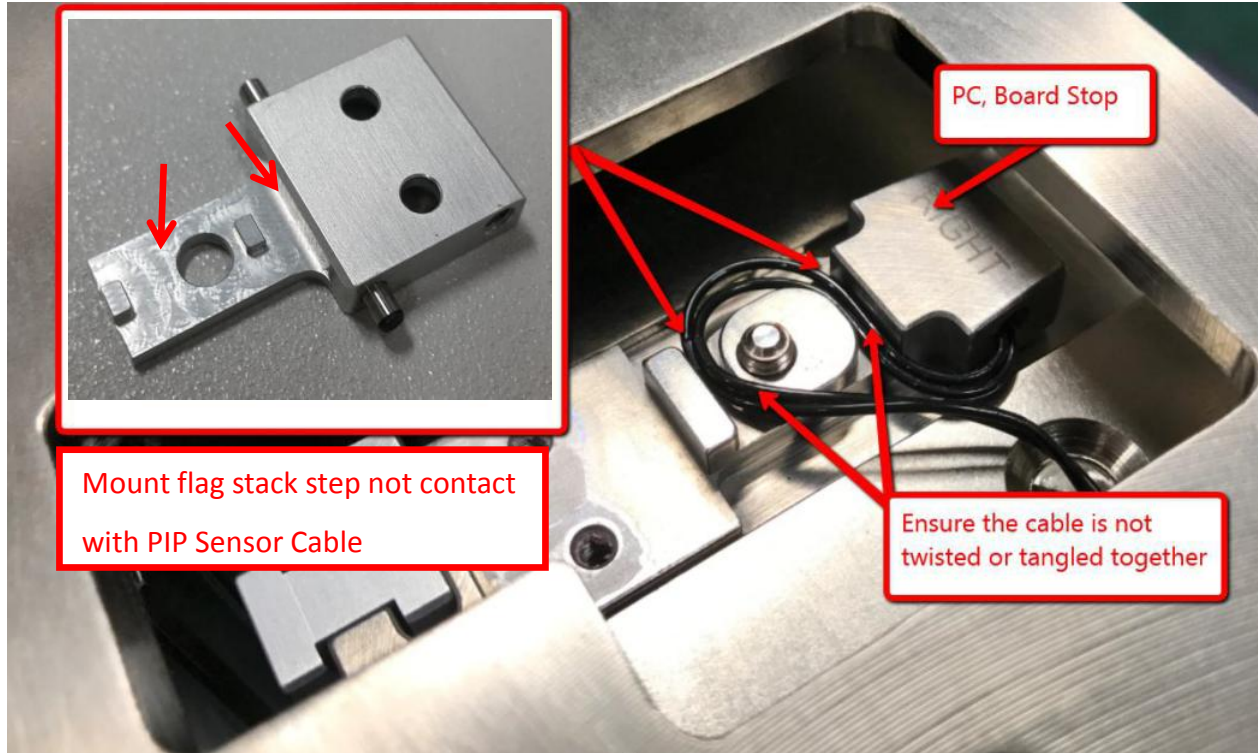


Figure 13 Flag Mount Installation

- Obtain a dummy carrier where require minimum of 4 inch.
- Go to Services -> Subsystem Status & Control -> Panel Handling and click Initialize as shown in the Figure 14

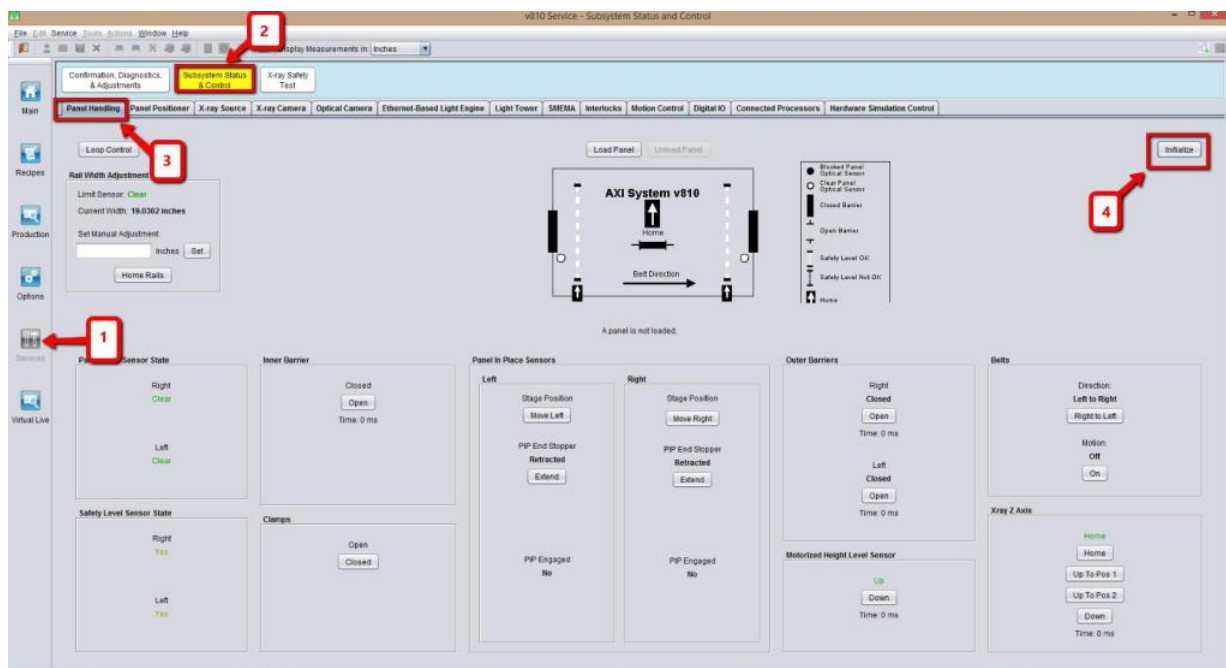


Figure 14 Panel Handling

	Work Instruction	Doc. Revision	01
	AXI V810 PIP Board Stop Replacement Procedure	Effective Date	2 Feb 2017

10. Set the parameters as shown in the Figure 15 and click Load Panel.

The outer barrier will open & awaiting for panel to load .Do not load any board & Click cancel.

Remarks :Panel width (inches) : 18 (Reference Value only , depends on dummy carrier width)

Panel length (inches): 18 (Reference Value only,depend on dummy carrier width)

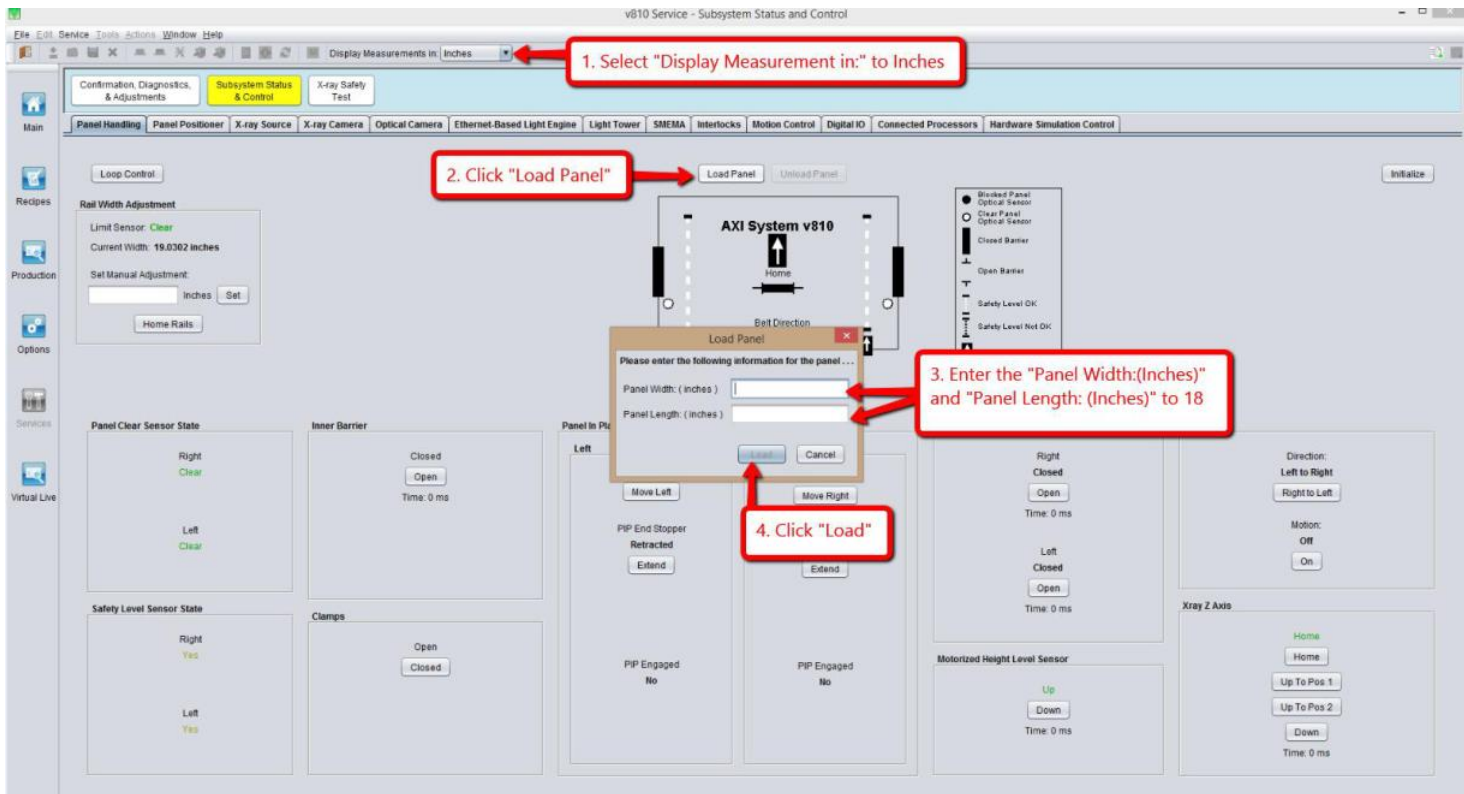


Figure 15 Panel Handling (Load Jig)

	Work Instruction	Doc. Revision	01
	AXI V810 PIP Board Stop Replacement Procedure	Effective Date	2 Feb 2017

11. Go to Services-> Confirmation, Diagnostics & Adjustment and run Panel Handling Confirmation for 5 loops as Figure 13

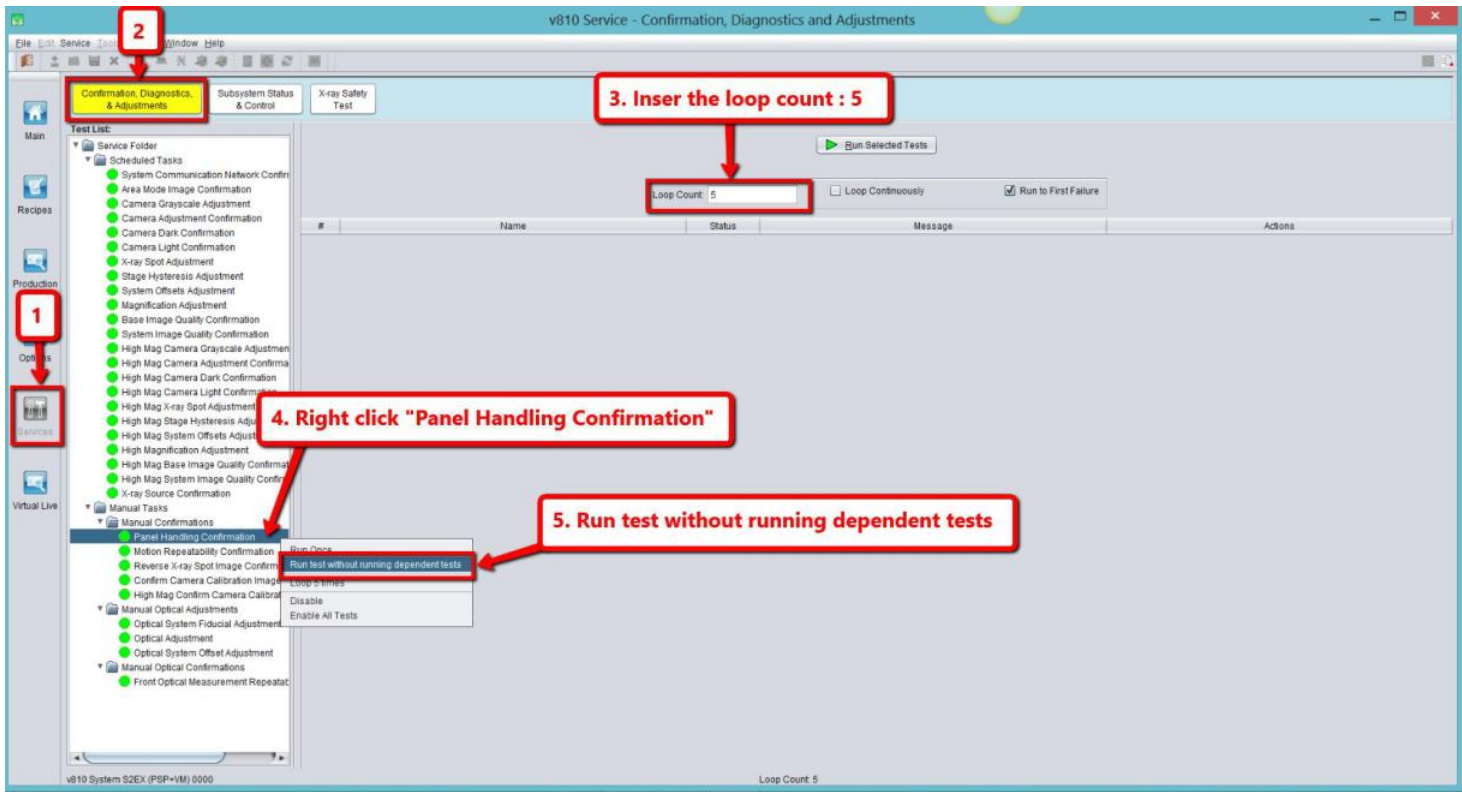


Figure 16 Panel Handling Confirmation

12. Load dummy board accordingly. Panel handing confirmation task will be prompt as “Passed”
13. Unload the board accordingly.