

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

This procedure is applicable to below models:

V810 STD	☐	S1	☐	S2
V810 XXL	☒	S1	☒	S2
V810 S2EX	☒			
V810 Mini	☐			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	30 May 2017	First Release	Tan Liang Kai

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

Content

Left PIP In Reed Switch Assembly Kit.....	3
Left PIP In Reed Switch Assembly Kit Removal.....	3
Left PIP In Reed Switch Assembly Kit Replacement.....	7
Left PIP Out Reed Switch Assembly Kit.....	9
Left PIP Out Reed Switch Assembly Kit Removal.....	9
Left PIP Out Reed Switch Assembly Kit Replacement.....	12
Right PIP In Reed Switch Assembly Kit.....	14
Right PIP In Reed Switch Assembly Kit Removal.....	14
Right PIP In Reed Switch Assembly Kit Replacement.....	17
Right PIP Out Reed Switch Assembly Kit.....	19
Right PIP Out Reed Switch Assembly Kit Removal.....	19
Right PIP Out Reed Switch Assembly Kit Replacement.....	22

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

Left PIP In Reed Switch Assembly Kit

Left PIP In Reed Switch Assembly Kit Removal

1. Open V810 > Services > Subsystem Status & Control > Digital IO > Initialize

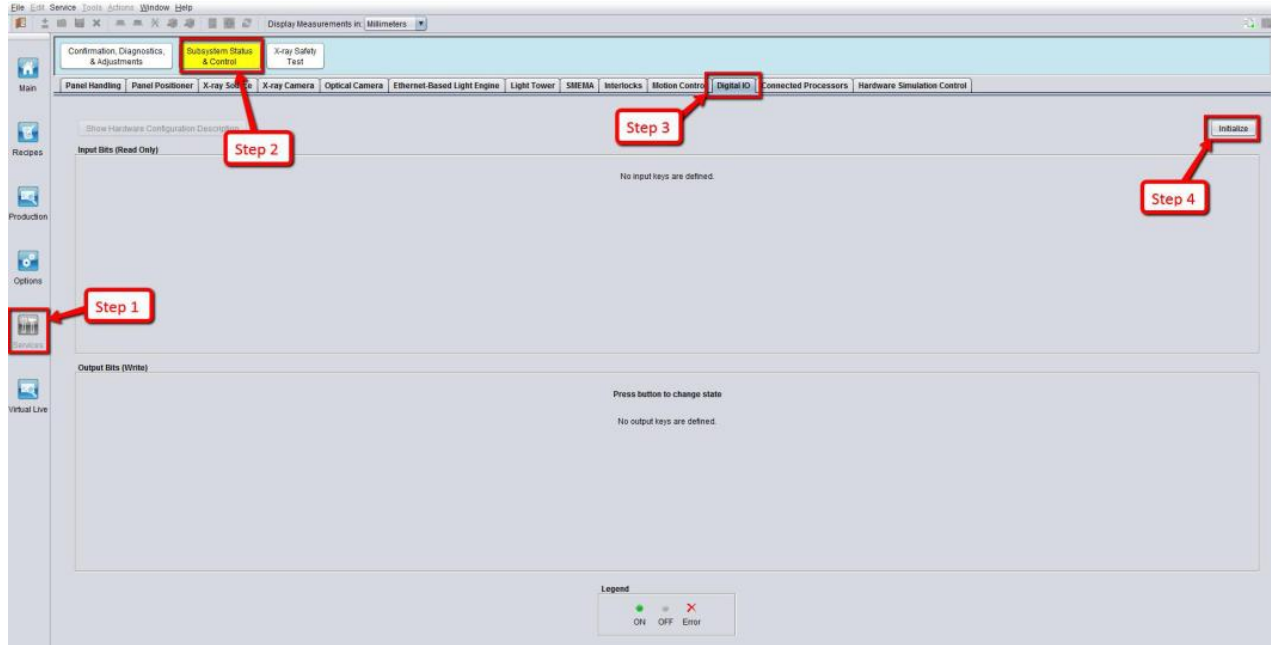


Figure 1 Digital IO

2. Close X-ray Source & open Front Door
3. Uncheck "Panel Clamps Closed" and ensure panel clumper is in "Open" status.
 - a) For S2EX machine:

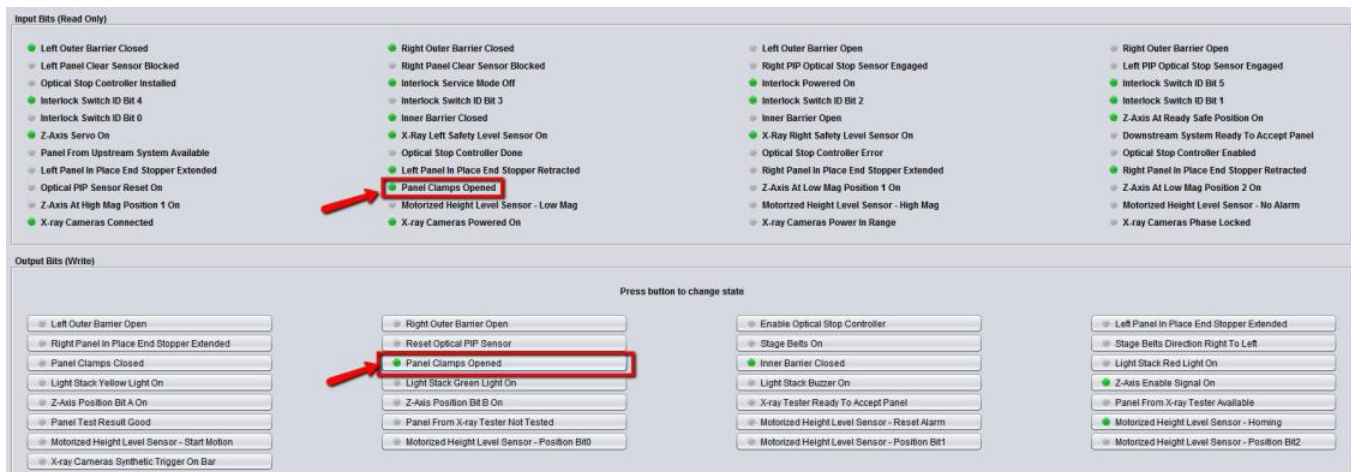


Figure 2 Panel Clumper "Open" status (S2EX machine)

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

b) For XXL machine:

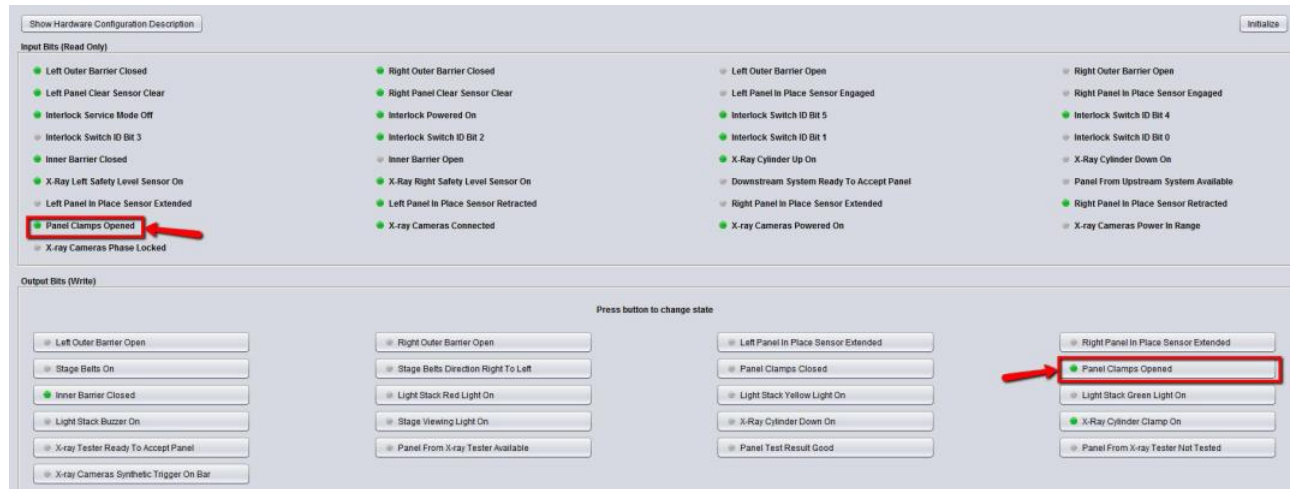


Figure 3 Panel Clamper "open" status (XXL machine)

4. Close SSCA.
5. Remove necessary cable ties as Figure 4

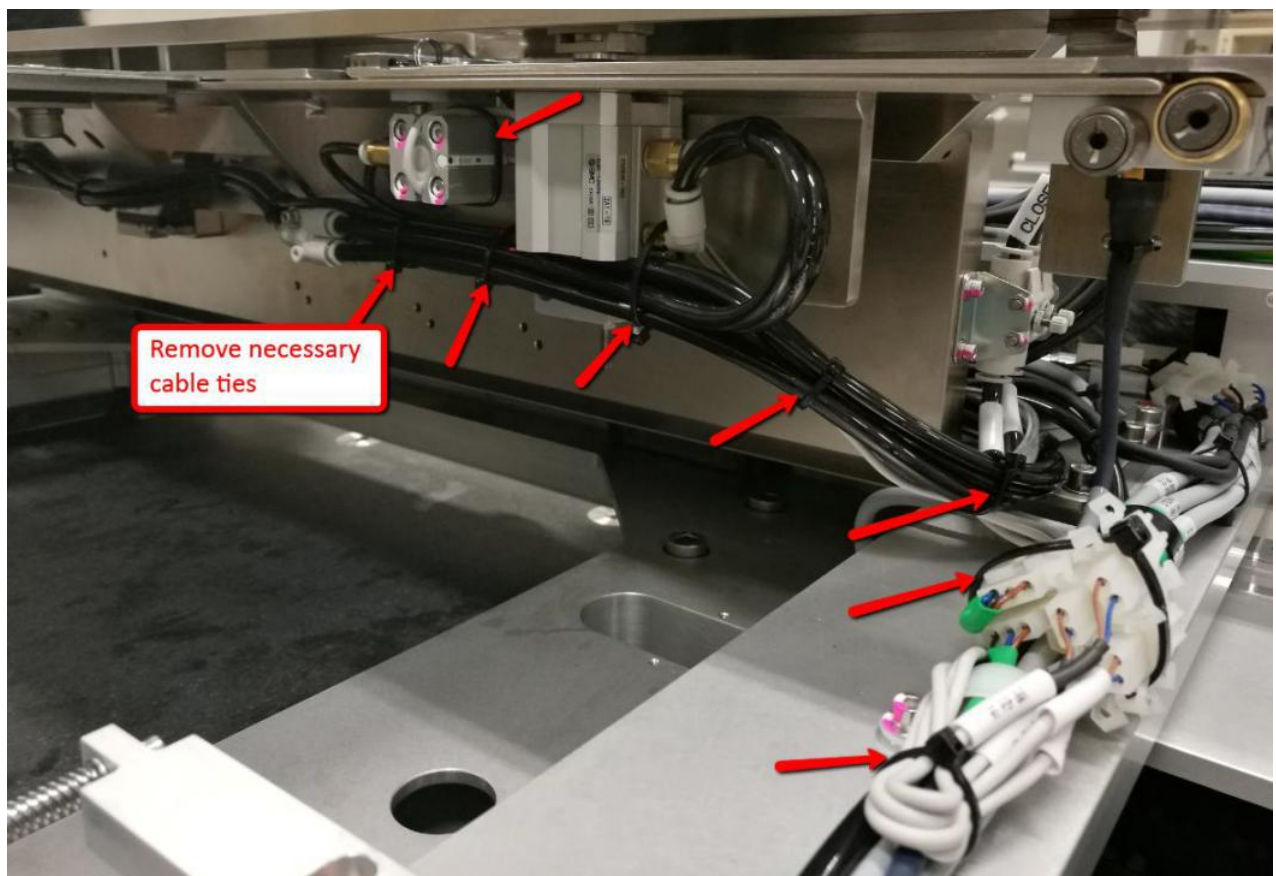


Figure 4 Cable Ties Removal

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

6. Identify "LT PIP In Label".Unplug Left PIP In Reed Sensor Cable connector as Figure 5

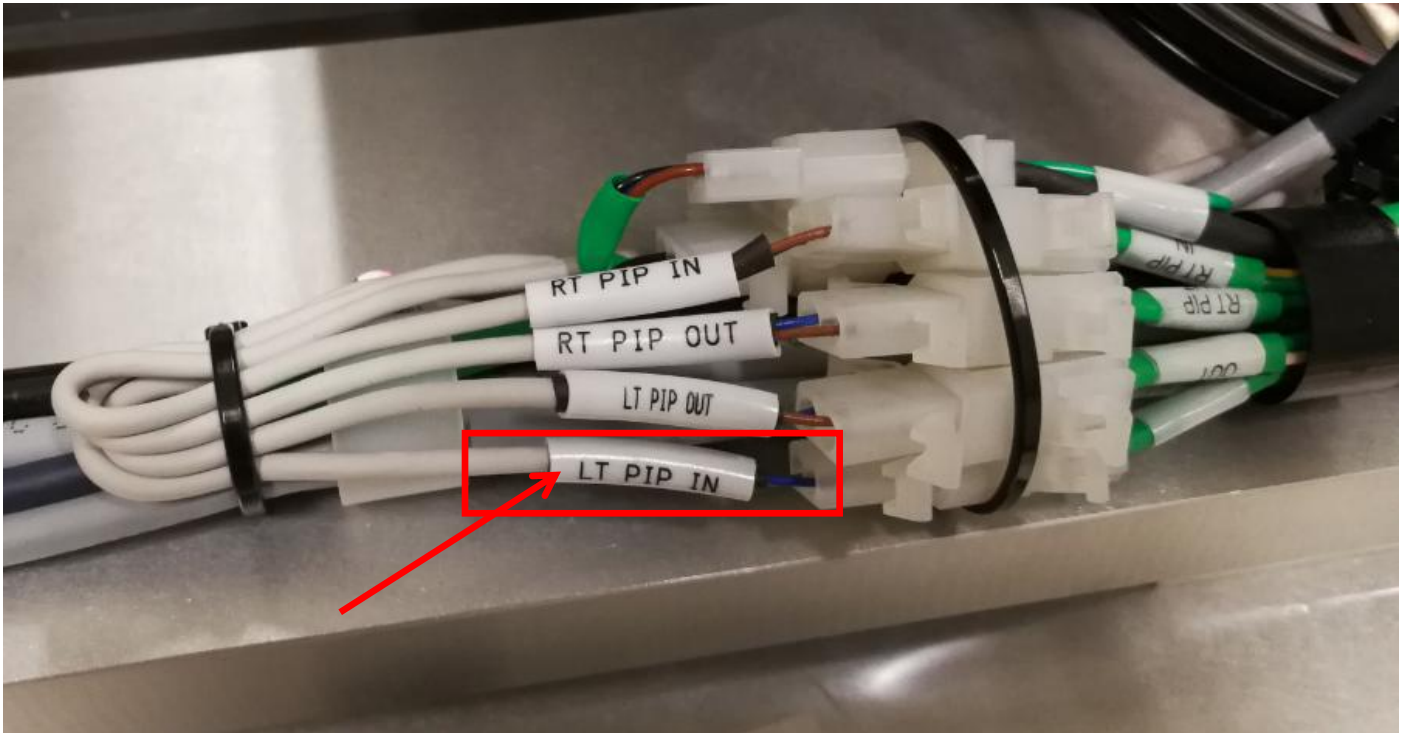


Figure 5 Left PIP In Connector Removal

7. Loosen screw and remove left PIP In Reed Sensor as Figure 6

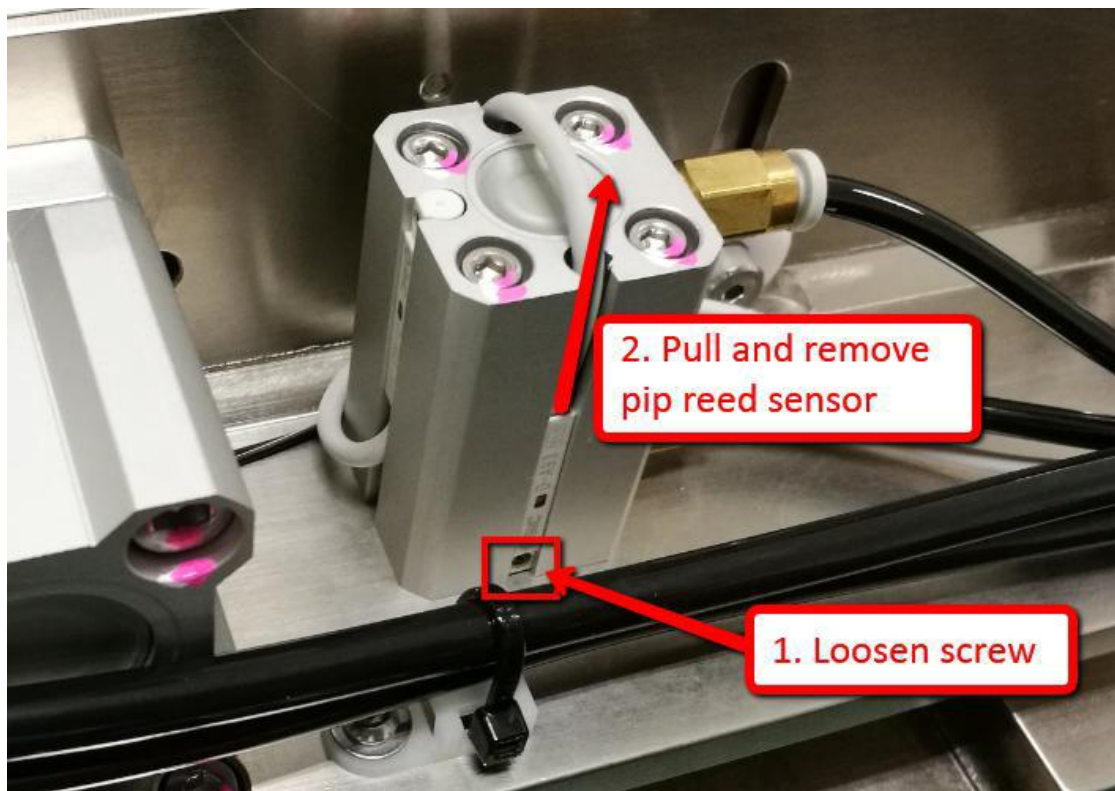


Figure 6 Left PIP In Reed Sensor Removal

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

8. Remove defective Left PIP In Reed sensor by below routing path. May refer to Figure 7

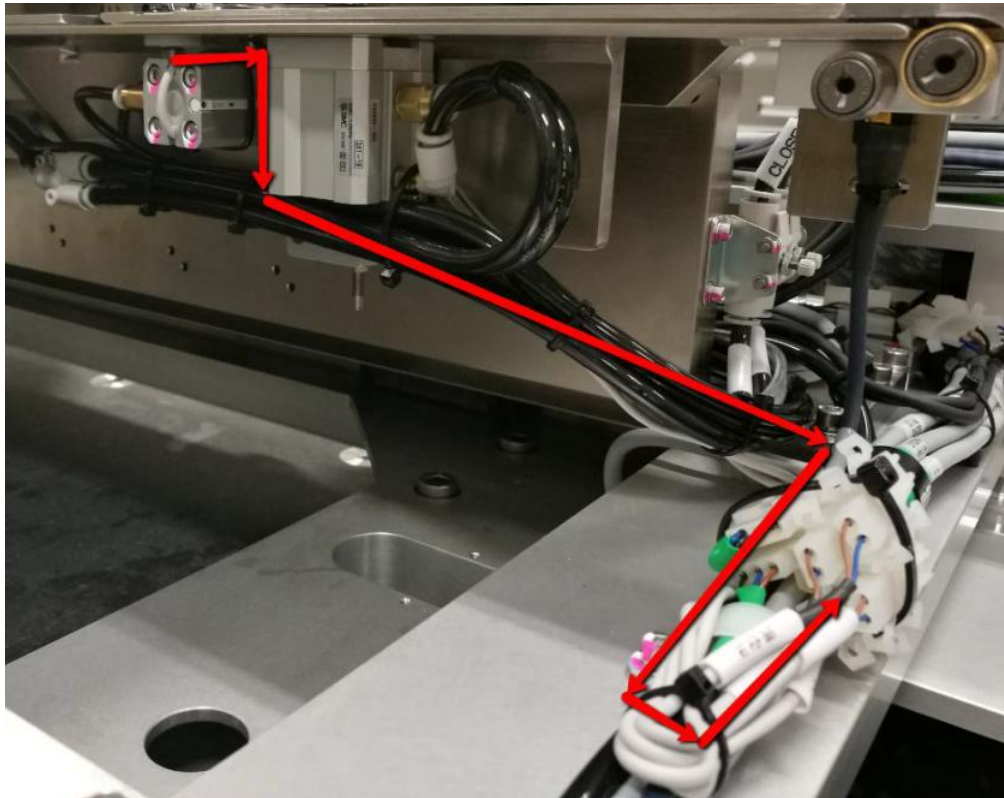


Figure 7 Left PIP In Reed Sensor Removal

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

Left PIP In Reed Switch Assembly Kit Replacement

XXL Left PIP In Reed Switch Assembly kit P/N: 4XASP-A094

S2EX Left PIP In Reed Switch Assembly kit P/N: 4XASP-A149

1. Assemble Left PIP In Reed Sensor to Left PIP Cylinder as shown in Figure 8 below. Hand Tight the Reed Sensor Screws Only



Figure 8 Left Pip In Reed Sensor Assembly

2. Plug Left PIP In Reed Sensor Cable connector by refer to ““LT PIP In Label” as Figure 9

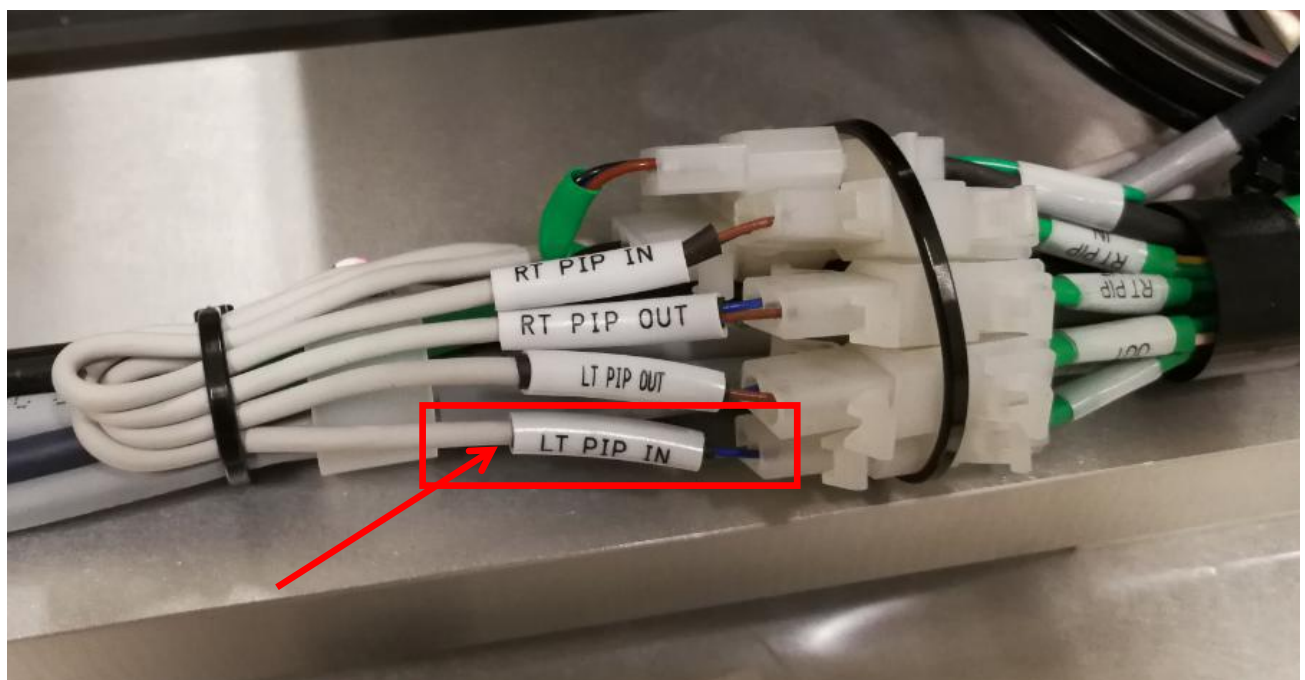


Figure 9 LT PIP In Connector Assembly

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

3. Manually retract Left PIP at Digital IO tab. Adjust Left PIP In Reed Sensor until RED LED is indicate. Tighten Reed Sensor Screw after adjustment. Apply cable tie on cylinder



Figure 10 LED light on In Reed Sensor

4. Route Left PIP In Reed sensor by refer to below routing (Figure 11). Apply necessary cable ties as well

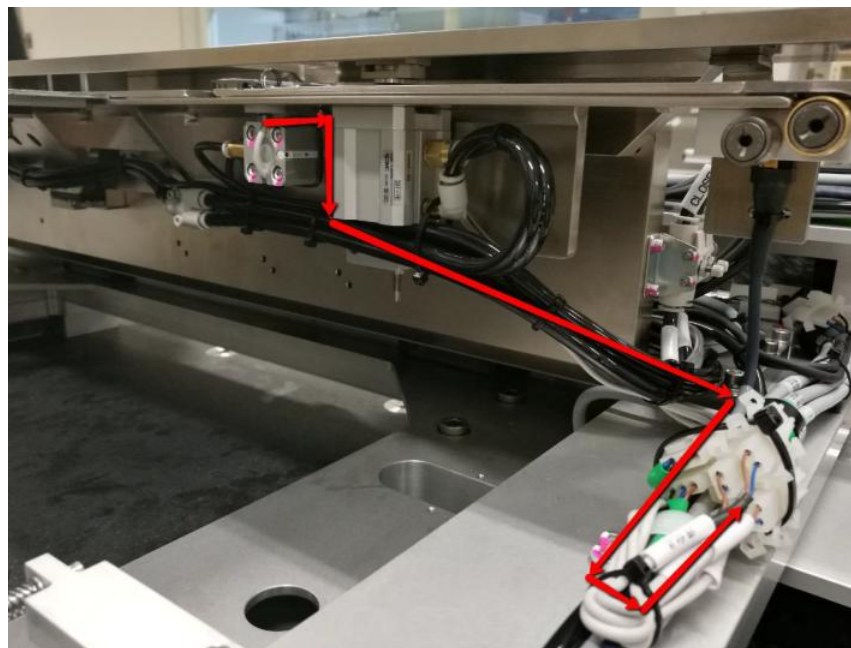


Figure 11 Left PIP In Reed Sensor Routing

5. Close Front Door & open X-ray source.
6. Run 3 loops CD&A.

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

Left PIP Out Reed Switch Assembly Kit

Left PIP Out Reed Switch Assembly Kit Removal

1. Open V810 > Services > Subsystem Status & Control > Digital IO > Initialize

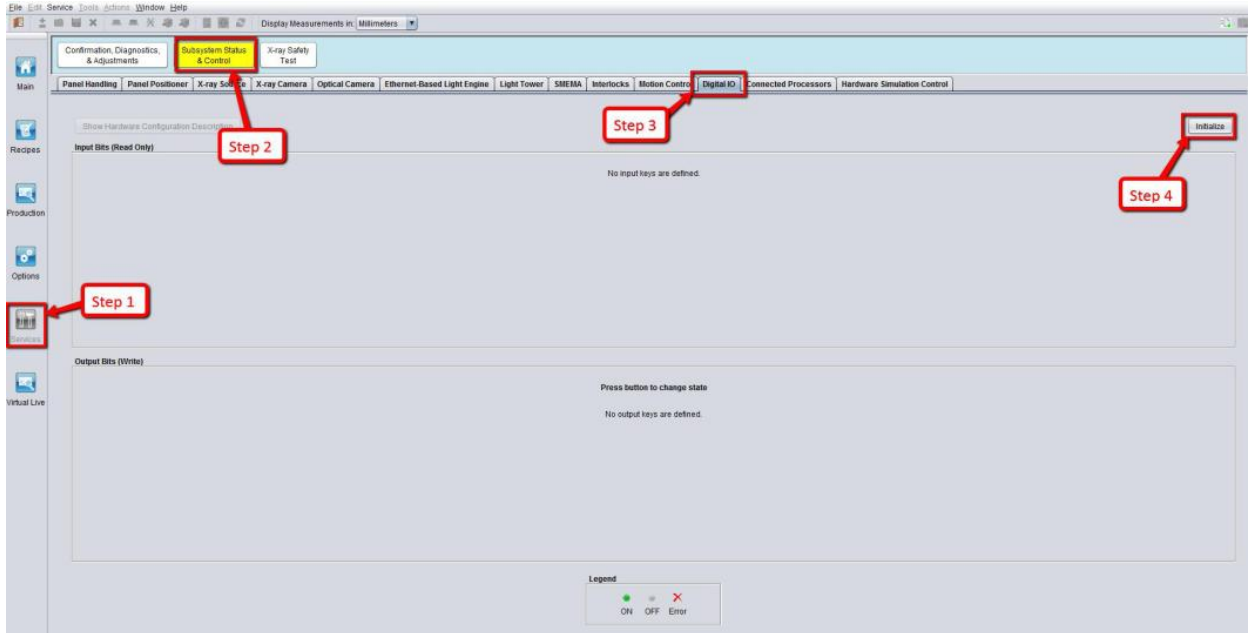


Figure 12 Initialize Digital IO

2. Close X-ray sources & open Front Door.
3. Uncheck "Panel Clamps Closed" and ensure panel clumper is in "open" status.
 - a) For S2EX machine:

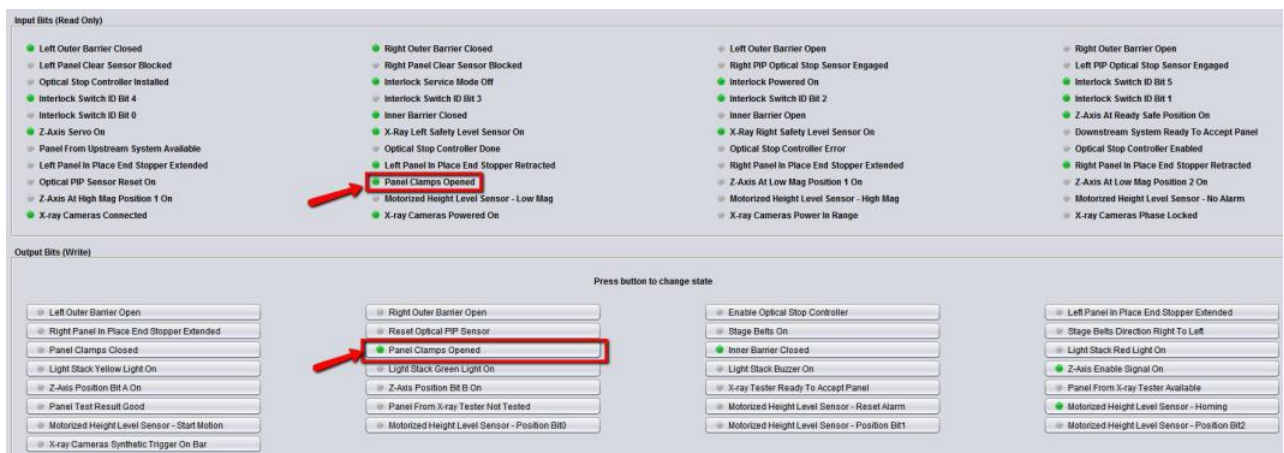


Figure 13 Panel Clumper "Open" status (S2EX machine)

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

b) For XXL machine:

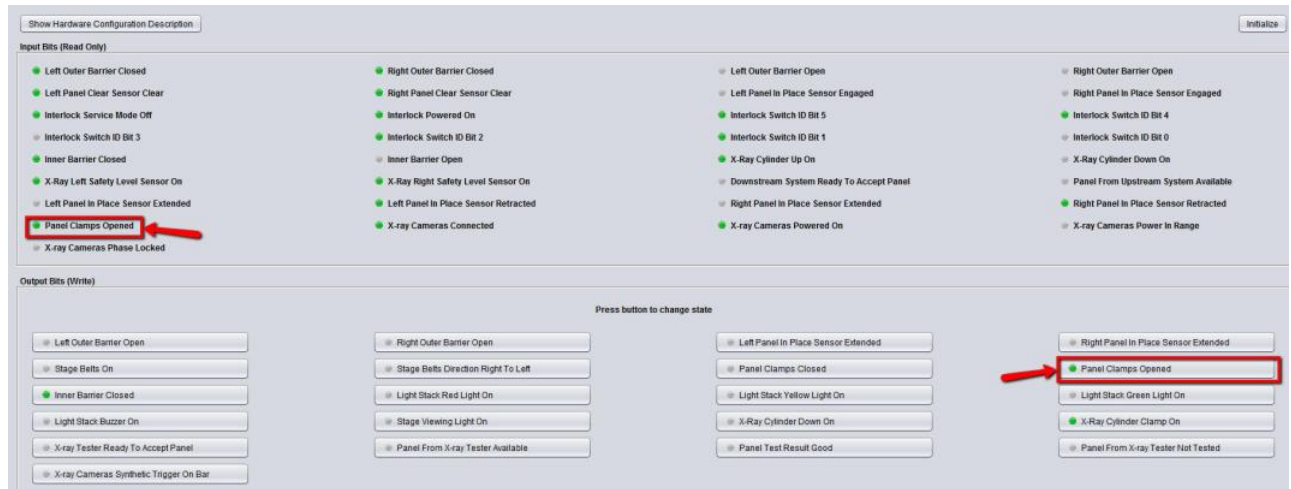


Figure 14 Panel Clamper "open" status (XXL machine)

4. Remove necessary cable ties as shown in Figure 15 below.



Figure 15 Cable ties Removal

5. Identify "LT PIP Out" Label. Unplug Left PIP Out Reed Sensor Cable Connector as shown in Figure 16 below.

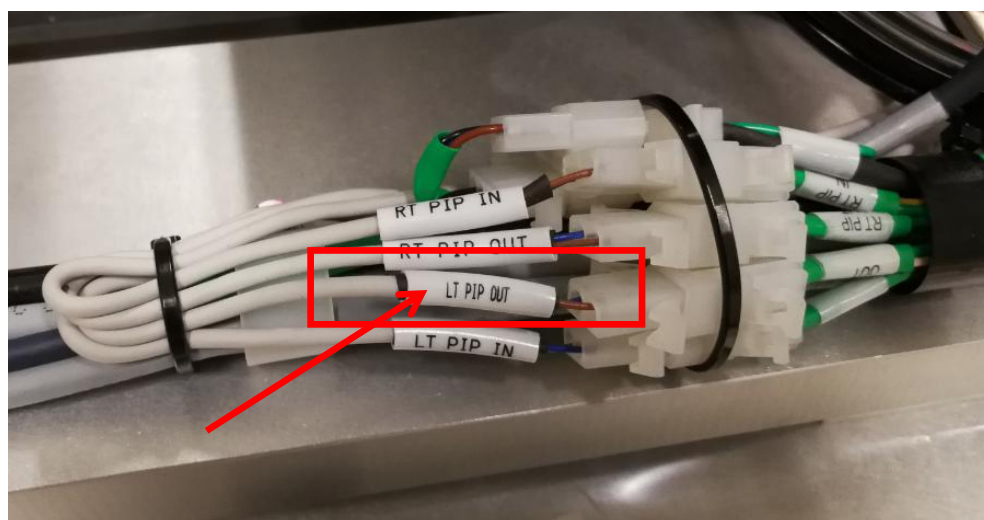


Figure 16 LT PIP Out Connector Removal

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

6. Loosen screw and remove Left PIP Out Reed Sensor as shown in Figure 17 below.

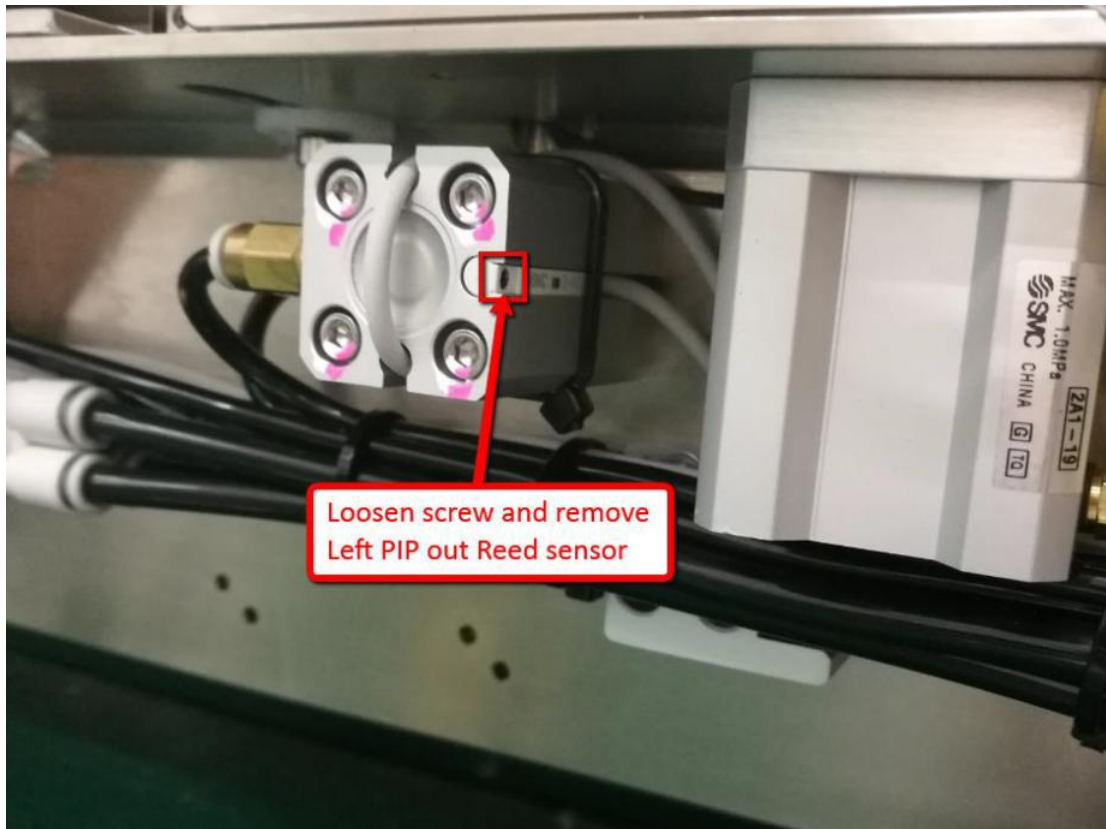


Figure 17 Left PIP Out Reed Sensor Removal

7. Remove defective Left PIP Out Reed sensor by following direction as shown in Figure 18 below.

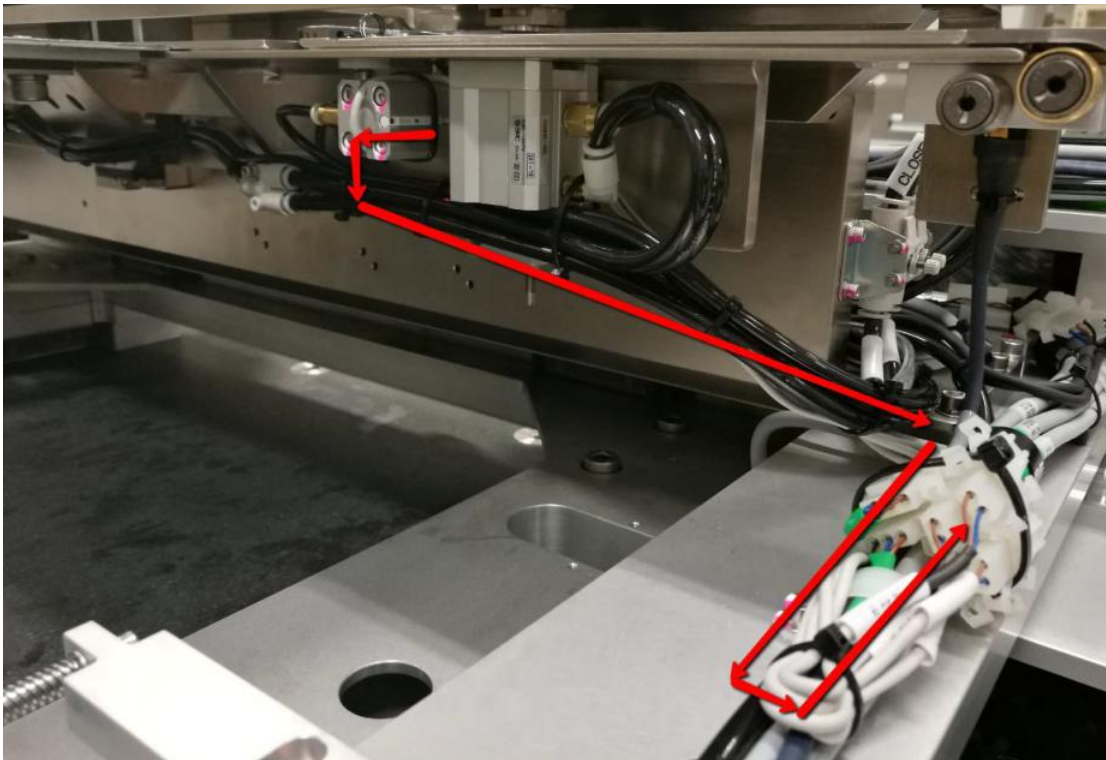


Figure 18 Left PIP Out Reed Sensor Removal

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

Left PIP Out Reed Switch Assembly Kit Replacement

XXL Left PIP Out Reed Switch Assembly kit P/N: 4XASP-A093

S2EX Left PIP Out Reed Switch Assembly kit P/N: 4XASP-A148

1. Assemble Left PIP Out Reed Sensor to Left PIP Cylinder as shown in Figure 19 below. Hand tight Reed Sensor Screw Only

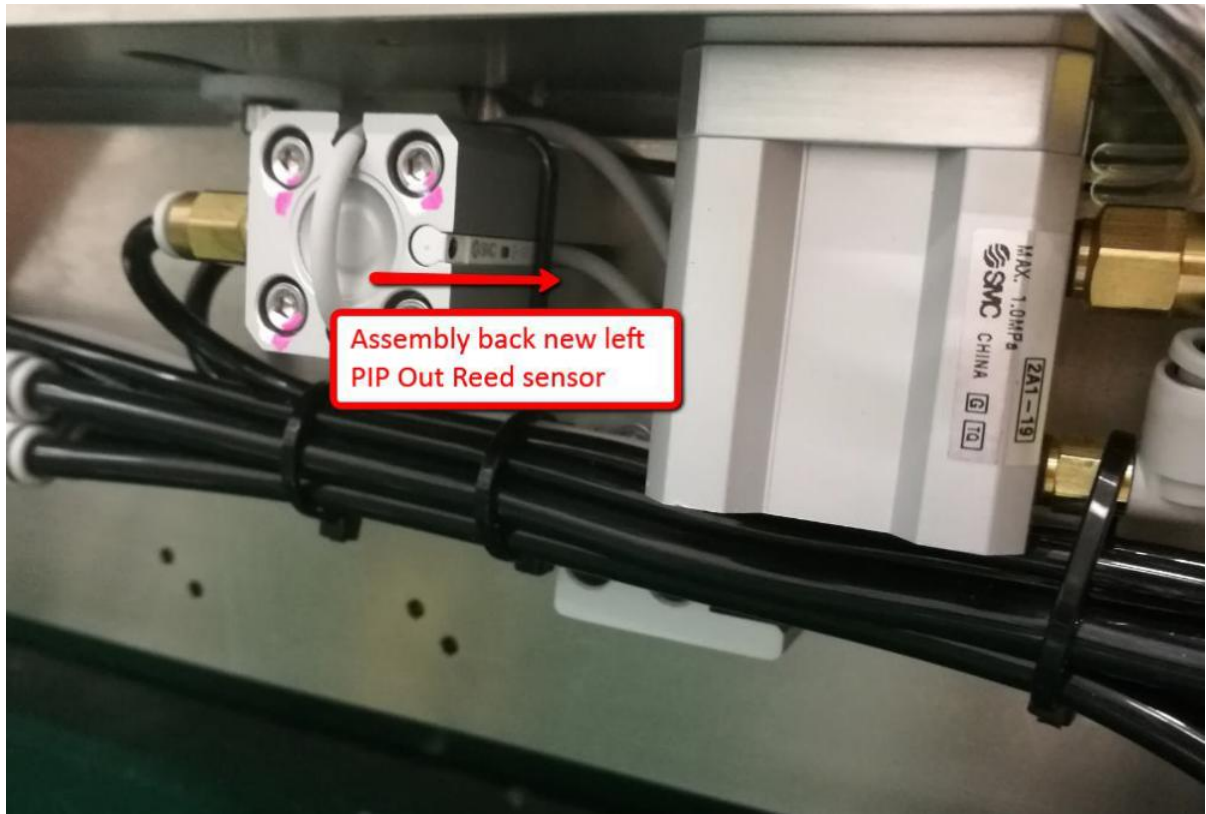


Figure 19 Left PIP Out Reed Sensor Assembly

2. Plug Left PIP Out Reed Sensor Cable Connector as shown in Figure 20 below.

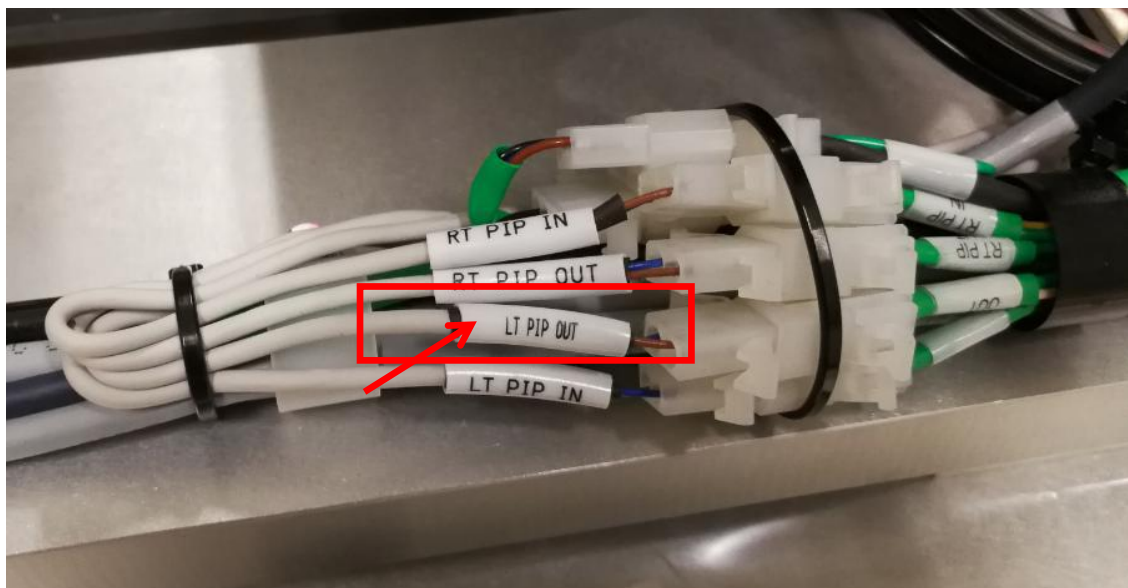


Figure 20 LT PIP Out Connector Assembly

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

3. Manually extend Left PIP at Digital IO tab. Adjust Left PIP Out Reed Sensor until RED LED is indicate. Tighten Reed Sensor Screw after adjustment. Apply cable tie on cylinder

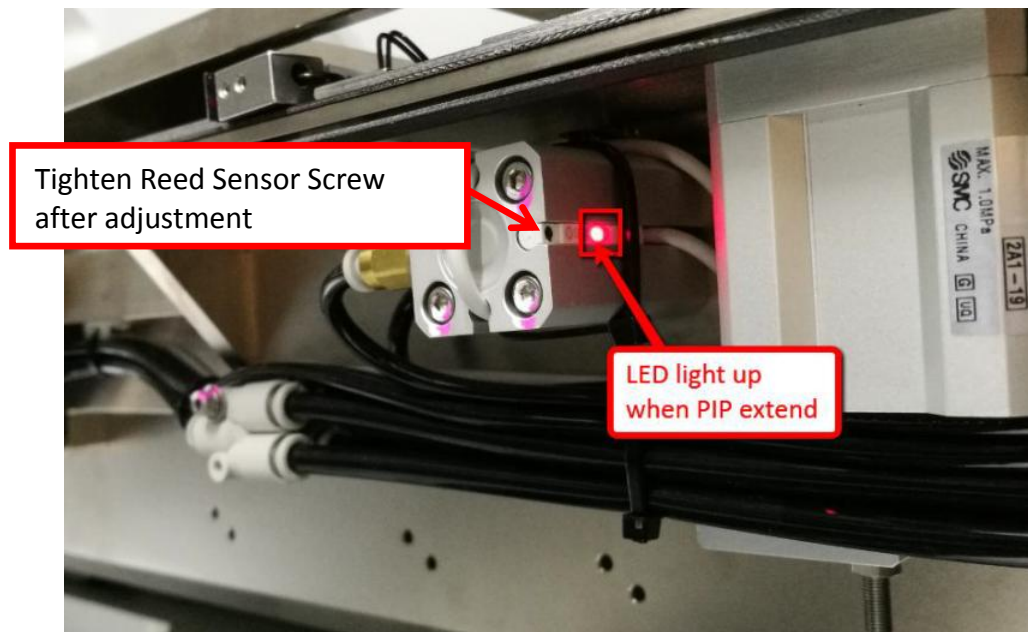


Figure 21 LED light on left PIP Out Reed Sensor

4. Route Left PIP Out Reed Sensor by following sensor routing as shown in Figure 22 below. Apply necessary cable ties.

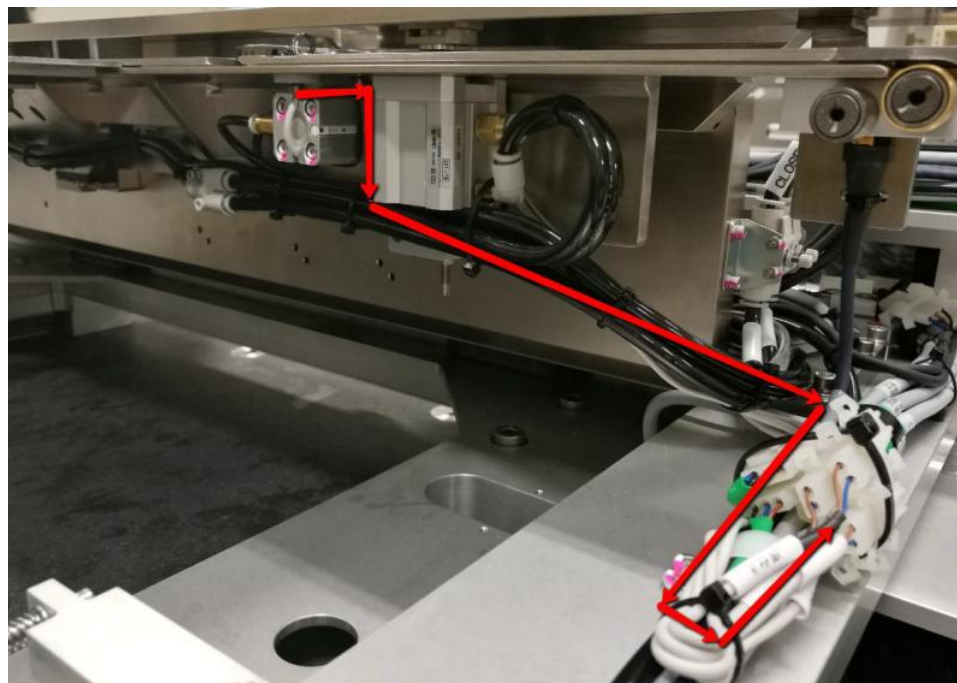


Figure 22 Left PIP Out Reed Sensor Routing

5. Close front door & open x-ray source.
6. Run 3 loops CD&A.

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

Right PIP In Reed Switch Assembly Kit

Right PIP In Reed Switch Assembly Kit Removal

1. Open V810 > Services > Subsystem Status & Control > Digital IO > Initialize

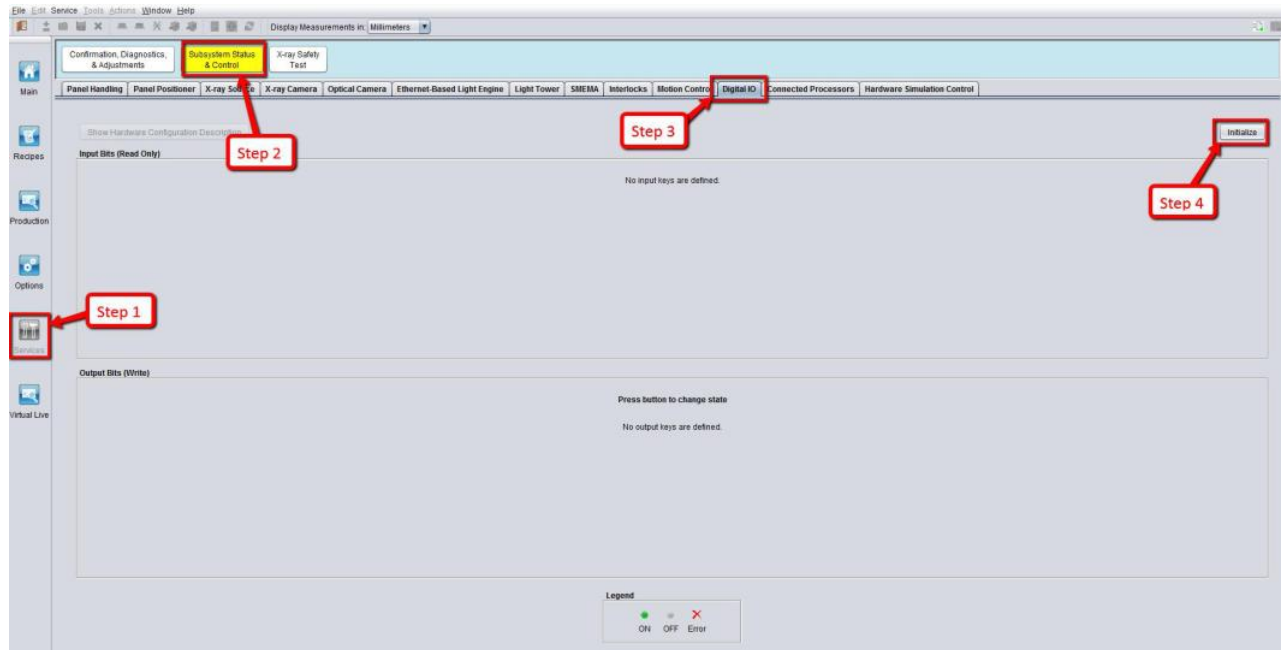


Figure 23 Initialize Digital IO

2. Close X-ray Sources & open Front Door.
3. Uncheck "Panel Clamps Closed" and ensure panel clumper is in "open" status.
 - a) For S2EX machine:

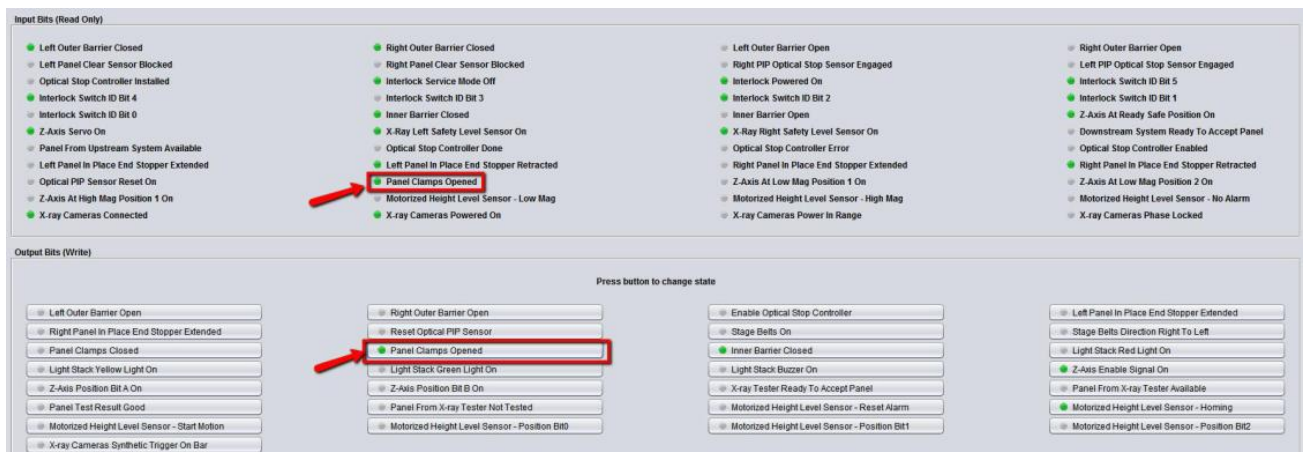


Figure 24 Panel Clumper "Open" status (S2EX machine)

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

b) For XXL machine:

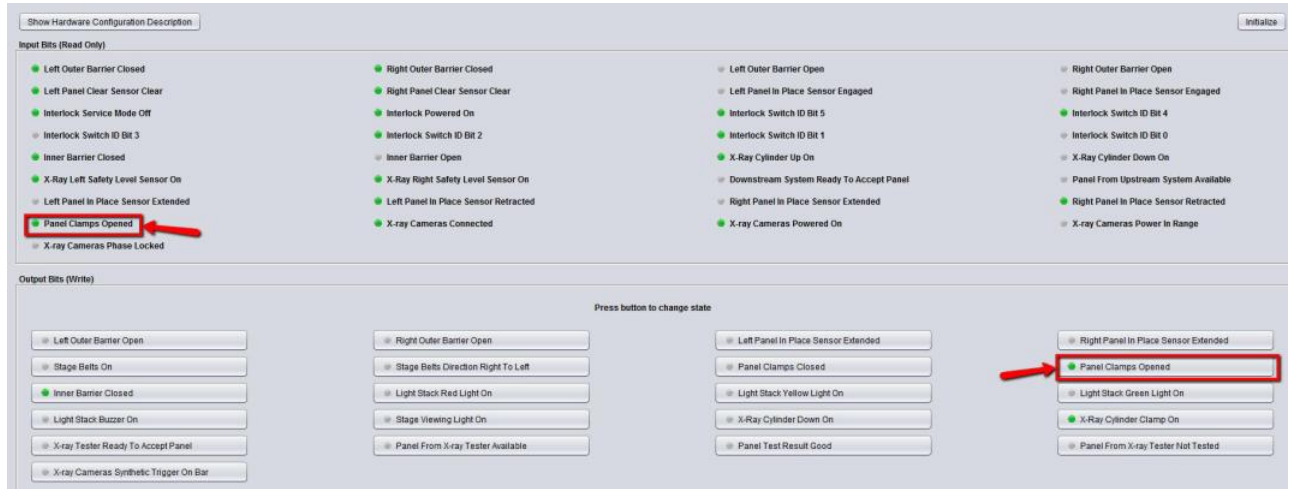


Figure 25 Panel Clamper “open” status (XXL machine)

4. Remove necessary cable ties as shown in Figure 26 below.

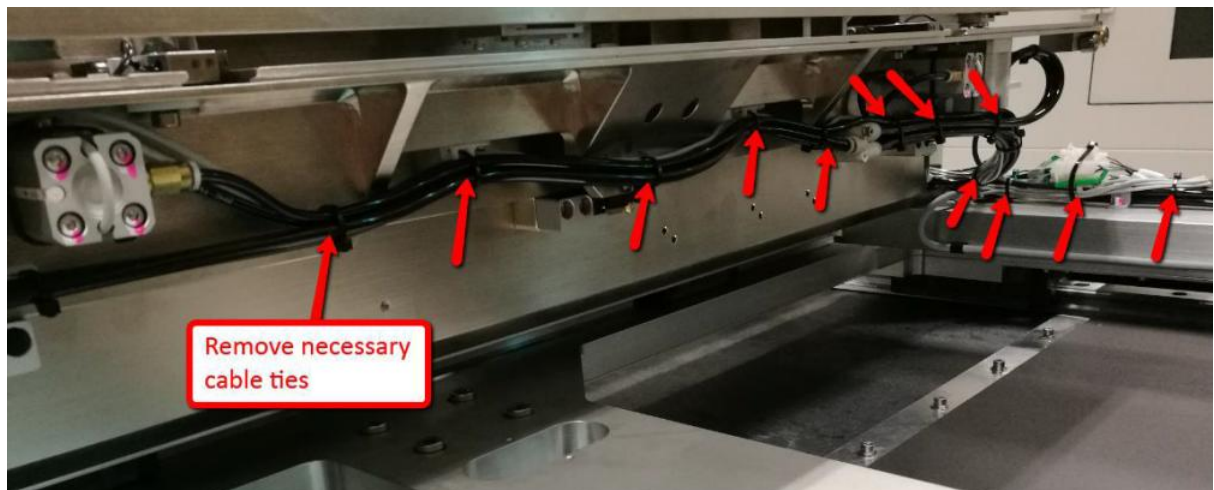


Figure 26 Cable ties Removal

5. Identify “RT PIP In” Label. Unplug Right PIP In Reed Sensor Cable Connector as shown in Figure 27 below.

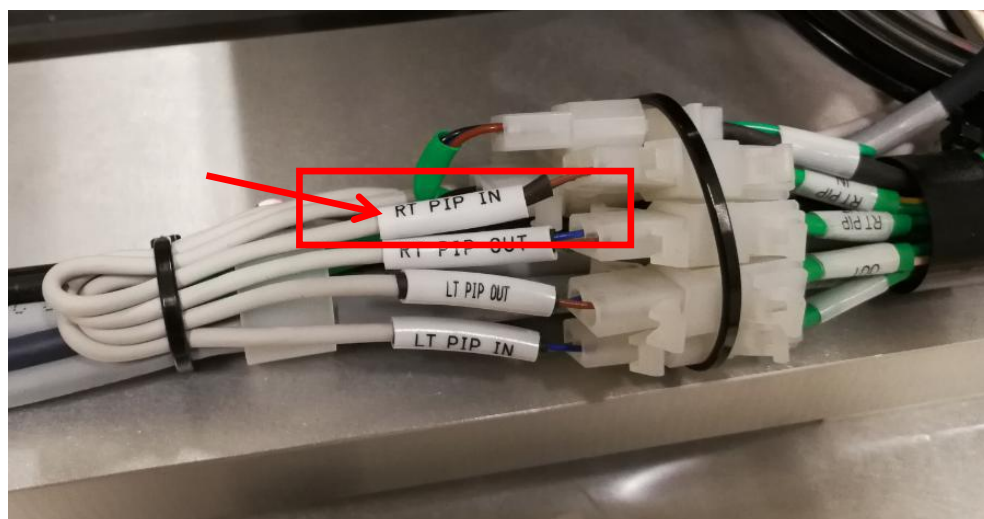


Figure 27 RT PIP In Connector Removal

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

6. Loosen screw and remove Right PIP In Reed Sensor as shown in Figure 28 below.

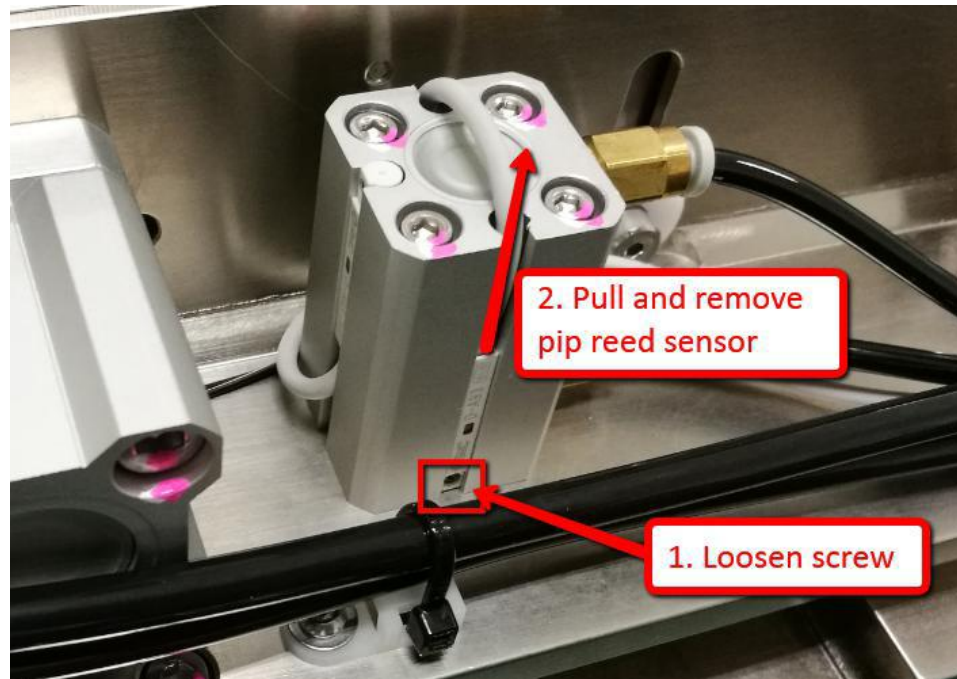


Figure 28 Right PIP In Reed Sensor Removal

7. Remove defective Right PIP In Reed sensor by following direction as shown in Figure 29 below.

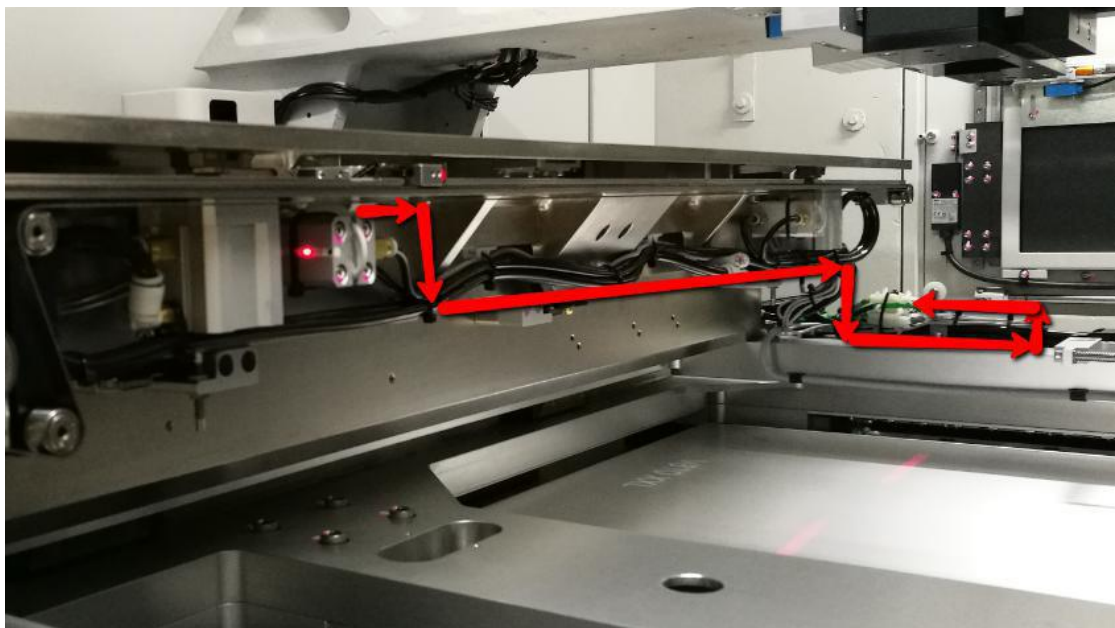


Figure 29 Right PIP In Reed Sensor Removal

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

Right PIP In Reed Switch Assembly Kit Replacement

XXL Right PIP In Reed Switch Assembly kit P/N: 4XASP-A092

S2EX Right PIP In Reed Switch Assembly kit P/N: 4XASP-A147

1. Assemble Right PIP In Reed sensor to Right PIP Cylinder as shown in Figure 30 below. Hand Tight the Reed Sensor Screw Only



Figure 30 Right PIP In Reed Sensor Replacement

2. Plug Right PIP In Reed Sensor Cable Connector by refer to "RT PIP In" Label as shown in Figure 31 below.

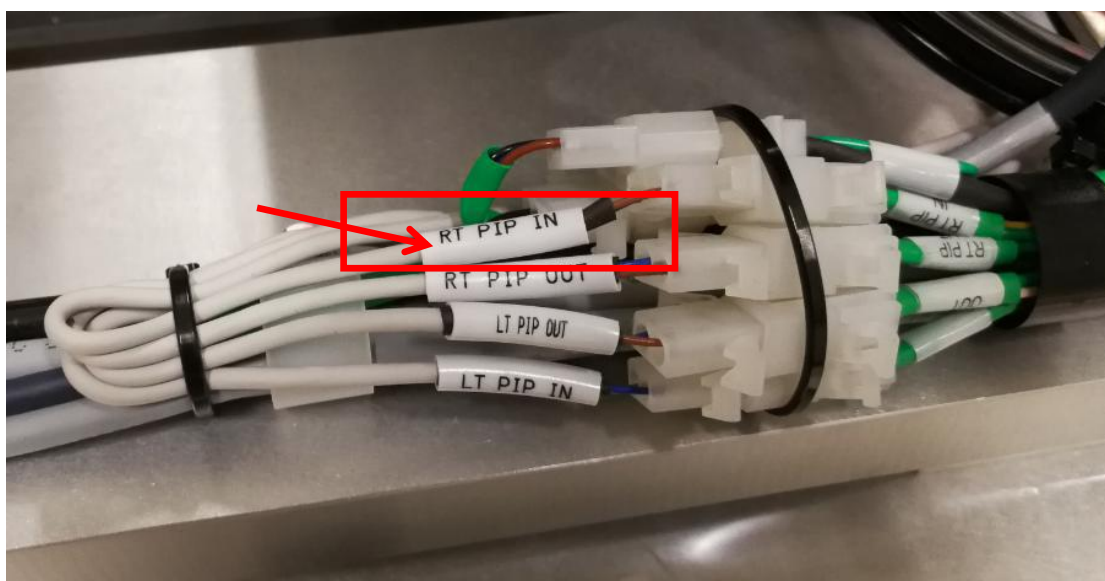


Figure 31 RT PIP In Connector Assembly

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

3. Manually retract Right PIP at Digital IO tab. Adjust Right PIP In Reed Sensor until RED LED is indicate. Tighten Reed Sensor Screw after adjustment. Apply cable tie on cylinder

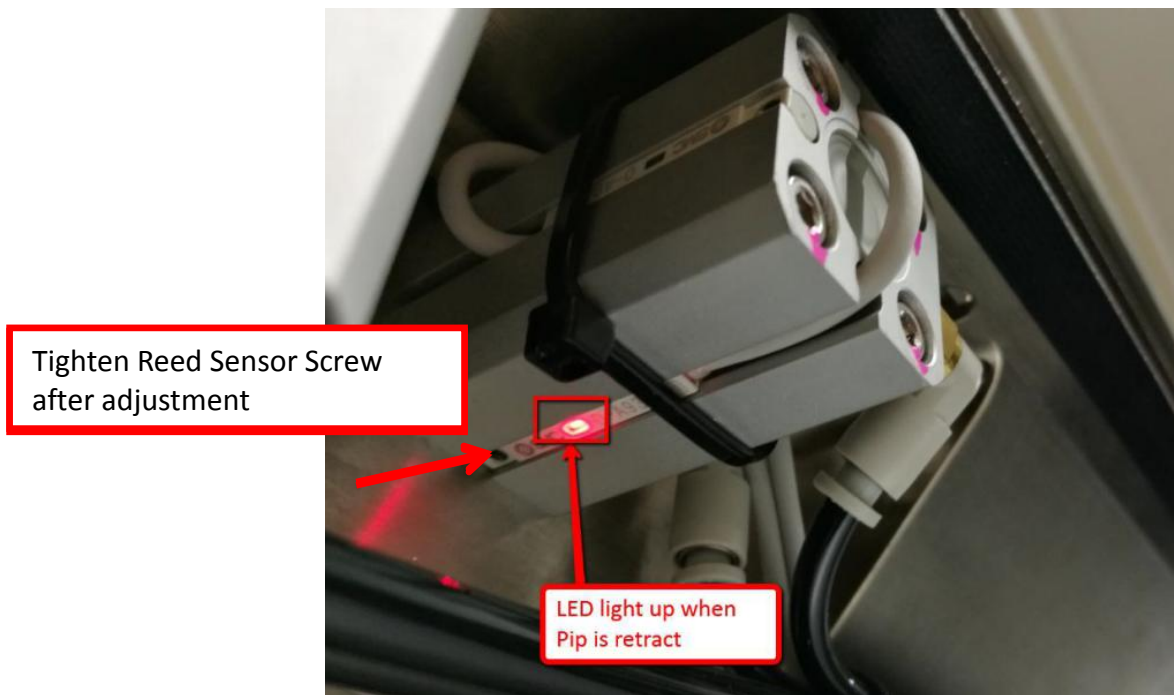


Figure 32 LED light on In Reed Sensor

4. Route Right PIP In Reed sensor by following sensor routing as shown in Figure 33 below. Apply necessary cable ties.

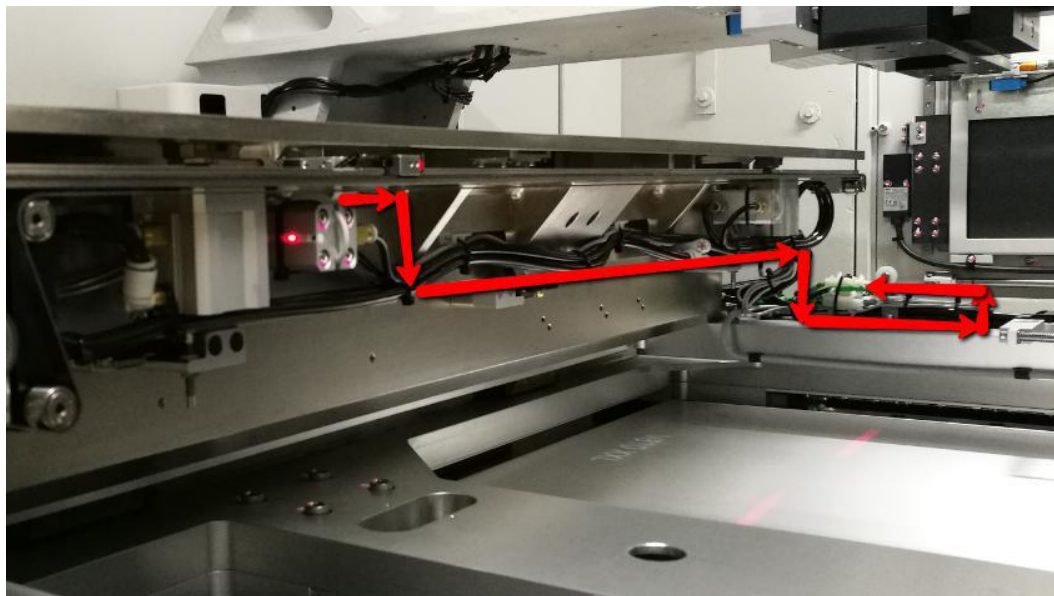


Figure 33 Pip In Reed sensor Routing

5. Close front door & open x-ray source.
6. Run 3 loops CD&A.

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

Right PIP Out Reed Switch Assembly Kit

Right PIP Out Reed Switch Assembly Kit Removal

1. Open V810 > Services > Subsystem Status & Control > Digital IO > Initialize

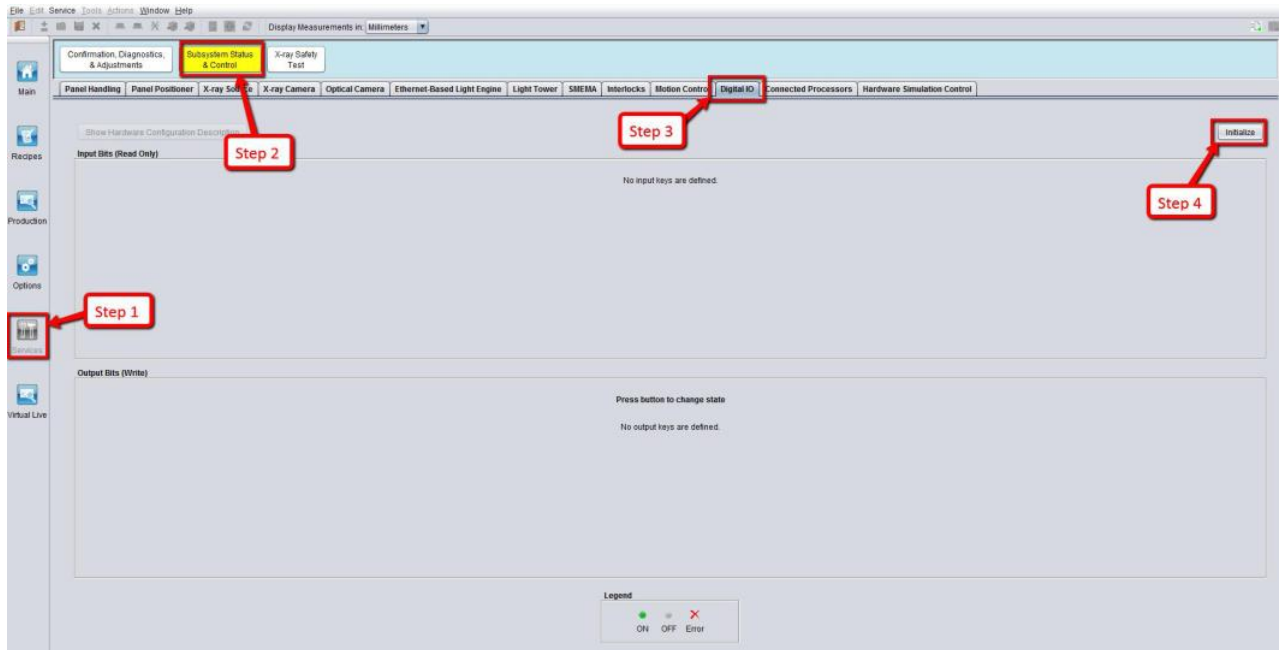


Figure 34 Initialize Digital IO

2. Close X-ray sources & open front door.
3. Uncheck "Panel Clamps Closed" and ensure panel clamber is in "open" status.
 - a) For S2EX machine:

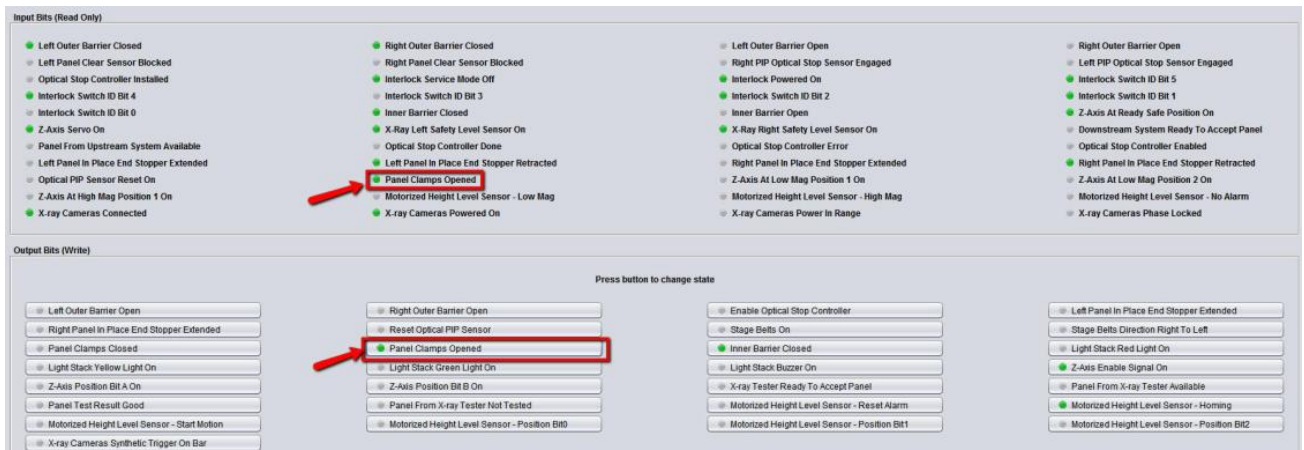


Figure 35 Panel Clamber "Open" status (S2EX machine)

	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

b) For XXL machine:

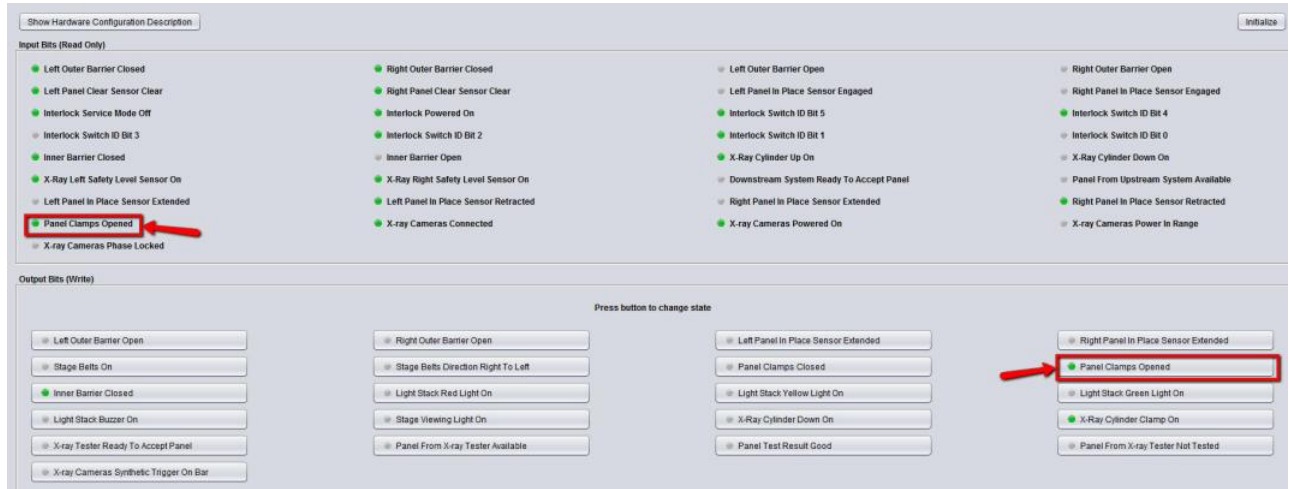


Figure 36 Panel Clamper "open" status (XXL machine)

4. Remove necessary cable ties as shown in Figure 37 below.

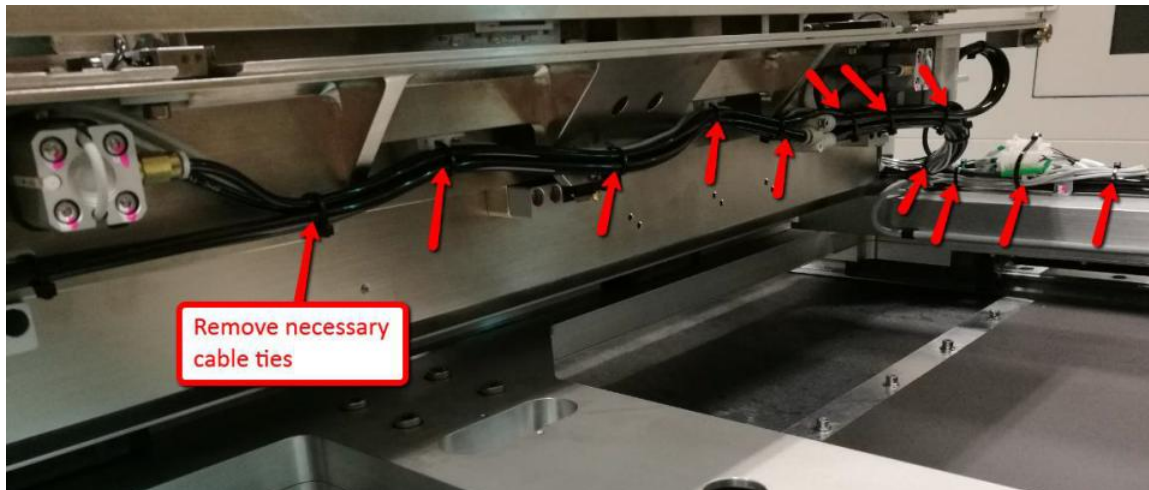


Figure 37 Cable ties Removal

5. Identify "RT PIP Out" Label. Unplug Right PIP Out Reed Sensor Cable Connector as shown in Figure 38 below.

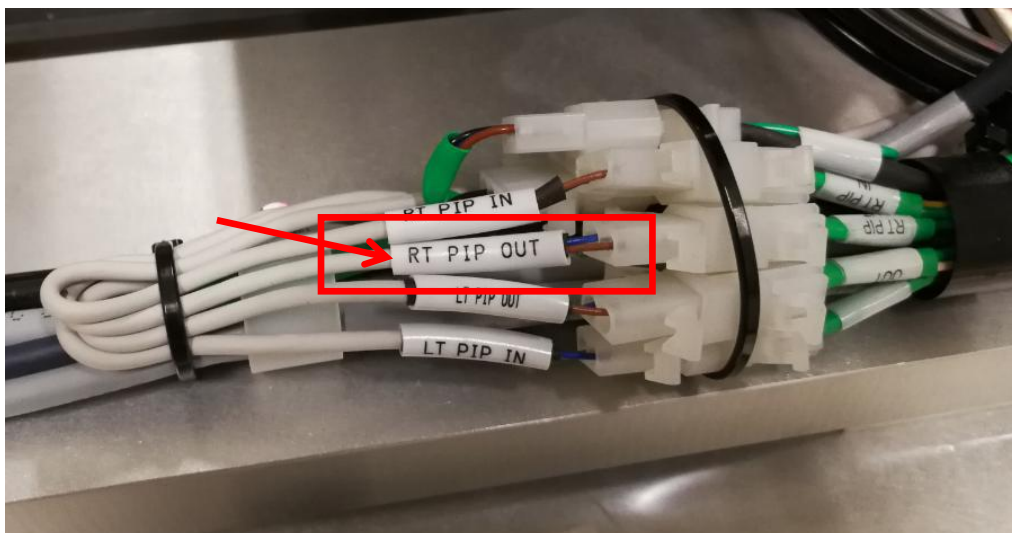


Figure 38 RT PIP Out Connector Removal

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

6. Loosen screw and remove Right PIP Out Reed Sensor from PIP Cylinder as shown in Figure 39 below.

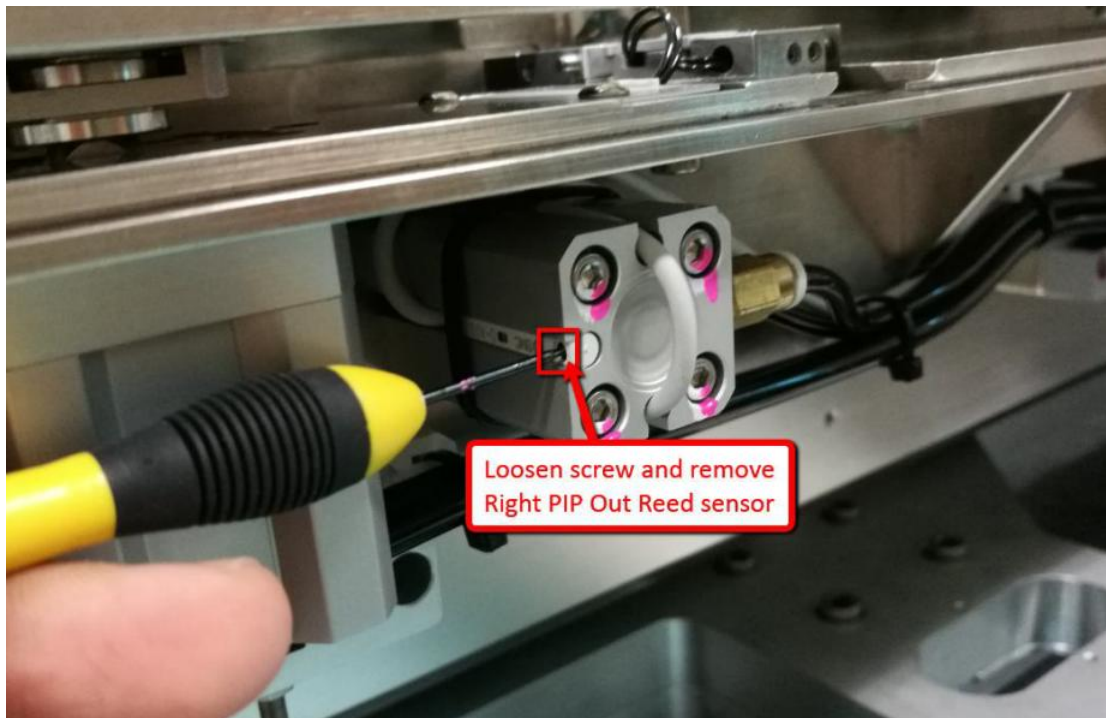


Figure 39 Right PIP Out Reed Sensor Removal

7. Remove defective Right PIP Out Reed Sensor by following direction as shown in Figure 40 below.

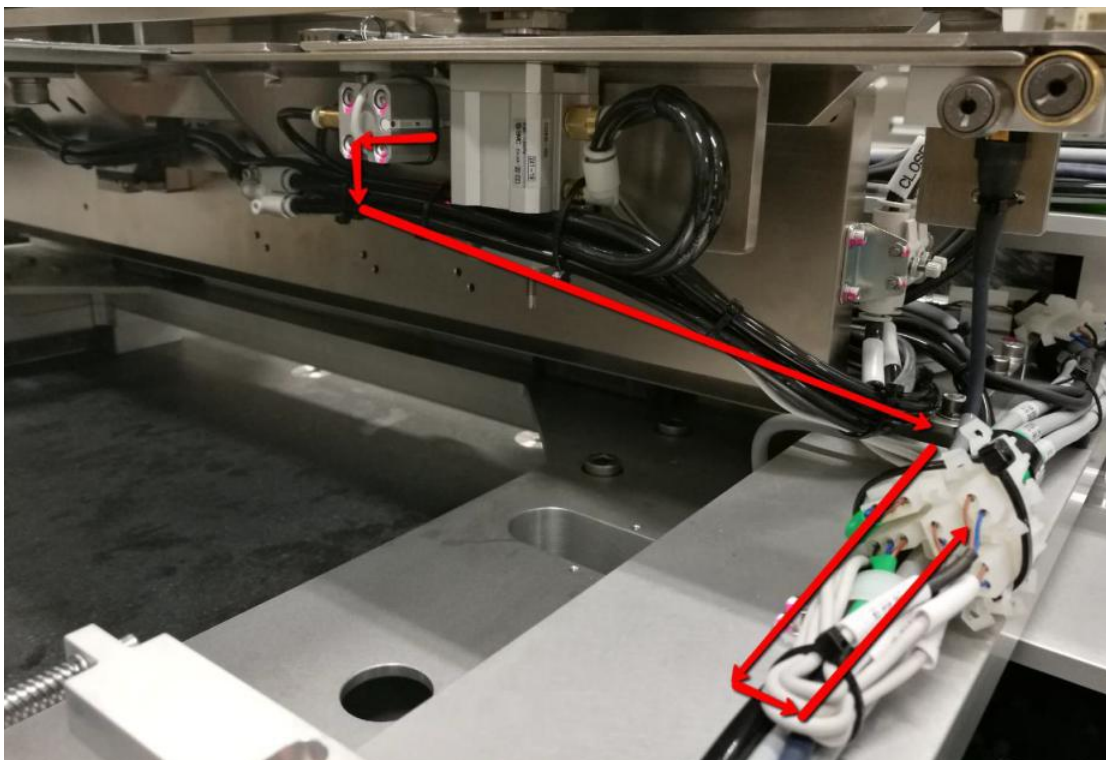


Figure 40 Right PIP Out Reed Sensor Removal

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

Right PIP Out Reed Switch Assembly Kit Replacement

XXL Right PIP Out Reed Switch Assembly kit P/N: 4XASP-A091

S2EX Right PIP Out Reed Switch Assembly kit P/N: 4XASP-A146

1. Assemble Right PIP Out Reed sensor to Right PIP Cylinder as shown in Figure 41 below. Hand Tight Reed Sensor Screw Only

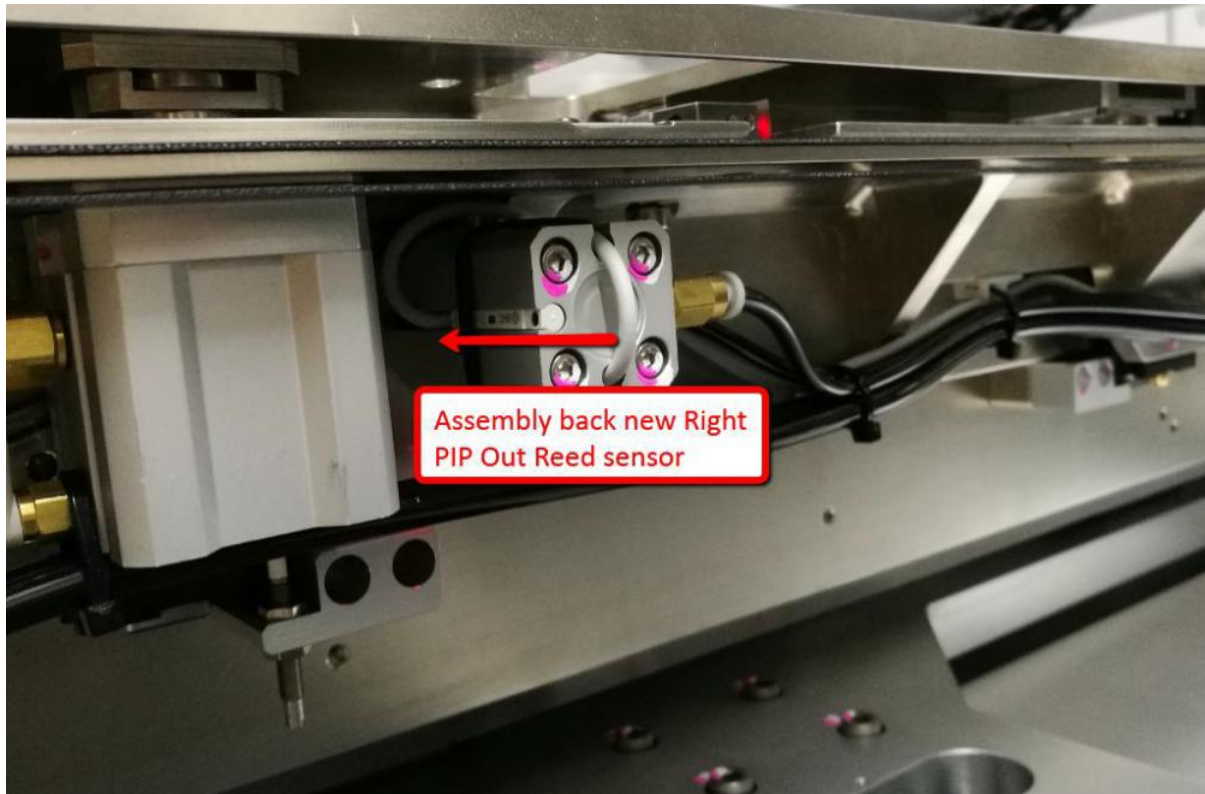


Figure 41 Right PIP Out Reed Sensor Assembly

2. Plug Right PIP Out Reed Sensor Cable Connector by refer to "RT PIP Out" as shown in Figure 42 below. Apply necessary cable tie as well

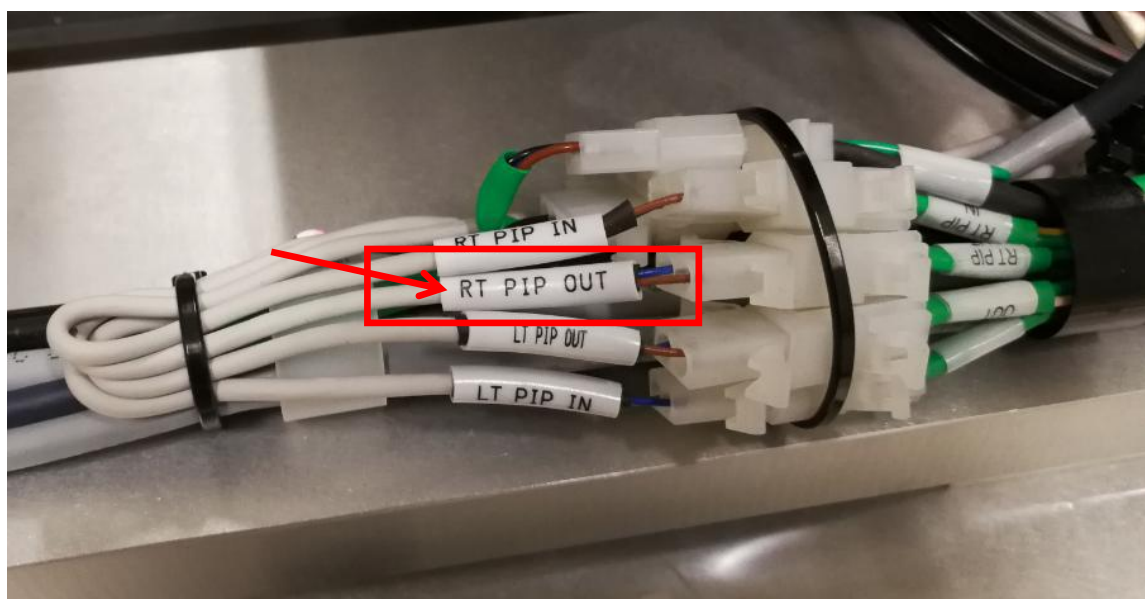


Figure 42 RT PIP Out Connector Assembly

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 PIP Reed Switch Assembly Replacement Procedure	Effective Date	30 May 2017

7. Manually extend Right PIP at Digital IO tab. Adjust Right PIP Out Reed Sensor until RED LED is indicate. Tighten Reed Sensor Screw after adjustment. Apply cable tie on cylinder

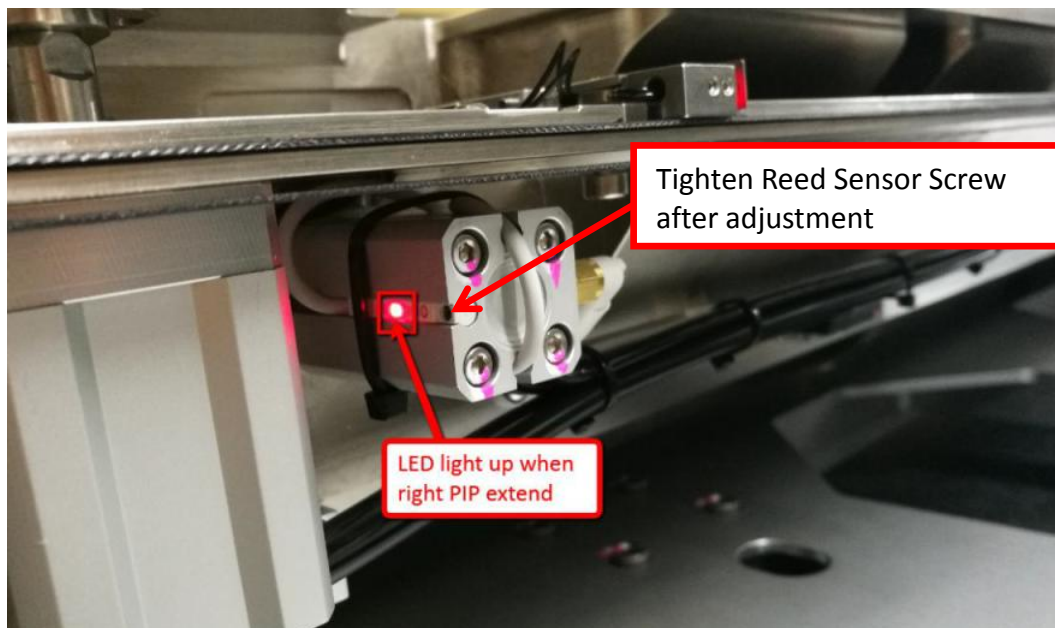


Figure 43 LED light on Right PIP Out Reed Sensor

3. Route back Right PIP Out Reed sensor by following sensor routing as shown in Figure 44 below. Apply back necessary cable ties.

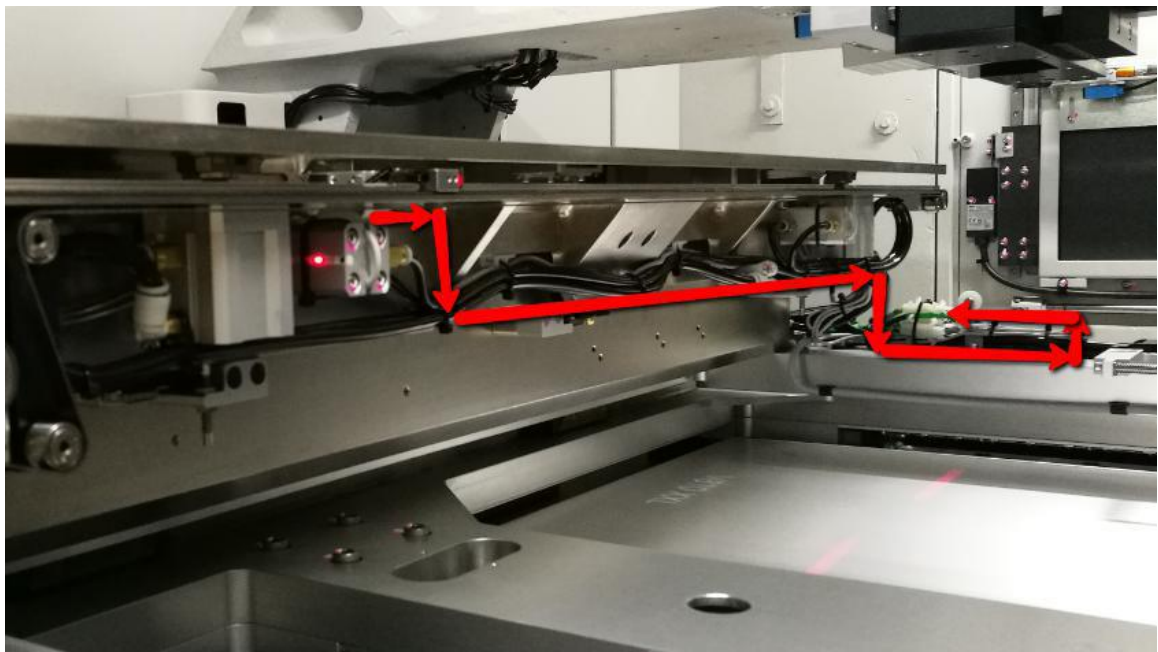


Figure 44 Right PIP Out Reed Sensor Routing

4. Close Front Door & open X-ray source.
5. Run 3 loops CD&A.