

	Work Instruction	Doc. Revision	01
	AXI V810 PIP SENSOR FLAG REMOVAL & REPLACEMENT PROCEDURE	Effective Date	2 Feb 2017

This procedure is applicable to below models:

V810 STD	☐	S1	☐	S2
V810 XXL	☒	S1	☒	S2
V810 S2EX	☐	Optical	☒	Mechanical
V810 Mini	☐			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	15 Jan 2017	First Release	Muhammed Shameem
01	2 Feb 2017	Template Changes & Content Update	ONG KEAN SHENG

	Work Instruction	Doc. Revision	01
	AXI V810 PIP SENSOR FLAG REMOVAL & REPLACEMENT PROCEDURE	Effective Date	2 Feb 2017

Content

PIP Sensor Flag Removal.....	3
PIP Sensor Flag Replacement.....	4

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 PIP SENSOR FLAG REMOVAL & REPLACEMENT PROCEDURE	Effective Date	2 Feb 2017

PIP Sensor Flag Removal

1. Loosen SHCS M3x6 (2x) & remove Mount Flag from the PC, Board Stop as Figure 1

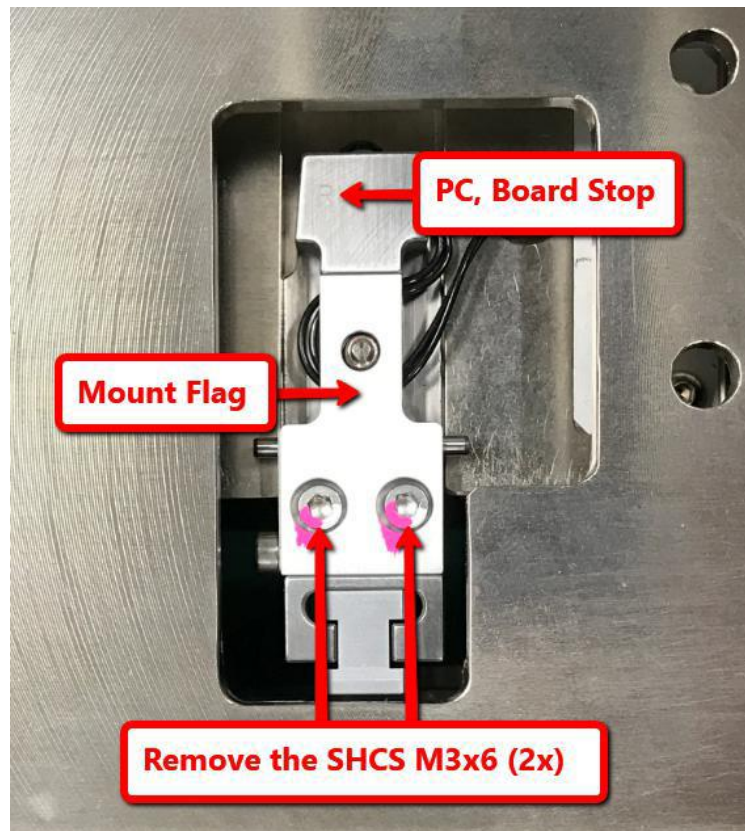


Figure 1 PIP Sensor Mount Flag

2. Remove SHCS M3x6 from the side of Mount Flag as Figure 2

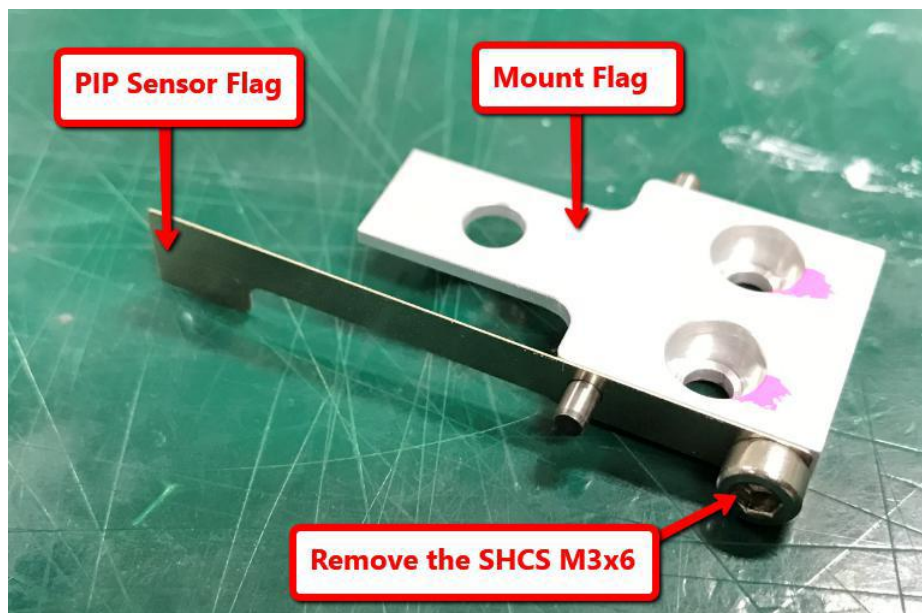


Figure 2 PIP Sensor Flag Removal

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 PIP SENSOR FLAG REMOVAL & REPLACEMENT PROCEDURE	Effective Date	2 Feb 2017

PIP Sensor Flag Replacement

- Prepare PIP Sensor Flag as Figure 3 & may refer to below Figure 3 for PIP Sensor Flag Orientation.

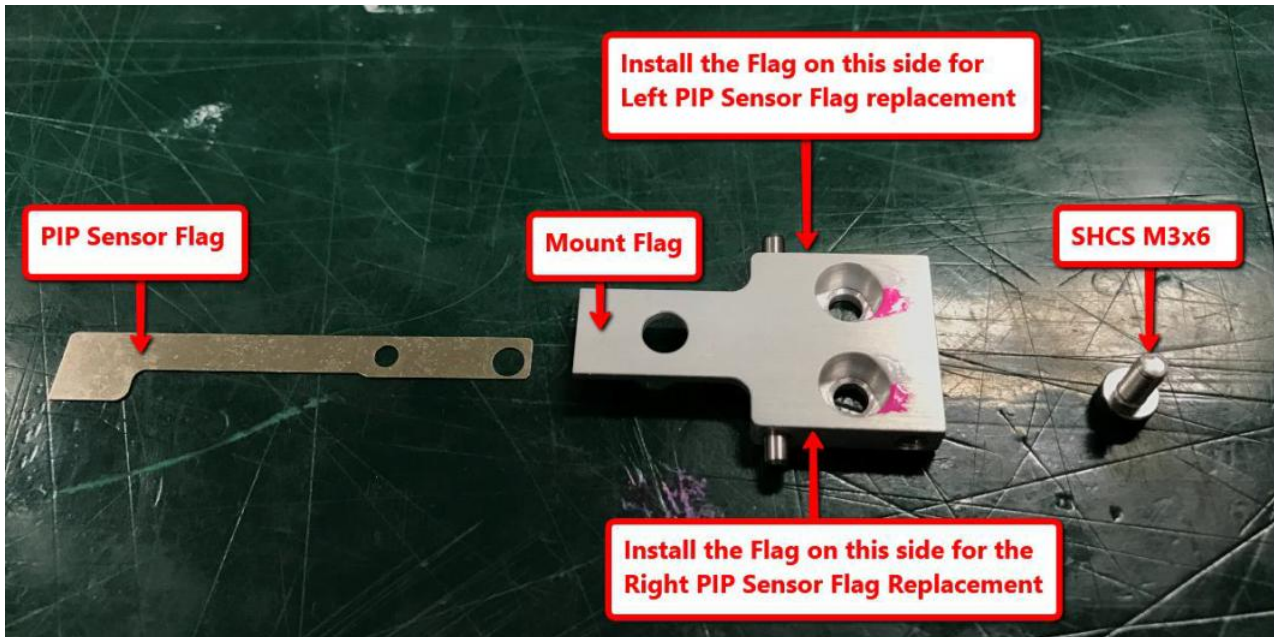


Figure 3 PIP Sensor Installation

- Install PIP Sensor Flag at Mount Flag as Figure 4. Hand tight SHCS M3x6.



Figure 4 PIP Sensor Flag Installation

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 PIP SENSOR FLAG REMOVAL & REPLACEMENT PROCEDURE	Effective Date	2 Feb 2017

5. Align the PIP Sensor Flag parallel with top surface Mount Flag as Figure 5 & 6 .Tighten SHCS M3x6.

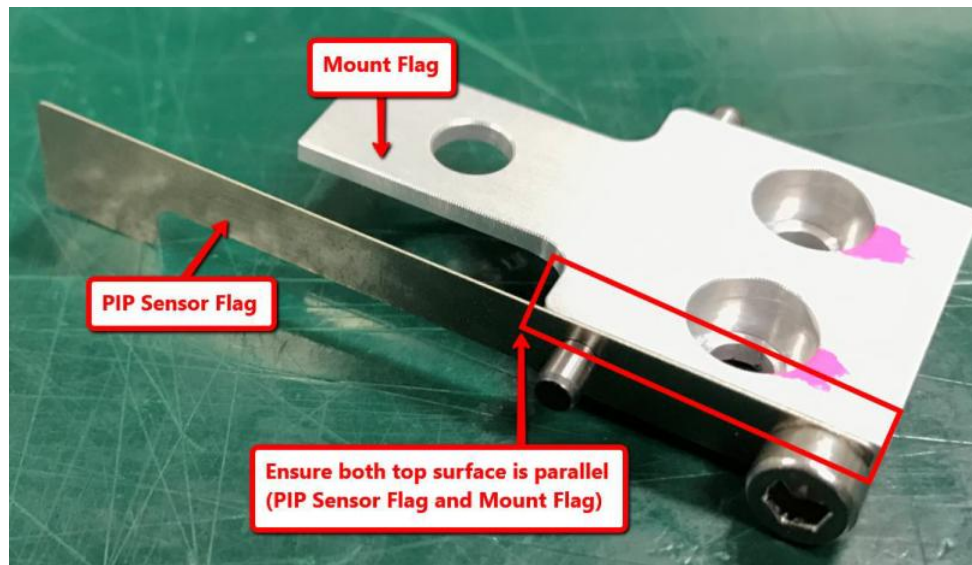


Figure 5 PIP Sensor Flag Alignment

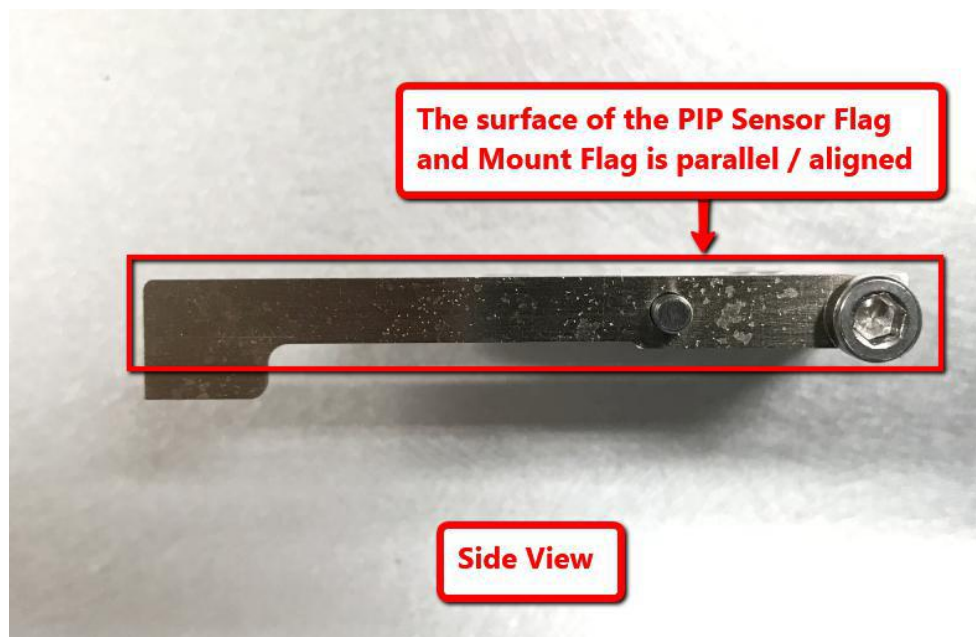


Figure 6 PIP Sensor Flag Alignment

	Work Instruction	Doc. Revision	01
	AXI V810 PIP SENSOR FLAG REMOVAL & REPLACEMENT PROCEDURE	Effective Date	2 Feb 2017

6. Assemble mount flag on the PC, Board Stop as Figure 7 by refer to below criteria.

- a) PIP Cable not twisted
- b) Mount flag stack step not contact with PIP Sensor Cable

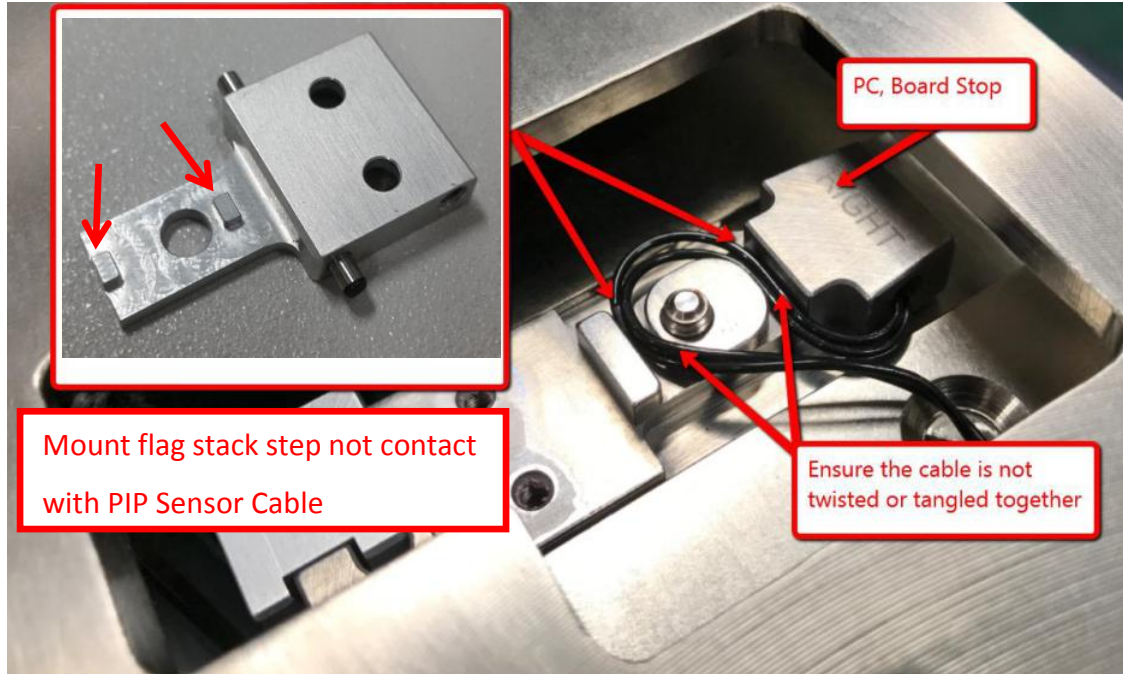


Figure 7 Flag Mount Installation

7. Tighten SHCS M3x6 (2x) & Visual check PIP flag condition as Figure 8.

If friction occur between PIP Flag with conveyor belt, repeat Step 5 to Step 7.

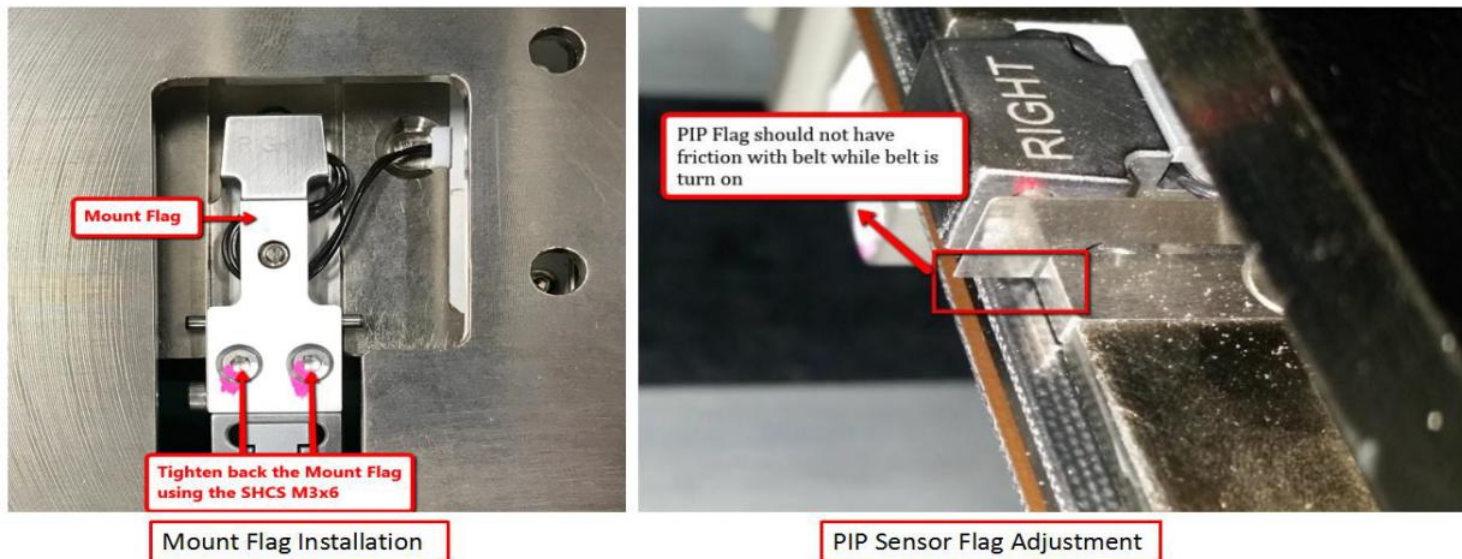


Figure 8 PIP flag assembly & adjustment