

	Work Instruction	Doc. Revision	01
	AXI V810 S2EX Optical PIP Sensor Amplifier Setting Procedure	Effective Date	2 Oct 2016

This procedure is applicable to below models:

V810 STD	☐	S1	☐	S2
V810 XXL	☐	S1	☐	S2
V810 S2EX	☒			
V810 Mini	☐			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	17 Aug 2015	First Release	MUHAMMED SHAMEEM
01	2 Oct 2016	Template Changes & Content Update	ONG KEAN SHENG

	Work Instruction	Doc. Revision	01
	AXI V810 S2EX Optical PIP Sensor Amplifier Setting Procedure	Effective Date	2 Oct 2016


Content

Optical PIP Sensor Amplifier Setting Steps:.....	3
--	---

Optical PIP Sensor Amplifier Setting Steps:


1. Hold [MODE] button for 3 seconds or longer to enter SET mode.
2. Enter [Function Selection]. Press [+/-] to select detailed setting mode. FUnCoPt



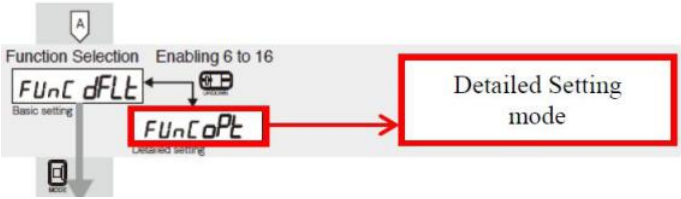

3. Press [MODE] once. Enter [Detection Function]. Press [+/-] to Select [GIGA].




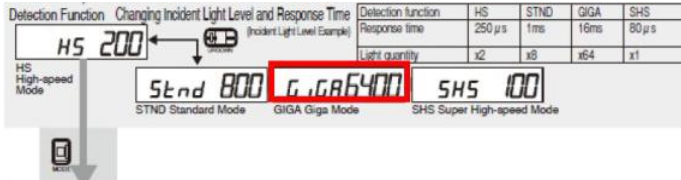

Detection function	HS	STND	GIGA	SHS
Response time	250 μs	1ms	16ms	80 μs
Light quantity	x2	x8	x64	x1


4. Press [MODE] once. Enter [DPC Function]. Press [+/-] to select [DPC off].



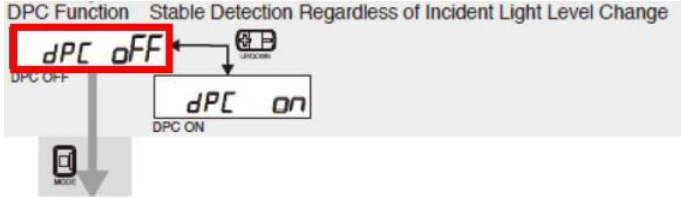

5. Press [MODE] once. Enter [Timer Function]. Press [+/-] to select [toff].



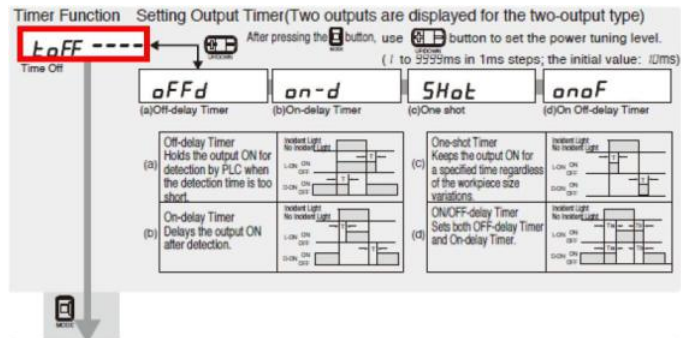

	Work Instruction	Doc. Revision	01
	AXI V810 S2EX Optical PIP Sensor Amplifier Setting Procedure	Effective Date	2 Oct 2016


6. Press [MODE] once. Enter [Power Tune Level]. Press [+/-] to adjust the value. Set the value at [300].



Power Tuning Level Changing the Target Incident Light Level (Power Tuning Level)
Use  button to set the power tuning level.
(100 to 9999 in 1 steps; the initial value: 9999)


7. Press [MODE] once. Enter [Bank Switching]. Remain as [Bank 1].

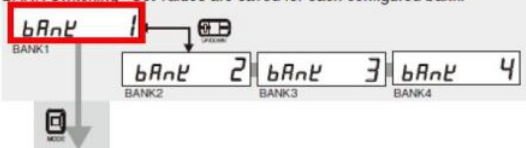

BANK Switching Set values are saved for each configured bank.


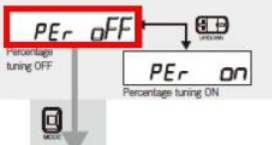
8. Press [MODE] once. Enter [Power Tuning ON/OFF Setting]. Press [+/-] to select [ON].

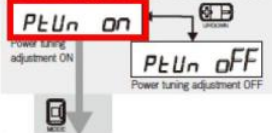

Power Tuning ON/OFF Setting To Turn ON/OFF the Light Amount Adjustment at Tuning


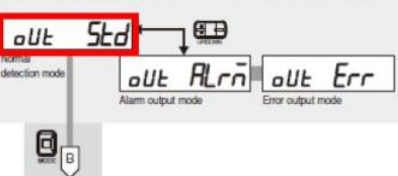
9. Press [MODE] once. Enter [Percentage Tuning]. Press [+/-] to select [OFF].



Percentage Tuning Detecting Transparent or Small Workpiece (Two outputs are displayed for the two-output type)

Press  button in [PEr on] menu, then use  button to set the percentage tuning level.
(-99% to 99% in 1% steps; the initial value: -6%)

10. Press [MODE] once. Enter [Output 1 Mode]. Press [+/-] to select [STD].



Output 2 Mode Output mode for the output 2 is changed.

Alarm Output Mode: After pressing the  button, press the  button to set alarm output level.
(0 to 50p in 1p steps; the initial value: 50p)
On-delay of 300ms is applied.
Error output mode: Output when a DPC error, EEPROM error, load short circuit detection error or overcurrent protection error occurs.

11. Press [MODE] once. Enter [External Input]. Press [+/-] to select [in PTUN]



External Input A type of external input is changed.

Signal input time when tuning(in tUnE) is selected is the same as the button input time.

Input OFF: in OFF

Tuning: in tUnE

Power tuning: in PtUn

Emission OFF: in LoFF

BANK switching OFF: 1, ON: 2 Zero reset: in bAnt

Enable / Cancel of Zero reset is the timing when input is turned off.

	1st point	2nd point
2-point Tuning	Less than 3 seconds	Less than 3 seconds
Maximum Sensitivity	Less than 7 seconds	-
Tuning	Less than 7 seconds	-
Position Tuning	Less than 3 seconds	3 sec min.
Zero reset	Enable	Cancel
	Less than 3 seconds	3 sec min.

12. Press [MODE] once. Enter [Digital Display]. Press [+/-] to select [DISP STD].



Digital Display Changing Digital Display in RUN Mode for Specific Purpose

Threshold /Receiving light amount: d.SP Std

(a)Margin of receiving light amount against threshold: d.SP PEr

(b)Peak incident light intensity level and bottom interrupted light intensity level: d.SP P-b

(c)Bar display: d.SP bAr

(f)Threshold/light intensity when the workpiece passes: d.SP CFdr

(e)CH number and receiving light amount: d.SP CH

(d)Peak receiving light amount: d.SP PEARL

	(a)	(b)	(c)	(d)	(e)	(f)
	2000	150P	8000	2000		
					3500	3000
					1ch	3000
					2000	9999

13. Press [MODE] once. Enter [Inverted Display]. Press [+/-] to select [REV ON].



Inverted Display Mounting Amplifier in Inverted Direction

The display reverses. Threshold and light intensity are displayed on green digital and white digital respectively.

Revers: rEv OFF

Revers: rEv ON

14. Press [MODE] once. Enter [Eco Function]. Press [+/-] to select [ECO OFF].



Eco Function Saving Power Consumption

Eco on: The indicators (green digital and white digital) turn OFF. They turn ON for approx. 10 seconds and then turn OFF by button operation.

Eco Lo: They turn ON for approx. 10 seconds and then the indicators (green digital and white digital) turn ON with low brightness.

OFF: ECe oFF

Eco function ON: ECe on

Eco function LO: ECe Lo

15. Press [MODE] once. Enter [Hysteresis width]. Press [+/-] to select [HUSr 37].



Hysteresis width

Reference value: HSt d 77

Standard setting: HUSr 26

User setting: HUSr 37

User setting (Displayed on the two-output type): HUSr 37

Set the hysteresis width by initial value. Hysteresis width is provided for threshold to prevent the judgment output from becoming unstable near the boundaries.

The hysteresis width can be set by pressing the button in the menu of "HUS-" and then pressing the button. (0 to 9999, increments of 1)

Be sure to check the stability of outputs as there is a possibility of chattering.

	Work Instruction	Doc. Revision	01
	AXI V810 S2EX Optical PIP Sensor Amplifier Setting Procedure	Effective Date	2 Oct 2016

16. Press [MODE] once. Enter [Writing to EEPROM of eternal input]. Press [+/-] to select [INSU OFF]. Press [MODE] 3 seconds or longer to enter detection mode.



17. Press [L/D] to select Dark ON. Press [MODE] to select Output Channel 1. Press [+/-] to adjust threshold value to [100].

