

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

This procedure is applicable to below models:

V810 STD	☐	S1	☐	S2
V810 XXL	☐	S1	☐	S2
V810 S2EX	☒			
V810 Mini	☐			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	30 May 2016	First Release	Tan Liang Kai

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

Content

PIP Sensor.....	3
Left PIP Sensor Removal.....	3
Left PIP Sensor Replacement.....	6
Right PIP Sensor Removal.....	14
Right PIP Sensor Replacement.....	17

ViTrox 	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

PIP Sensor

Left PIP Sensor Removal

1. Close X-ray Source & Air Pressure Regulator
2. Open Front Access Door.
3. Unlock & remove Defective PIP Sensor Cable Adapter from Left Amplifier as shown in Figure 1.

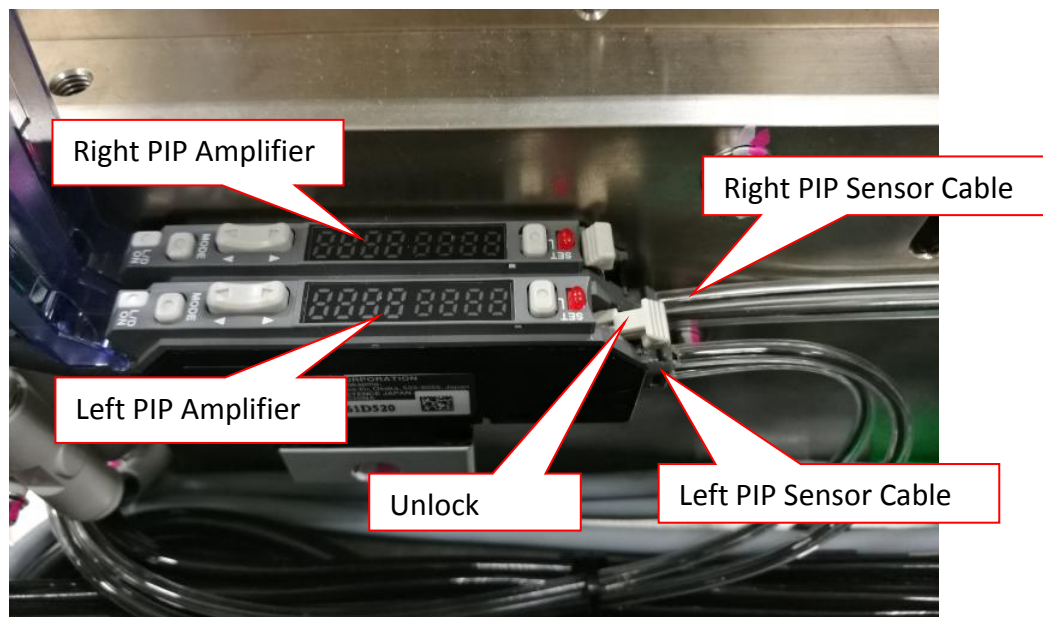


Figure 1 PIP Sensor Amplifier

4. Remove PIP Sensor Cable by refer to below route. May refer to Figure 2 & Figure 3.
- Remark: Remove necessary cable tie & cable clamp



Figure 2 PIP Sensor Cable Removal

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

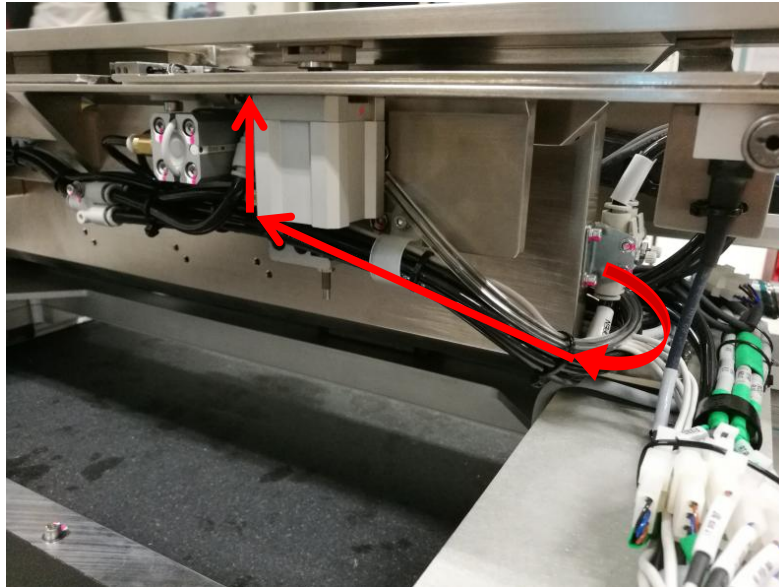


Figure 3 PIP Sensor Cable Removal

5. Remove 2 x screws (M3 x 6) & PIP Cover as shown in Figure 4.

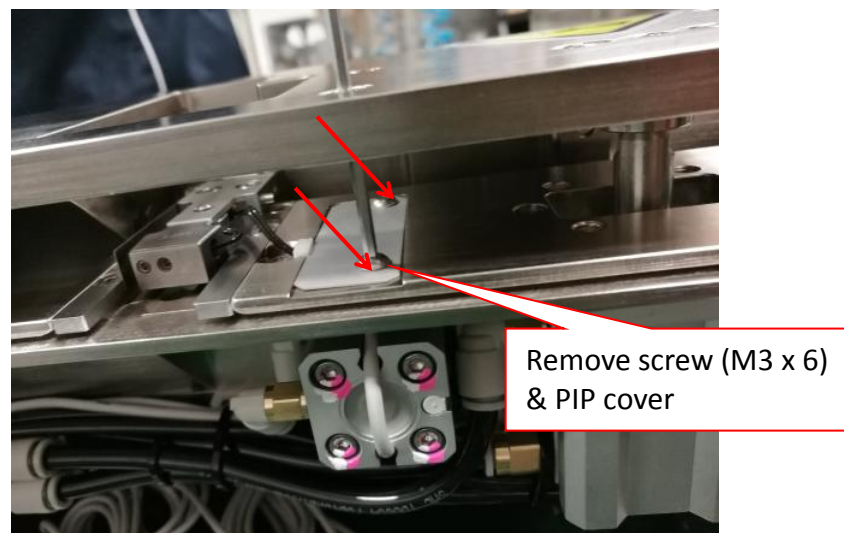


Figure 4 PIP Cover Removal

6. Remove PIP Sensor Cable Guide as shown in Figure 5.

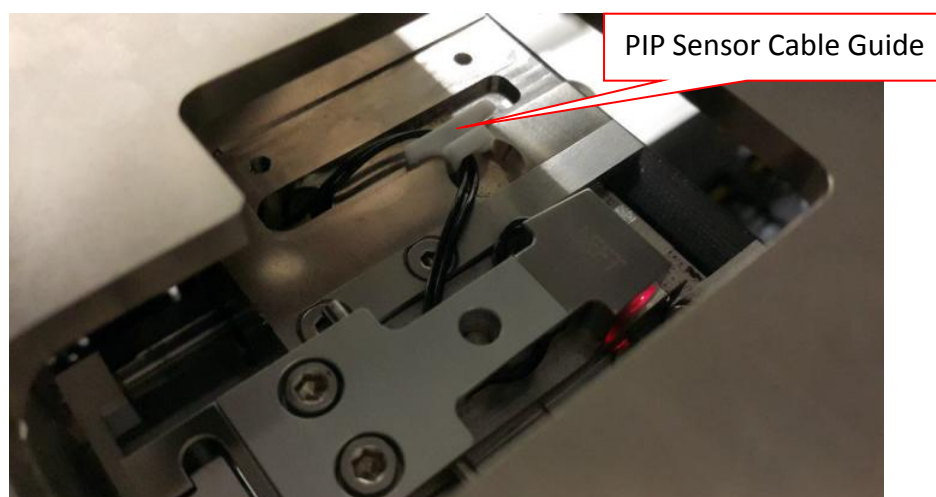


Figure 5 PIP Sensor Cable Guide Removal

ViTrox 	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

7. Remove 2 x screws (M3 x 4) & Mount Flag as shown in Figure 6.

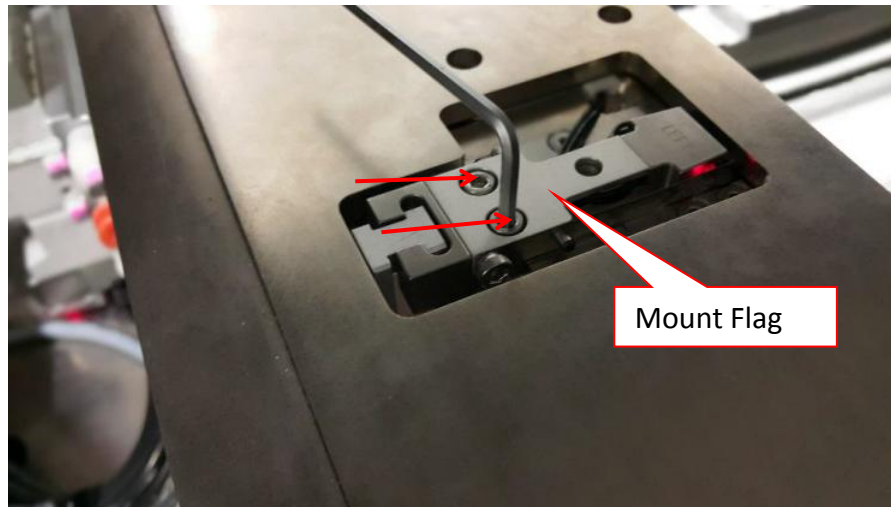


Figure 6 Mount Flag Removal

8. Loosen 2 x Set screws & remove PIP Sensor Cable as shown in Figure 7.

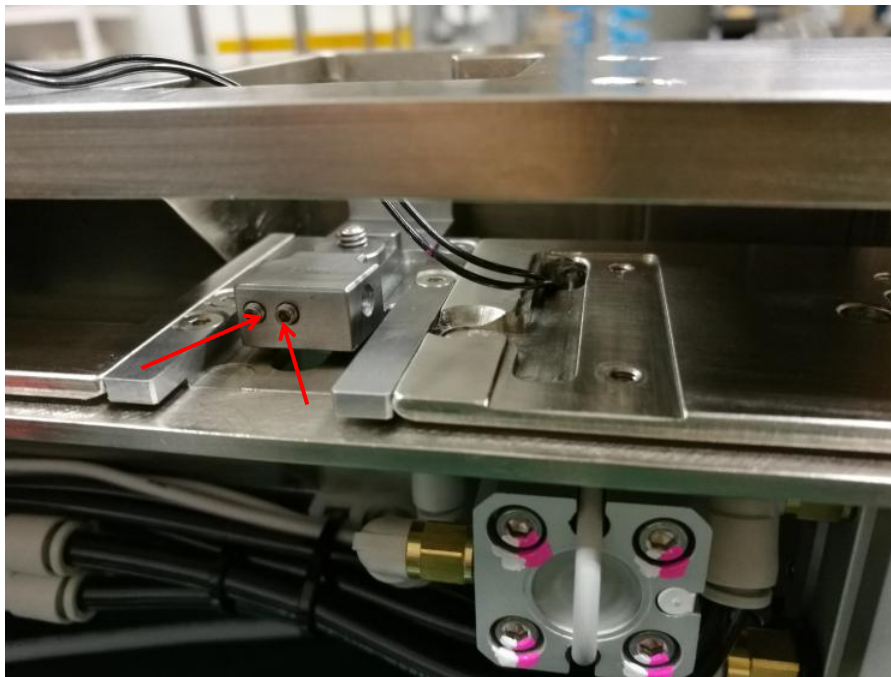


Figure 7 PIP Sensor Cable Removal



	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

Left PIP Sensor Replacement


S2EX PIP sensor (left side) part ID: 4JASCC-A231

1. Gentle route PIP Sensor Head into PIP Board Stop as shown in Figure 8.

Remark: Caution on Sensor Head Protrusion upon routing

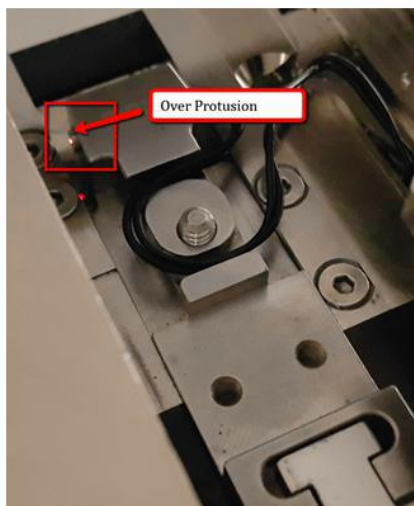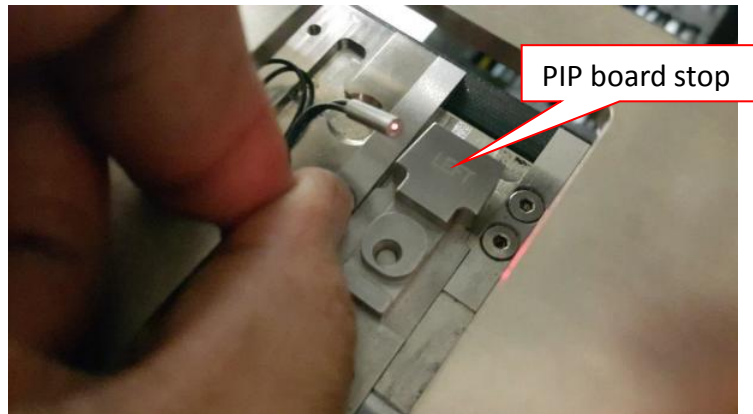

NG

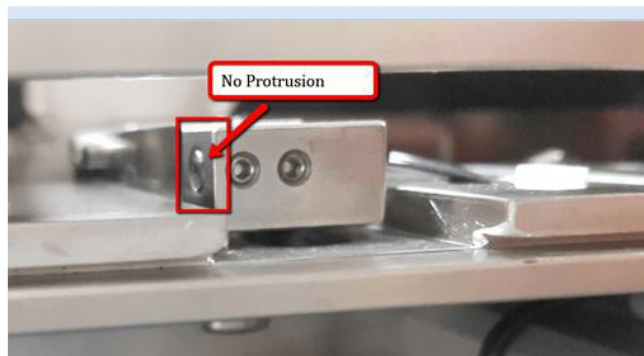

GOOD

Figure 8 PIP Sensor Head Assembly

2. Tighten 2 x Set Screws as shown in Figure 9.



Figure 9 Set Screw Fastening

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

3. Route PIP Sensor Cable by refer to below routing. May refer to Figure 10.

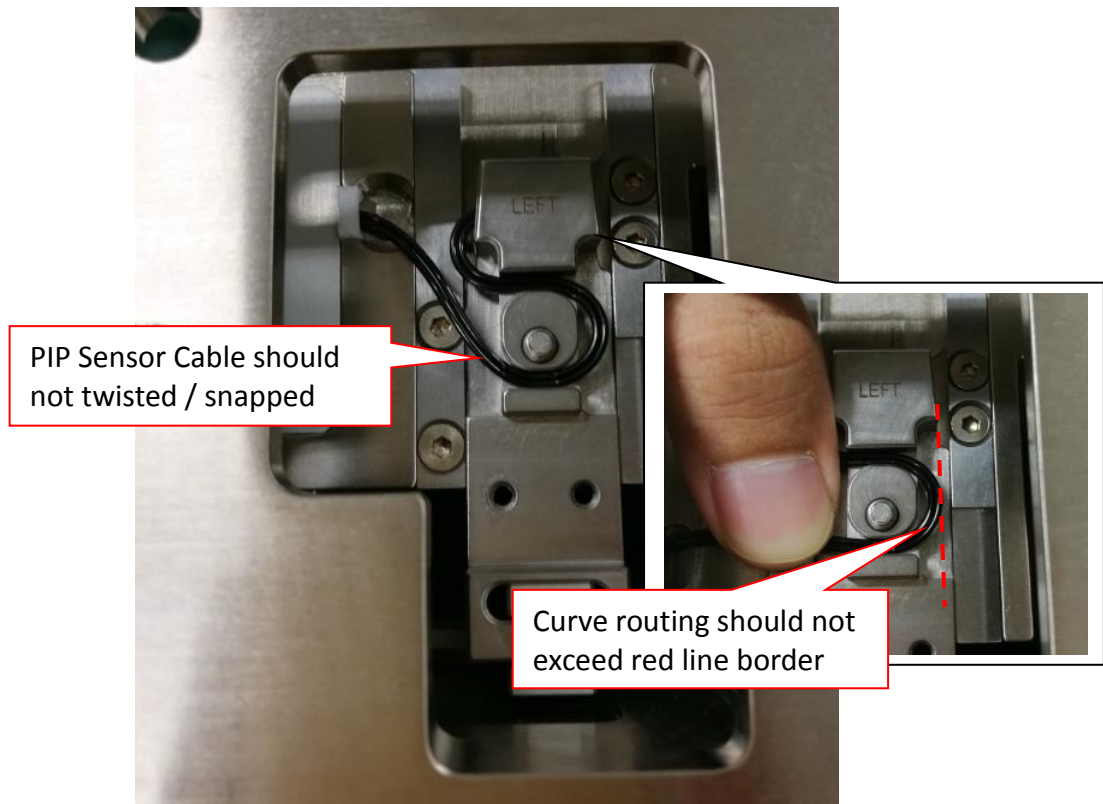


Figure 10 PIP Sensor Cable S-shape routing

4. Assemble Mount Flag & tighten 2 x Screws (M3 x 4) as shown in Figure 11.

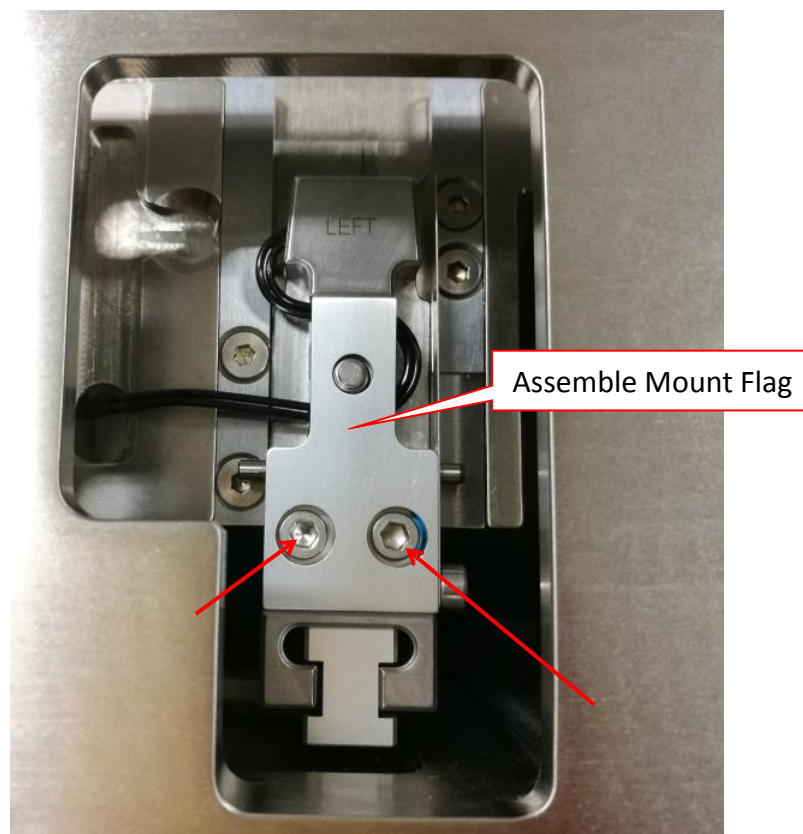


Figure 11 Mount Flag Assembly

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

5. Assemble PIP Cable Guide & PIP Cover as shown in Figure 12.

Remarks: Sufficient Cable Buffering would be require upon cable routing

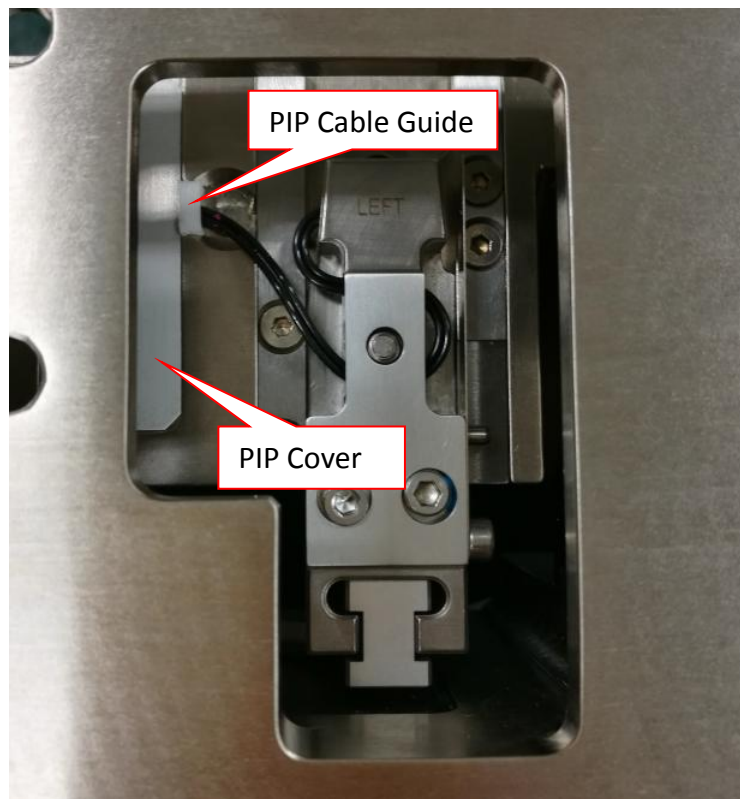


Figure 12 PIP Sensor Cable Routing

6. Tighten 2 x Screws (M3 x 6) as shown in Figure 13.

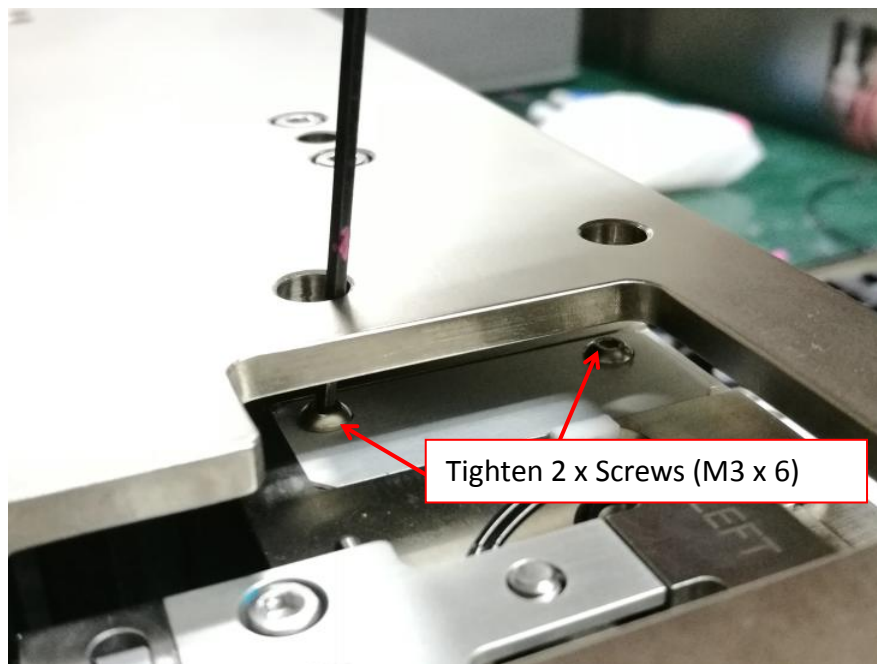


Figure 13 PIP Cover Assembly

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

7. Manually Extend & Retract PIP board stop for several times. Visual check PIP Cable Buffering (Red Box Highlight) where Cable Stressing & Friction should not persist upon PIP Board Stop movement.

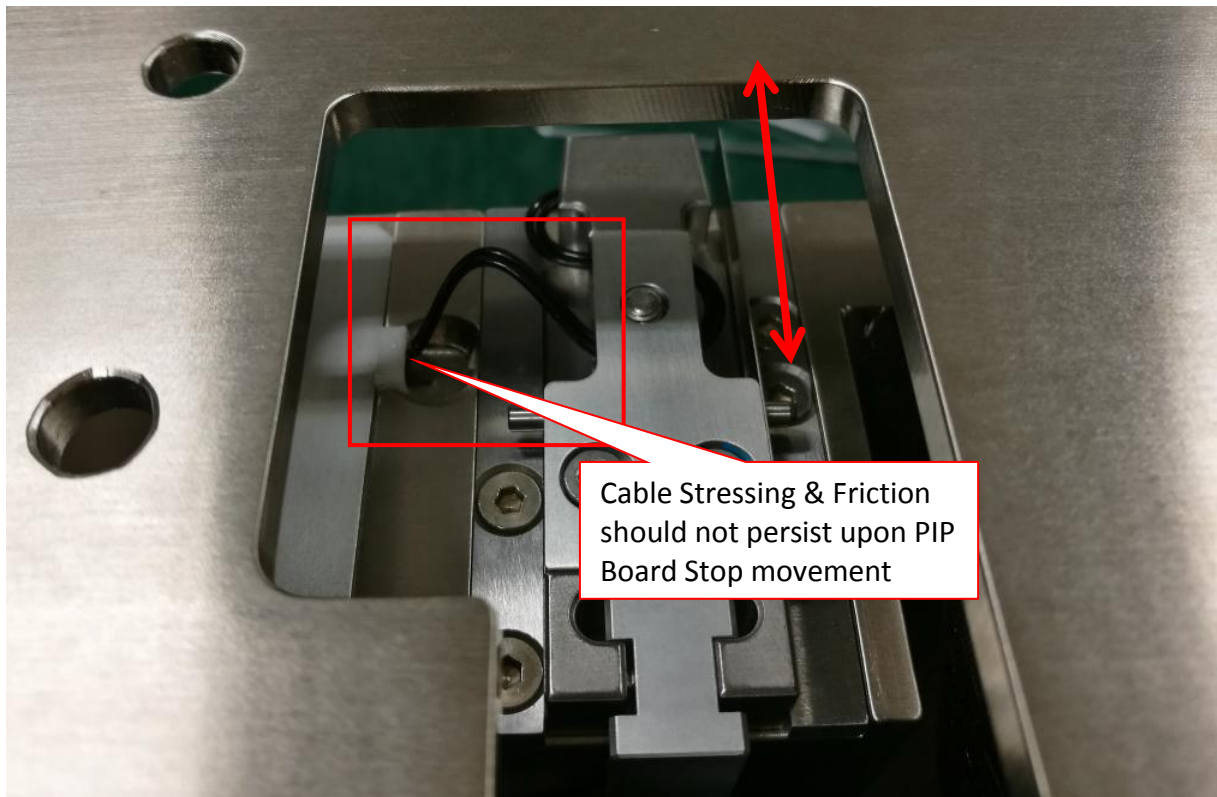


Figure 14 PIP Sensor Cable Checking

8. Route PIP Sensor Cable to Left Amplifier by refer to below routing. May refer to Figure 15 & Figure 16.

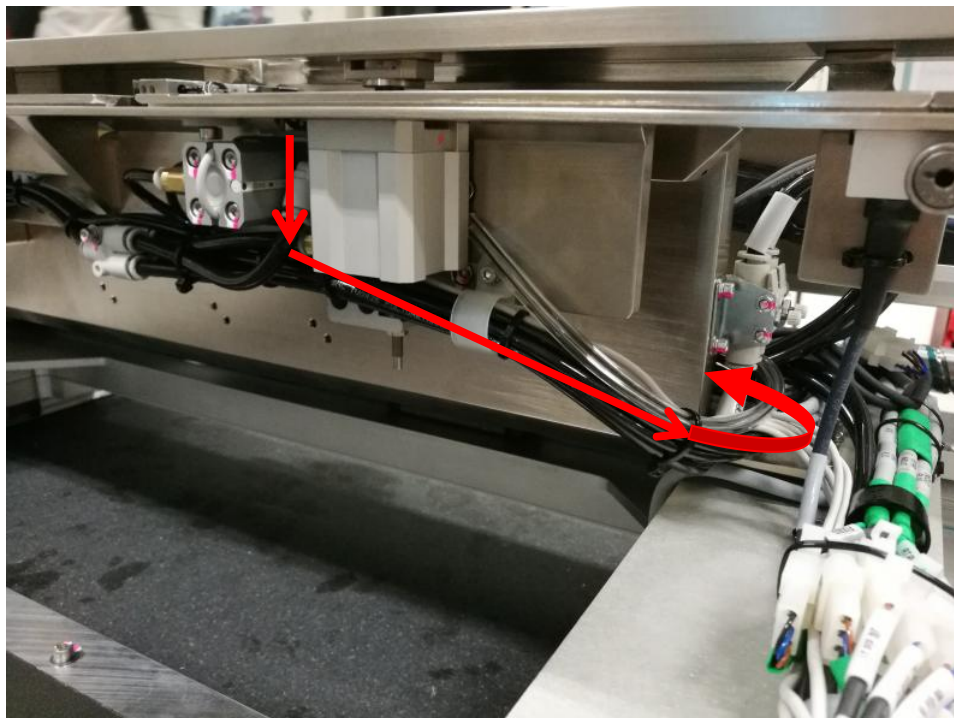


Figure 15 PIP Sensor Cable Routing

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

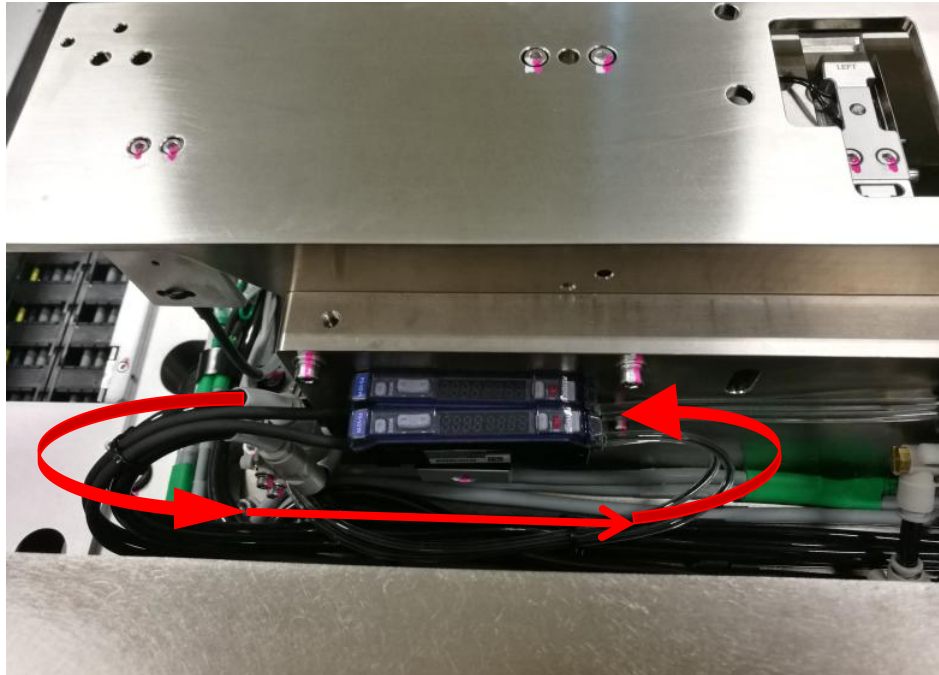


Figure 16 PIP Sensor Cable Routing

9. Remove excessive PIP Sensor Cable as shown in Figure 17.

Remarks : Cable Cutter pack within PIP Sensor Cable Spare

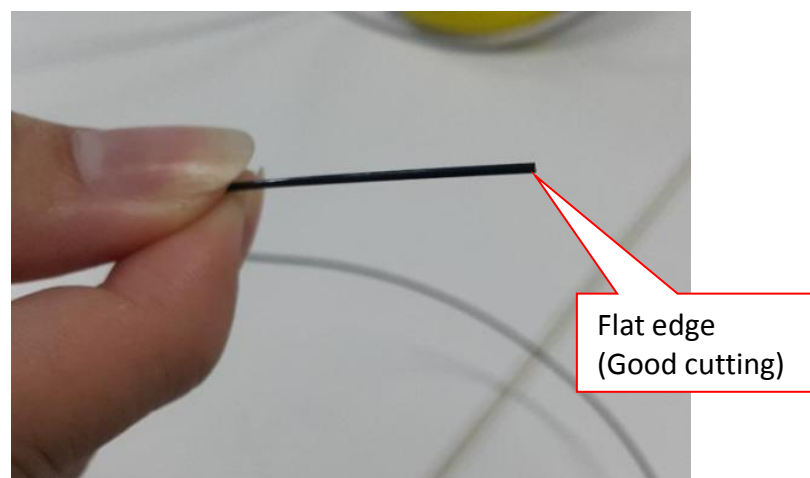
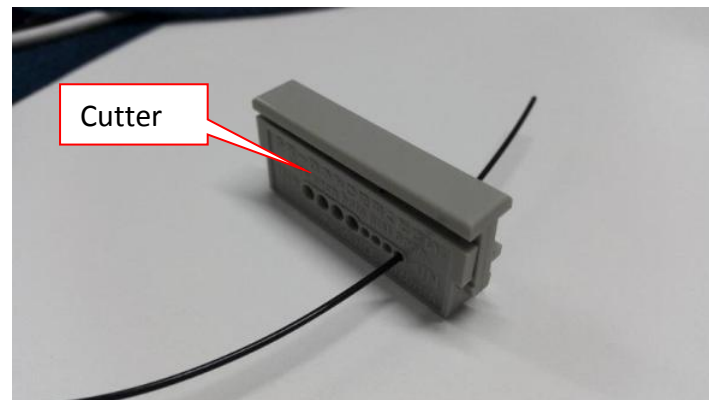


Figure 17 PIP Sensor Cable

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

10. Gently slot PIP Sensor End Cable into adapter as shown in Figure 18.

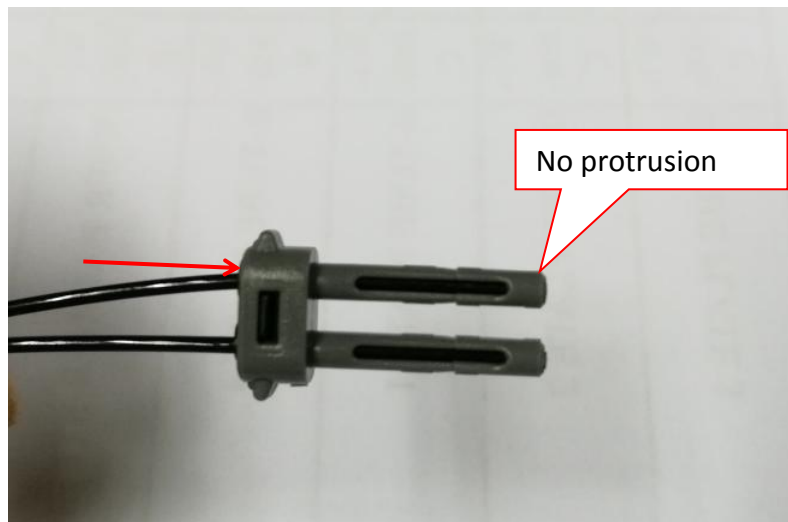


Figure 18 PIP Sensor End Cable Adapter

11. Plug adapter to Left Amplifier & lock as shown in Figure 19.

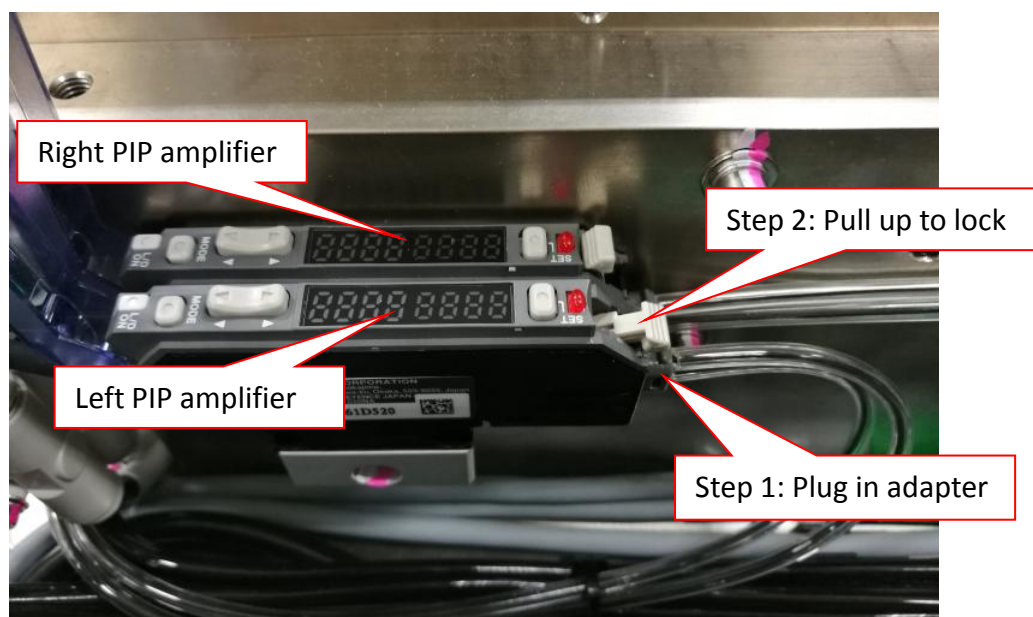


Figure 19 PIP Sensor Amplifier

12. Turn on Air Pressure Regulator & adjust it to 80 PSI.
13. Close front access door.
14. Obtain 1 x Dummy Board or Carrier for board clamping test.
15. Initialize Panel Handling

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

16. Set the parameters as shown in the Figure 20 and click Load Panel.

Panel width : Subjected to Dummy Board Or Carrier

Panel length : Subjected to Dummy Board Or Carrier

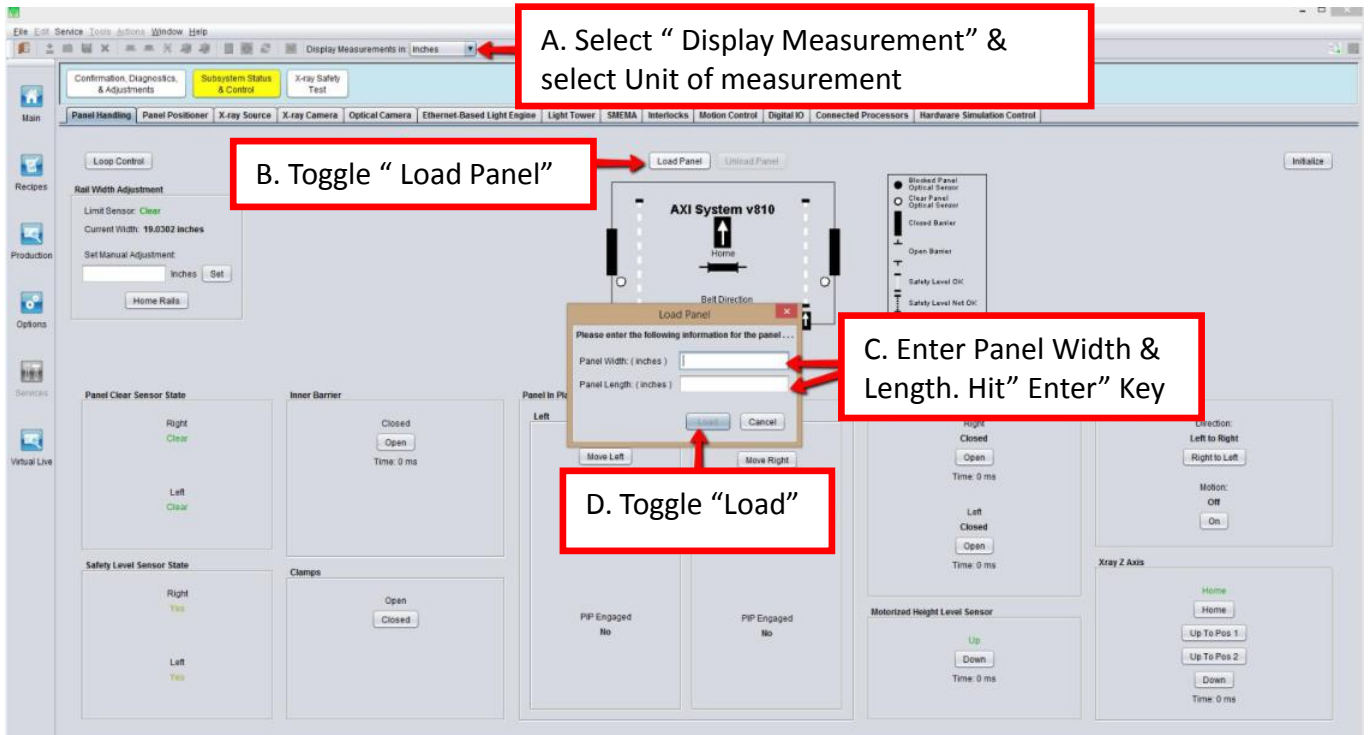


Figure 20 Panel Handling

17. Load the Dummy Board Or Carrier into machine after outer barrier open.

18. Check Left PIP Sensor Engage Sensor Status where YES should be illustrated at Panel Handling GUI

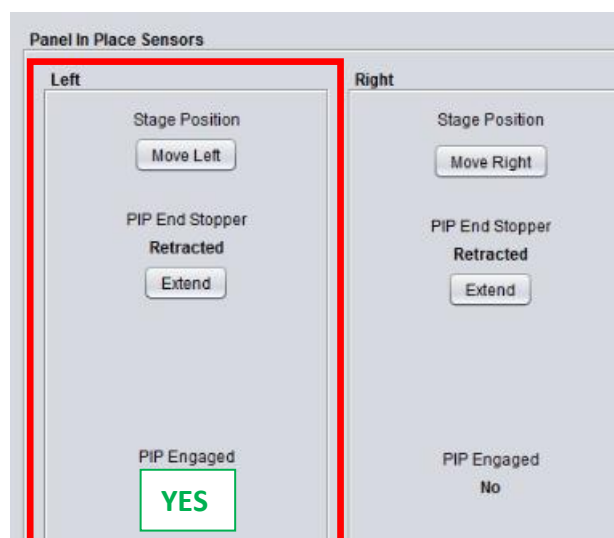


Figure 21 Left PIP Sensor Status

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

19. Unload the board at Panel Handling
20. Return to Panel Handling and click initialize
21. Check Left PIP Sensor Engage Sensor Status where “NO” should be illustrated at Panel Handling GUI

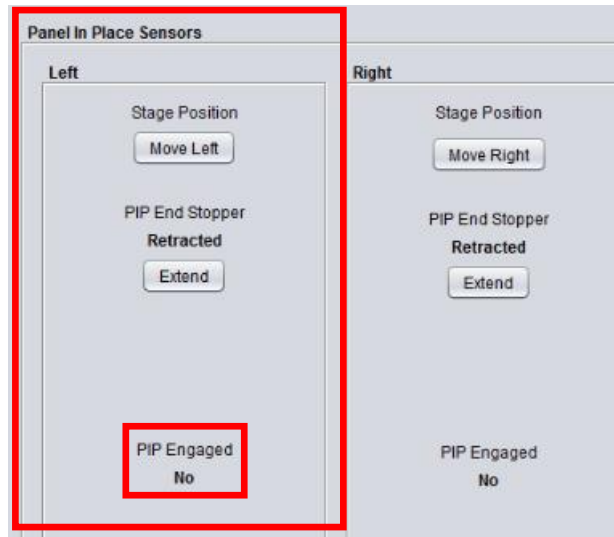


Figure 22 Left PIP Sensor Status

22. Run 1 loop of CD&A

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

Right PIP Sensor Removal

1. Close X-ray source & Air Pressure.
2. Open Front Access Door.
3. Unlock & remove Defective PIP Sensor Cable Adapter from Right Amplifier as shown in Figure 23

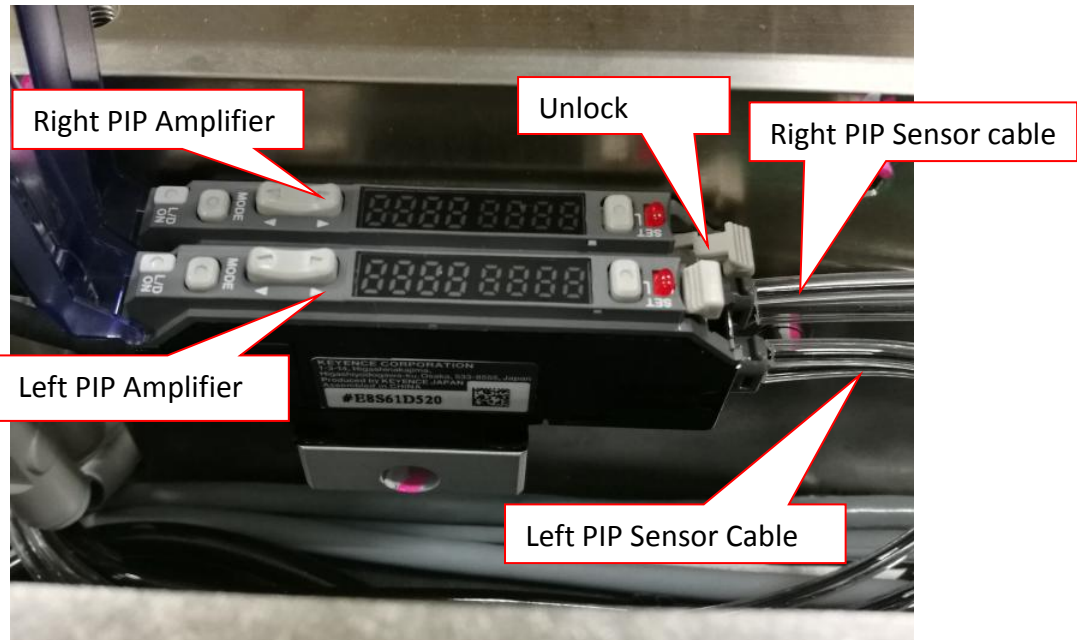


Figure 23 PIP Sensor Amplifier

4. Remove PIP Sensor Cable by refer to below routing. May refer to Figure 24 & Figure 25

Remark: Remove necessary cable tie & cable clamp

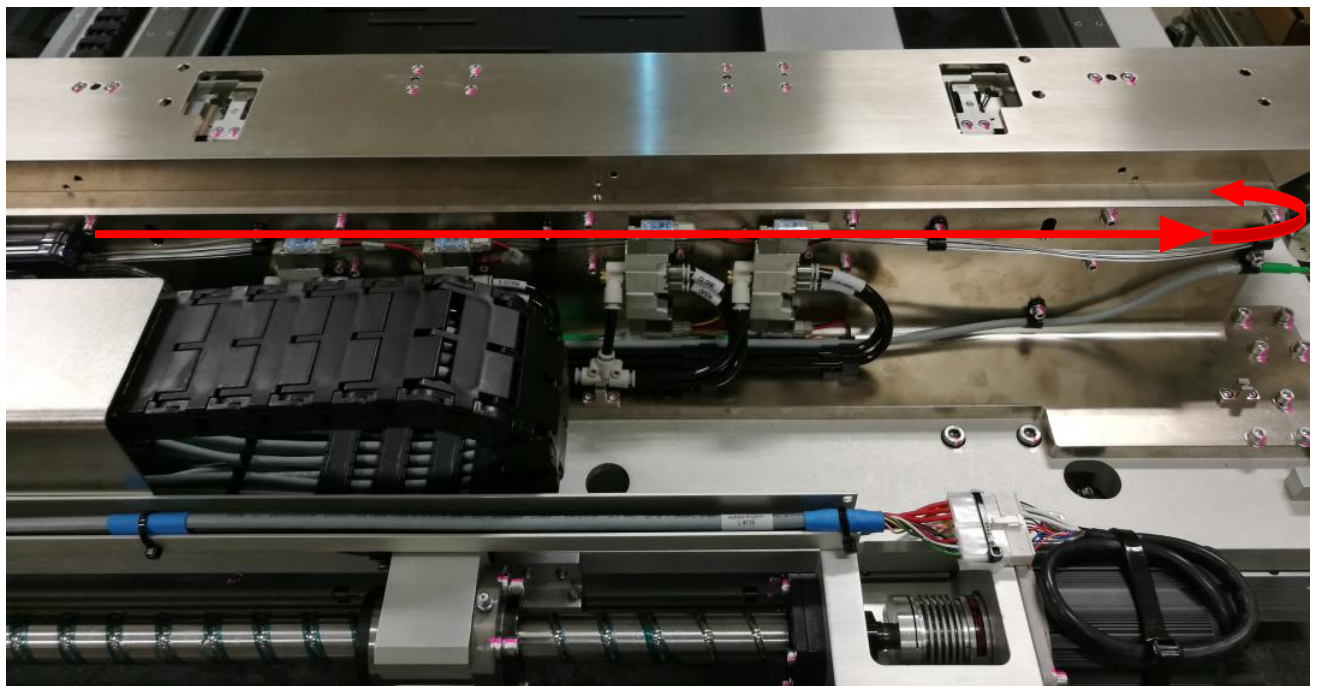


Figure 24 PIP Sensor Cable Removal

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

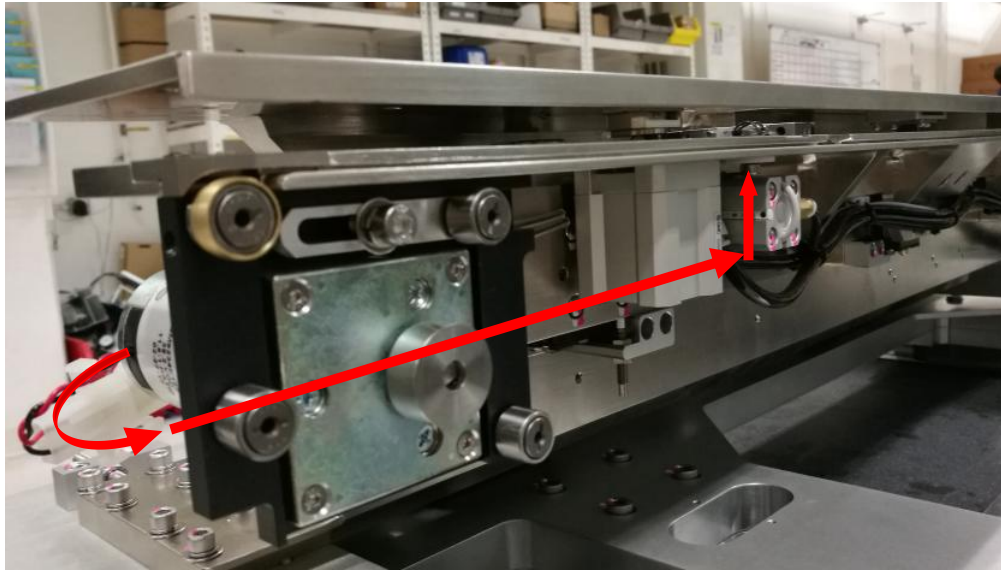


Figure 25 PIP Sensor Cable Removal

5. Remove 2 x Screws (M3 x 6) & PIP Cover as shown in Figure 26

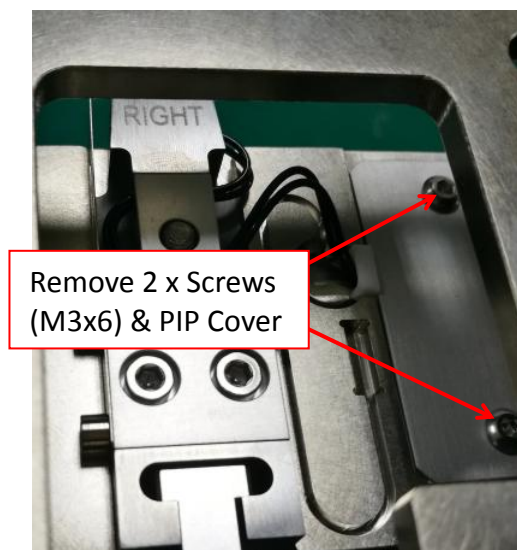


Figure 26 PIP Cover Removal

6. Remove PIP Cable Guide as shown in Figure 27

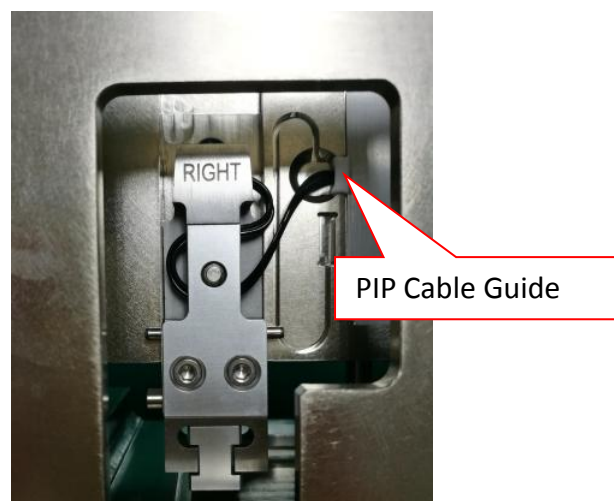


Figure 27 PIP Cable Guide Removal

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

7. Remove 2 x Screws (M3 x 4) & Mount Flag as shown in Figure 28

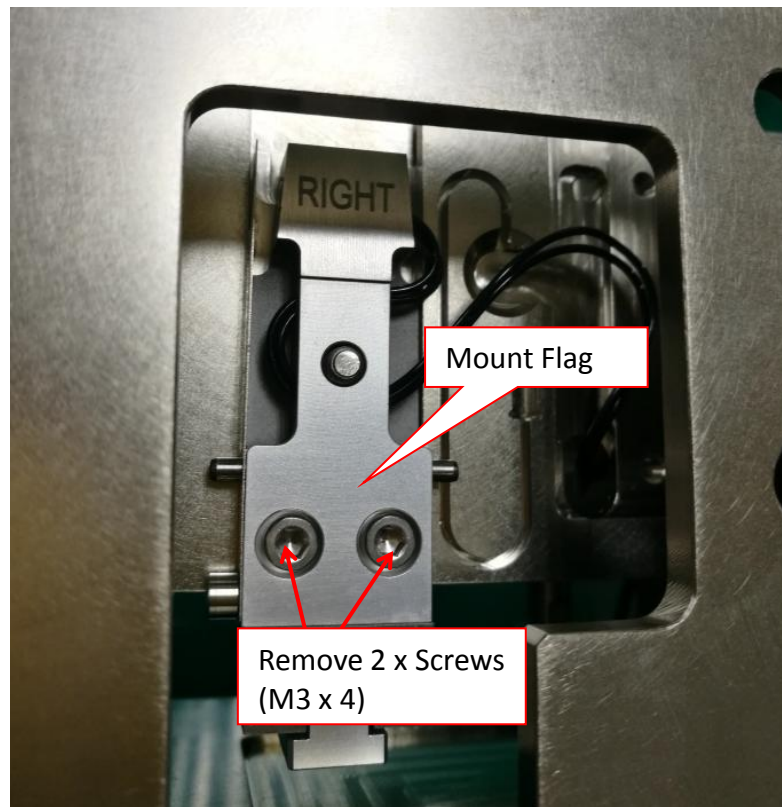


Figure 28 Mount Flag Removal

8. Loosen 2 x Set Screws & remove PIP Sensor Cable as shown in Figure 29

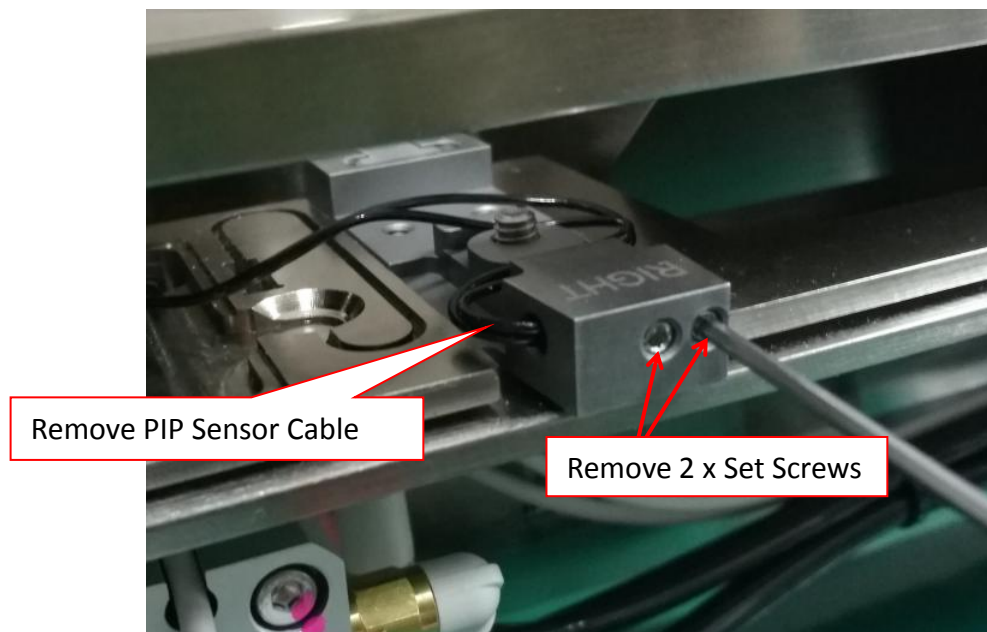


Figure 29 PIP Sensor Cable Removal

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

Right PIP Sensor Replacement

S2EX PIP sensor (right side) part ID: 4JASCC-A232

1. Gently route PIP Sensor Head into PIP Board Stop as shown in Figure 30

Remark: Caution on Sensor Head Protrusion upon routing

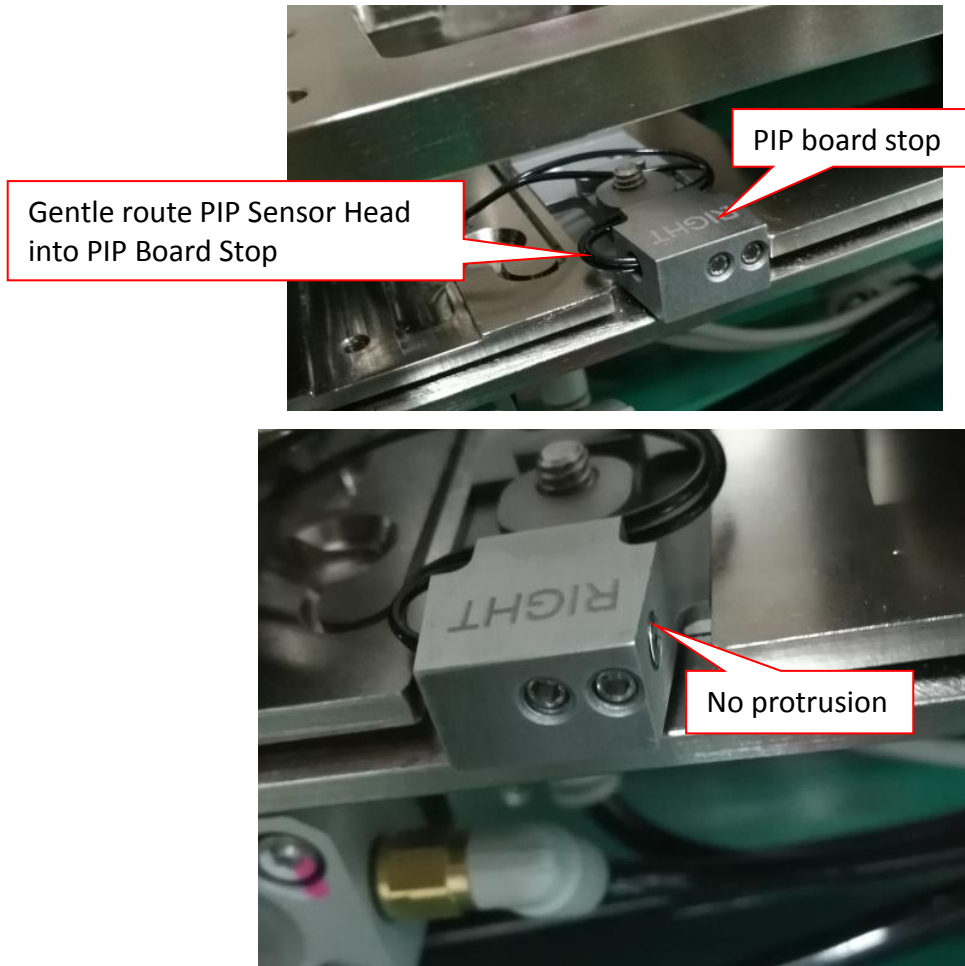


Figure 30 PIP Sensor Head Assembly

2. Tighten 2 x Set Screws as shown in Figure 31



Figure 31 Set Screw Fastening

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

3. Route PIP Sensor cable by refer to below routing. May refer to Figure 32

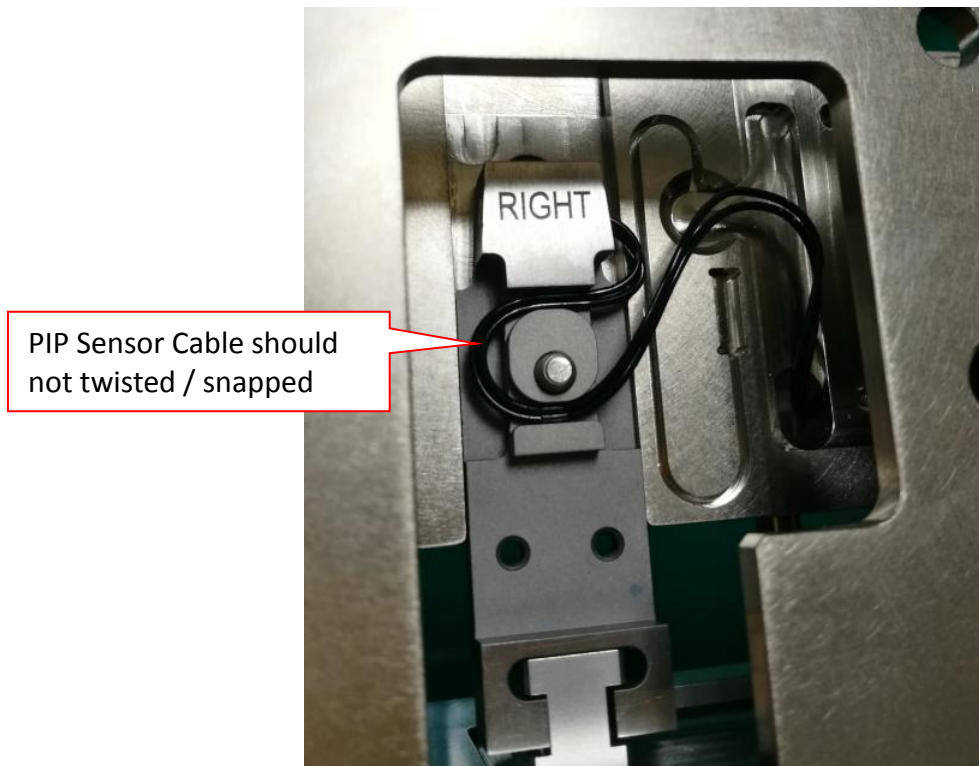


Figure 32 PIP S-shape Routing

4. Assemble Mount Flag & tighten 2 x screws (M3 x 4) as shown in Figure 33.

Remarks : Caution on Curve Routing

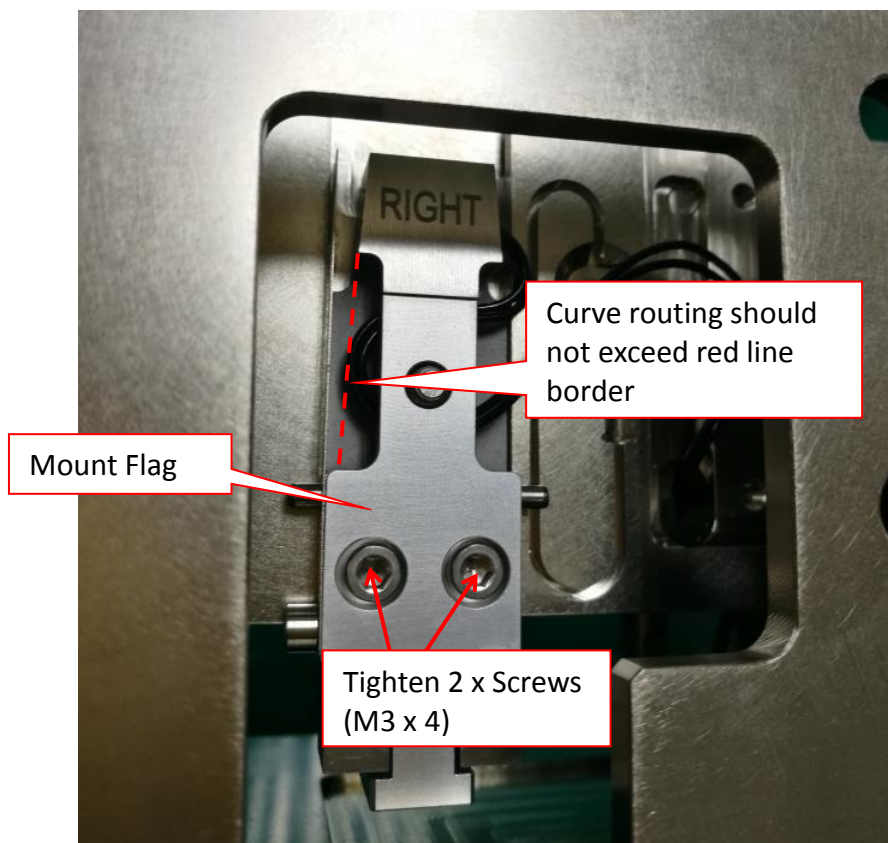


Figure 33 Mount Flag Assembly

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

5. Assemble PIP Cover Guide & PIP Cover as shown in Figure 34

Remarks: Sufficient Cable Buffering would be require upon cable routing

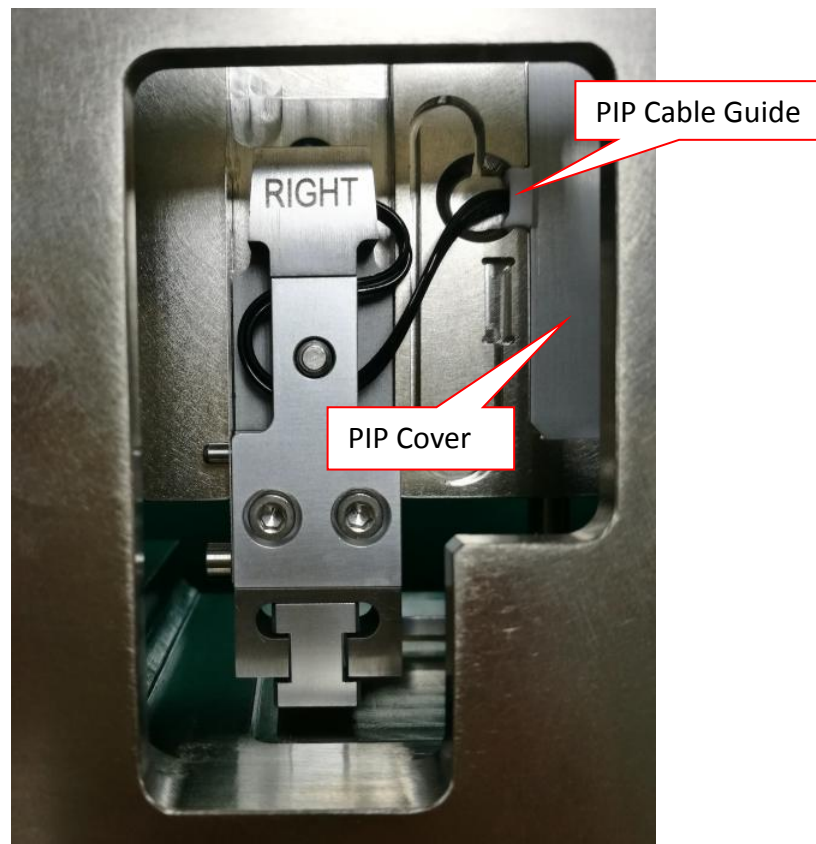


Figure 34 PIP Sensor Cable Routing

6. Tighten 2 x Screws (M3 x 6) as shown in Figure 35

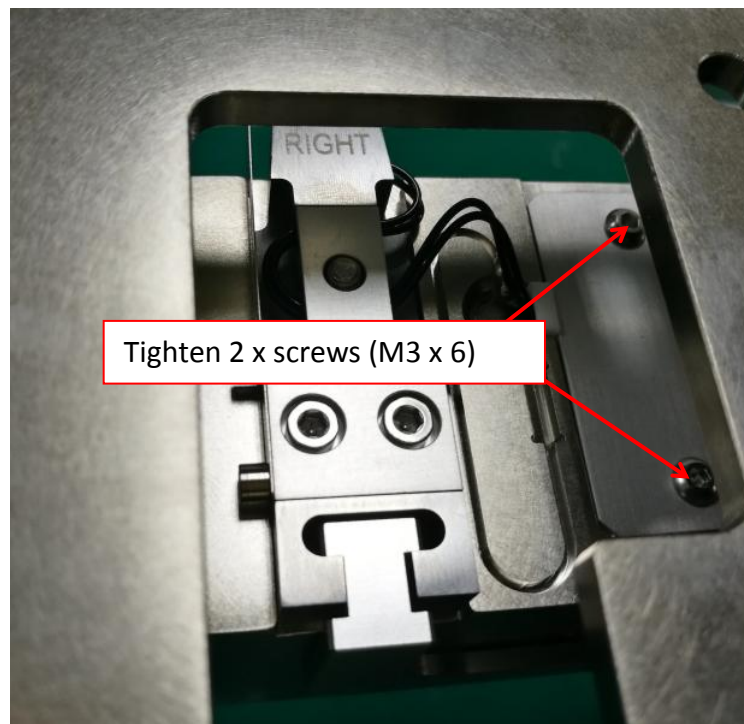


Figure 35 PIP Cover Assembly

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

7. Manually Extend & Retract PIP board stop for several times. Visual check PIP Cable Buffering (Red Box Highlight) where Cable Stressing & Friction should not persist upon PIP Board Stop movement.

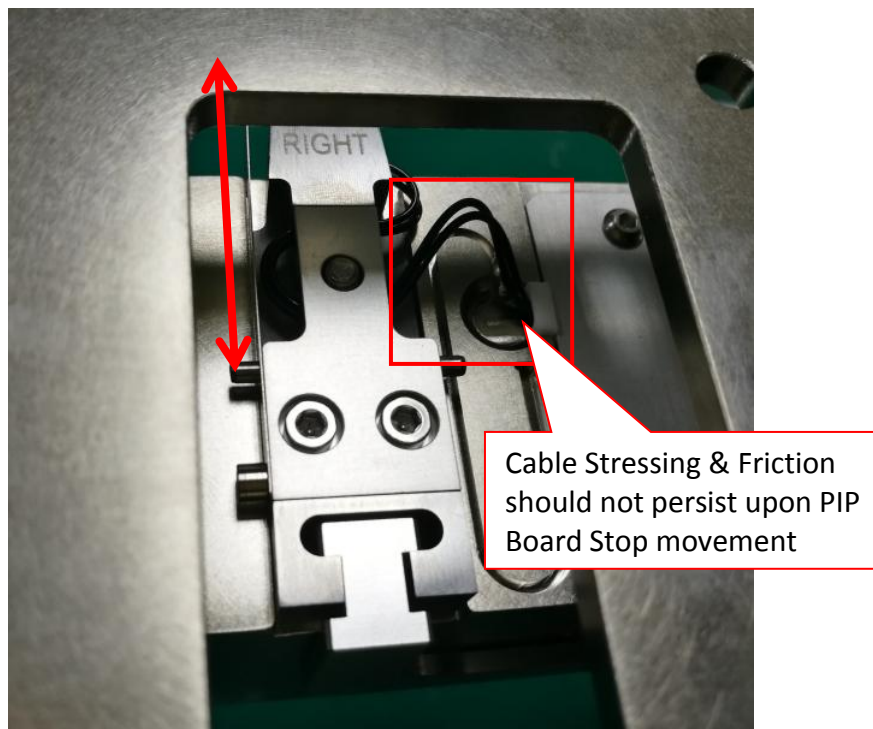


Figure 36 PIP Sensor Cable Checking

8. Route PIP Sensor Cable to Right amplifier by refer to below routing. May refer to Figure 37 & Figure 38

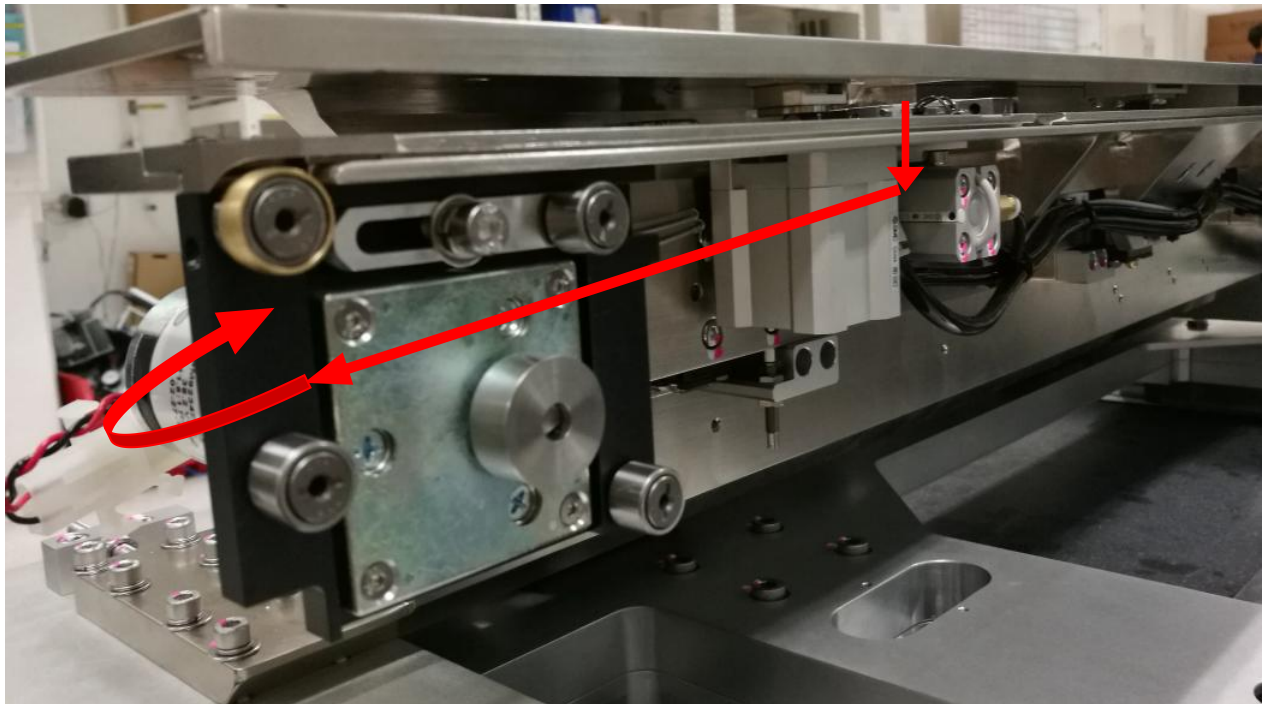


Figure 37 PIP Sensor Cable Routing

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

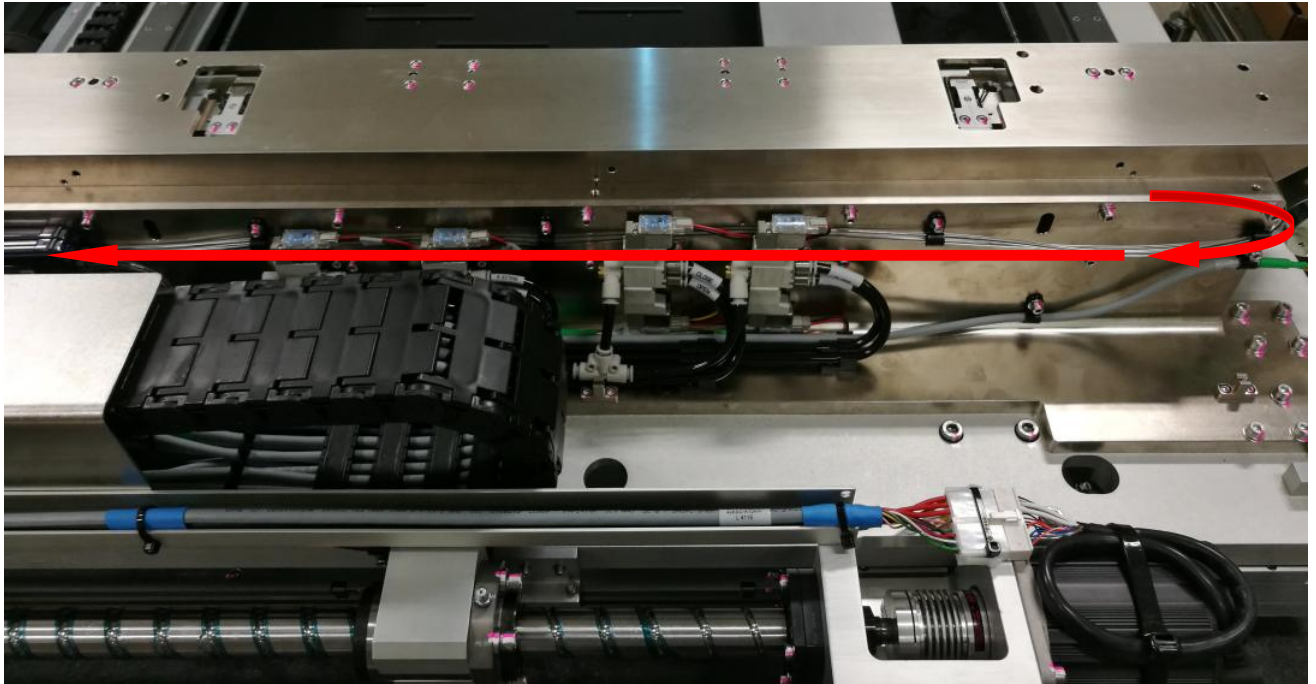


Figure 38 PIP Sensor Cable Routing

9. Remove excessive PIP Sensor Cable as shown in Figure 39

Remarks : Cable Cutter pack within PIP Sensor Cable Spare

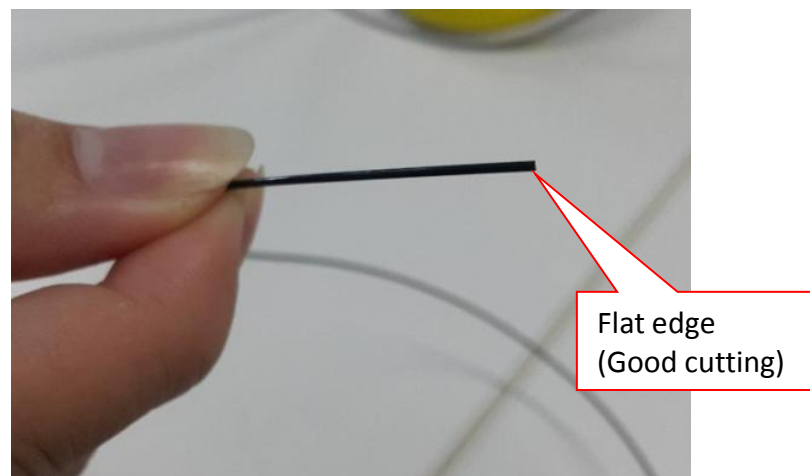
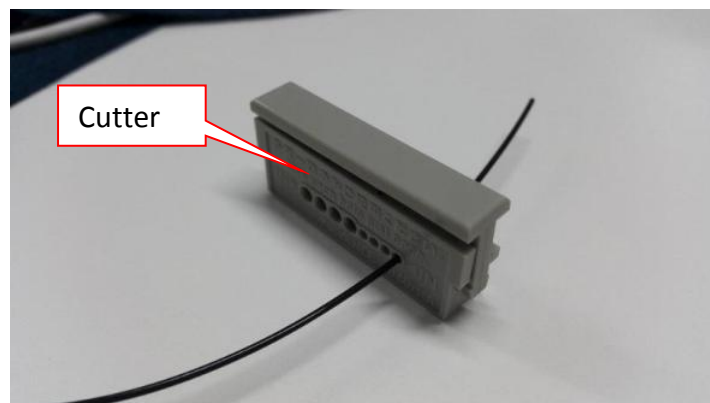


Figure 39 PIP Sensor Cable

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

10. Gently slot PIP Sensor End Cable into adapter as shown in Figure 40

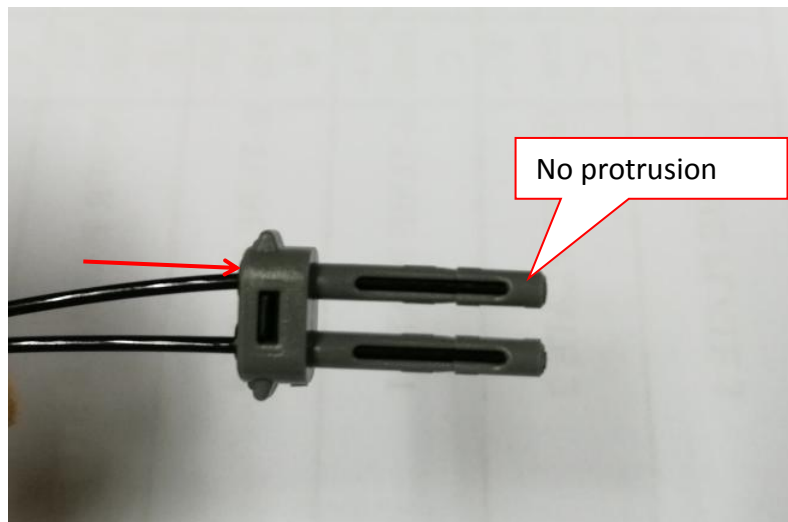


Figure 40 PIP Sensor Cable Adapter

11. Plug adapter to Right Amplifier & lock as shown in Figure 41

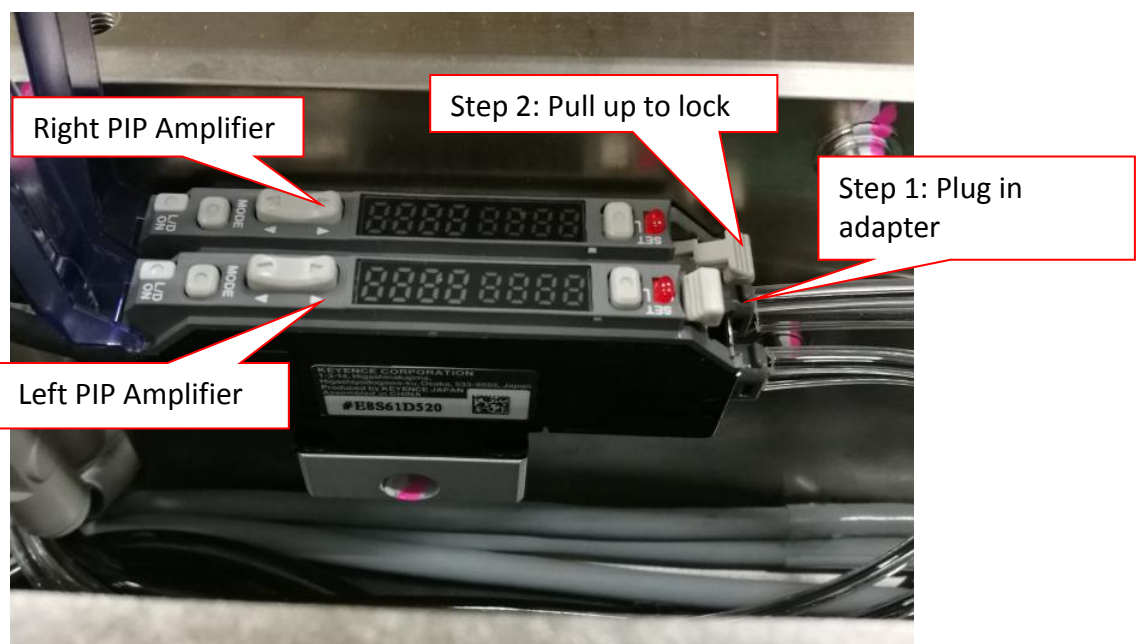


Figure 41 PIP Sensor Amplifier

12. Turn on Air Pressure Regulator & adjust it to 80 PSI.
13. Close front access door.
14. Obtain 1 x Dummy Board or Carrier for board clamping test.
15. Initialize Panel Handling

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

16. Set the parameters as shown in the Figure 42 and click Load Panel.

Panel width : Subjected to Dummy Board Or Carrier

Panel length : Subjected to Dummy Board Or Carrier

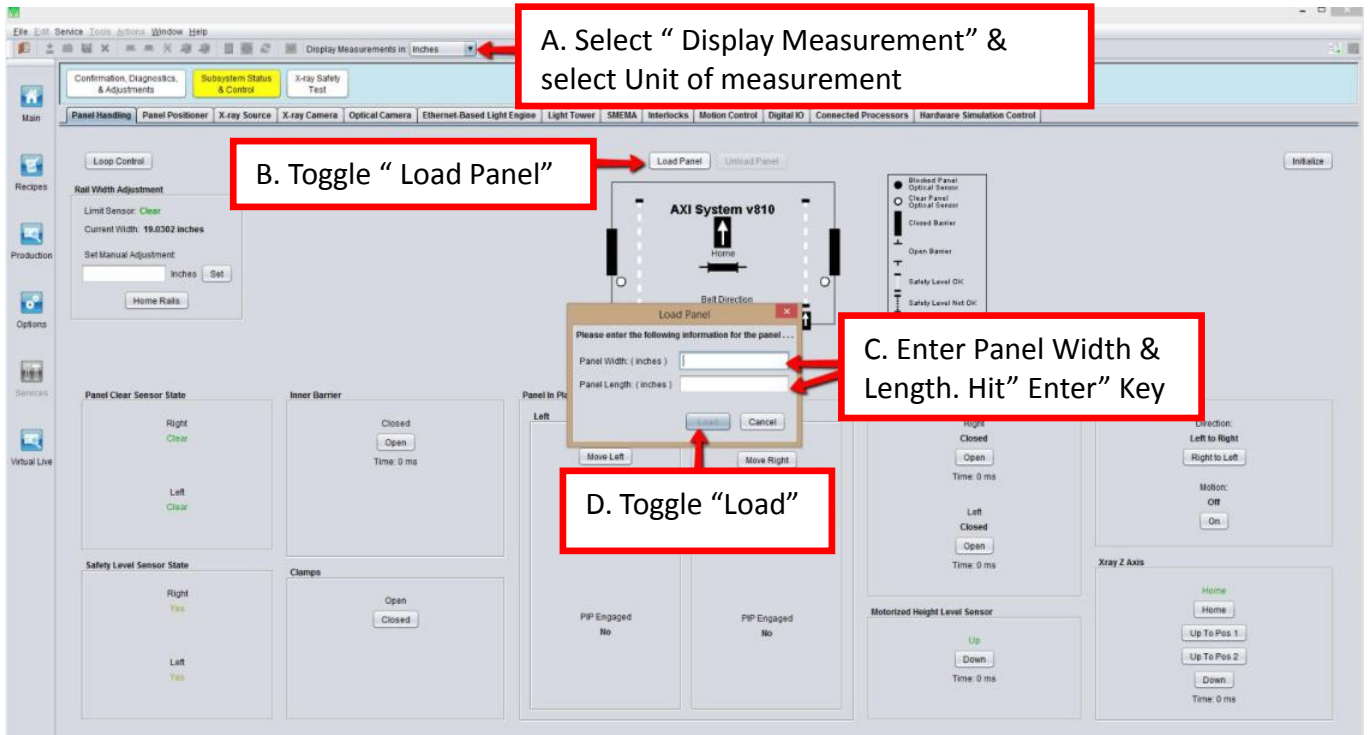


Figure 42 Panel Handling

17. Load the Dummy Board Or Carrier into machine after outer barrier open.

18. Check Right PIP Sensor Engage Sensor Status where YES should be illustrated at Panel Handling GUI

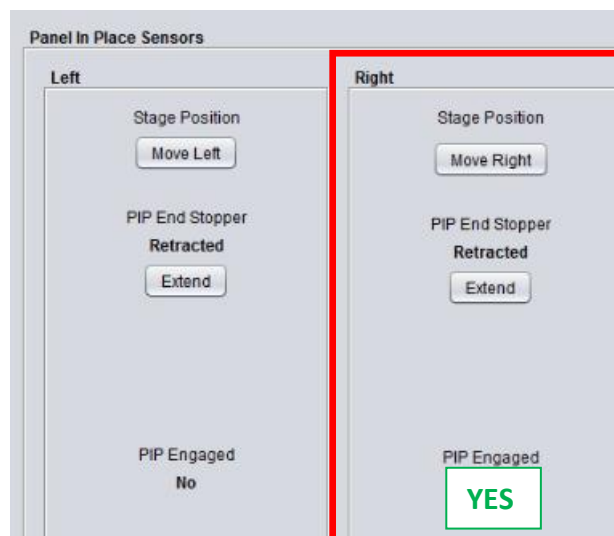


Figure 43 Right PIP Sensor Status

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX PIP Sensor Removal & Replacement Procedure	Effective Date	30 May 2016

19. Unload the board.
20. Return to Panel Handling and click initialize
21. Check Right PIP Sensor Engage Sensor Status where “NO” should be illustrated at Panel Handling GUI

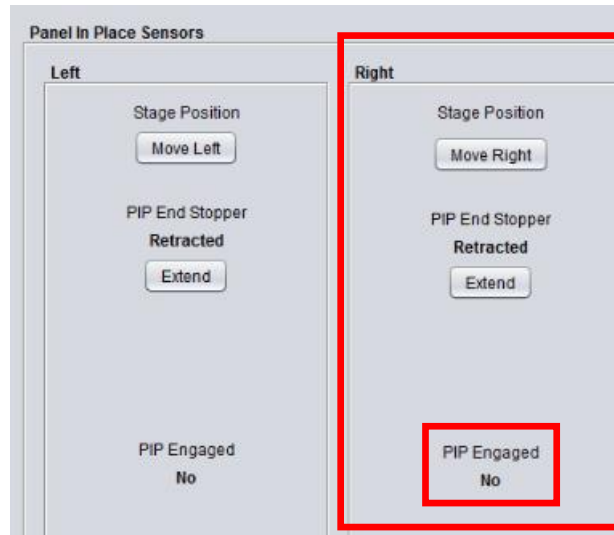


Figure 44 Right PIP Sensor Status

23. Run 1 loop of CD&A