

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX Panel Clear Sensor Position and Sensitivity Adjustment	Effective Date	7 July 2017

This procedure is applicable to below models:

V810 STD	☐	S1	☐	S2
V810 XXL	☐	S1	☐	S2
V810 S2EX	☒			
V810 Mini	☐			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	7 July 2017	First Release	Muhammed Shameem

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX Panel Clear Sensor Position and Sensitivity Adjustment	Effective Date	7 July 2017

Content

Left Panel Clear Sensor Position Adjustment.....	3
Left Panel Clear Sensor Sensitivity Adjustment.....	8
Right Panel Clear Sensor Position Adjustment.....	10
Right Panel Clear Sensor Sensitivity Adjustment.....	14

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX Panel Clear Sensor Position and Sensitivity Adjustment	Effective Date	7 July 2017

Left Panel Clear Sensor Position Adjustment

1. Prepare the latest S2EX Panel Clear Sensor Jig (PN : 4JACMM-N041-B) as shown in Figure 1

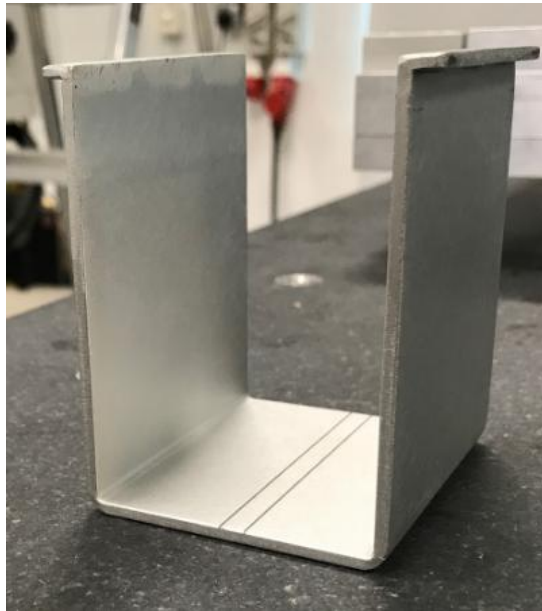


Figure 1 S2EX Panel Clear Sensor Jig

2. Close X-Ray Source
3. Disable "SMEMA Communication at Production Option tab

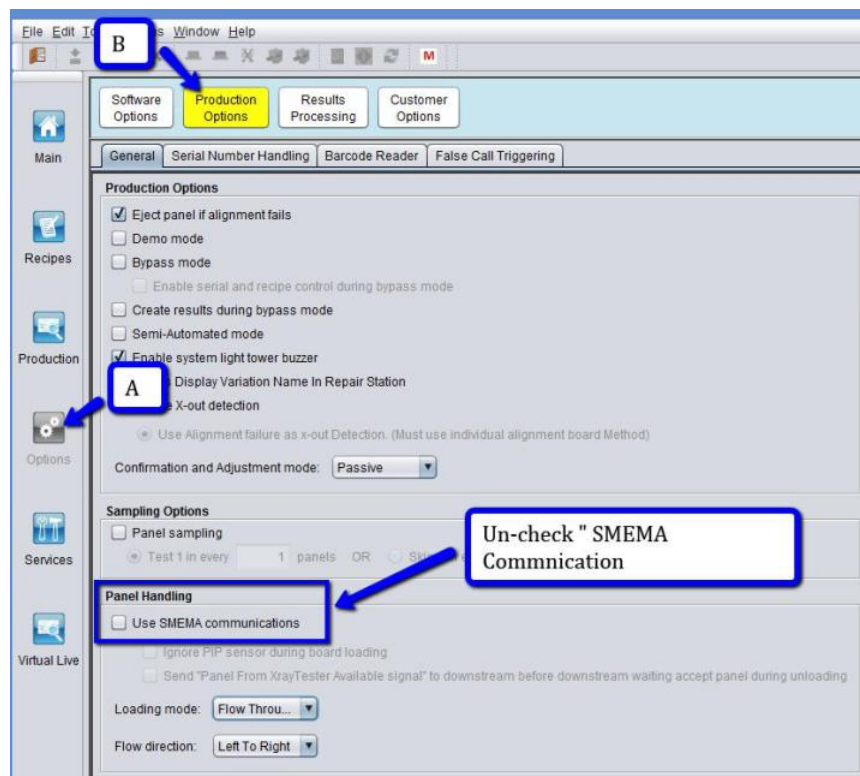


Figure 2 Production Option

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX Panel Clear Sensor Position and Sensitivity Adjustment	Effective Date	7 July 2017

4. Choose “Left to Right” Option at “Flow Direction” (Production Option)

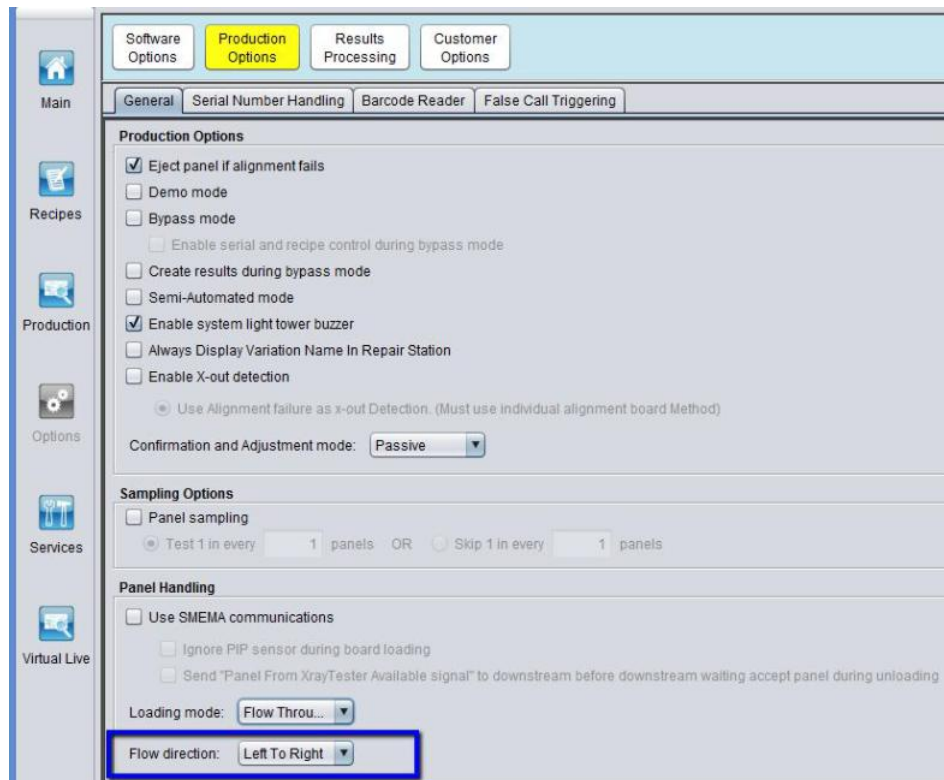


Figure 3 Left to Right (Flow Direction)

5. At V810 GUI, go to Services->Subsystem Status & Control->Panel Handling and click “Initialize” as shown in Figure 4

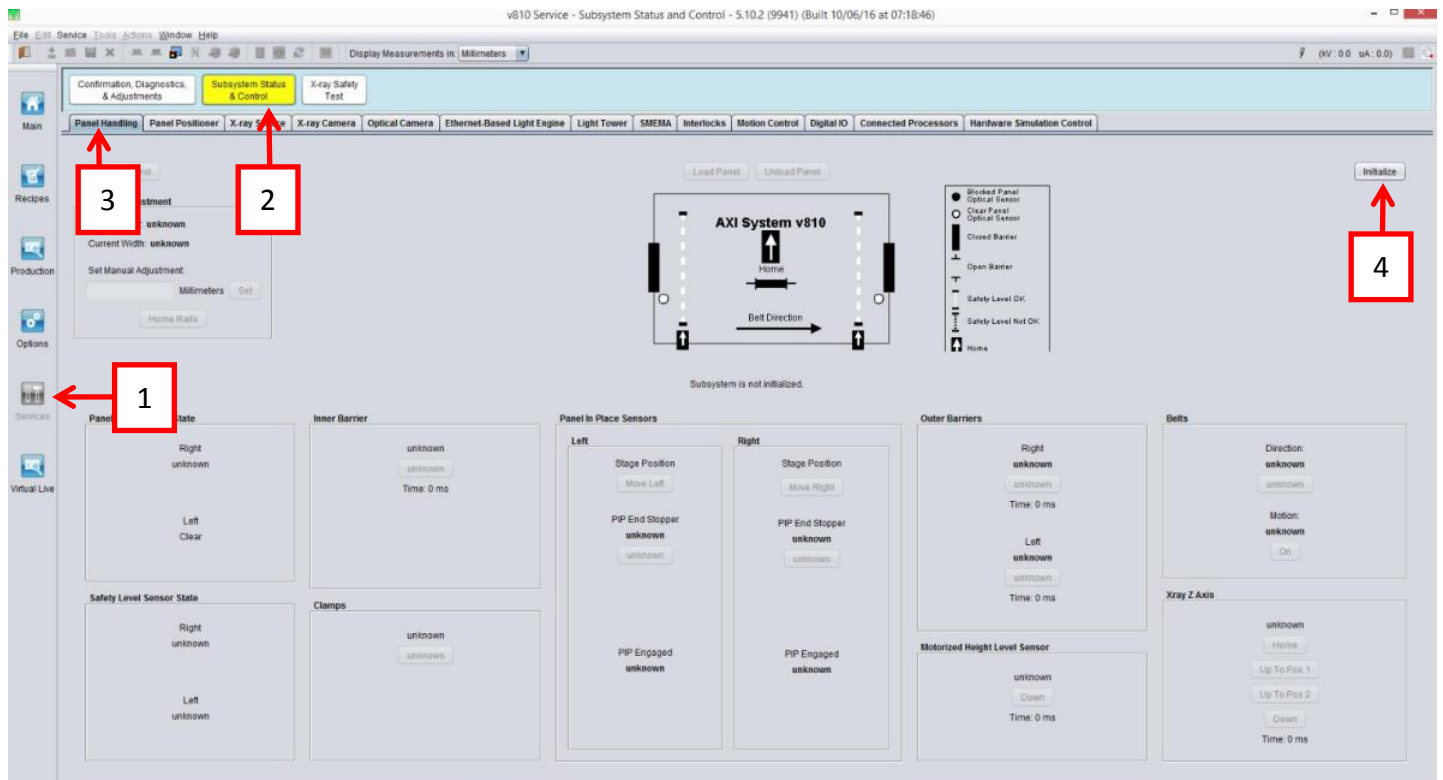


Figure 4 Panel Handling (Initialization)

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX Panel Clear Sensor Position and Sensitivity Adjustment	Effective Date	7 July 2017

- After Initialization complete, select “Display Measurement In: Inches”. Click “Load Panel”.
Enter “Width” and “Length” as 3 inches
Click “Load” as shown in Figure 5

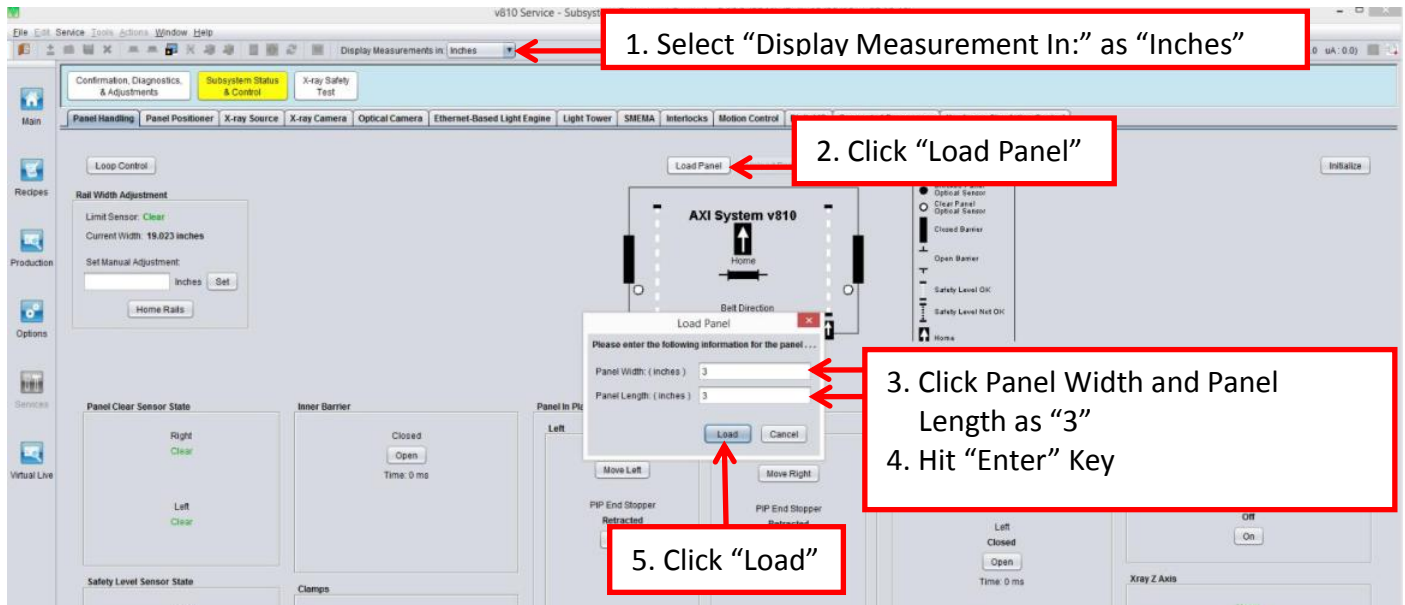


Figure 5 Panel Handling (Load Panel)

- Click “Yes” when “Warning Message” prompt out as shown in Figure 6
After Outer Barrier open, click “Cancel”. DO NOT Load Any Board

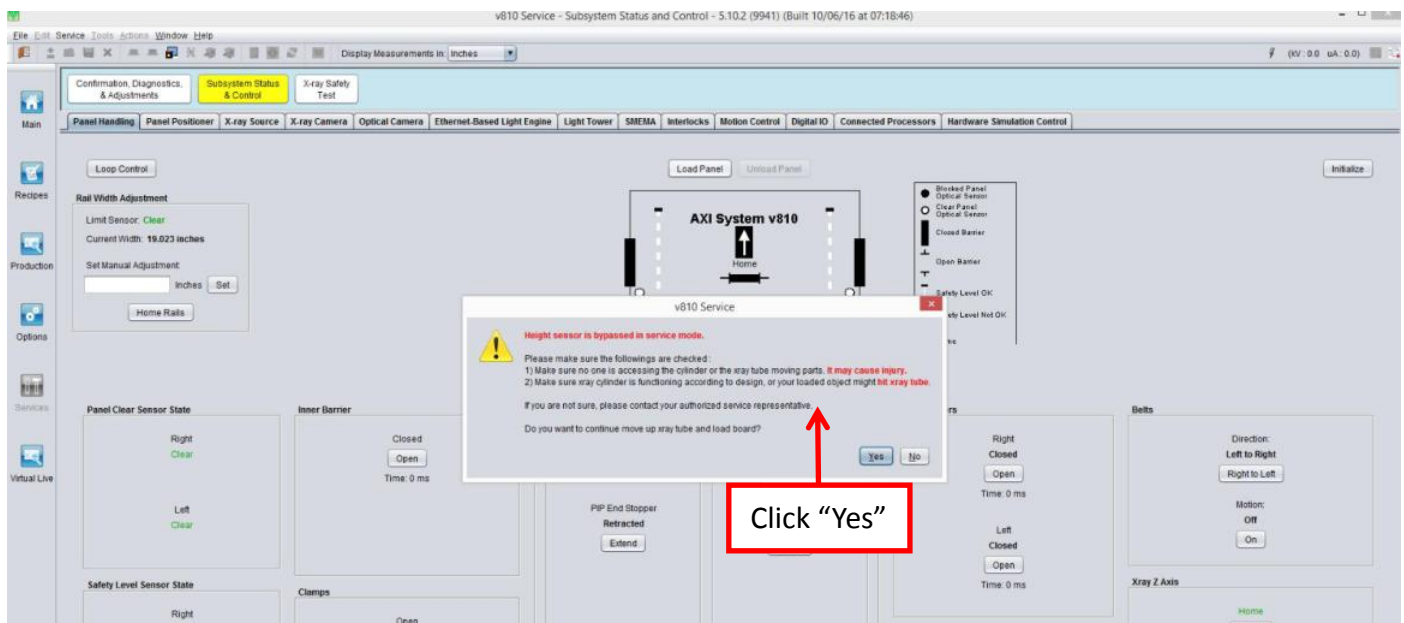


Figure 6 Panel Handling (Warning Message)

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 S2EX Panel Clear Sensor Position and Sensitivity Adjustment	Effective Date	7 July 2017

8. At Panel Handling tab, toggle “Outer Barrier Open” option.

Place V810S2EX Panel Clear Sensor Jig and align evenly with Rail Tip Flat Surface as shown in Figure 7 and Figure 8

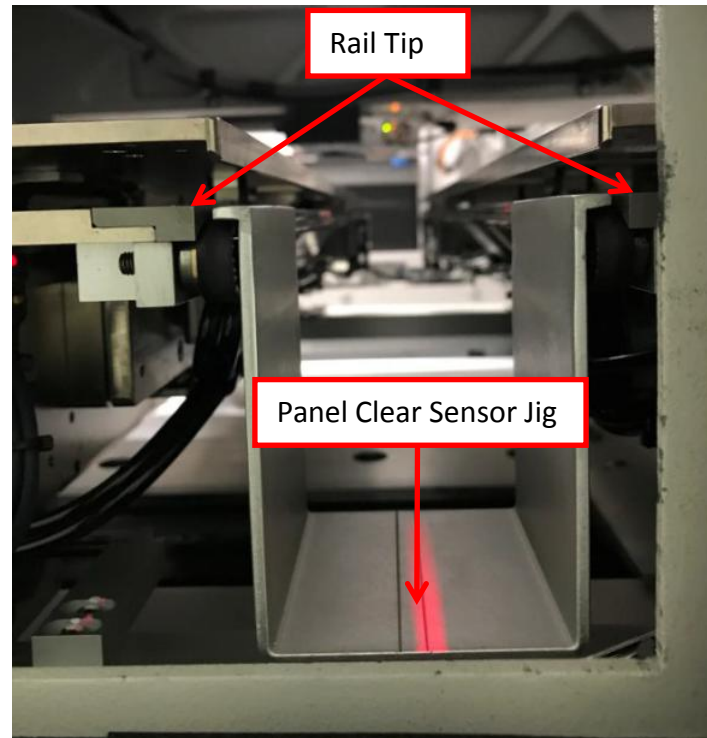


Figure 7 V810S2EX Panel Clear Sensor Jig Positioning[1]

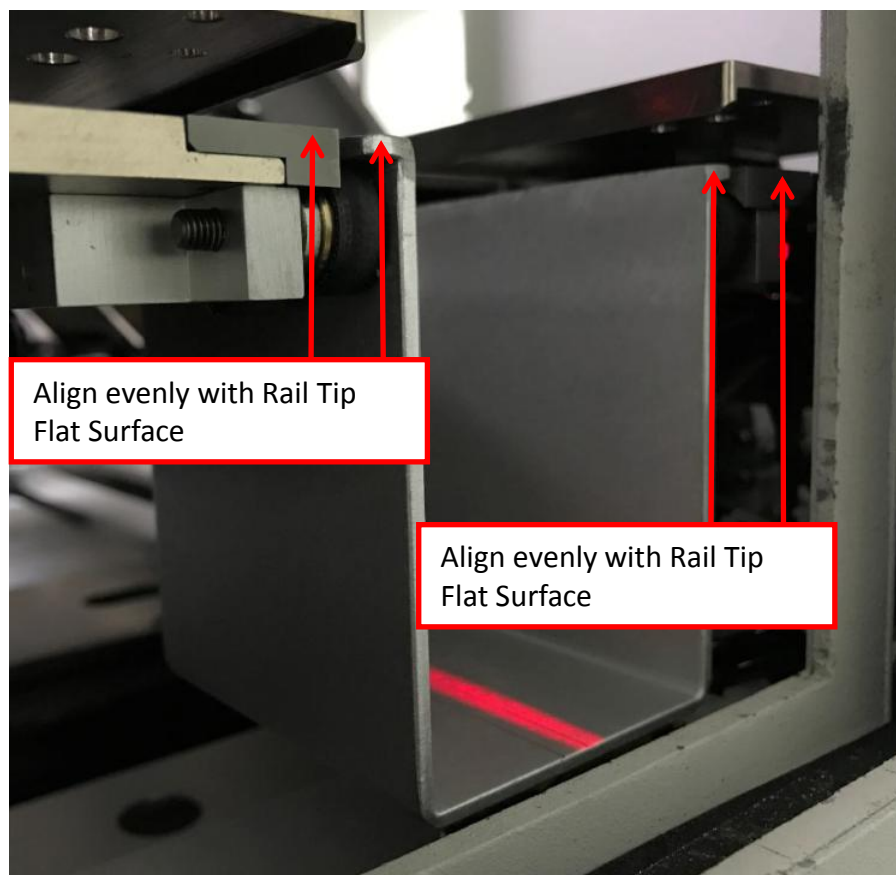


Figure 8 V810S2EX Panel Clear Sensor Jig Positioning[2]

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX Panel Clear Sensor Position and Sensitivity Adjustment	Effective Date	7 July 2017

9. Open Front Access Door
10. Loosen 2 x Screws at Panel Clear Sensor

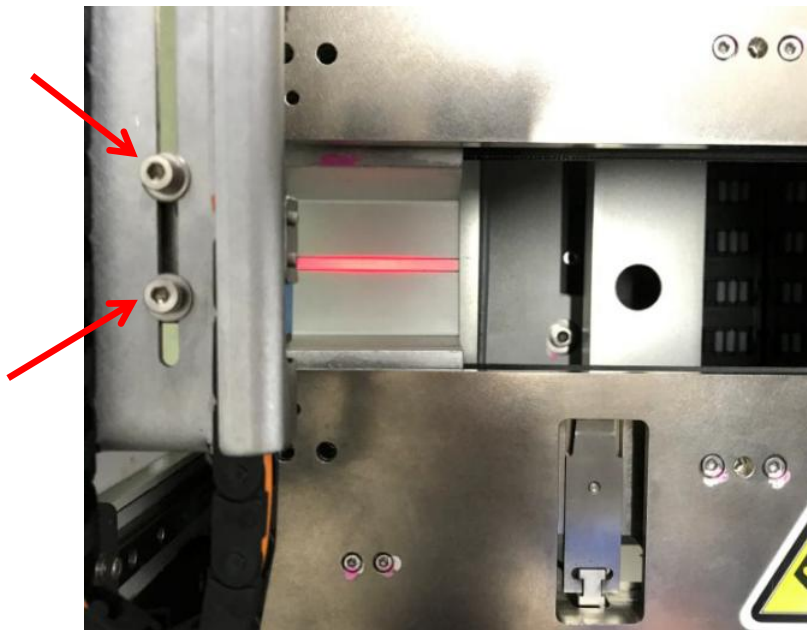


Figure 9 Panel Clear Sensor Screw Location

11. Adjust Panel Clear Sensor until laser spot is reflect within the Square Region. Tighten 2 x Screws after adjustment.

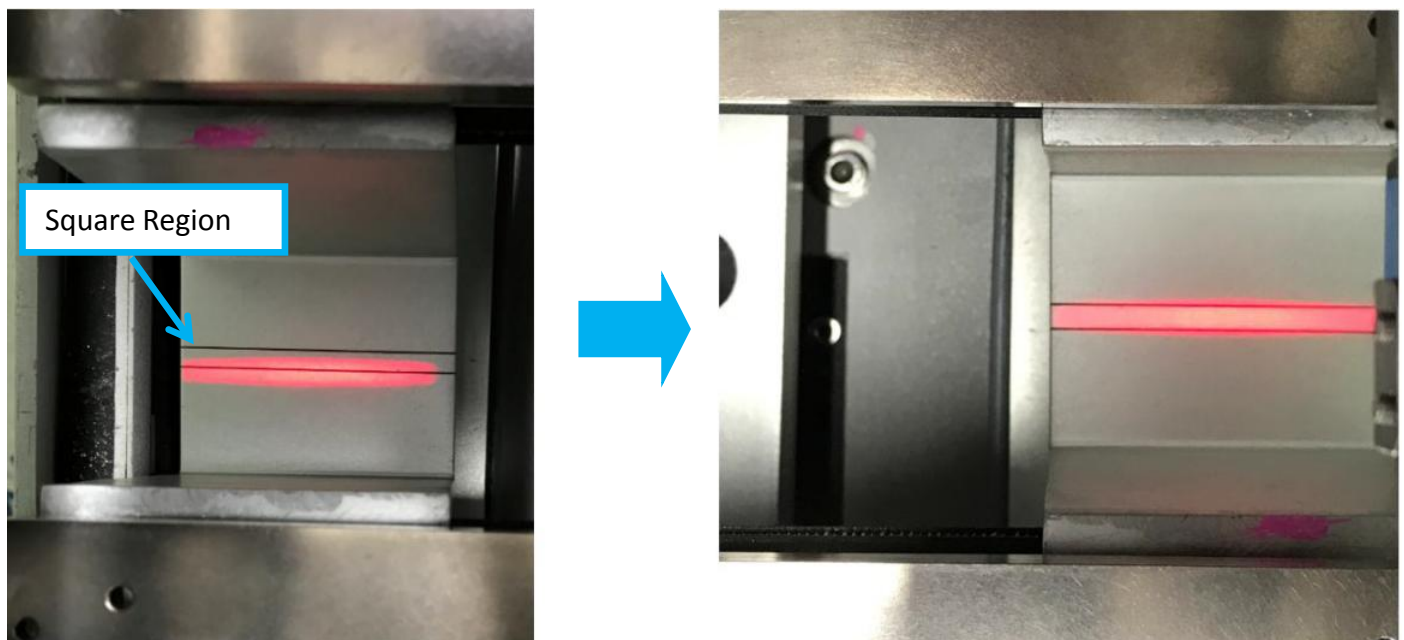


Figure 10 Laser Spot Location

12. Direct refer to Section “ Left Panel Clear Sensor Sensitivity Adjustment”

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX Panel Clear Sensor Position and Sensitivity Adjustment	Effective Date	7 July 2017

Left Panel Clear Sensor Sensitivity Adjustment

1. Remain the S2EX Panel Clear Sensor Jig at appointed location where laser spot still reflect within Square Region.

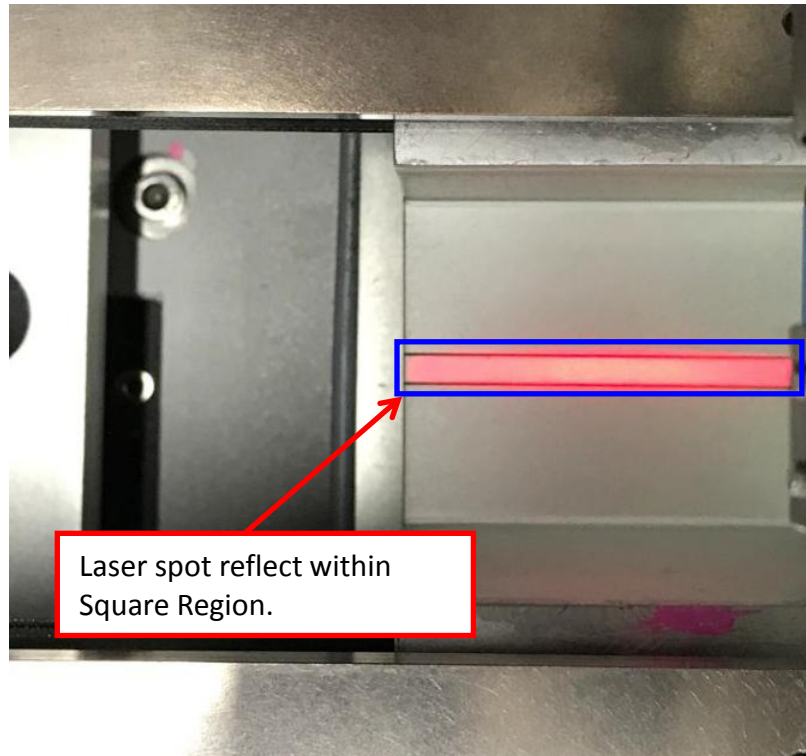


Figure 11 Panel Clear Sensor Jig (Square Region)

2. Adjust Panel Clear Sensor Philip Screw where require to meet below requirement (Table 1)



Figure 12 Panel Clear Sensor Sensitivity Adjustment

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX Panel Clear Sensor Position and Sensitivity Adjustment	Effective Date	7 July 2017

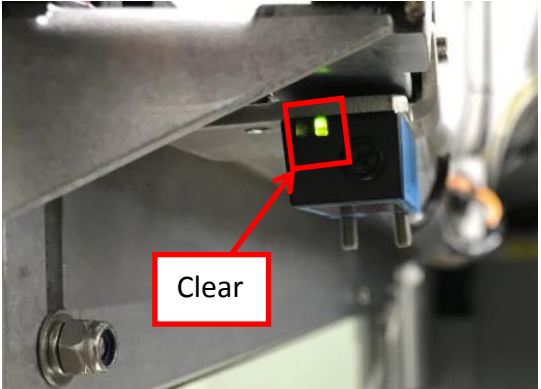
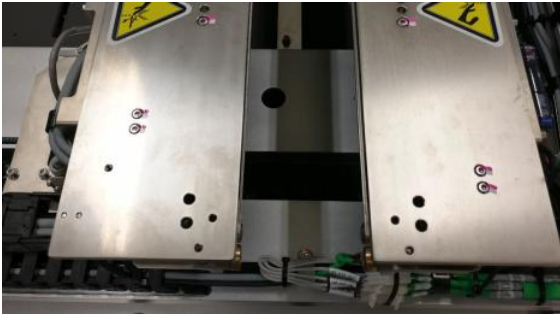
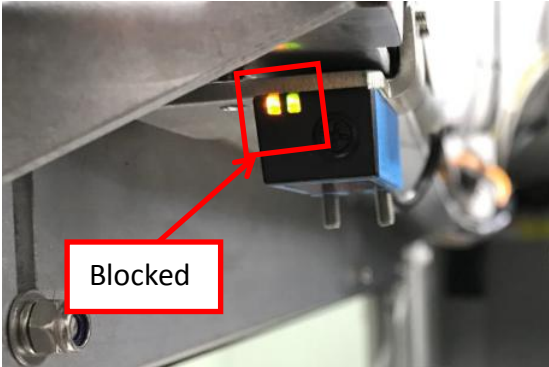
Position	Scenario	Panel Clear Sensor Status
Loading Position	Laser Spot reflect within Jig Square Region 	
Loading Position	Without Jig at rail 	

Table 1

3. Remove jig from the rail
4. Close Front Access Door
5. Run 1 loop of C D & A

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX Panel Clear Sensor Position and Sensitivity Adjustment	Effective Date	7 July 2017

Right Panel Clear Sensor Position Adjustment

1. Prepare the latest S2EX Panel Clear Sensor Jig (4JACMM-N041-B) as shown in Figure 13

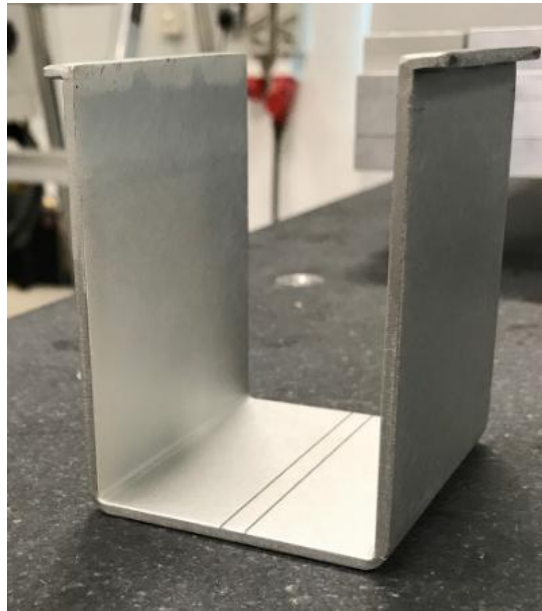


Figure 13 S2EX Panel Clear Sensor Jig

2. Close X ray Source
3. At V810 GUI, go to Services->Production Options->General. Select "Right To Left" as shown in Figure 14

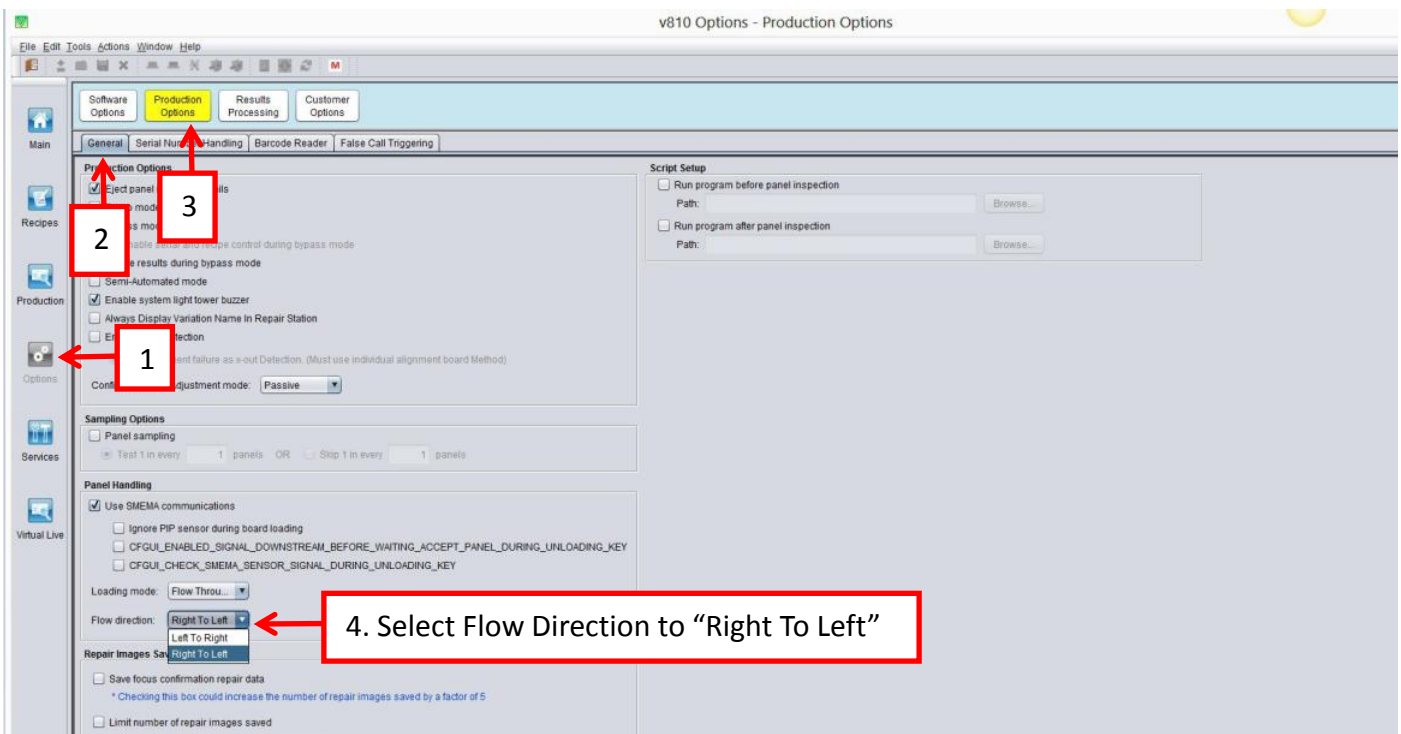


Figure 14 Production Option

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX Panel Clear Sensor Position and Sensitivity Adjustment	Effective Date	7 July 2017

- At V810 GUI, go to Services->Subsystem Status & Control->Panel Handling and click “Initialize” as shown in Figure 15

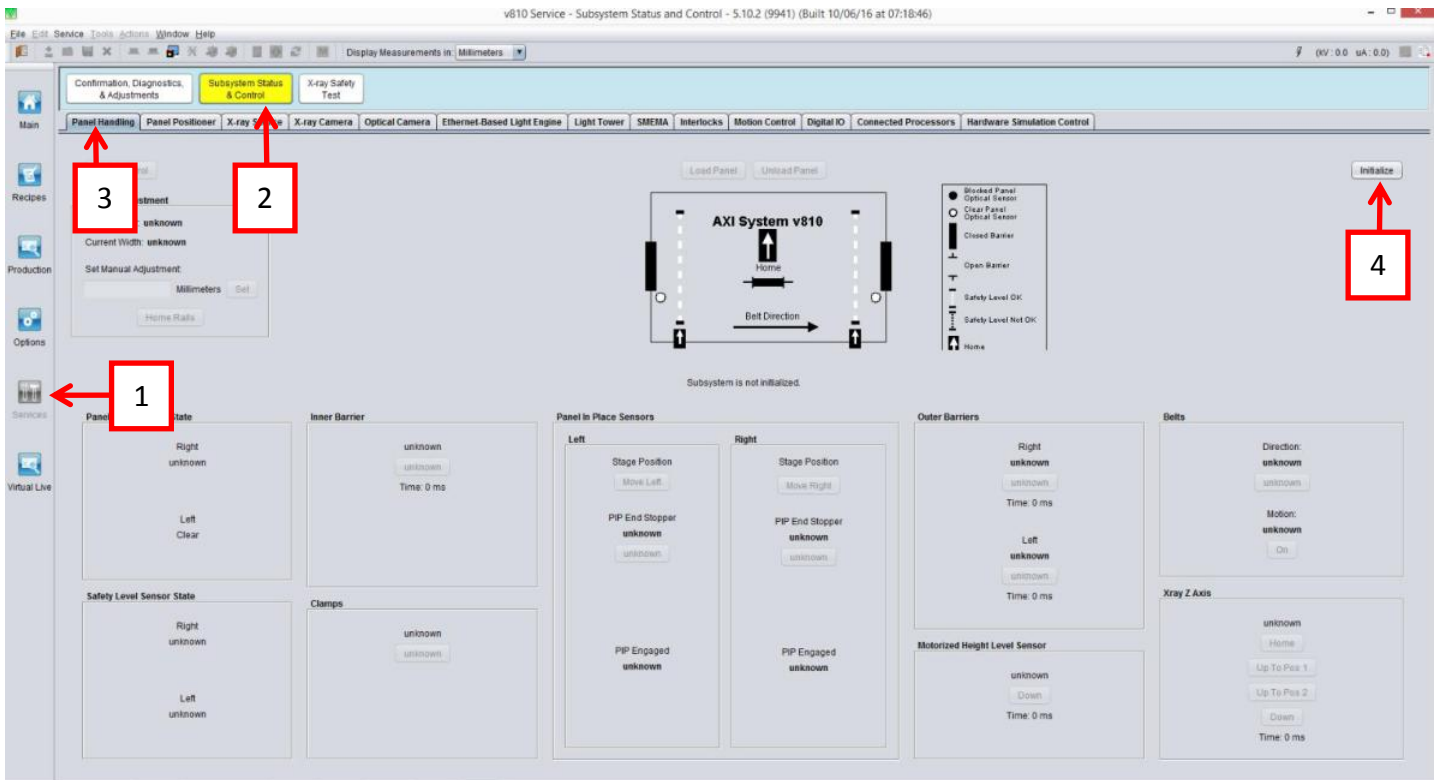


Figure 15 Panel Handling (Initialization)

- After Initialization complete, select “Display Measurement In: Inches”. Click “Load Panel”. Enter “Width” and “Length” as 3 inches. Click “Load” as shown in Figure 16

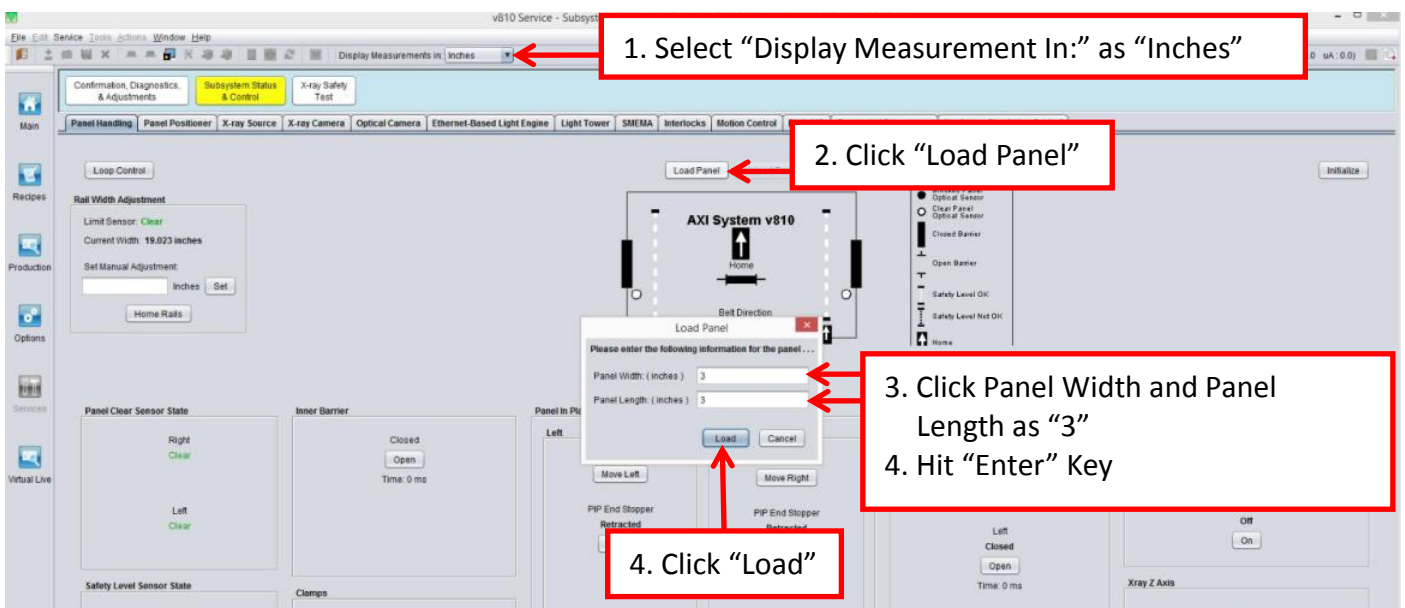


Figure 16 Panel Handling (Load Panel)

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 S2EX Panel Clear Sensor Position and Sensitivity Adjustment	Effective Date	7 July 2017

6. Click “Yes” when “Warning Message” prompt out as shown in Figure 17.

After Outer Barrier open, click “Cancel”. DO NOT Load Any Board

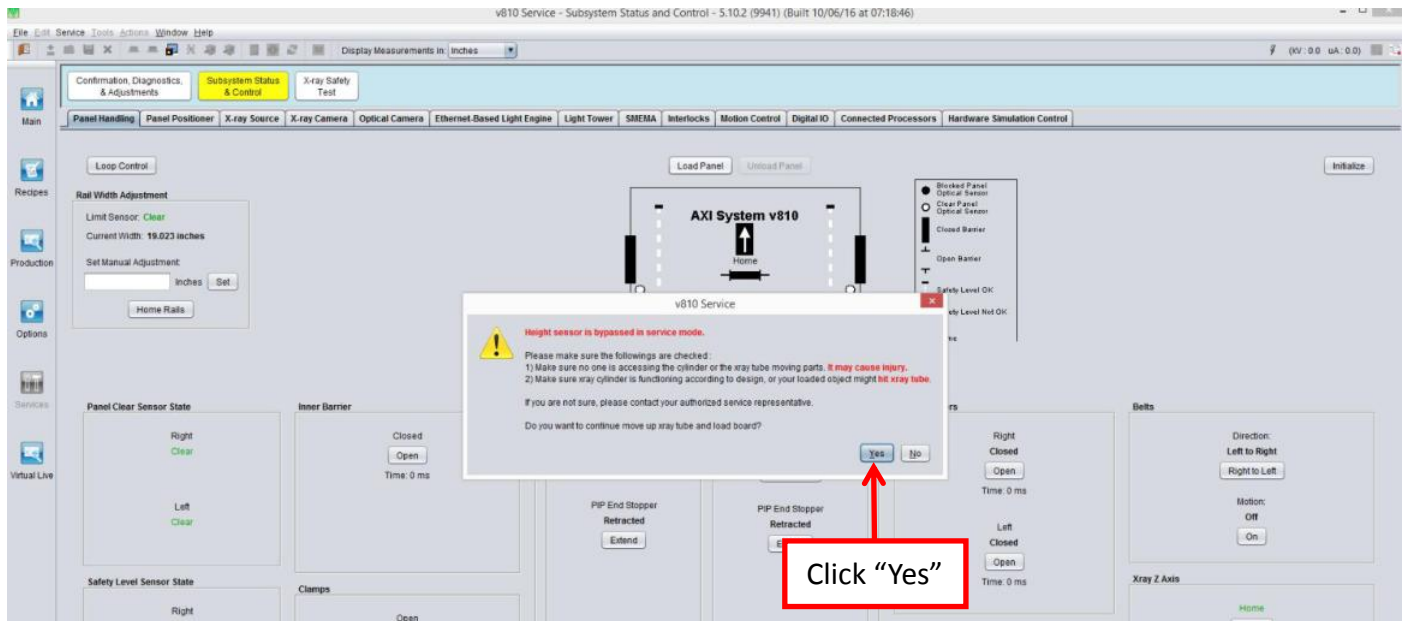


Figure 17 Panel Handling (Warning Message)

7. At Panel Handling tab, toggle “Outer Barrier Open” option.

Place V810S2EX Panel Clear Sensor Jig and align evenly with Rail Tip Flat Surface as shown in Figure 18 and Figure 19

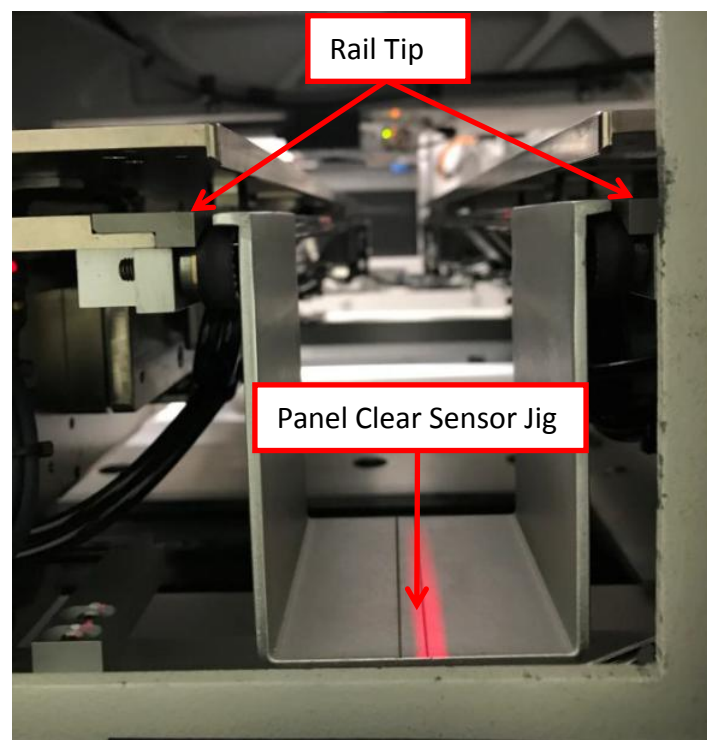


Figure 18 V810S2EX Panel Clear Sensor Jig Positioning[1]

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 S2EX Panel Clear Sensor Position and Sensitivity Adjustment	Effective Date	7 July 2017

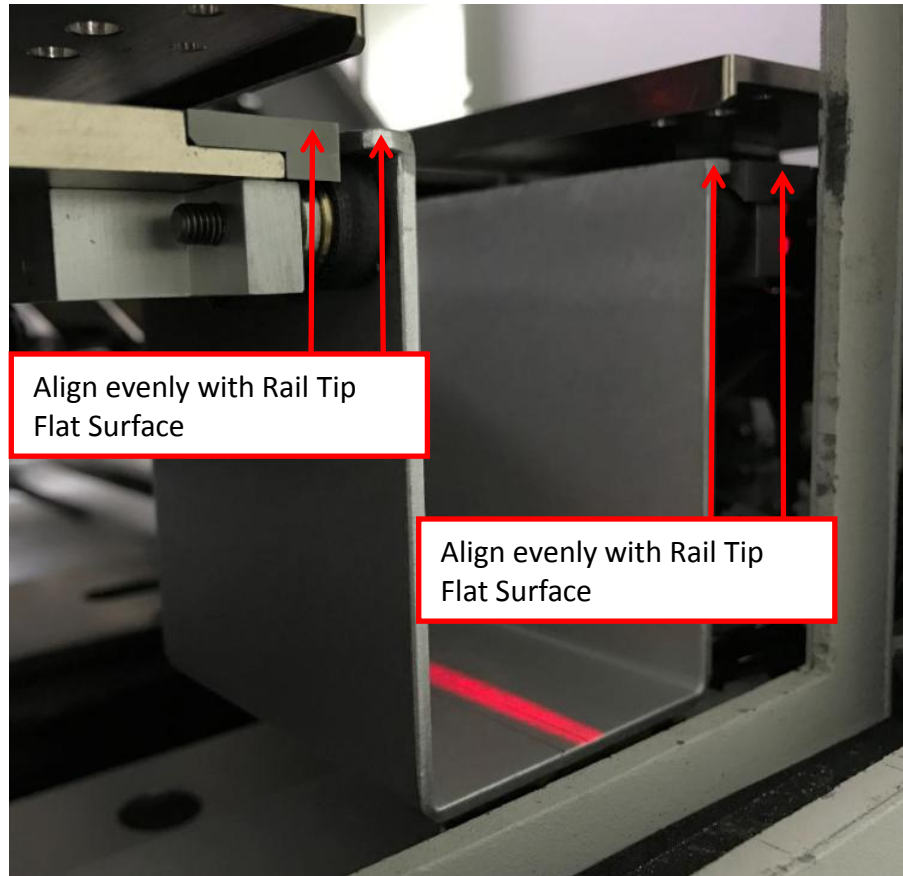


Figure 19 V810S2EX Panel Clear Sensor Jig Positioning[2]

8. Open Front Access Door
9. Loosen 2 x Screws at Panel Clear Sensor

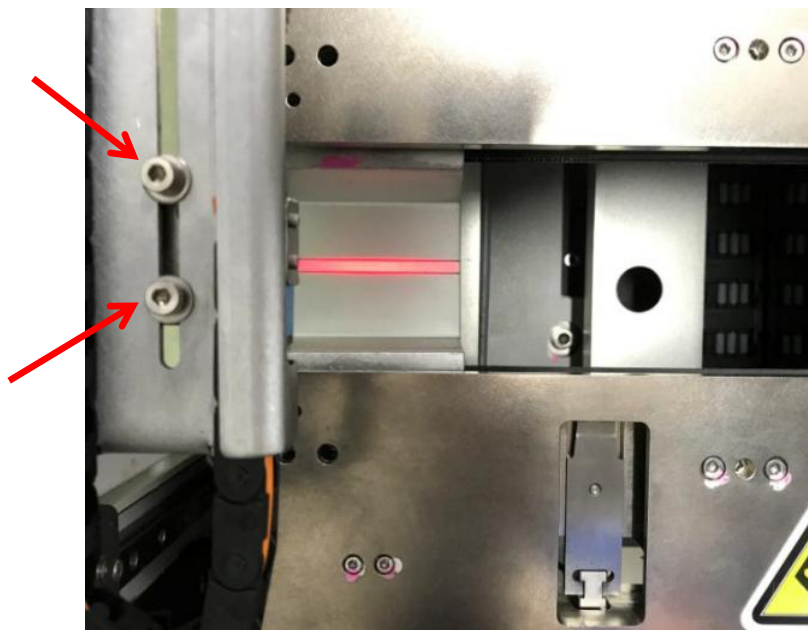


Figure 20 Panel Clear Sensor Screw Location

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX Panel Clear Sensor Position and Sensitivity Adjustment	Effective Date	7 July 2017

10. Adjust Panel Clear Sensor until laser spot is reflect within the Square Region.Tighten 2 x Screws after adjustment.

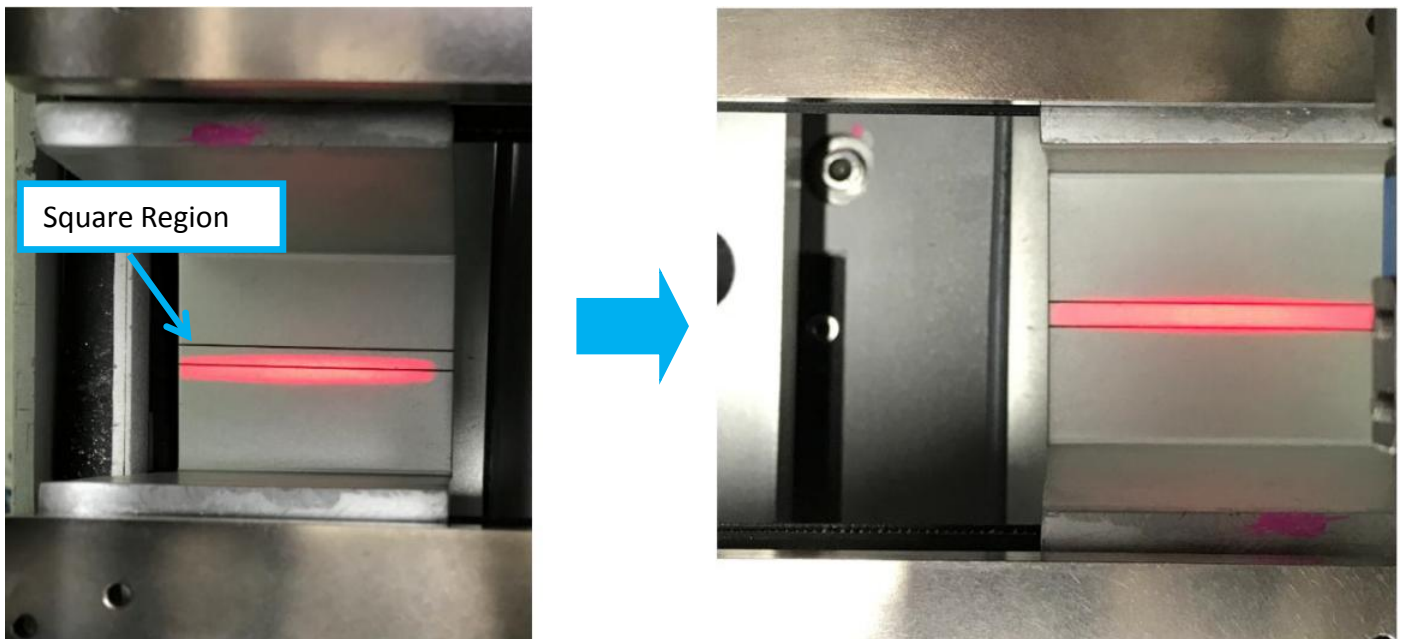


Figure 21 Laser Spot Location

11. Direct refer to Section “ Right Panel Clear Sensor Sensitivity Adjustment”

Right Panel Clear Sensor Sensitivity Adjustment

1. Remain the S2EX Panel Clear Sensor Jig at appointed location where laser spot still reflect within Square Region.

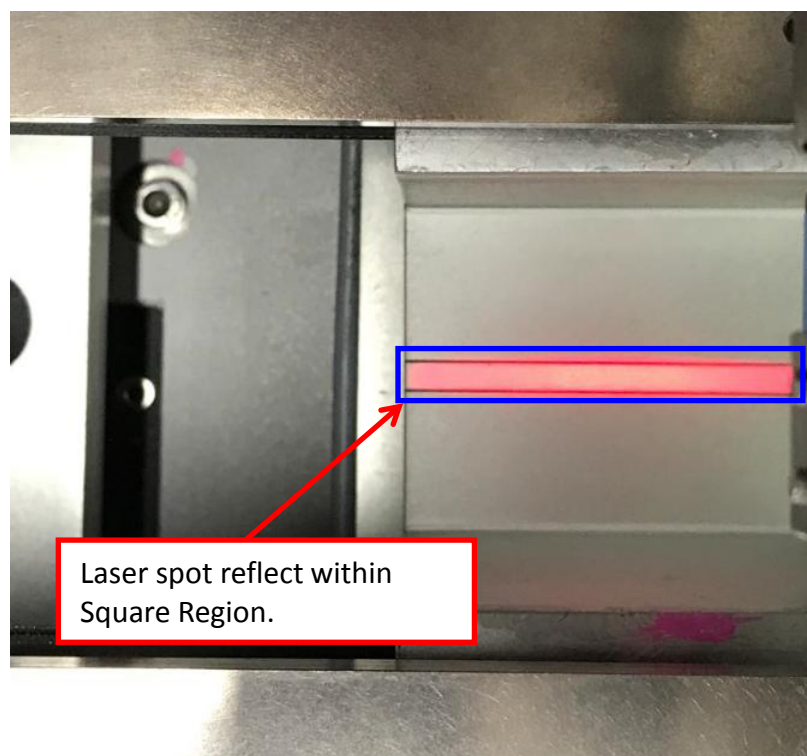


Figure 22 Panel Clear Sensor Jig (Square Region)

2. Adjust Panel Clear Sensor Philip Screw where require to meet below requirement (Table 2)



Figure 23 Panel Clear Sensor Sensitivity Adjustment

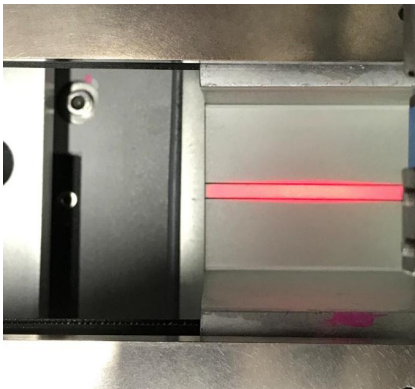
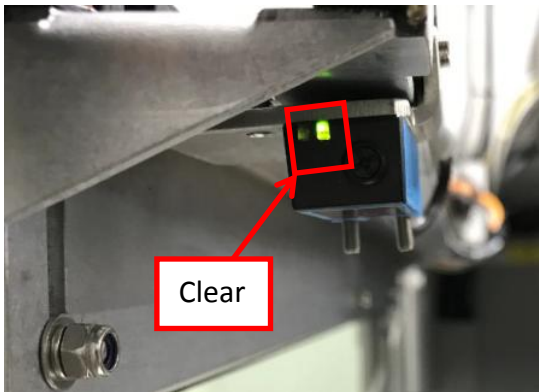
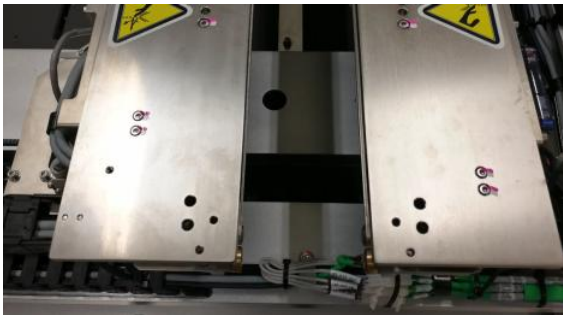
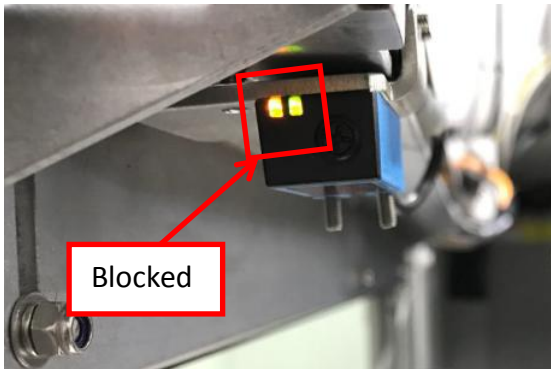
Position	Scenario	Panel Clear Sensor Status
Loading Position	Laser Spot reflect within Jig Square Region 	
Loading Position	Without Jig at rail 	

Table 2

	Work Instruction	Doc. Revision	00
	AXI V810 S2EX Panel Clear Sensor Position and Sensitivity Adjustment	Effective Date	7 July 2017

6. Remove jig from the rail
7. Close Front Access Door
8. Run 1 loop of C D & A