

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

This procedure is applicable to below models:

V810 STD	☒	S1	☒	S2
V810 XXL	☐	S1	☐	S2
V810 S2EX	☐			
V810 Mini	☐			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	1 May 2016	First Release	Tan Liang Kai

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

Content

PIP Sensor.....	3
Left PIP Sensor Removal.....	3
Left PIP Sensor Replacement.....	5
Right PIP Sensor Removal.....	11
Right PIP Sensor Replacement.....	14

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

PIP Sensor

Left PIP Sensor Removal

1. Close X-ray Source & Air Pressure Regulator
2. Open Front Access Door
3. Unlock & remove Defective PIP Sensor Cable Adapter from Left Amplifier as shown in Figure 1.



Figure 1 PIP Sensor Amplifier

4. Remove PIP Sensor Cable by refer to below route. May refer to Figure 2 & Figure 3.

Remark: Remove necessary cable tie & cable clamp

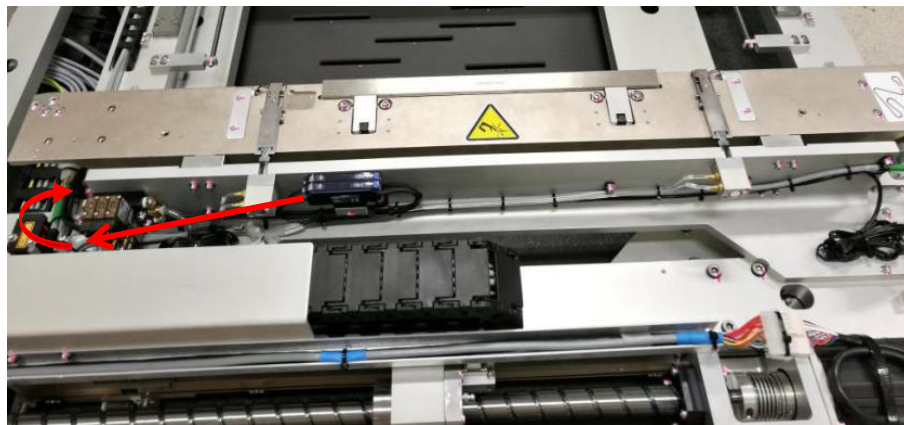


Figure 2 PIP Sensor Cable Removal

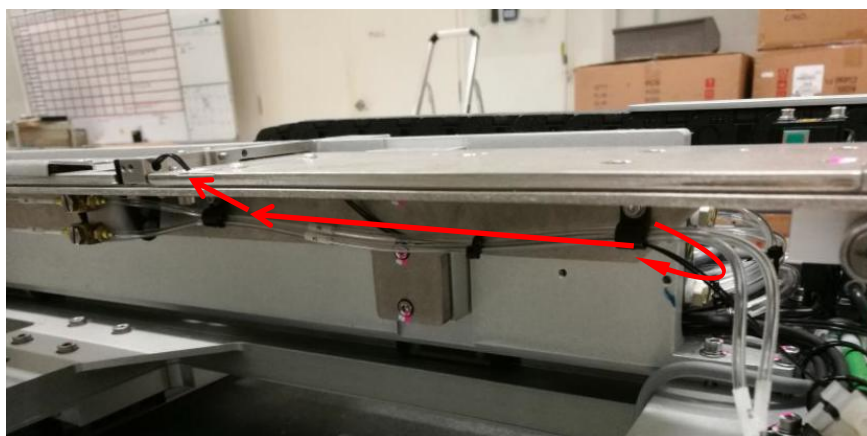


Figure 3 PIP Sensor Cable Removal

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

5. Remove 2 x screws (M3 x 6) & PIP Cover as shown in Figure 4.

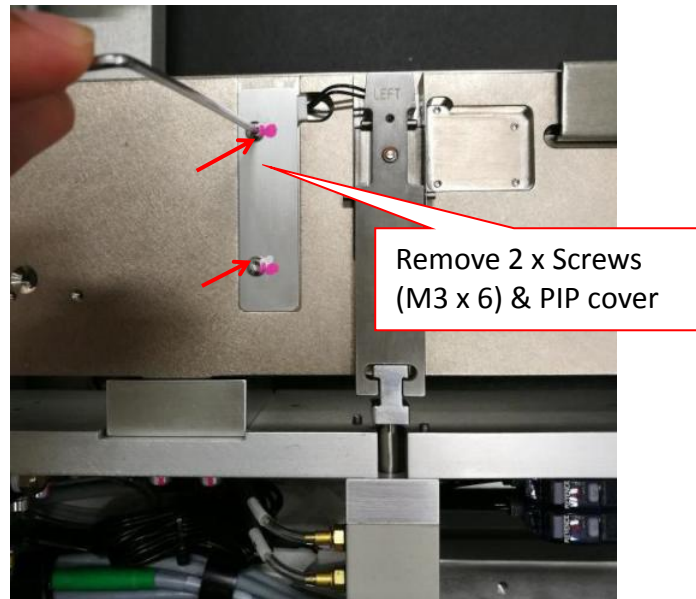


Figure 4 PIP Cover Removal

6. Remove PIP Sensor Cable Guide as shown in Figure 5.

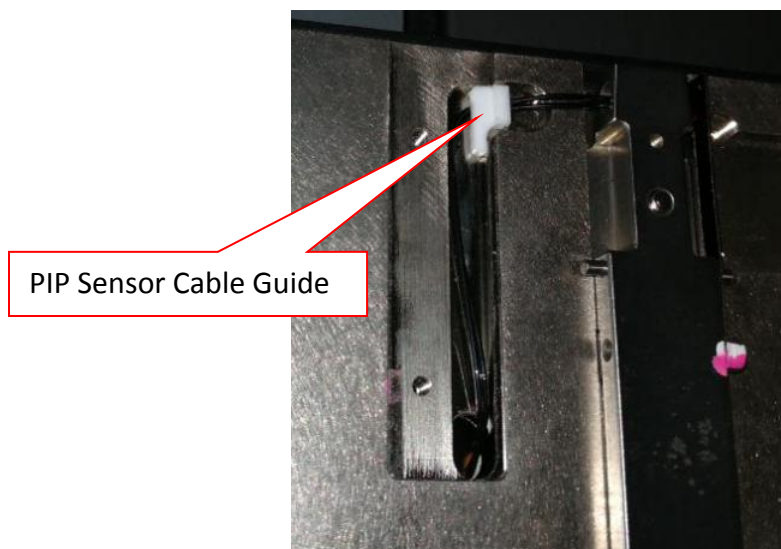


Figure 5 PIP Sensor Cable Guide Removal

7. Loosen 2 x Set screws as shown in Figure 6.

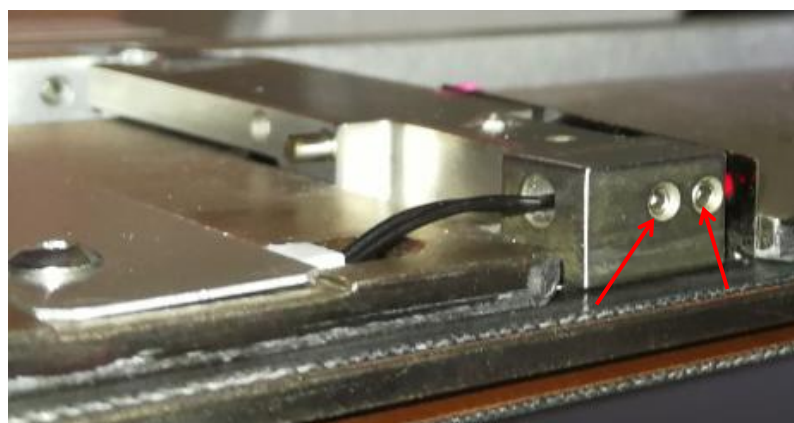


Figure 6 Set Screw Removal

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

8. Remove PIP Sensor Cable as shown in Figure 7.

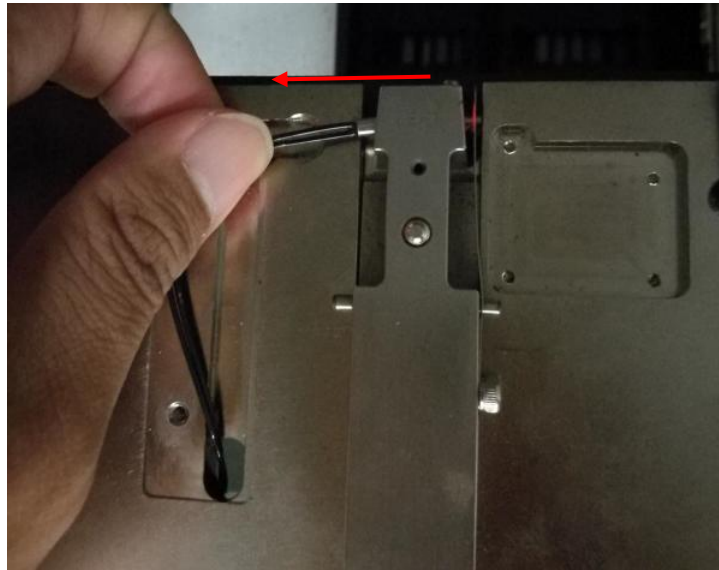


Figure 7 PIP Sensor Cable Removal

Left PIP Sensor Replacement

STD PIP fiber optic sensor Part ID: 2284-0051

1. Gentle route PIP Sensor Head into PIP Board Stop as shown in Figure 8.

Remark: Caution on Sensor Head Protrusion upon routing

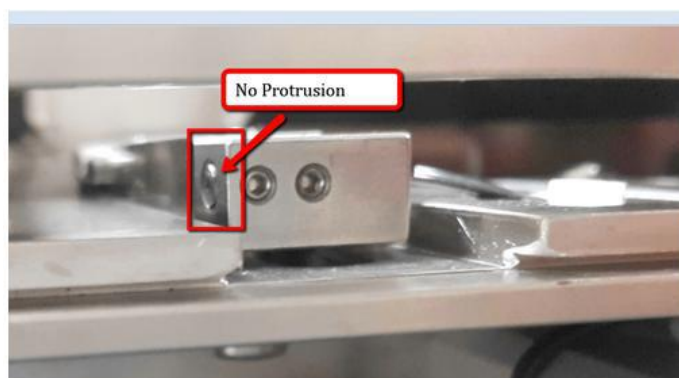
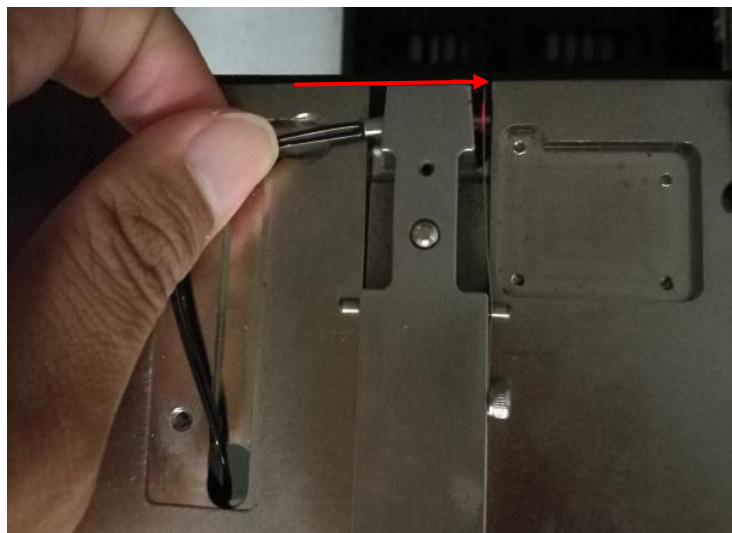


Figure 8 PIP Sensor Head Assembly

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

2. Tighten 2 x Set Screws as shown in Figure 9.

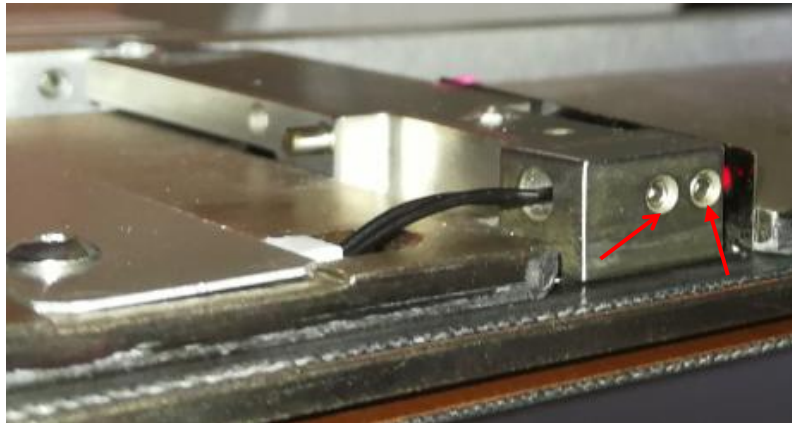


Figure 9 Set Screw Fastening

3. Assemble PIP Cable Guide as shown in Figure 12.

Remarks: Sufficient Cable Buffering would be require upon cable routing

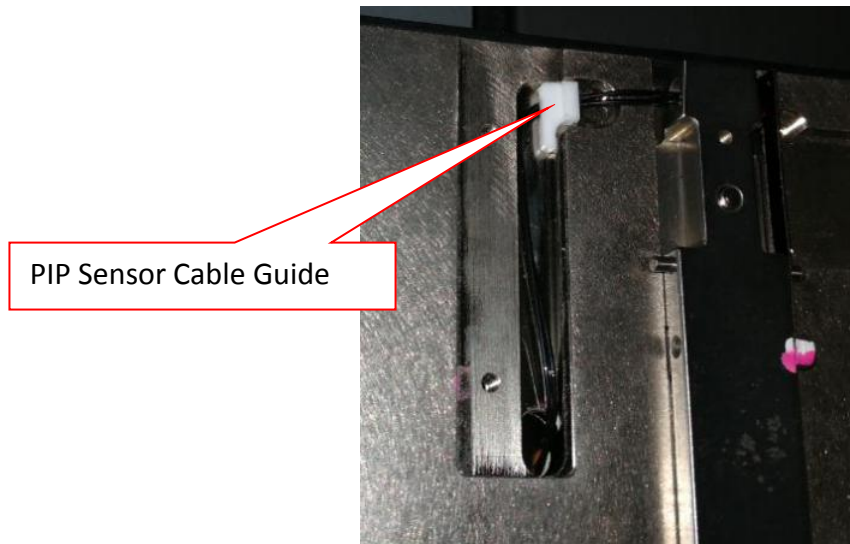


Figure 10 PIP Sensor Cable Routing

4. Assemble PIP Cover & tighten 2 x Screws (M3 x 8) as shown in Figure 11.

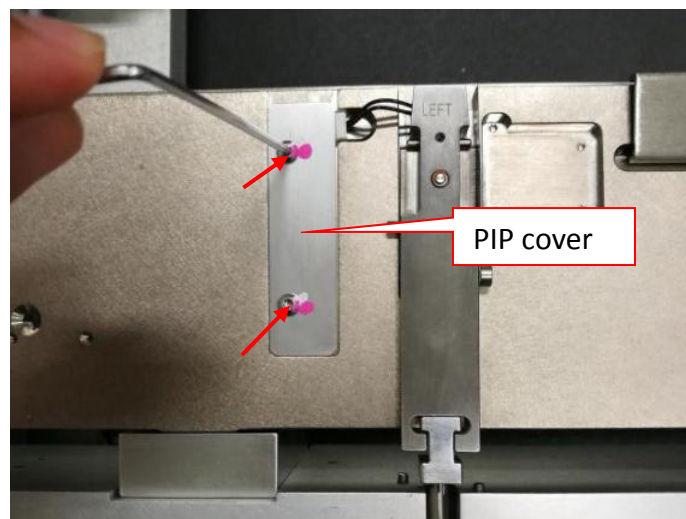


Figure 11 PIP Cover Assembly

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

5. Manually Extend & Retract PIP board stop for several times. Visual check PIP Cable Buffering (Red Box Highlight) where Cable Stressing & Friction should not persist upon PIP Board Stop movement.

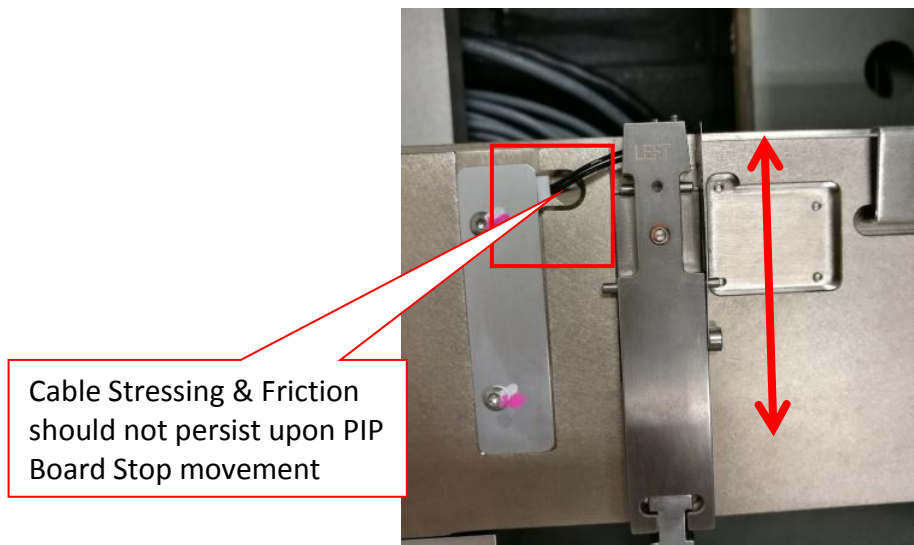


Figure 12 PIP Sensor Cable Checking

6. Route PIP Sensor Cable to Left Amplifier by refer to below routing. May refer to Figure 13 & Figure 14

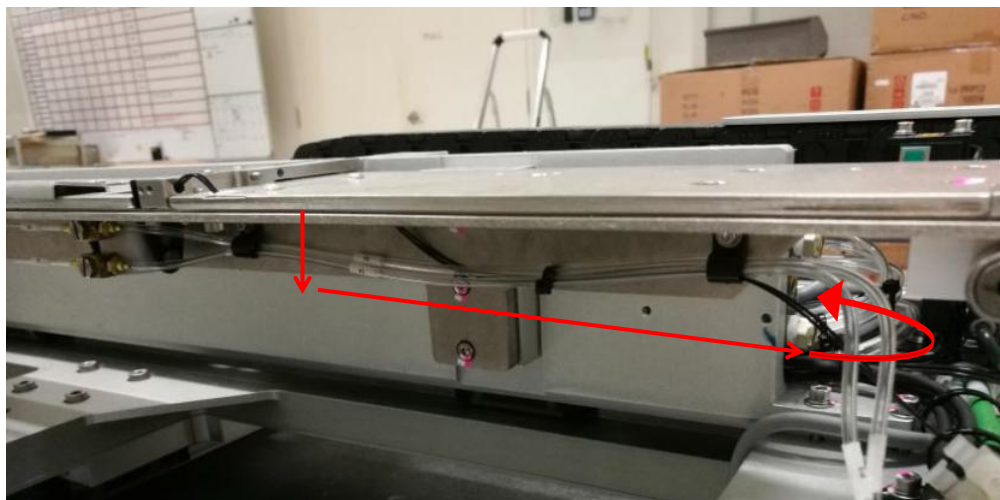


Figure 13 PIP Sensor Cable Cable Routing



Figure 14 PIP Sensor Cable Cable Routing

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

7. Remove excessive PIP Sensor Cable as shown in Figure 15.

Remarks : Cable Cutter pack within PIP Sensor Cable Spare

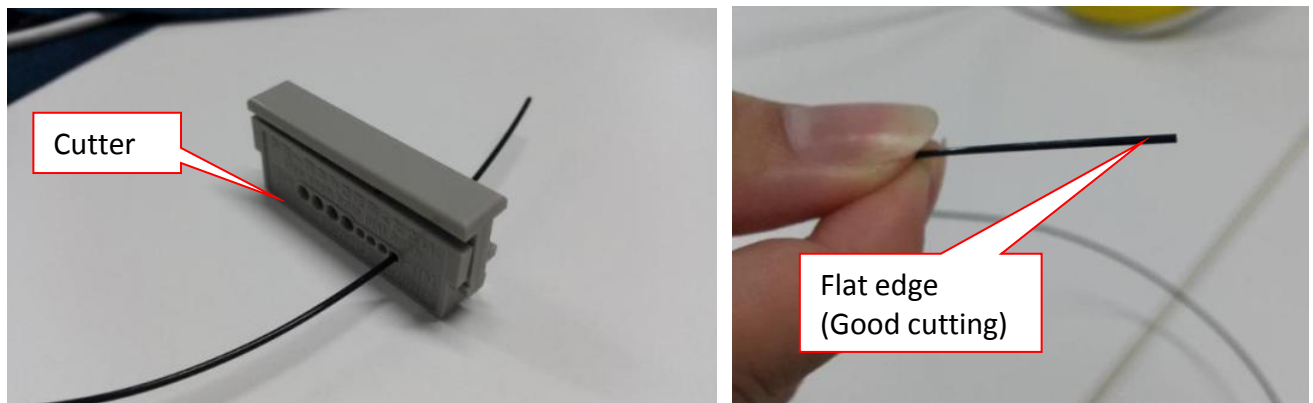


Figure 15 PIP Sensor Cable

8. Gently slot PIP Sensor End Cable into adapter as shown in Figure 16.

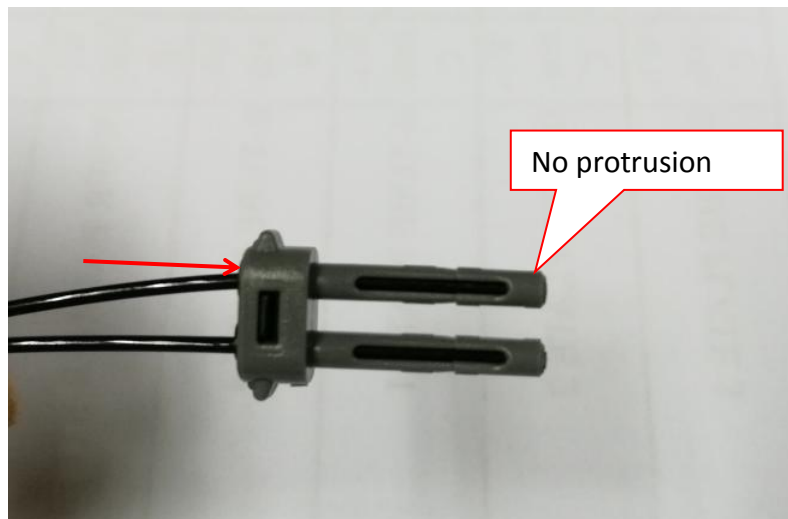


Figure 16 PIP Sensor End Cable Adapter

9. Plug adapter to Left Amplifier & lock as shown in Figure 17

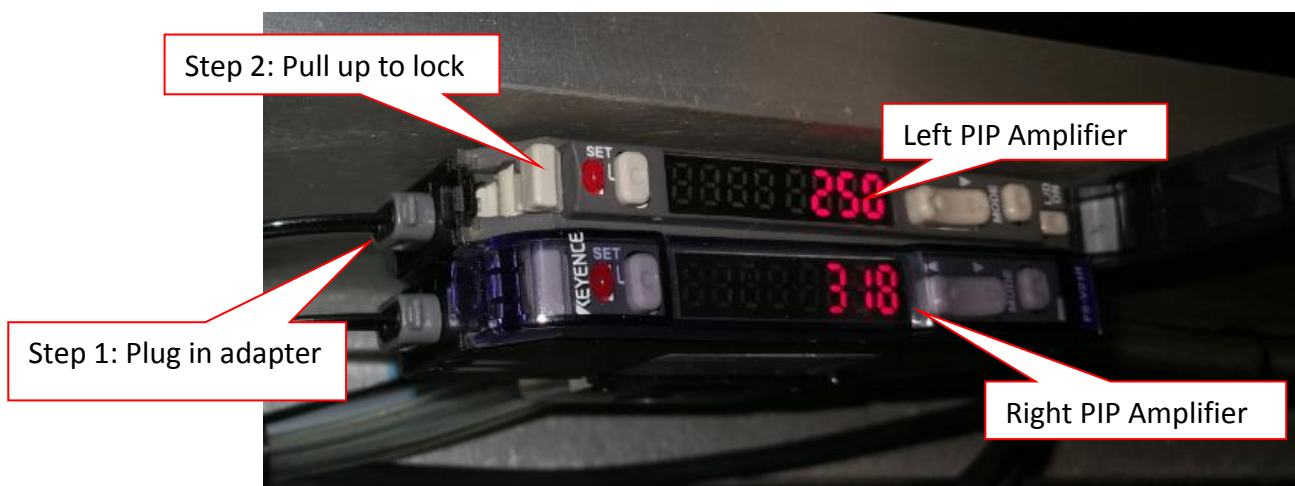


Figure 17 PIP Sensor Amplifier

ViTrox	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

10. Turn on Air Pressure Regulator & adjust it to 80 PSI.
11. Close front access door.
12. Obtain 1 x Dummy Board or Carrier for board clamping test.
13. Initialize Panel Handling
14. Set the parameters as shown in the Figure 18 and click Load Panel.

Panel width : Subjected to Dummy Board Or Carrier

Panel length : Subjected to Dummy Board Or Carrier

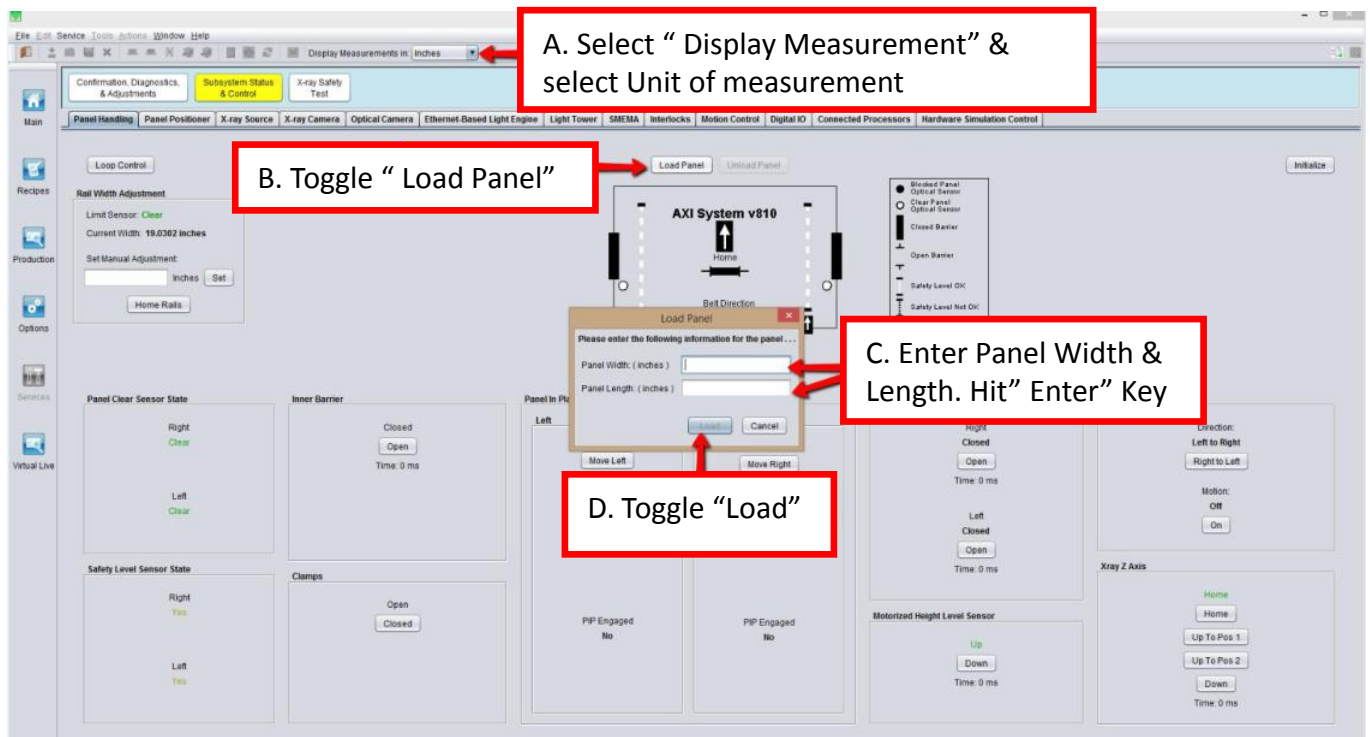


Figure 18 Panel Handling

15. Load the Dummy Board Or Carrier into machine after outer barrier open.
16. Check Left PIP Sensor Engage Sensor Status where YES should be illustrated at Panel Handling GUI

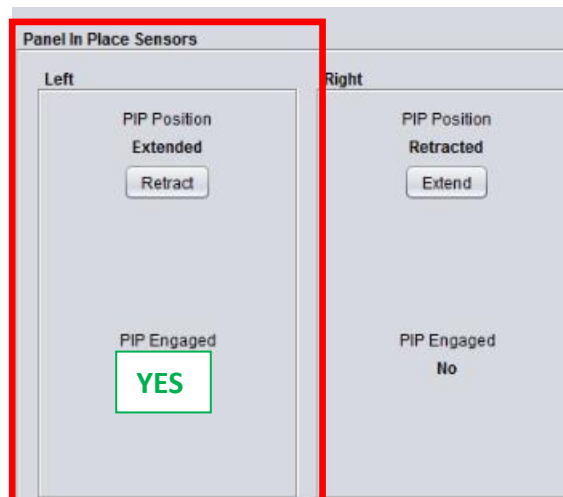


Figure 19 Left PIP Sensor Status

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

17. Unload the board at Panel Handling
18. Return to Panel Handling and click initialize
19. Check Left PIP Sensor Engage Sensor Status where “NO” should be illustrated at Panel Handling GUI

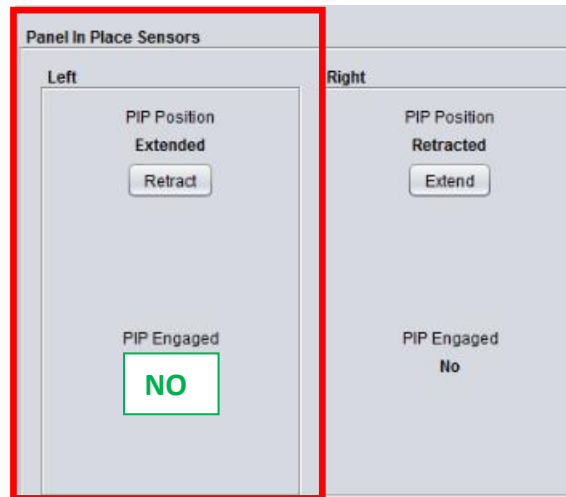


Figure 20 Left PIP Sensor Status

20. Run 1 loop of CD&A

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

Right PIP Sensor Removal

1. Close X-ray source & Air Pressure.
2. Open Front Access Door.
3. Unlock & remove Defective PIP Sensor Cable Adapter from Right Amplifier as shown in Figure 21



Figure 21 PIP amplifier

4. Remove PIP Sensor Cable by refer to below routing. May refer to Figure 22 & Figure 23
- Remark: Remove necessary cable tie & cable clamp

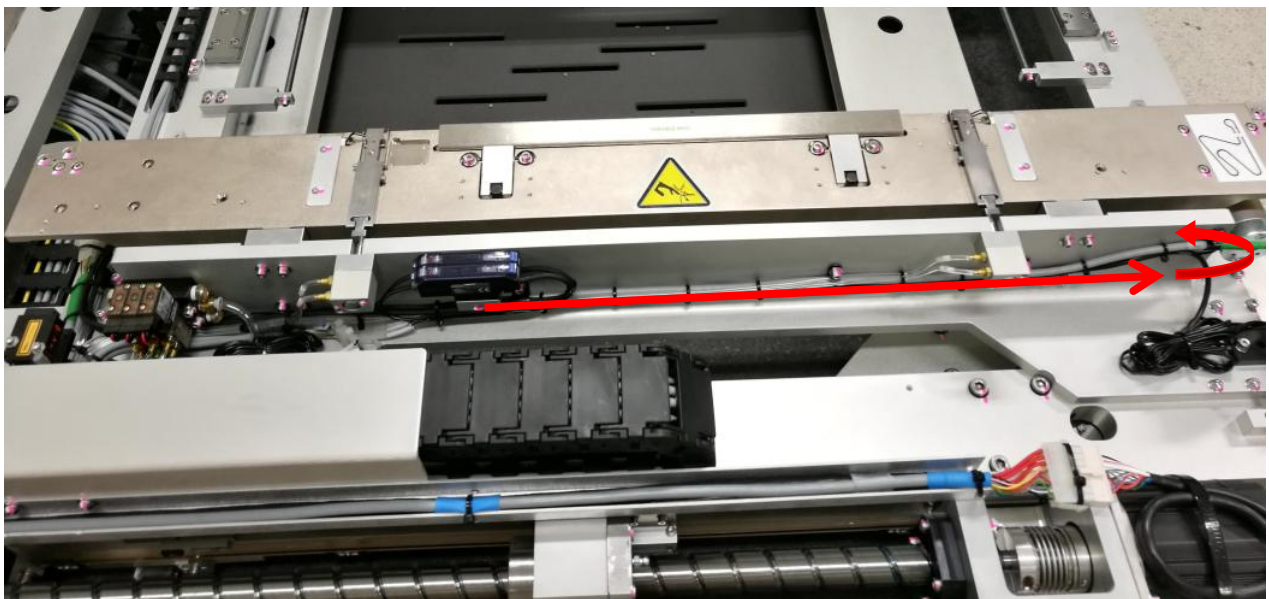


Figure 22 PIP Sensor Cable Removal

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

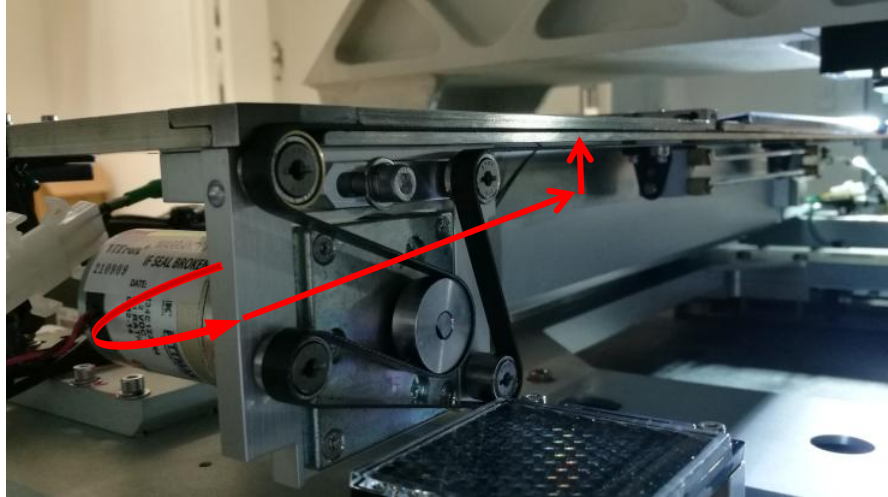


Figure 23 PIP Sensor Cable Removal

5. Remove 2 x screws (M3 x 6) & PIP Cover as shown in Figure 24



Figure 24 PIP Cover Removal

6. Remove PIP Cable Guide as shown in Figure 25

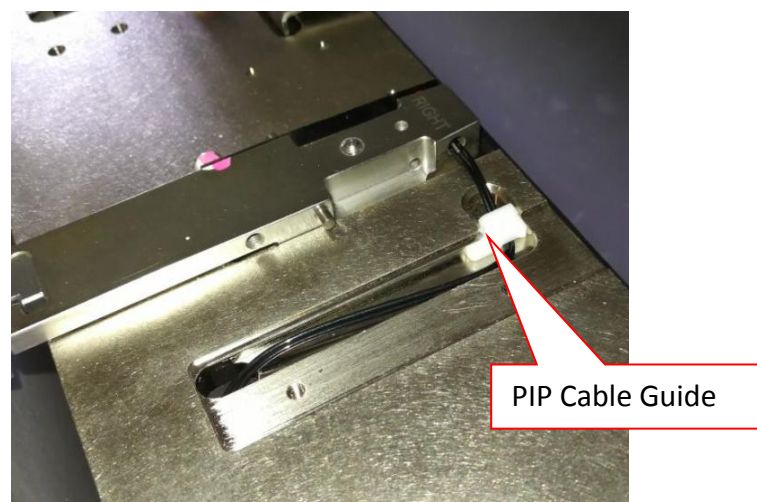


Figure 25 PIP Cable Guide removal

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

7. Loosen 2 x Set Screws as shown in Figure 26

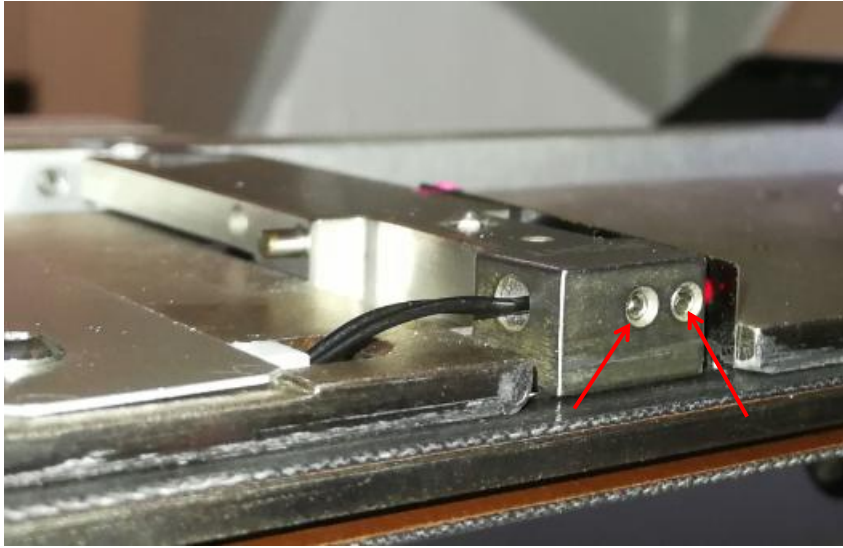


Figure 26 Set Screw Removal

8. Remove PIP Sensor Cable as shown in Figure 27

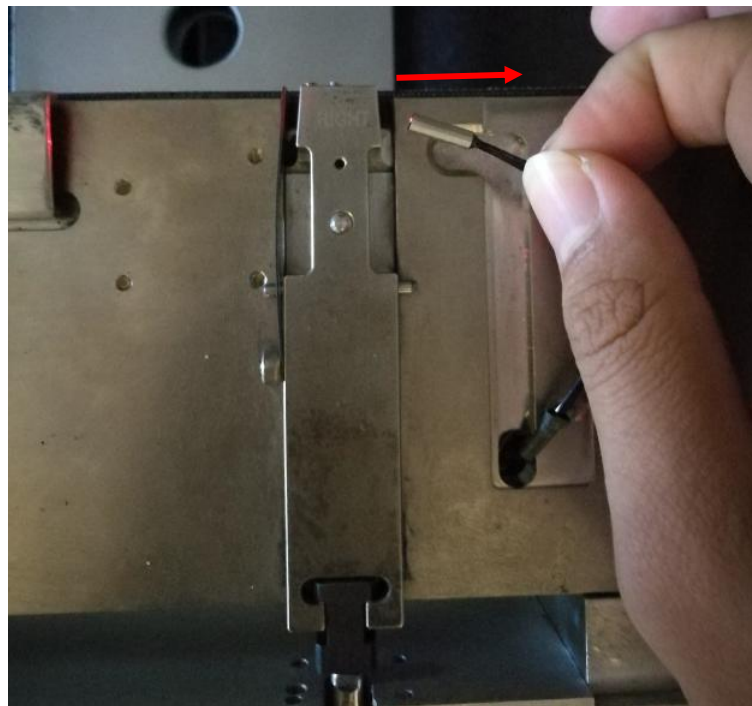


Figure 27 PIP Sensor Cable Removal

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

Right PIP Sensor Replacement

STD PIP fiber optic sensor Part ID: 2284-0051

1. Gentle route PIP Sensor Head into PIP Board Stop as shown in Figure 28

Remark: Caution on Sensor Head Protrusion upon routing

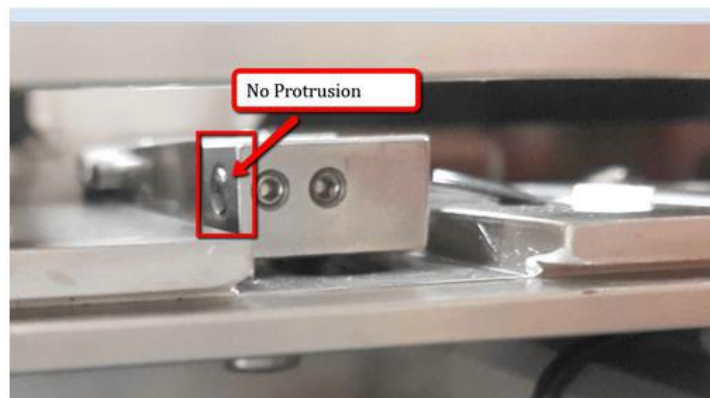
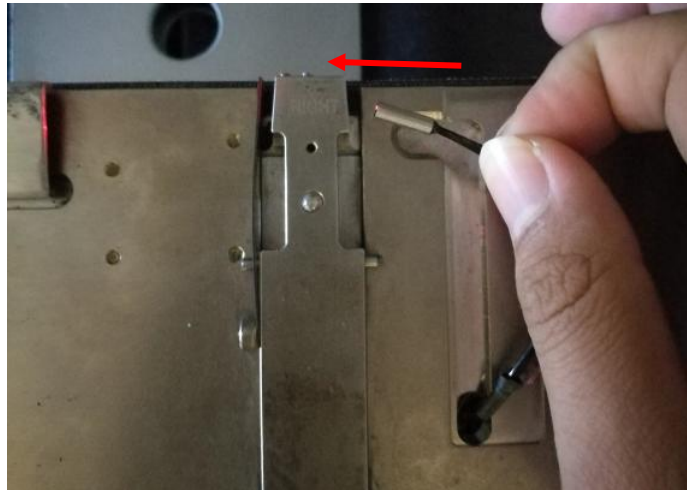


Figure 28 PIP Sensor Head Assembly

2. Tighten 2 x Set Screws as shown in Figure 29

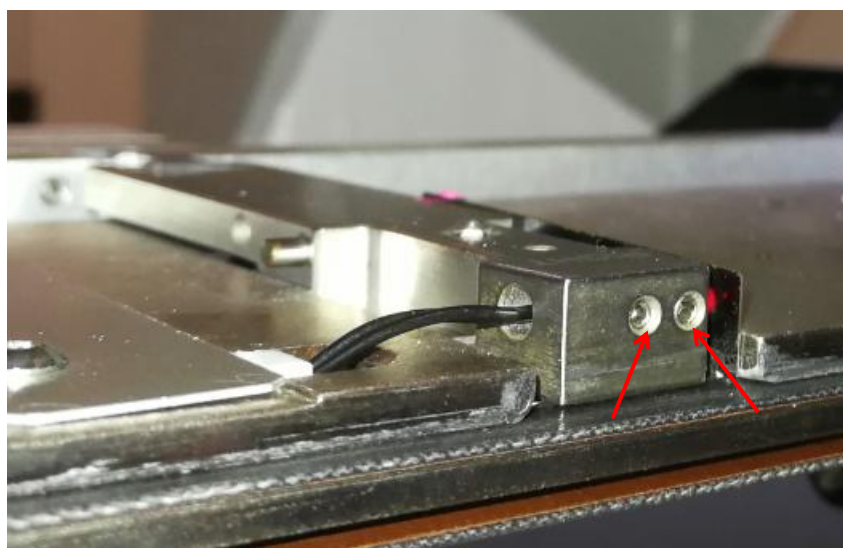


Figure 29 Set Screw Fastening

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

3. Assemble PIP Guide as shown in Figure 30

Remarks: Sufficient Cable Buffering would be require upon cable routing

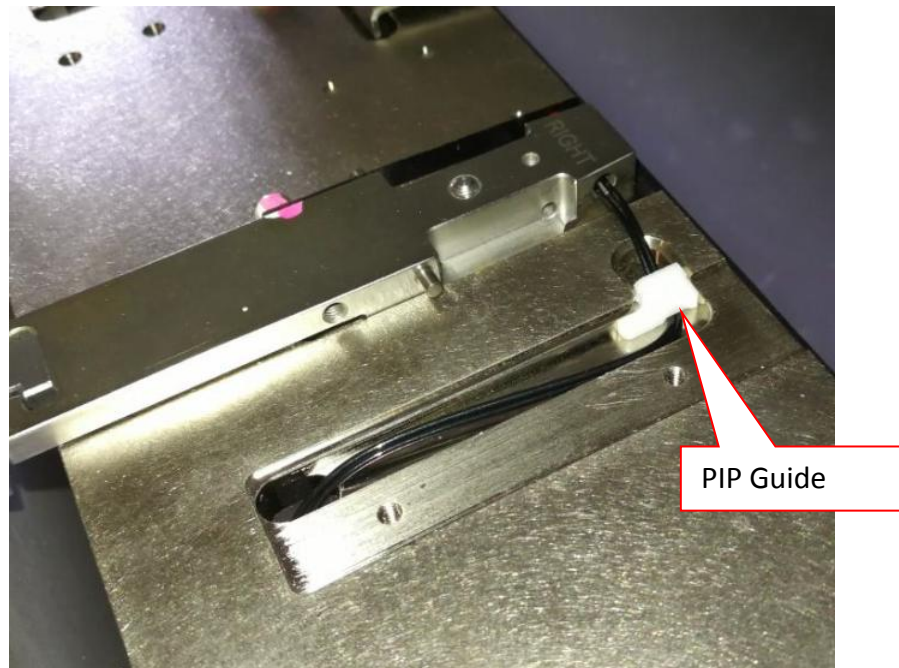


Figure 30 PIP sensor wire guide assembly

4. Assemble PIP Cover & tighten 2 x Screws (M3 x 8) as shown in Figure 31

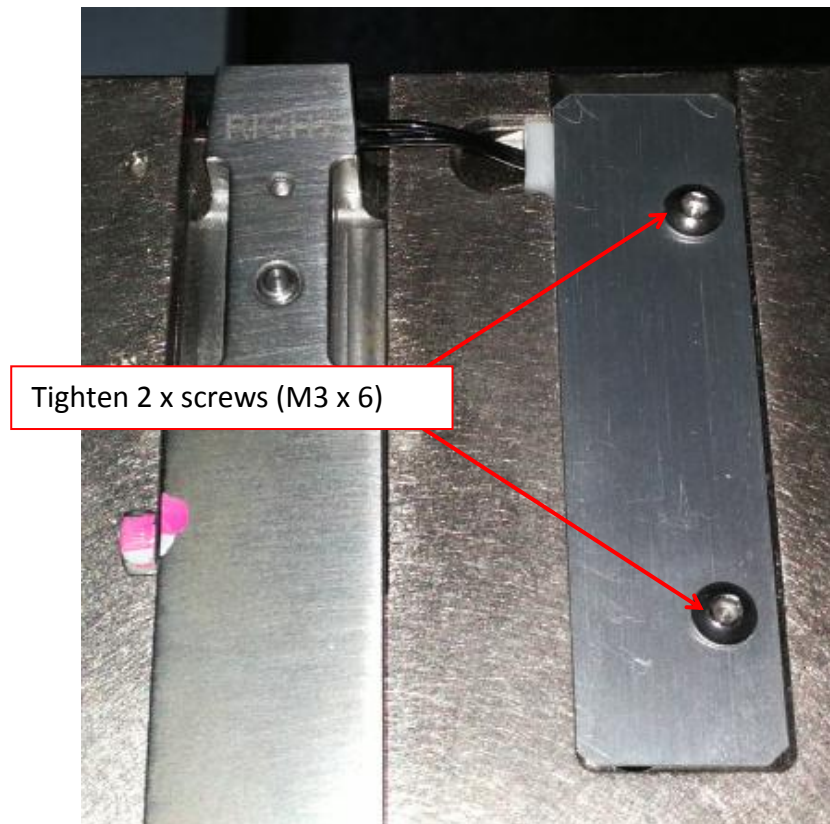


Figure 31 PIP Cover Assembly

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

5. Manually Extend & Retract PIP board stop for several times. Visual check PIP Cable Buffering (Red Box Highlight) where Cable Stressing & Friction should not persist upon PIP Board Stop movement.

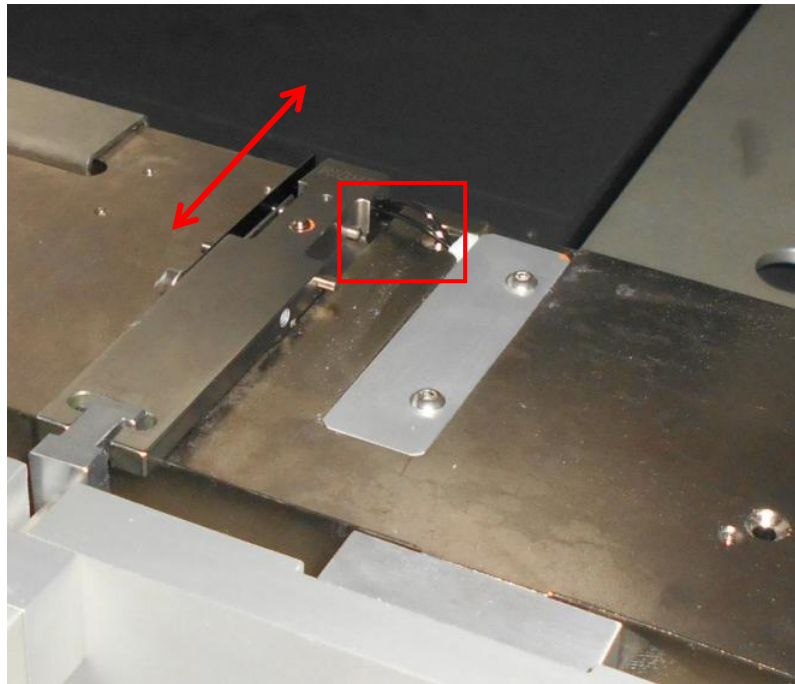


Figure 32 PIP Sensor Cable Checking

6. Route PIP Sensor Cable to Right amplifier by refer to below routing. May refer to Figure 33 & Figure 34

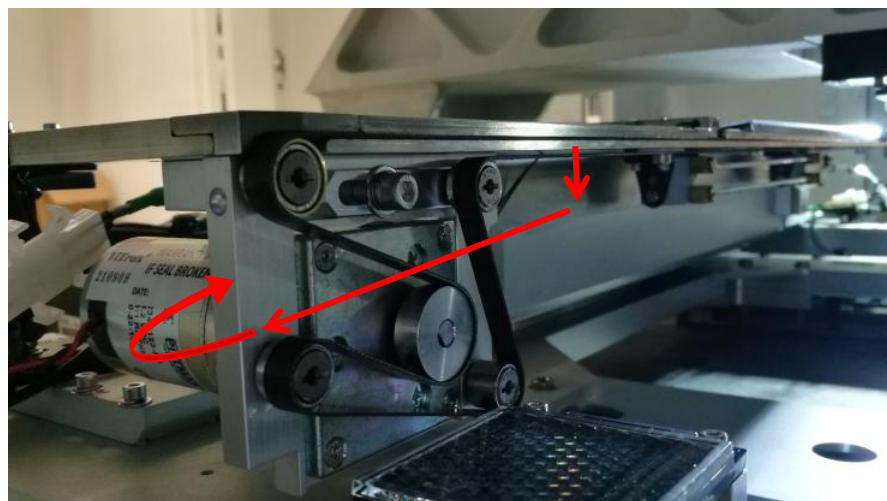


Figure 33 PIP Sensor Cable Routing

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

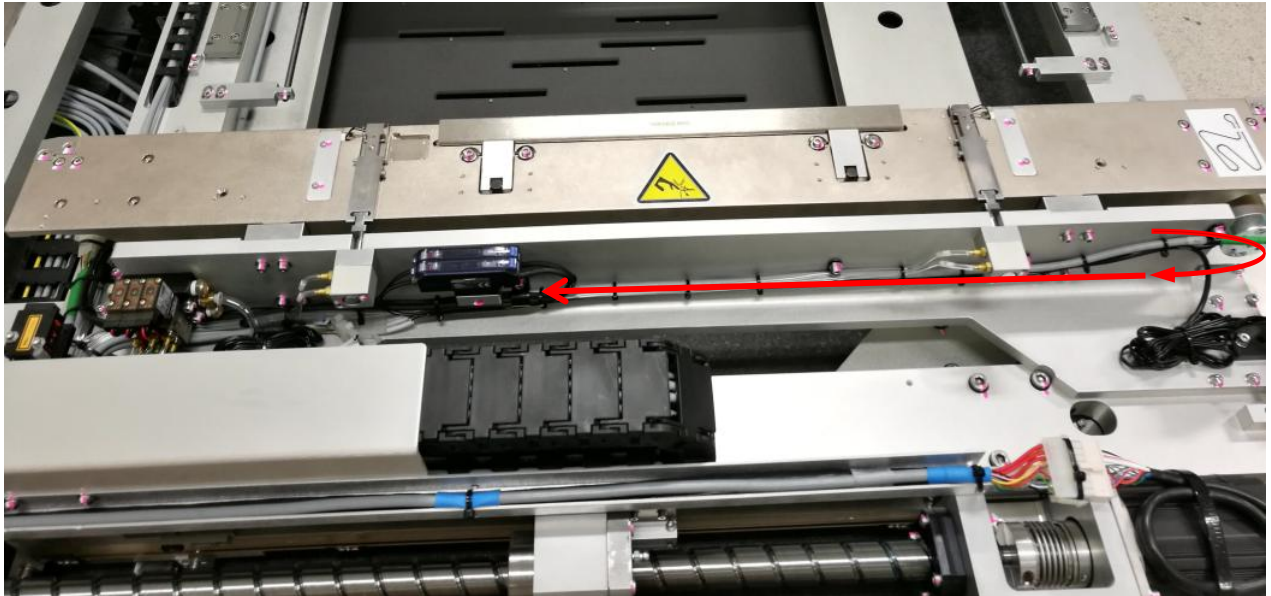


Figure 34 PIP Sensor Cable Routing

8. Remove excessive PIP Sensor Cable as shown in Figure 35

Remarks : Cable Cutter pack within PIP Sensor Cable Spare

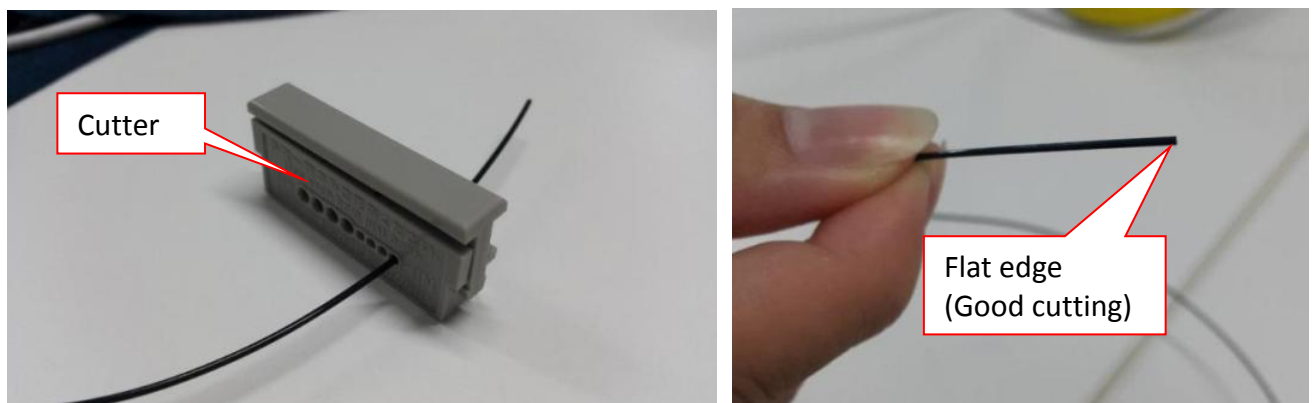


Figure 35 PIP Sensor Cable

9. Gently slot PIP Sensor End Cable into adapter as shown in Figure 36

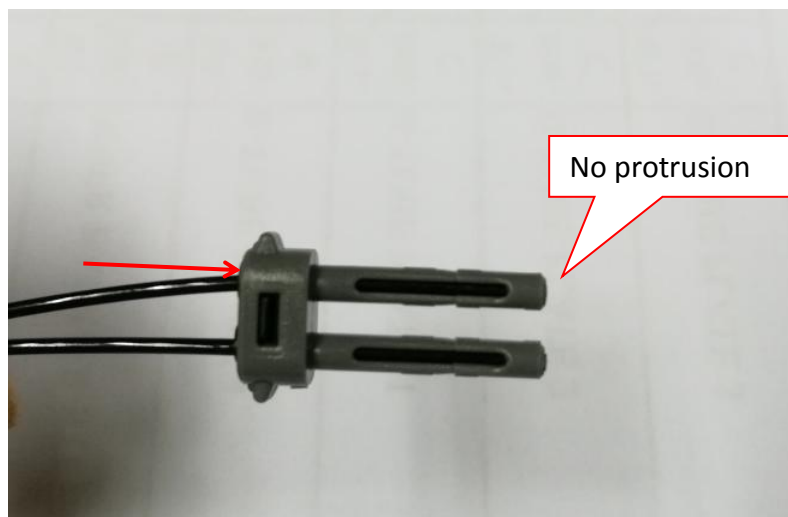


Figure 36 PIP Sensor Cable

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

10. Plug adapter to Right Amplifier & lock as shown in Figure 37



Figure 37 PIP Sensor Amplifier

11. Turn on Air Pressure Regulator & adjust it to 80 PSI.
12. Close front access door.
13. Obtain 1 x Dummy Board or Carrier for board clamping test.
14. Initialize Panel Handling
15. Set the parameters as shown in the Figure 38 and click Load Panel.

Panel width : Subjected to Dummy Board Or Carrier

Panel length : Subjected to Dummy Board Or Carrier

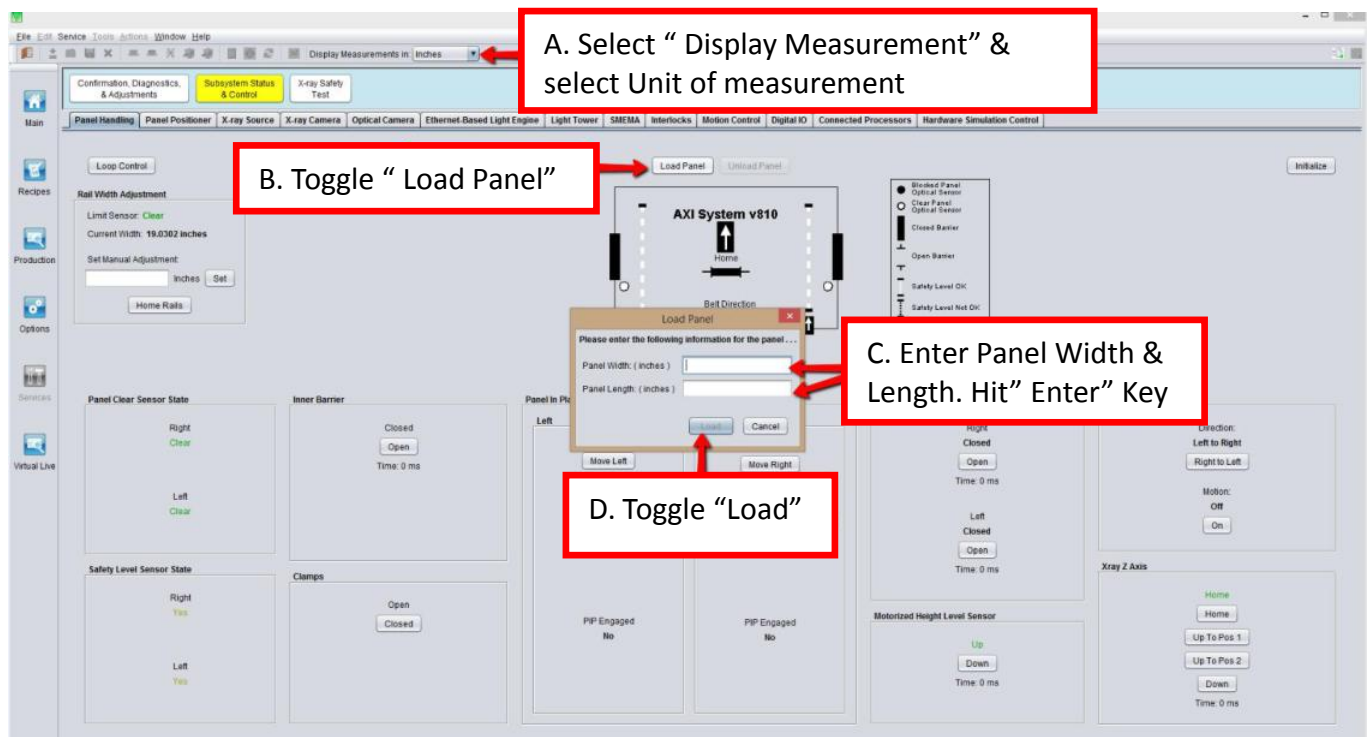


Figure 38 Panel Handling

	Work Instruction	Doc. Revision	00
	AXI V810 STD PIP Sensor Removal & Replacement Procedure	Effective Date	1 May 2016

16. Load the Dummy Board Or Carrier into machine after outer barrier open.
17. Check Right PIP Sensor Engage Sensor Status where YES should be illustrated at Panel Handling GUI



Figure 39 Right PIP Sensor Status

18. Unload the board.
19. Return to Panel Handling and click initialize
20. Check Right PIP Sensor Engage Sensor Status where “NO” should be illustrated at Panel Handling GUI

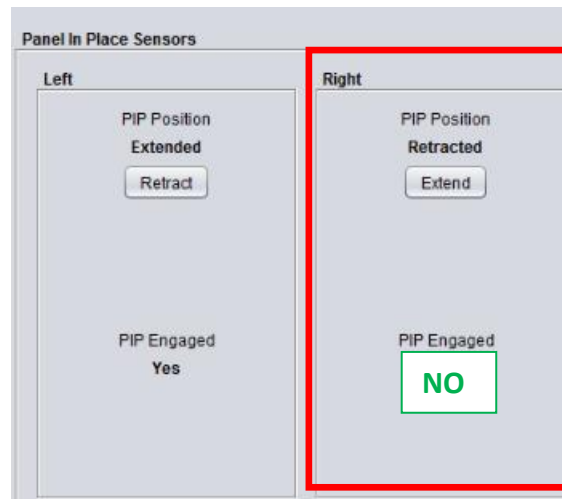


Figure 40 Right PIP Sensor Status

21. Run 1 loop of CD&A