

	Work Instruction	Doc. Revision	02
	AXI V810 X-Axis Home Sensor Adjustment Procedure	Effective Date	20 Oct 2016

This procedure is applicable to below models:

V810 STD	☒	S1	☒	S2
V810 XXL	☒	S1	☒	S2
V810 S2EX	☒			
V810 Mini	☐			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	19 Aug 2013	First Release	ONG KEAN SHENG
01	04 Jun 2015	Second Release	MUHAMMED SHAMEEM
02	20 Oct 2016	Template Changes & Content Update	ONG KEAN SHENG

	Work Instruction				Doc. Revision	02
	AXI	V810	X-Axis	Home	Sensor	Adjustment
	Procedure				Effective Date	20 Oct 2016

1. Go to the **Services-> Subsystem Status & Control-> Panel Positioner** tab as shown in Figure 1.
Change the **Display Measurement** to **millimetres** and click initialize as shown in Figure 1. After the initialization complete, disable the motion for the X-axis and Y-axis as shown in Figure 1.

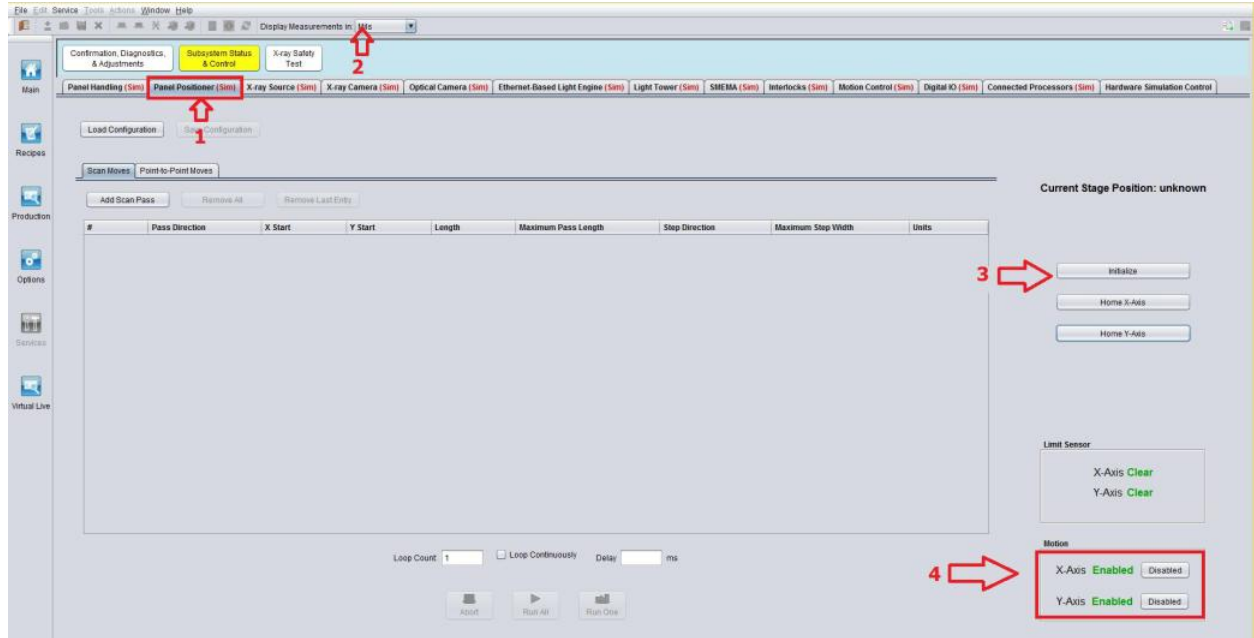


Figure 1 Panel Positioner

2. Close the X-ray source and open the front access door.
3. Push the X Axis stage towards Left outer barrier direction until it reach to X axis Minimum Hard stop.

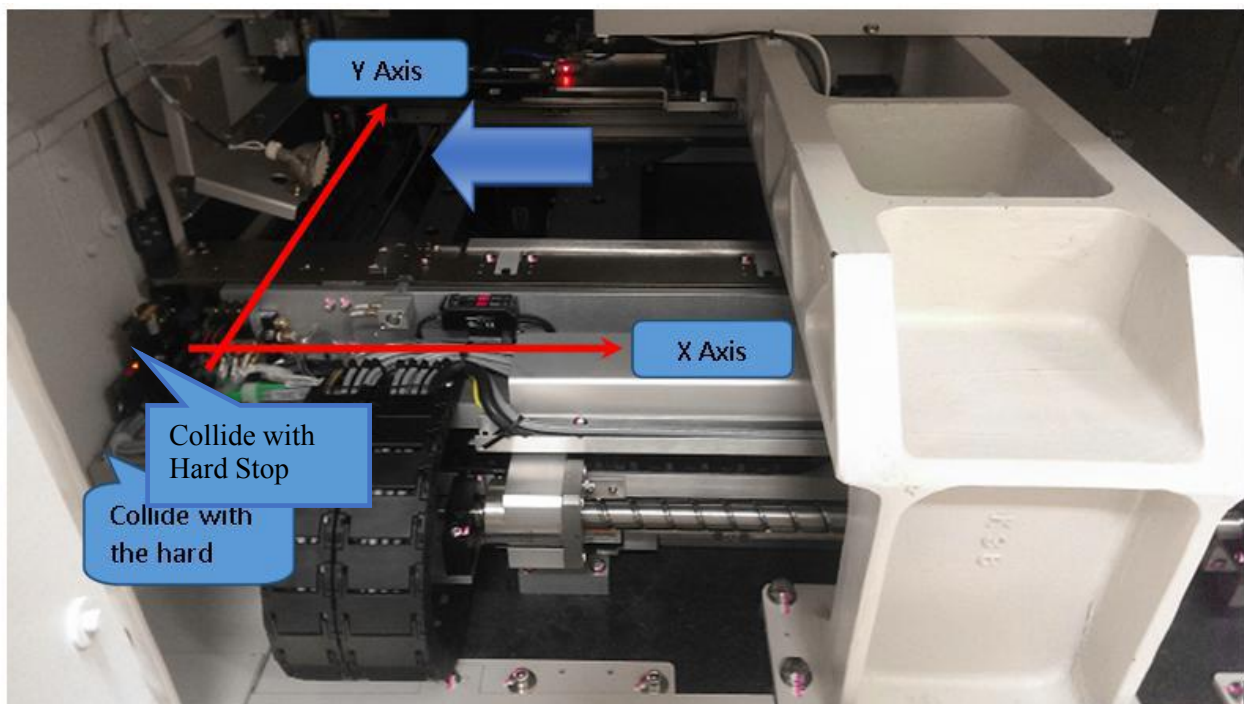


Figure 2 X axis Minimum Hard Stop (V810 Std)

	Work Instruction					Doc. Revision	02	
	AXI	V810	X-Axis	Home	Sensor	Adjustment	Effective Date	20 Oct 2016
Procedure								

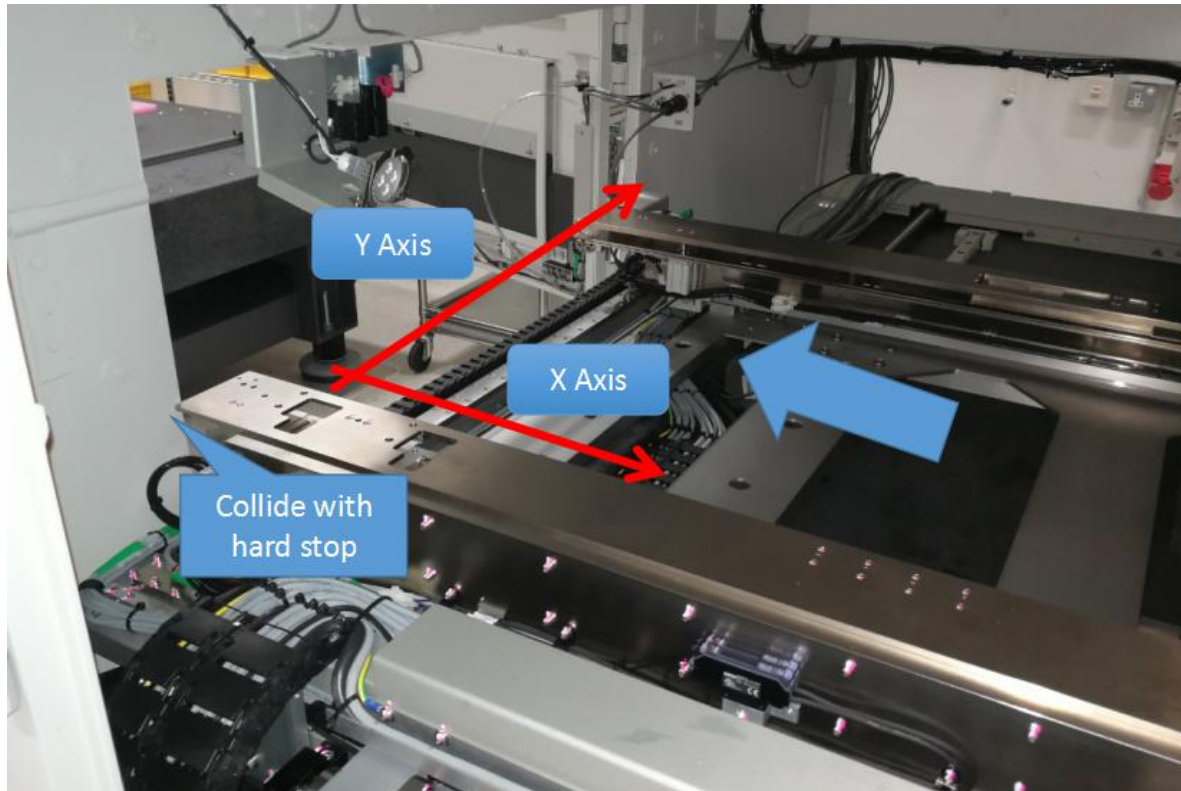


Figure 3 X axis Minimum Hard Stop (V810 XXL)

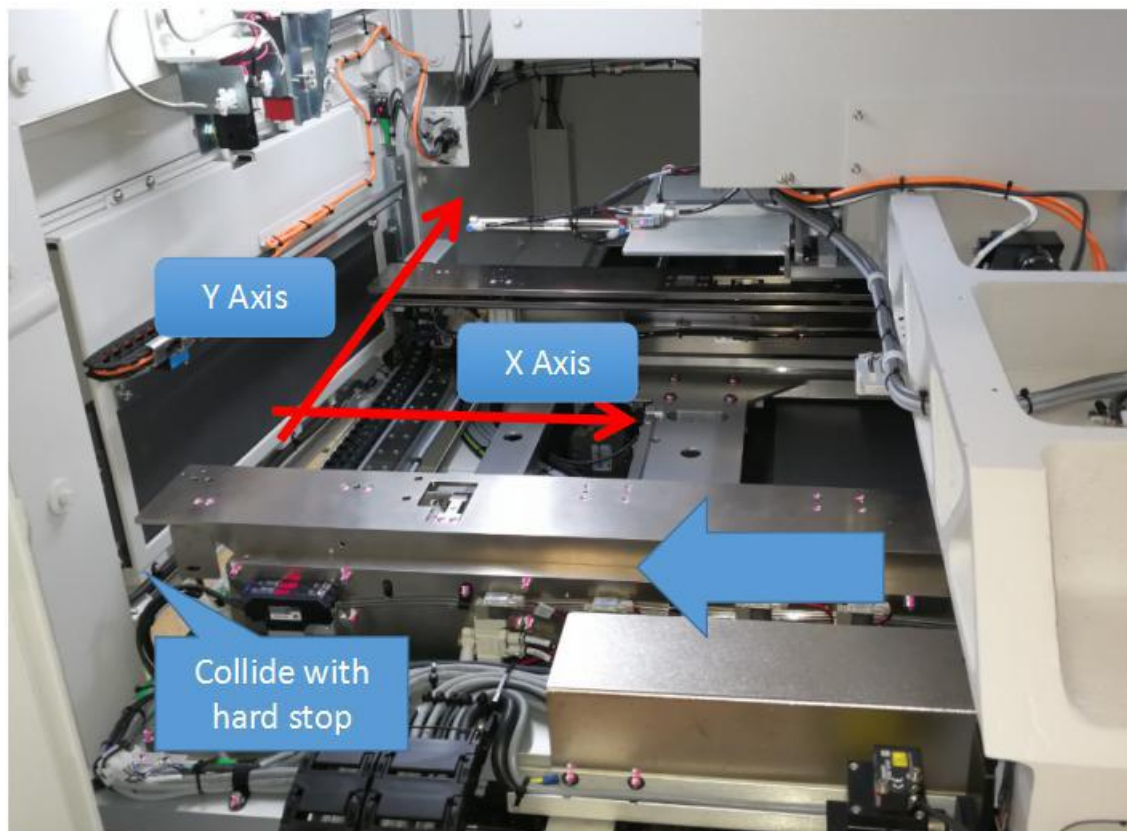


Figure 4 X axis Minimum Hard Stop (V810 S2EX)

	Work Instruction				Doc. Revision	02
	AXI	V810	X-Axis	Home Sensor Adjustment Procedure	Effective Date	20 Oct 2016

4. Record down the value for the X-axis in the current stage position as shown in the Figure 5.



Figure 5 X-axis minimum hard stop position

5. The value for the X-axis should be between -3.00mm to -3.30 mm.
- If the value is not within desire range, please proceed with Step 6.
 - If the value is within desire range, please proceed with Step 12.
6. Loosen the M3 screw as shown below in the Figure 6.

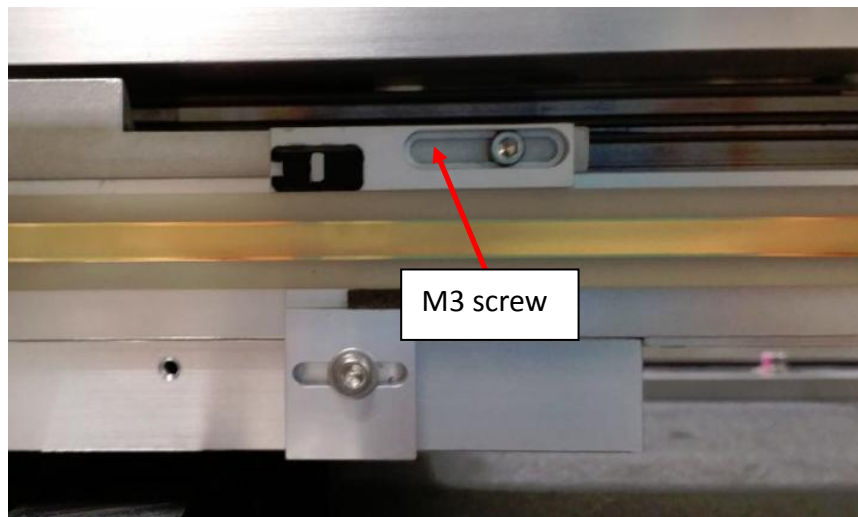


Figure 6 Home Sensor M3 Screw

7. Adjust the X-axis as below table.

Current stage position after initialize the Panel Positioner	Direction of the home sensor need to be adjusted
Less than -3.00mm	Towards the left outer barrier side
More than -3.30mm	Towards the right outer barrier side

	Work Instruction					Doc. Revision	02
	AXI	V810	X-Axis	Home	Sensor	Adjustment Procedure	Effective Date

8. Once the home sensor is adjusted, tighten the M3 screw as shown in Figure 6.
9. Push the X axis & Y axis stage to the middle of the machine.
10. Close the front access door.
11. Repeat Step 1 ~ 11 until X axis Home sensor is within -3.00mm~-3.33mm.
12. In the Panel Positioner tab, change the **Display Measurement** to **Nanometer** and Initialize.
13. After initialization complete, disable the motion for the X-axis and Y-axis.
14. Open the front access door and push the X axis towards right outer barrier direction until it reach to X Axis Maximum Hard Stop.



Figure 7 X axis Maximum Hard Stop (V810 Std)

	Work Instruction					Doc. Revision	02
	AXI	V810	X-Axis	Home	Sensor	Adjustment Procedure	Effective Date

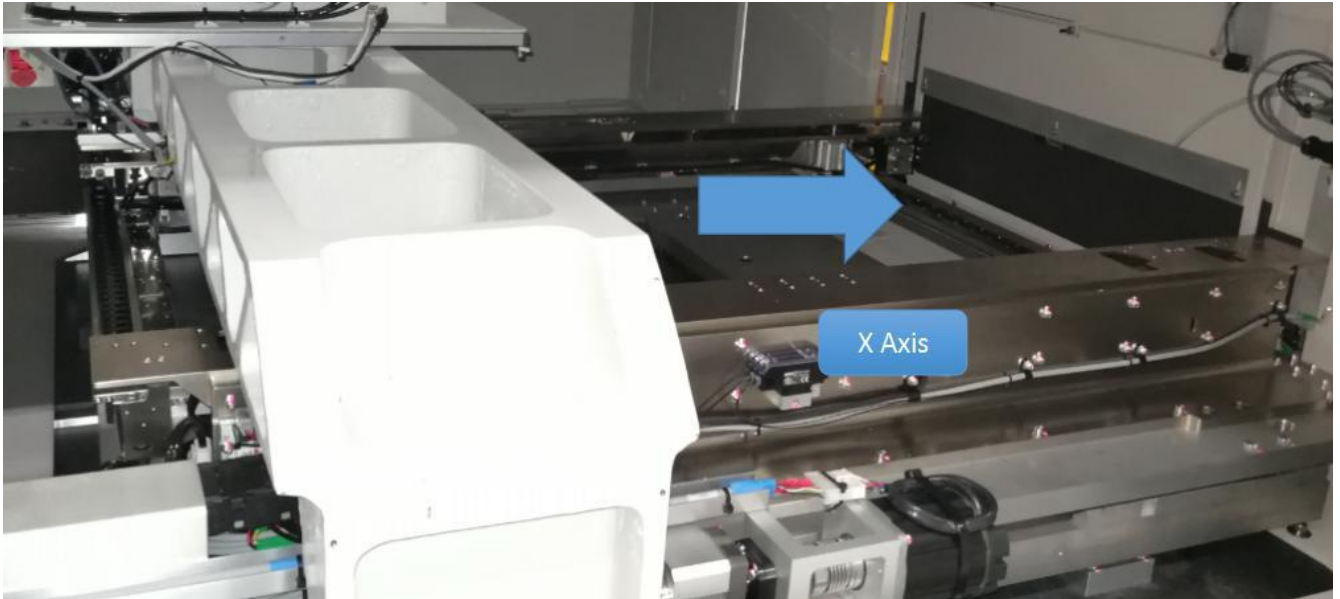


Figure 8 X axis Maximum Hard Stop (V810 XXL)



Figure 9 X axis Maximum Hard Stop (V810 S2EX)

	Work Instruction	Doc. Revision	02
	AXI V810 X-Axis Home Sensor Adjustment Procedure	Effective Date	20 Oct 2016

15. Verify Y axis Actual max travel stroke (Panel Positioner `s Current position) where MUST more than Command Distance by refer to below Machine Model.

Machine Model	Command Distance (NM)	X axis Actual Max Travel Stroke (NM)
V810 S2	501650000	Required to be more than Command Distance Value
V810 XXL S2	859941200	Required to be more than Command Distance Value
V810 S2EX	532650000	Required to be more than Command Distance Value