

	Work Instruction	Doc. Revision	01
	AXI V810 XY Axis Motion Scope Capture Procedure	Effective Date	2 Oct 2016

This procedure is applicable to below models:

V810 STD	☒	S1	☒	S2
V810 XXL	☒	S1	☒	S2
V810 S2EX	☒			
V810 Mini	☐			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	10 Apr 2015	First Release	Chin Chee Yan
01	2 Oct 2016	Template Changes & Content Update	ONG KEAN SHENG

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 XY Axis Motion Scope Capture Procedure	Effective Date	2 Oct 2016

IMPOTANT, ENSURE NO BOARD INSIDE MACHINE

1. Go to Services → Subsystem status and Control → Digital IO → Click “X ray cameras synthetic Trigger On Bar”.

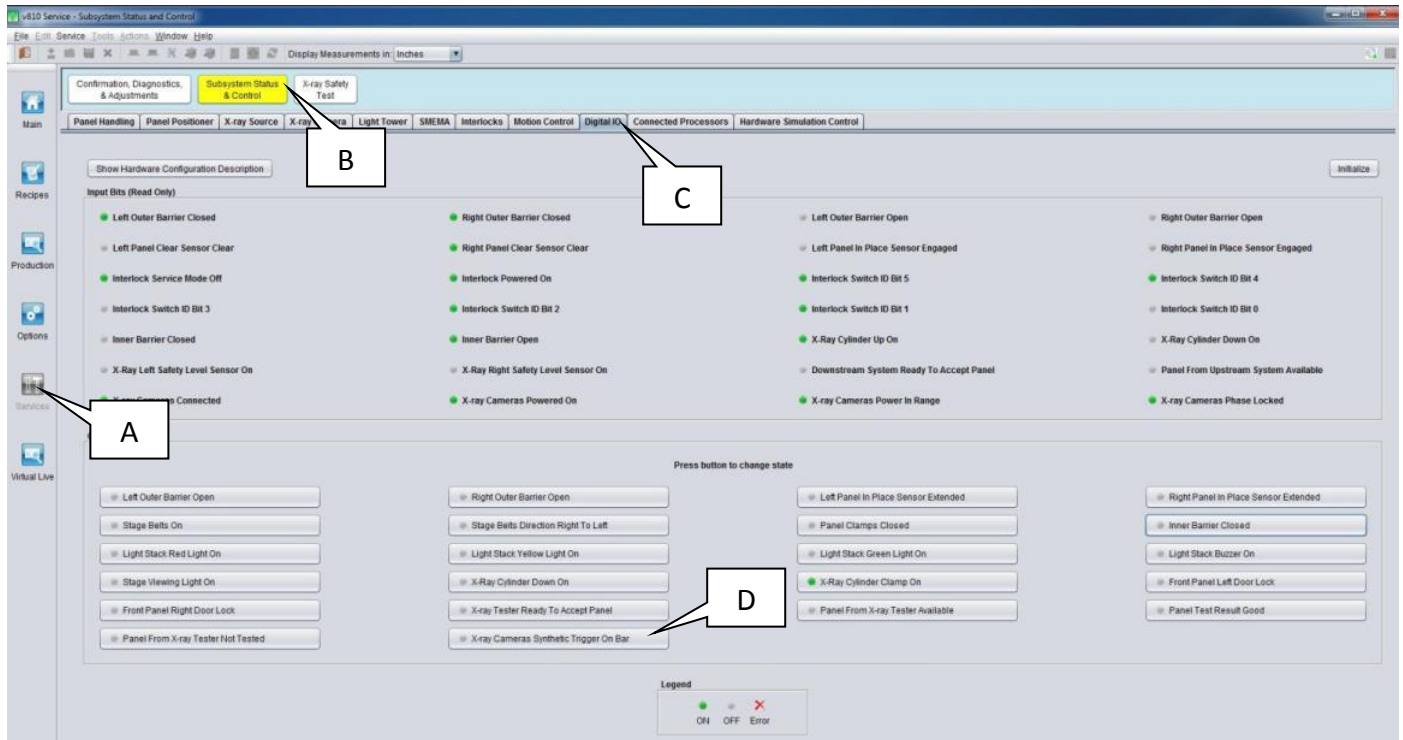


Figure 1 Digital IO

	Work Instruction	Doc. Revision	01
	AXI V810 XY Axis Motion Scope Capture Procedure	Effective Date	2 Oct 2016

2. Go to Services → Subsystem status and Control → Panel Positional → Initialize → Scan Moves → Load Configuration” → load profile → OK → key in “10” in “Loop Count” → “Run all”

For Std machine, load V810 LongScans.scan

For XXL machine, load V810XXLLongScans.scan

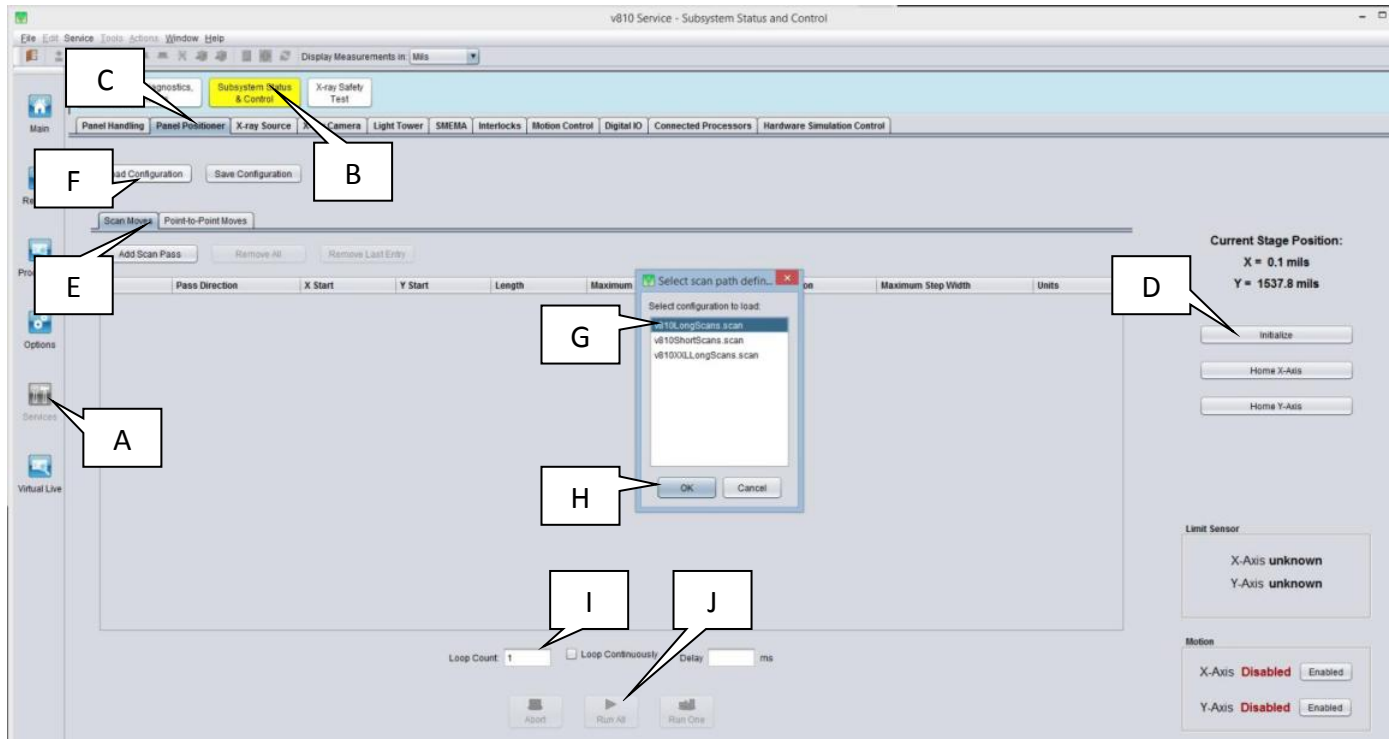


Figure 2 Panel Positioner

3. Remote desktop to Remote Motion Server (Atom PC) with IP below;



Type	IP Address	Password
V810 Series 1	10.1.1.55	Please!
V810 Series 2	192.168.128.70	Please!

Figure 3 Remote Desktop Connection

	Work Instruction	Doc. Revision	01
	AXI V810 XY Axis Motion Scope Capture Procedure	Effective Date	2 Oct 2016

4. Go to this path “C:\Program Files\AXI System\v810\5.0\bin” and double click “MS_XMP_NT”

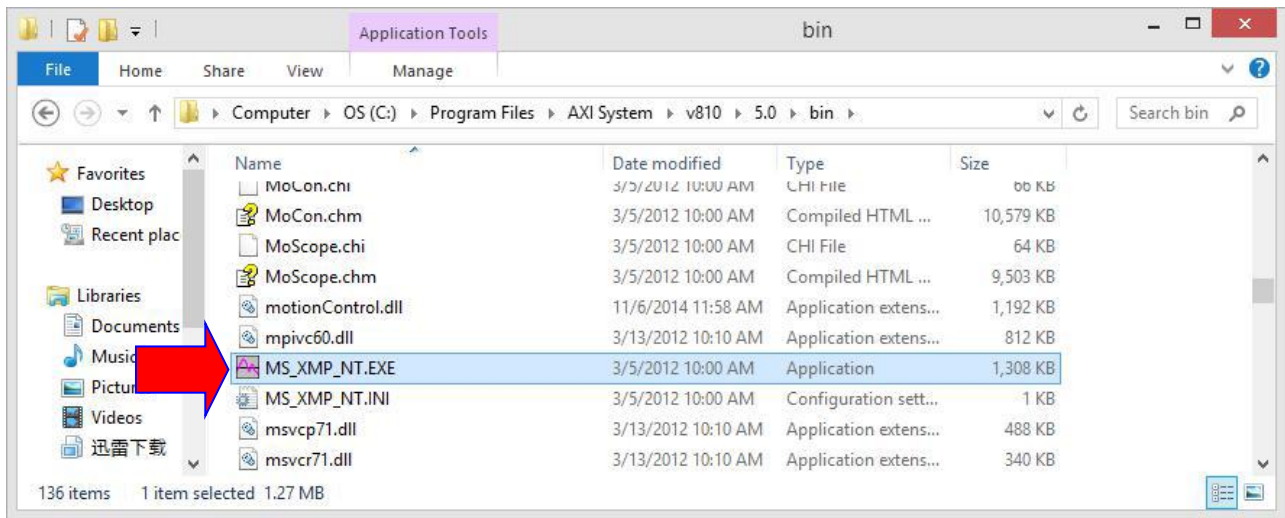


Figure 4 Motion Scope Icon

5. Click on new (White sheet) → Pane Mode (Default setting) → OK

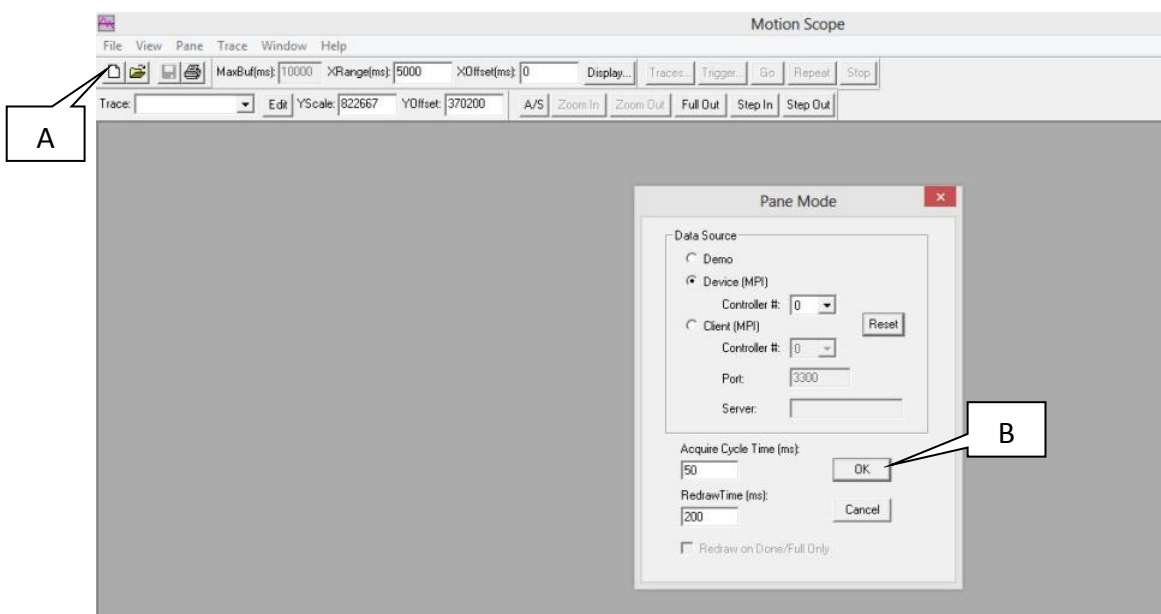


Figure 5 Motion scope

6. Update the Max Buff(ms) and XRange(ms) to 60000ms.

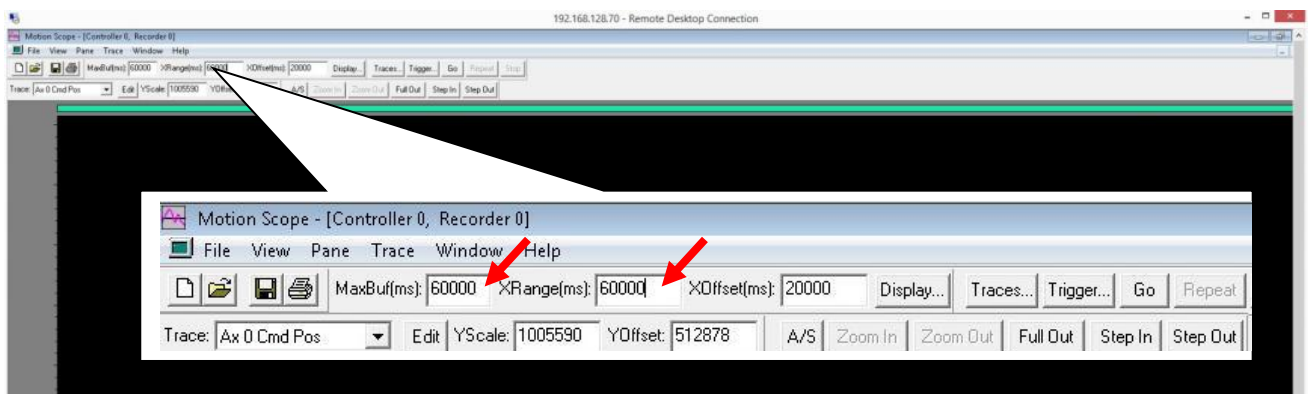


Figure 6 Motion scope

7. Click “Traces” and select setting as Figure 7-9.

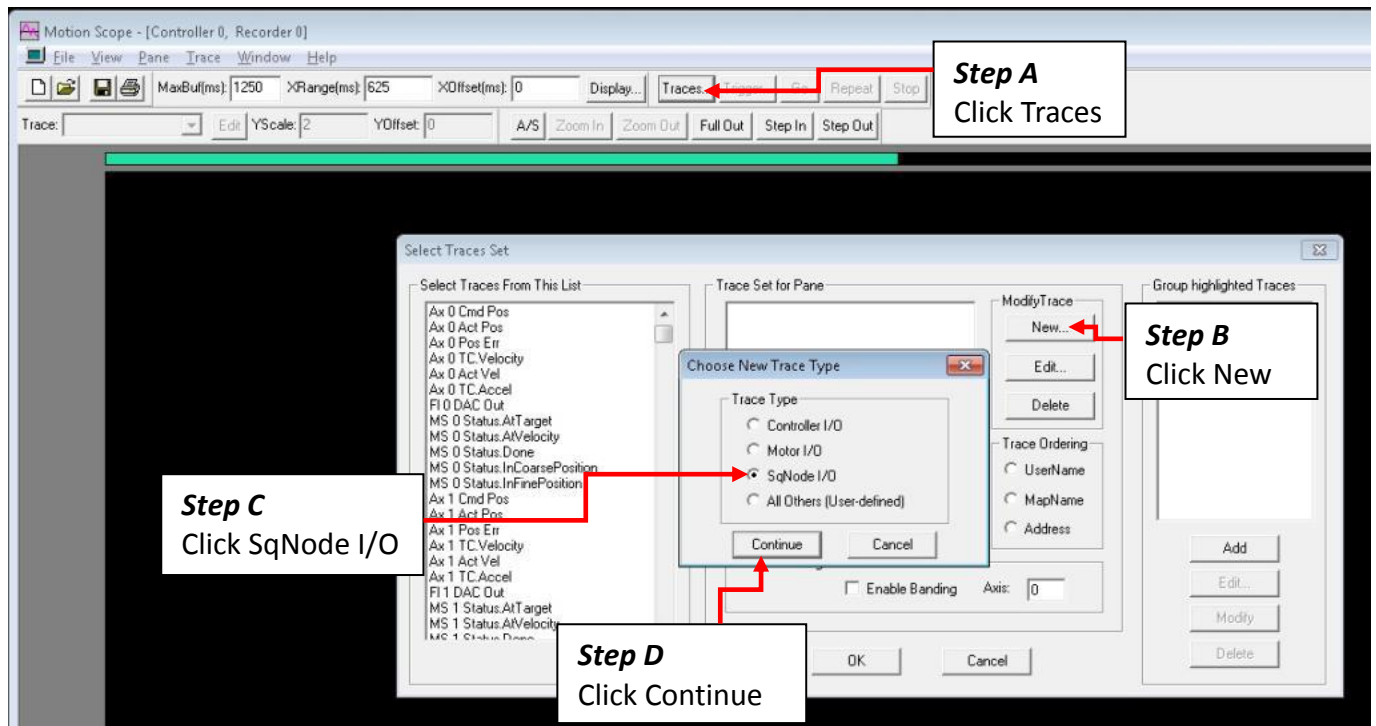


Figure 7 Motion Scope

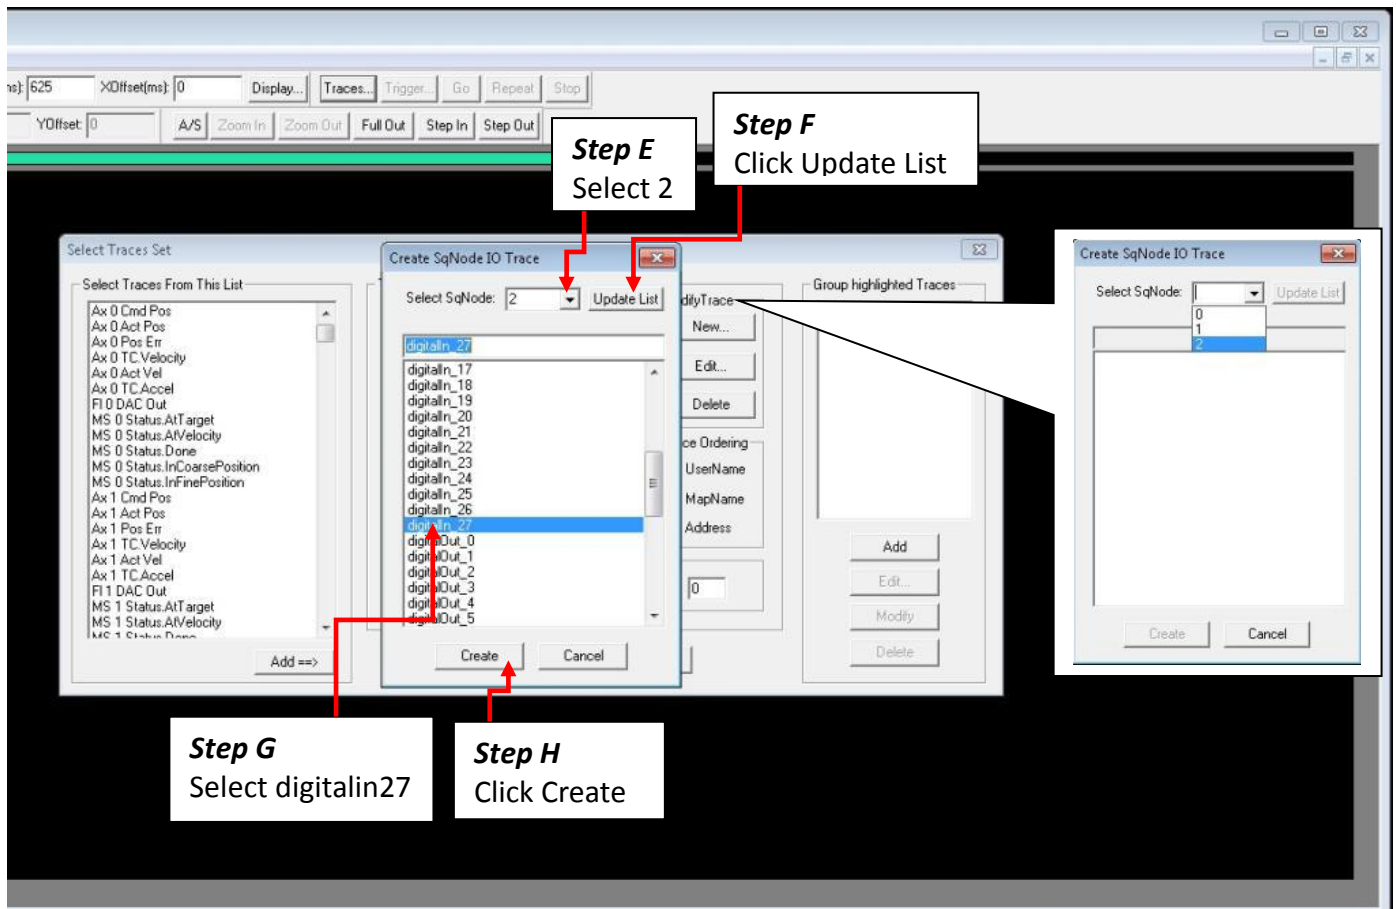


Figure 8 Motion Scope

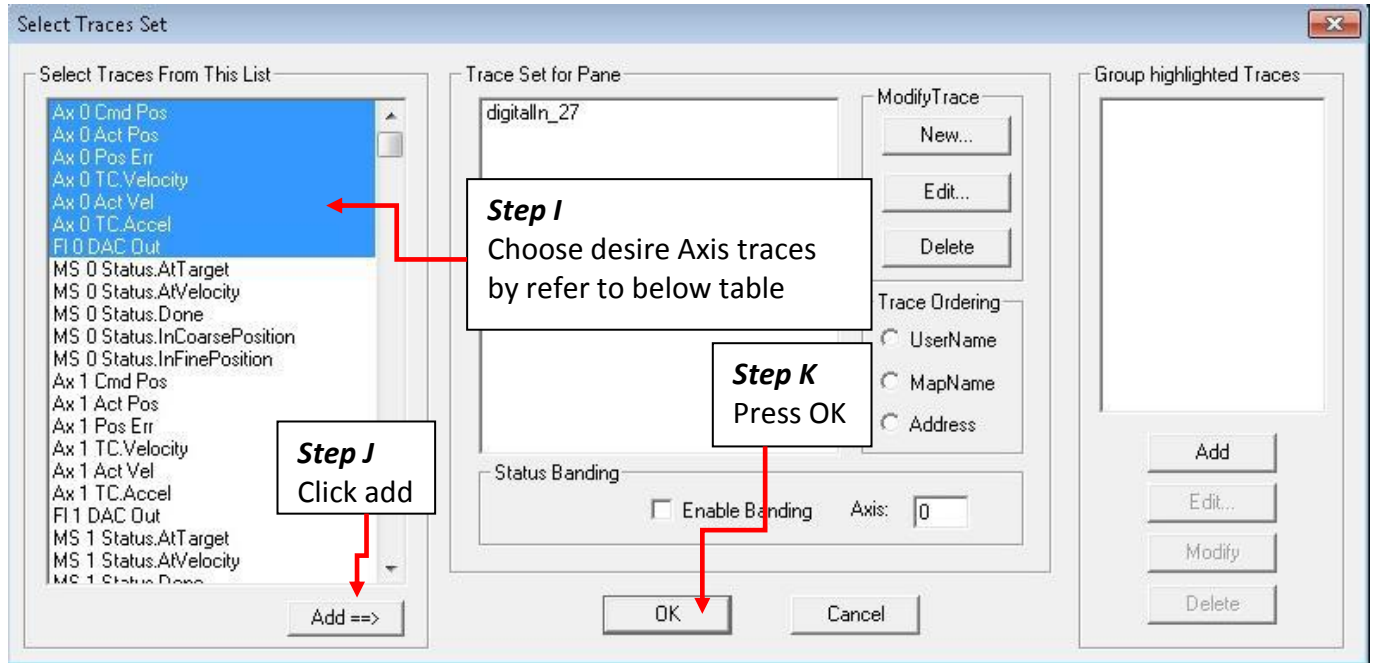


Figure 9 Motion Scope

Servo motor X Axis
Axis 0 Cmd Position (Command position)
Axis 0 Act Position (Actual position)
Axis 0 Pos err (Position error)
Axis 0 TC acceleration (Command acceleration)
Axis 0 TC Velocity (Command velocity)
Axis 0 Act Velocity (Actual velocity)
FI 0 DAC OUT (Current)

Table 1

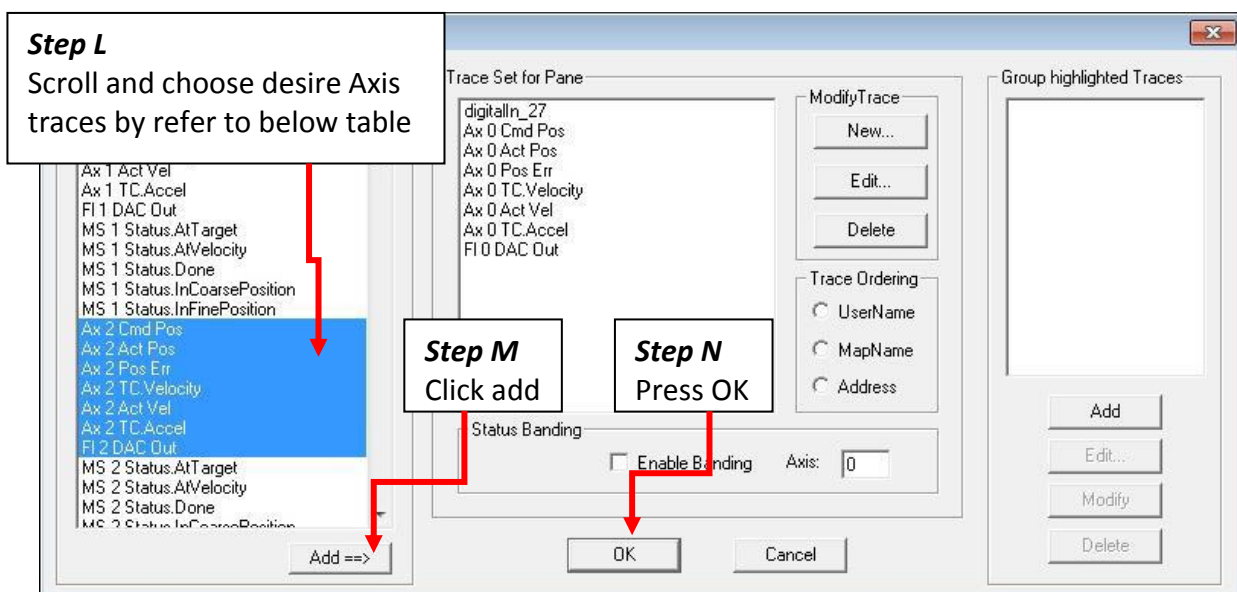


Figure 10 Motion scope

Servo motor Y Axis
Axis 2 Cmd Position (Command position)
Axis 2 Act Position (Actual position)
Axis 2 Pos err (Position error)
Axis 2 TC acceleration (Command acceleration)
Axis 2 TC Velocity(Command velocity)
Axis 2 Act Velocity (Actual velocity)
FI 2 DAC OUT (Current)

Table 2

8. Click “Go” and motion waveform will start capture show like Figure 11.

Remarks : May begin to capture at Homing Position ,click Stop save the motion scope.

Saved files will name as Controller 0, Recorder 0.pan under path at RMS(Atom PC).

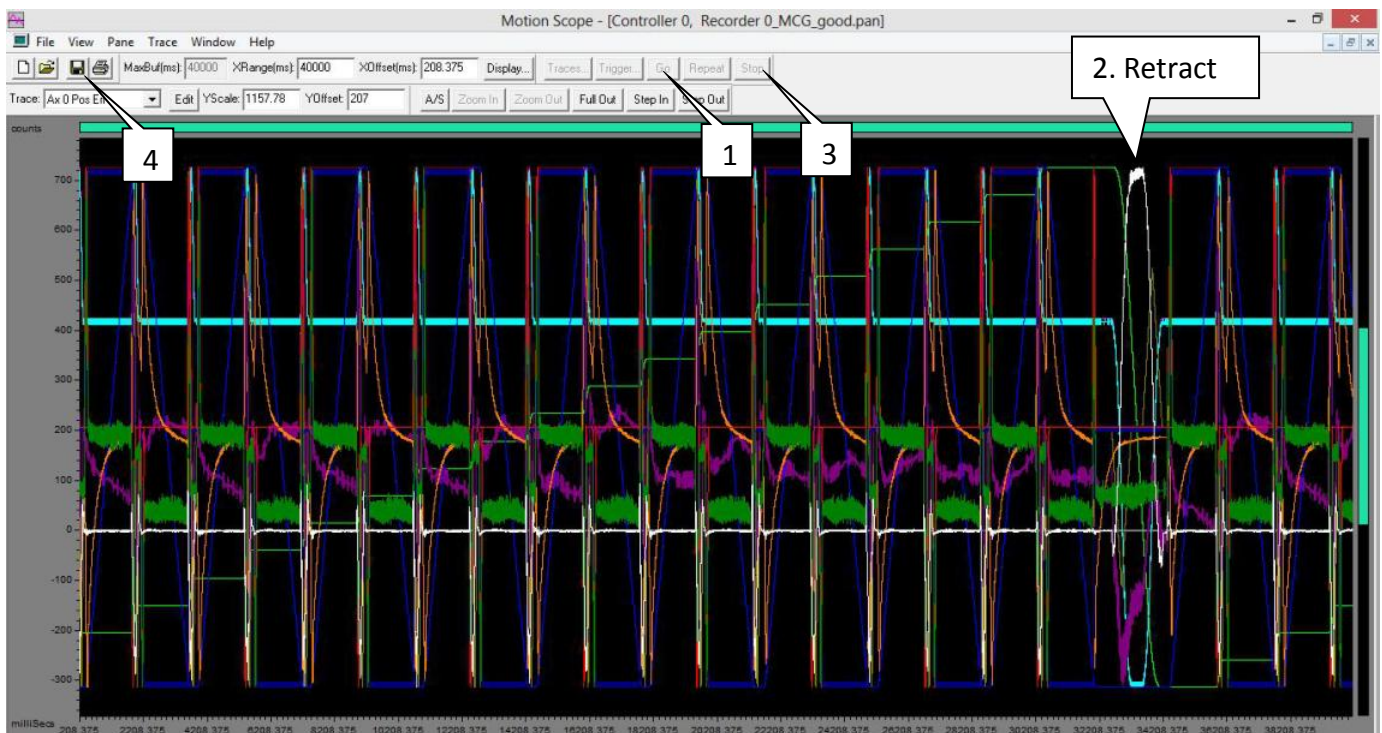


Figure 11 XY Motion Pattern [COMPLETE]

9. Back to V810 GUI and click stop at Panel Positional tab.