Tenebrio rig · SHT45 sensor wiring

Raspberry Pi 4 header seen from above, USB and Ethernet ports facing you.
Odd pins on the left, even pins on the board edge.

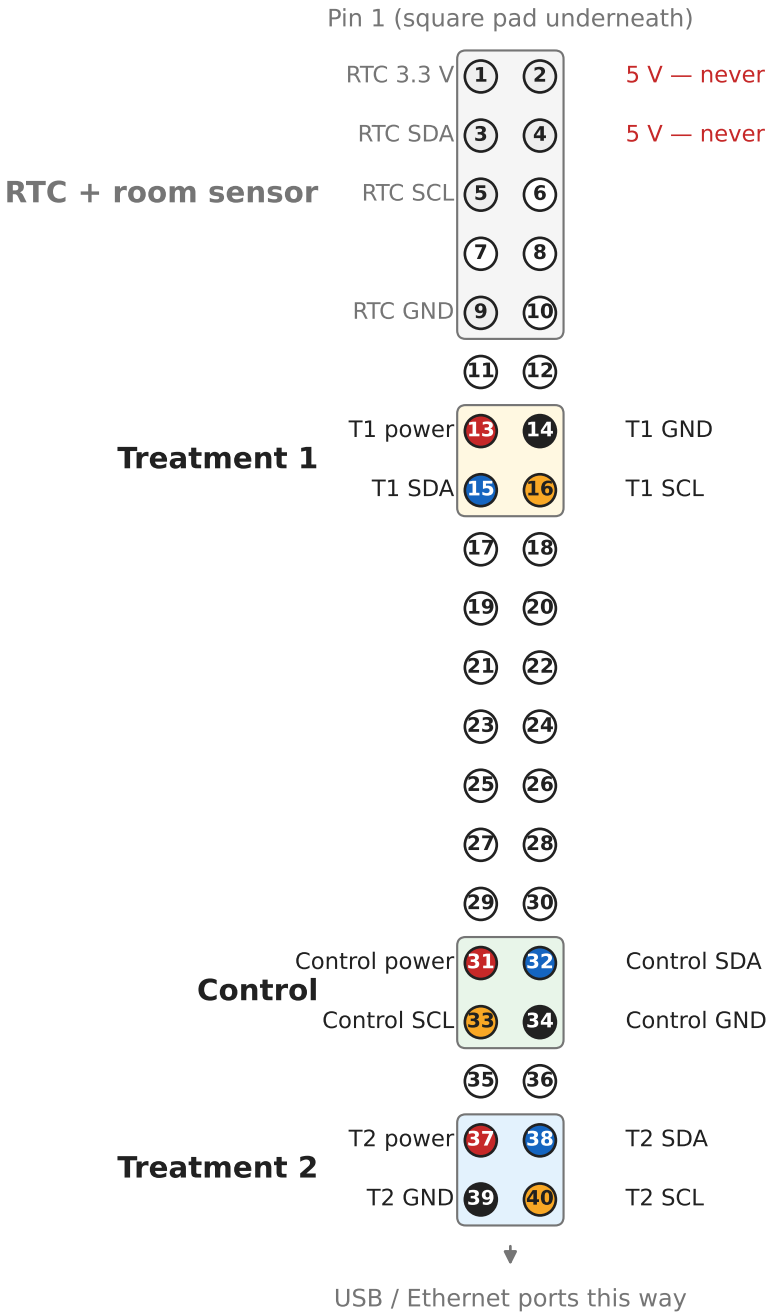

Sensor	Power (red)	GND (black)	SDA (blue)	SCL (yellow)	Bus
Treatment 1	13	14	15	16	i2c-6 (hardware)
Control	31	34	32	33	i2c-5 (hardware)
Treatment 2	37	39	38	40	i2c-7 (software)
Room	—	—	—	—	i2c-1 (via RTC)

- On each sensor board the red wire goes to VIN, not 3Vo (the Qwiic socket already does this).
- Each sensor is powered from a GPIO that the Pi drives high from boot (gpio=27,6,26=op,dh in config.txt). Until config.txt has that line, those pins are off, so wiring is safe. Never use pins 2 and 4 (5 V).
- The room sensor plugs into the RTC board's spare Qwiic connector; it needs no header pins.
- Label every cable at both ends: a swapped T1/T2 cable silently swaps the data.
- Must match SENSORS in lights/tenebrio_logger.py and lights/README.md, "Sensors".