Carbonator weld filming guide

Set up each shot. Record the work clearly.
Hands and below shoulder level throughout.



A practical capture sequence for the rotator-assisted carbonator weld.

One shot per page - fixed views - narration afterward

START HERE

Follow the work

Film the process in its real order. Use the page numbers to jump between camera positions.

03-07	**Set up** Equipment, overall view, detail view, settings and active-process camera placement.
08-14	**Before welding** Parts, preparation, seating, unwelded geometry and tacks.
15-21	**Explain the mechanism** Disabled head, indicator, contact, belt, pedal, lap and settings.
22-29	**Attempt and result** Full attempt, fresh observation, bead, endpoints, interior and inspection.
30-33	**Finish the session** Closing image, atmosphere, room tone and original files.

If time is short

Prioritize pages 09, 13, 15, 20, 22, 25 and 32: overall view, clean joint, disabled head, dry lap, real attempt, matched result and room tone.

Capture before access changes

The unwelded detail is page 13. The accessible interior is page 28: film it before final closure. Record the actual bead before dressing or cleaning changes it.

The drawings are framing sketches. They show what to include, not actual weld results or measured equipment positions. The PDF sidebar lists every shot; the footer returns to this page.

SETUP 01

Put the kit on the bench

Two cameras, two tripods and two lights. The GoPro holds the overall view; the Canon R50 V holds the detail.

A

Overall position

GoPro HERO13, stock protective lens, SmallRig CT-10 tripod.

B

Detail position

Canon EOS R50 V with its 14-30 mm kit lens, SmallRig CT25 overhead tripod.

Canon EOS R50 V + RF-S 14-30mm	Camera B
SmallRig CT25	Holds B
SmallRig CT-10	Holds A
NEEWER NL-192AI two-light kit	Main and fill light
SanDisk Extreme 128 GB SD and Anker card reader	B's card and its transfer

The two cameras can record at once: let A run through dry demonstrations and the attempt while B holds its detail. Keep the iPhone available for the DJI receiver and Voice Memos.

Prepare before work starts


Charge both cameras, phone, mic and lights. Format the R50 V's card in the camera, clear the GoPro's card, clean lenses, silence notifications and keep lens covers nearby. The light kit includes stands and power adapters.

These cameras serve ordinary setup, detail and result footage; page 7 covers the separate active-process camera arrangement.

SETUP 02 - CAMERA A

Set the overall view

Put the CT-10 on the floor, off one front corner of the bench. Keep the camera fixed.

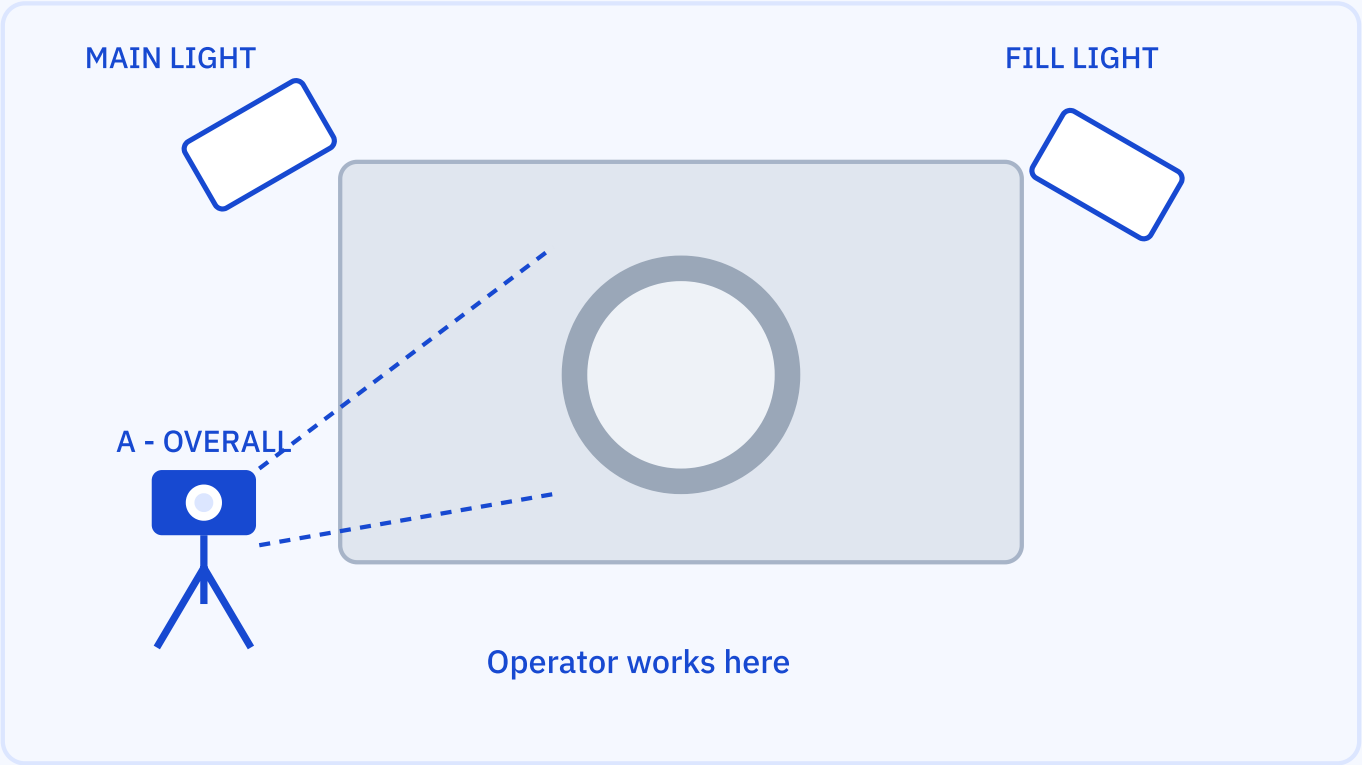

Top view. Blue dashed lines show the camera view; the diagram sets relationships, not distances.

1. Mount the stock-lens GoPro on the tripod using its built-in 1/4-20 thread. Start around 1-1.5 m from the rig, then adjust to include the whole tube, nest and your working hands.
2. Set the top edge below shoulder level, at upper chest or lower. Rehearse entering, reaching and leaving. Keep your head and shoulders out of every part of that movement.
3. Keep enough downward angle to show the cap, while preserving the tube's rotation in the picture. Check shiny metal, windows and screens for face reflections.


FINISHED WHEN

The viewer can see the hands, head of the tool and moving work. The picture stays below shoulder level throughout your movement.

SETUP 03 - CAMERA B

Set the detail view

Use the CT25 to look into the joint without the near rim blocking it. Do this with emission disabled.

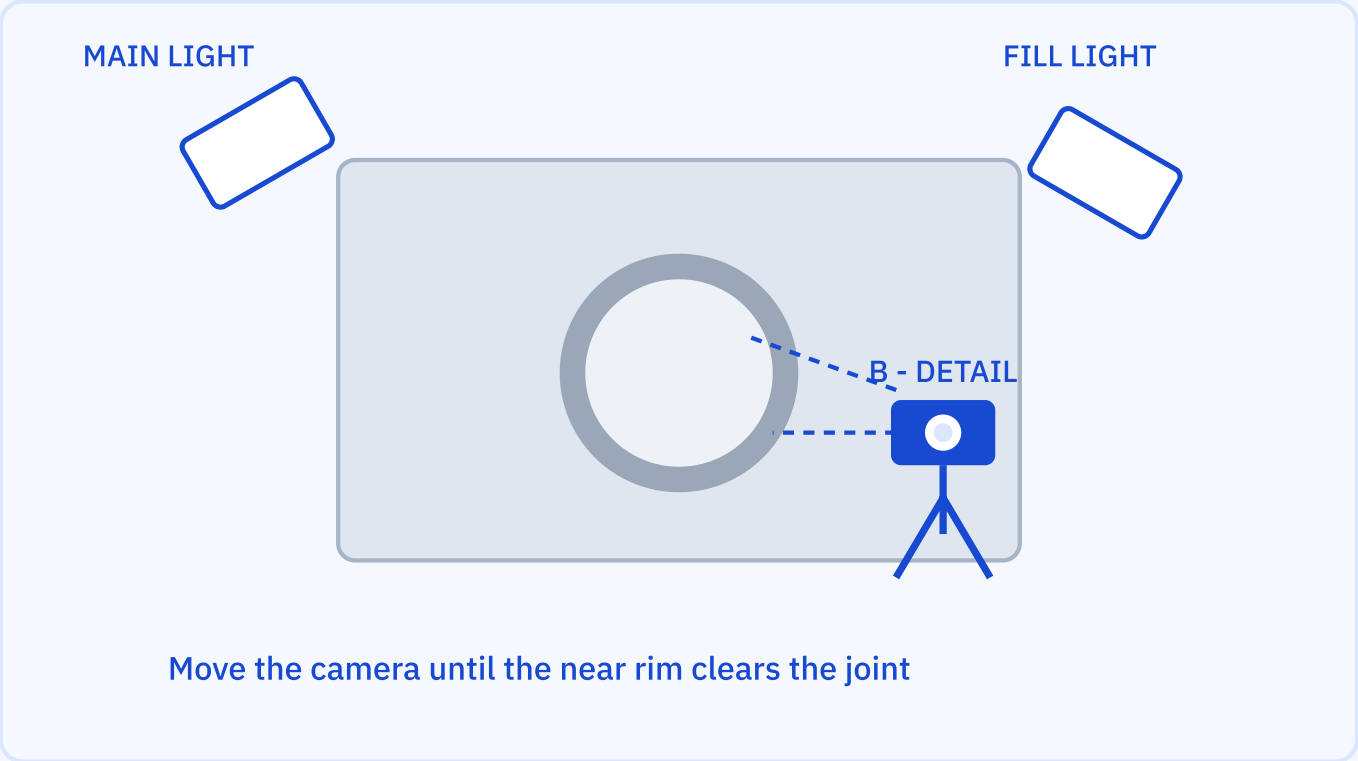

Top view. Start close to the selected arc; refine the camera and lights from the recorded image.

1. Mount the R50 V on the CT25, above and to one side. Zoom to 30 mm and start about 20-25 cm from the selected joint arc; the lens focuses as close as 15 cm. Set focus mode to MF and turn the lens ring until peaking outlines the edge.
2. Use the overhead arm only as far as needed. Follow the tripod instructions for leg position and counterweight. Keep support and cables outside the work and drive areas.
3. Start both lights at 5600 K, about 50 cm from the subject: main at 50%, fill at 20%. Move the main light until wall and cap separate clearly. Reduce fill if the corner loses definition.

FINISHED WHEN

Wall, cap and joint are sharp together. The metal has visible detail, the near rim does not hide the line, and there is space for labels.

SETUP 04

Set recording and focus

Make the image predictable before the real work starts.

A - GoPro	4K / 30 fps / 16:9 / Linear. Standard SDR, HDR off, Natural color, High bitrate, HyperSmooth off on the rigid tripod.
B - R50 V	Movie rec. size 3840x2160 / 29.97 fps / Standard (Long GOP). Movie rec. format XF-AVC S YCC420 8bit. Color mode: Picture Style Standard, HDR shooting (PQ) off. Movie digital IS off on the tripod.
Exposure at B	Movie manual exposure: 1/60 s, f/8 to start, the lowest ISO that exposes well, zebras on. White balance 5600 K to match the lights.
Focus at B	Focus mode MF. Turn the lens ring with MF peaking on and check the magnified view. Refocus after changing distance or zoom.
Speech	DJI receiver into iPhone. Voice Memos records the mic; camera audio supplies sync and shop sounds.

1. Record a ten-second disabled sample with a representative hand movement, then a clear hold. Play it back at full size.
2. Adjust camera or lighting if the joint is soft, a hand blocks it, reflections erase the edge, or a display flickers. If only a sliver of the joint is sharp, close B toward f/11 or move it back. On the GoPro, use shutter Auto as the first ordinary bench-light setting.
3. For a static shot, start five seconds early and keep recording five seconds after the useful action. Name a clip aloud, then pause before the clean take.

> **Focus and exposure are different**
>
> The lens ring sets focus. If a bright reflection is white and featureless, move the light or camera and reduce exposure as needed. Brightness settings do not establish laser protection.

Canon documents the R50 V's movie size, format, manual focus and peaking in its online manual; GoPro documents capture controls in Protune support.

SETUP 05 - BEFORE EMISSION

Set the active-process view

The detail pages are filmed with the laser disabled. Active welding uses a separate suitable camera arrangement.



Framing only. This sketch does not specify a laser-safe camera location or viewing barrier.

1. Use A only from a camera position outside exposure or through a viewing arrangement specified for this laser and use. Get that arrangement from XLaserlab or a qualified laser-safety provider before exposing a camera to the process.
2. With emission disabled, rehearse the whole working movement and check the picture. The top stays below shoulder level; your hands, the tool head and moving tube remain visible.
3. Clear temporary filming props and restore normal guarding before emission. Start recording before taking your working position. Make camera adjustments only after emission is disabled.

Picture exposure is not protection

A dark picture, photographic ND filter or ordinary welding glass does not establish protection. Keep an unprotected camera covered and outside exposure during emission, even when it is not recording.

XLaserlab: Class 4 and laser-specific protection. Sony: direct and reflected laser exposure can damage sensors. If a suitable active view is unavailable, use the dry demonstrations, actual observations and result footage to tell the story.


SHOT 01 / 25 - BEFORE WELDING

LASER DISABLED FOR CAMERA SETUP

Lay out the real parts

Show what is being joined before the cap disappears into the tube.

CAMERA	RECORD
A - GoPro	**30 s**

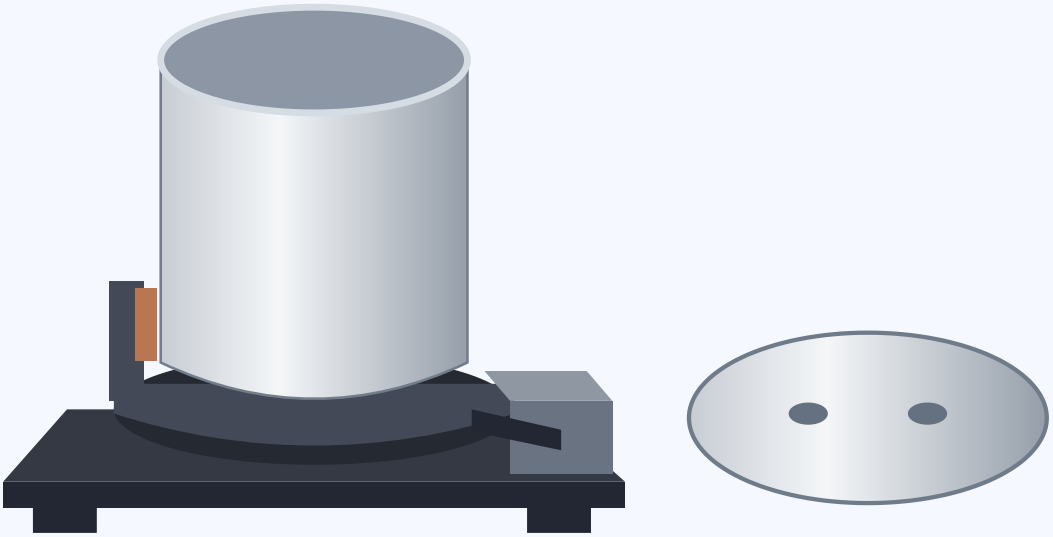

Tube and the actual cap for this closure

5 s settle + 20 s clear view + 5 s tail

1. Set the tube and this closure's cap side by side on a clean bench. Frame both completely, with enough room for your hands to enter.
2. Start recording. After five seconds, place the cap beside the tube with its joint face visible. Withdraw your hands and leave the view still.
3. Take one still photograph before moving anything. Keep names, shipping labels and unrelated screens outside the picture.

KEEP THE TAKE WHEN

Both parts are sharp, their relative size is clear, and the cap is unobstructed.

In the edit: Introduces the job and supplies a clean title image.


SHOT 02 / 25 - BEFORE WELDING

LASER DISABLED FOR CAMERA SETUP

Show the whole work area

Give the viewer a map before moving into details.

CAMERA	RECORD
A - GoPro	**25 s**

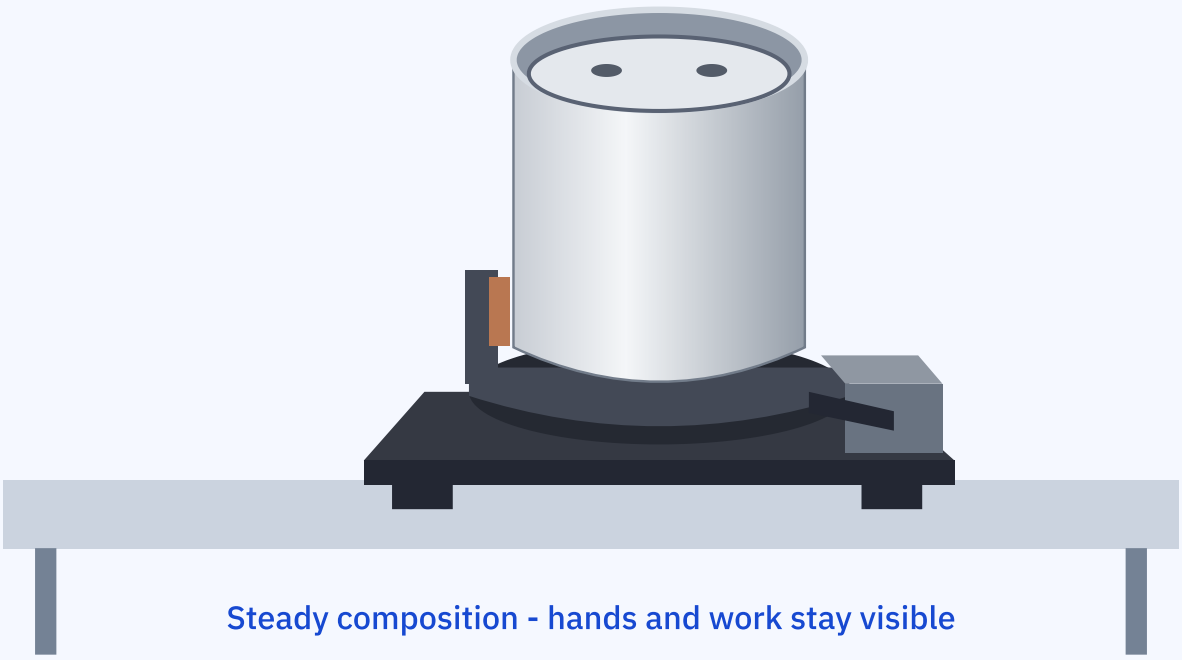

Steady composition - hands and work stay visible

5 s settle + 15 s untouched + 5 s tail

1. With the tube in its normal fixture, show the whole rotator, tube and surrounding working space from a front corner of the bench.
2. Set the top of the picture below shoulder level. Record the empty setup, then a short separate take of your hands entering the working position.
3. Keep the camera still. Leave enough room around the rig to see that the head will stay in position while the work rotates.

KEEP THE TAKE WHEN

The tube, nest and drive are identifiable, and your head stays outside the frame during entry and exit.

In the edit: Establishes where each later closeup belongs.

SHOT 03 / 25 - BEFORE WELDING


LASER DISABLED FOR CAMERA SETUP

Record the preparation

Show the preparation you actually perform for this attempt.

CAMERA
A - GoPro

RECORD
Whole action

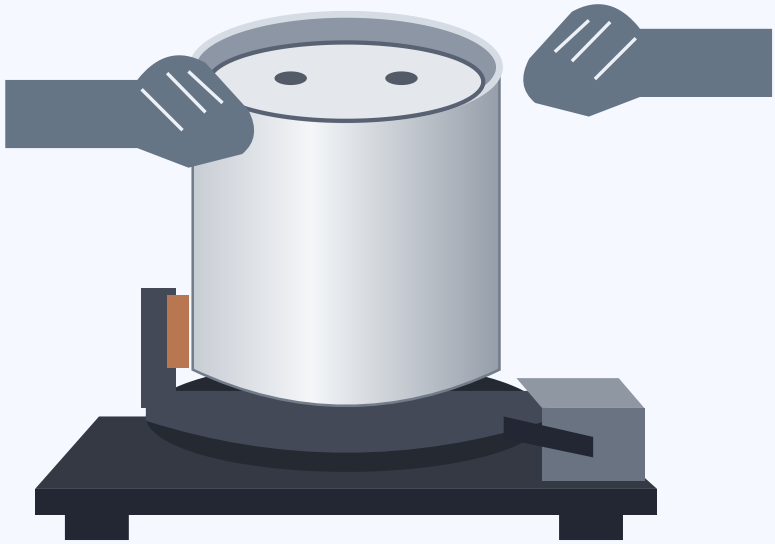

Keep the contact area visible between your hands

5 s before + real action + 5 s after

1. Move A closer for a medium view of your hands and the prepared joint area. Keep both sides of the work visible.
2. Record a useful real cleaning or preparation action from beginning to end. Let the tool enter, do its job, then leave a clear finished view.
3. Continue the fabrication procedure in its normal order. Capture another genuine operation if a second view is useful; preserve prepared surfaces.

KEEP THE TAKE WHEN

The viewer can see the tool's contact and what your hands accomplished.

In the edit: Bridges the loose parts to a prepared joint.


SHOT 04 / 25 - BEFORE WELDING

LASER DISABLED FOR CAMERA SETUP

Show the cap seating

Let the viewer see how the cap fits into the tube.

CAMERA	RECORD
A - GoPro	**Whole action**

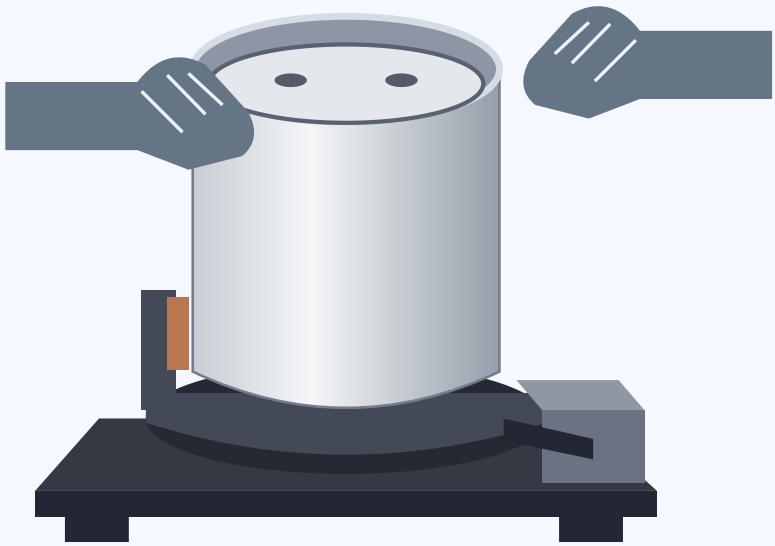

Keep the contact area visible between your hands

5 s before + seating + 10 s settled

1. Aim slightly downward so the near rim does not hide the cap. Arrange the frame around the real seating operation before starting it.
2. Record the complete seating action as the fabrication procedure calls for it. Keep the contact area visible between your hands.
3. When the cap is in position, withdraw your hands if the setup permits and hold the view for ten seconds. Keep the accepted fit undisturbed.

KEEP THE TAKE WHEN

The cap's final position inside the tube is visible, with an uninterrupted view of the real seating operation.

In the edit: Explains the recessed end-cap arrangement.


SHOT 05 / 25 - BEFORE TACKING

LASER DISABLED FOR CAMERA SETUP

Show the circular joint

Show the entire path the weld must follow.

CAMERA	RECORD
B - R50 V	30 s

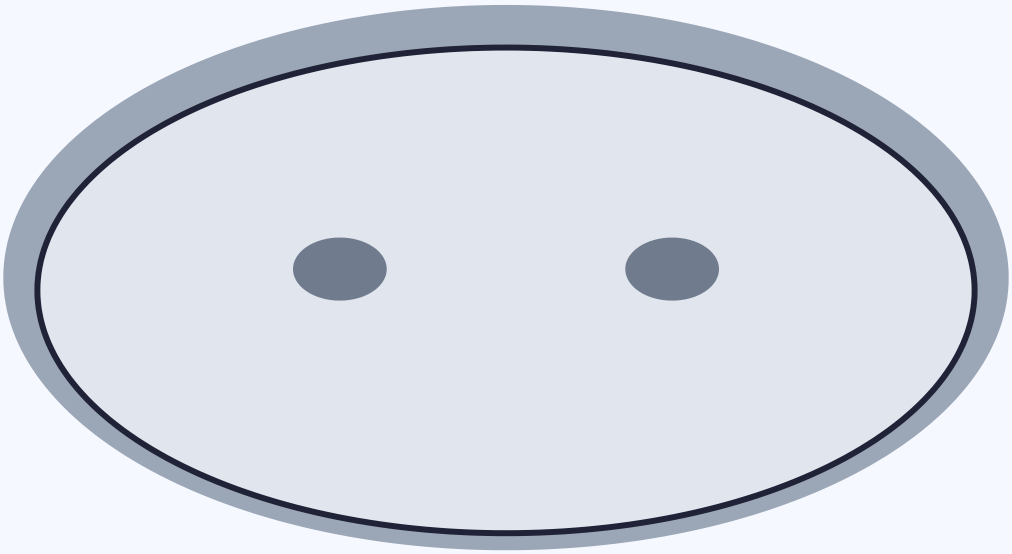

Whole cap and circular joint remain in frame

5 s settle + 20 s clear view + 5 s tail

1. Use the detail position above and to one side of the tube. Zoom out toward 14 mm, or raise the camera, until the whole cap and joint fit.
2. Focus on the cap and circular joint. Include the port features so the viewer has an orientation reference.
3. Record without hands or tools covering the circle. Take a matching still photograph.

KEEP THE TAKE WHEN

The whole circular joint is in frame and both cap and tube remain recognizable.

In the edit: Supports a circular path graphic and the transition into the tight detail.


SHOT 06 / 25 - BEFORE TACKING

LASER DISABLED FOR CAMERA SETUP

Hold the unwelded detail

This is the key image for arrows and technical explanation.

CAMERA	RECORD
B - R50 V	**40 s**

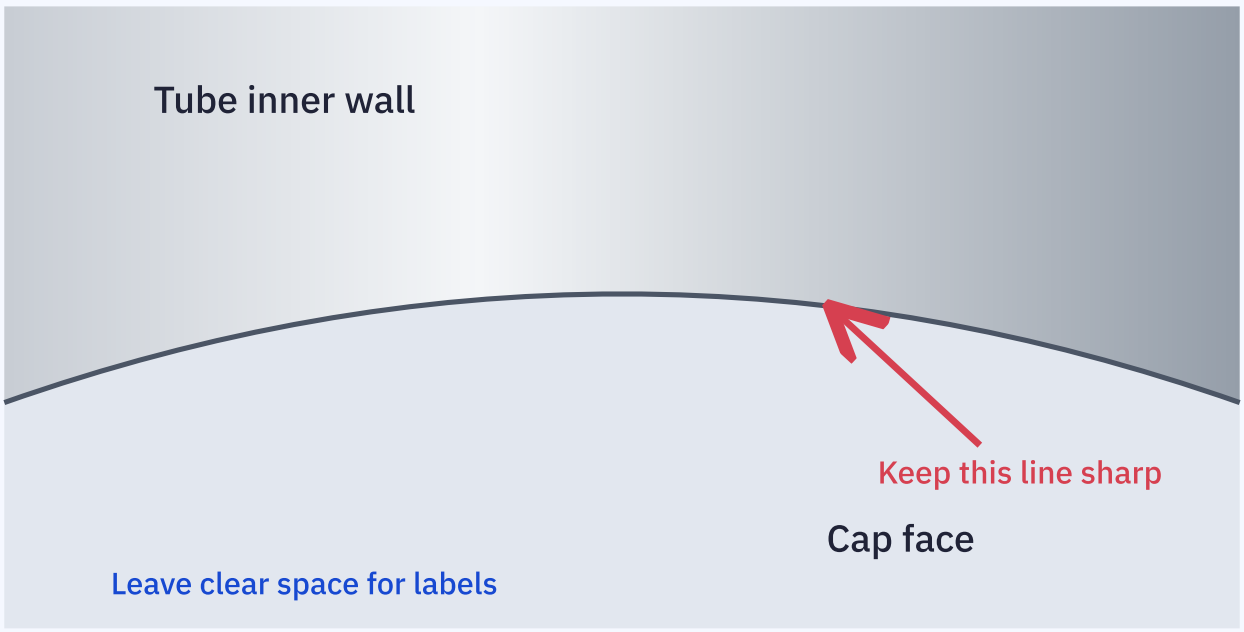

5 s settle + 30 s untouched + 5 s tail

1. Move B to one short arc of the joint. Zoom to 30 mm and start about 20-25 cm from the surface. Focus with the lens ring and peaking, then refine position and aperture until wall, cap and joint line are sharp.
2. Let the joint occupy about half to two-thirds of the picture width. Leave a plain area beside it for labels and keep the bottom strip available for subtitles.
3. Withdraw your hands. Record a completely still thirty-second hold, then take a full-resolution still. Note the tripod position for the matching result shot.

KEEP THE TAKE WHEN

The joint line is sharp, reflections reveal both surfaces, and nothing moves through the clean hold.

In the edit: A clean plate for a moving arrow, traced edge, freeze or inset.


SHOT 07 / 25 - AFTER TACKING

LASER DISABLED FOR CAMERA SETUP

Record the real tacks

Show how the cap is held before the continuous pass.

CAMERA	RECORD
B - R50 V	30 s

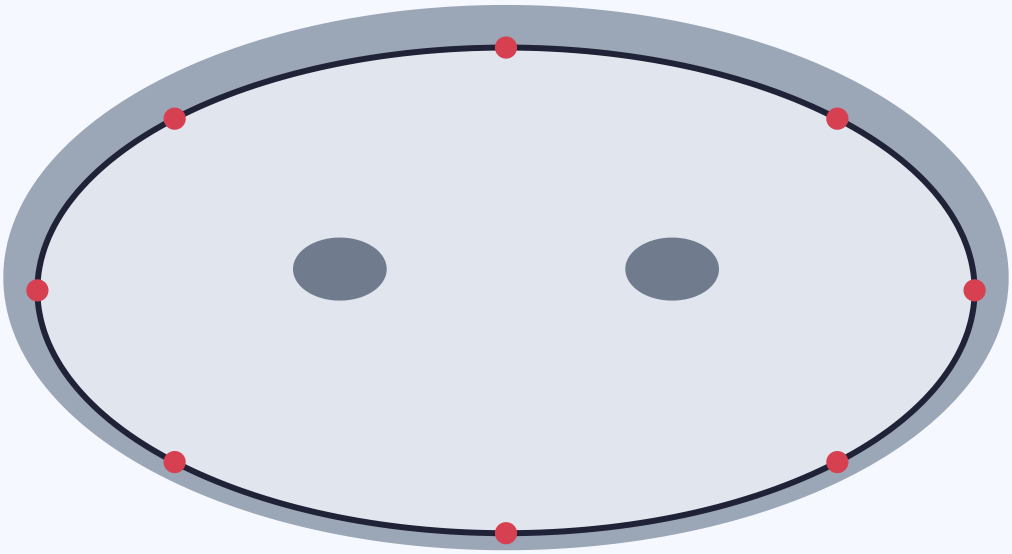

Whole cap and circular joint remain in frame

5 s settle + 20 s view + 5 s tail

1. Capture this view after the normal tacking operation, with emission disabled. Use the whole-cap framing from the circular joint shot.
2. Show the actual tack positions. Hold a clear overall view, then record a separate detail of one useful tack if needed.
3. Keep the pattern as it stands. Follow the fabrication procedure for securing the cap before any dry rotation.

KEEP THE TAKE WHEN

The viewer can locate the tacks around the cap and relate them to the planned pass.

In the edit: Explains the starting condition for the continuous weld.


SHOT 08 / 25 - DRY DEMONSTRATION

LASER DISABLED FOR CAMERA SETUP

Place the disabled head

Show the head, wire and joint together without emission.

CAMERA	RECORD
B - R50 V	**35 s**

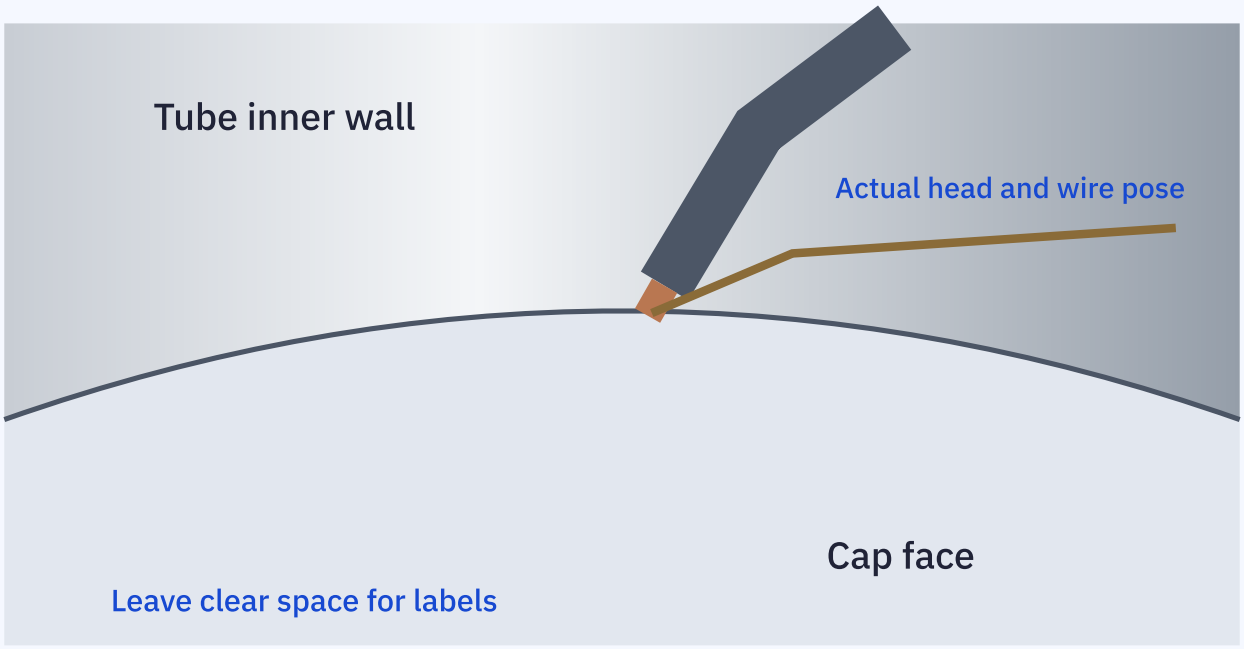

5 s clear + 20 s pose + 10 s clear

1. Keep the laser disabled. Reuse the unwelded joint detail and put the head and wire at the actual working pose.
2. Arrange B so the nozzle and glove do not hide the wire endpoint or joint. Hold the pose for twenty seconds without operating the trigger.
3. Withdraw the head and hand, then leave ten seconds of clear joint. Say a short note identifying what the wire and head positions show.

KEEP THE TAKE WHEN

The relationship among nozzle, wire endpoint and joint is clear in one stable view.

In the edit: Supports labels for the welding location and arriving material.


SHOT 09 / 25 - DURING NORMAL SETUP

LASER DISABLED FOR CAMERA SETUP

Show the runout check

Film the measurement already called for by the welding procedure.

CAMERA	RECORD
B - R50 V	**One sweep**

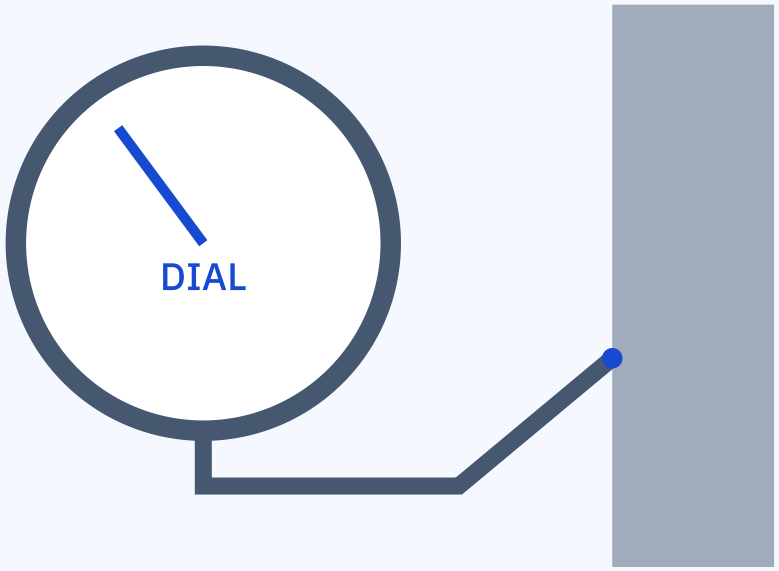

Dial and contact point in the same view

5 s before + existing check + 5 s after

1. Capture the real check when the procedure calls for it. Frame the dial and contact point together; use a wider locator view first if the contact is otherwise ambiguous.
2. Focus on the dial face. Include a useful sweep during the normal check without blocking it with a hand.
3. Record the actual reading in a spoken note or clip note. Keep the filming sequence subordinate to the fabrication sequence.

KEEP THE TAKE WHEN

The dial can be read and the viewer can see which surface it measures.

In the edit: Explains setup accuracy using the measurement actually observed.


SHOT 10 / 25 - DRY DEMONSTRATION

LASER DISABLED FOR CAMERA SETUP

Show the copper contact

Make the stationary work contact understandable.

CAMERA	RECORD
B - R50 V	**30 s**

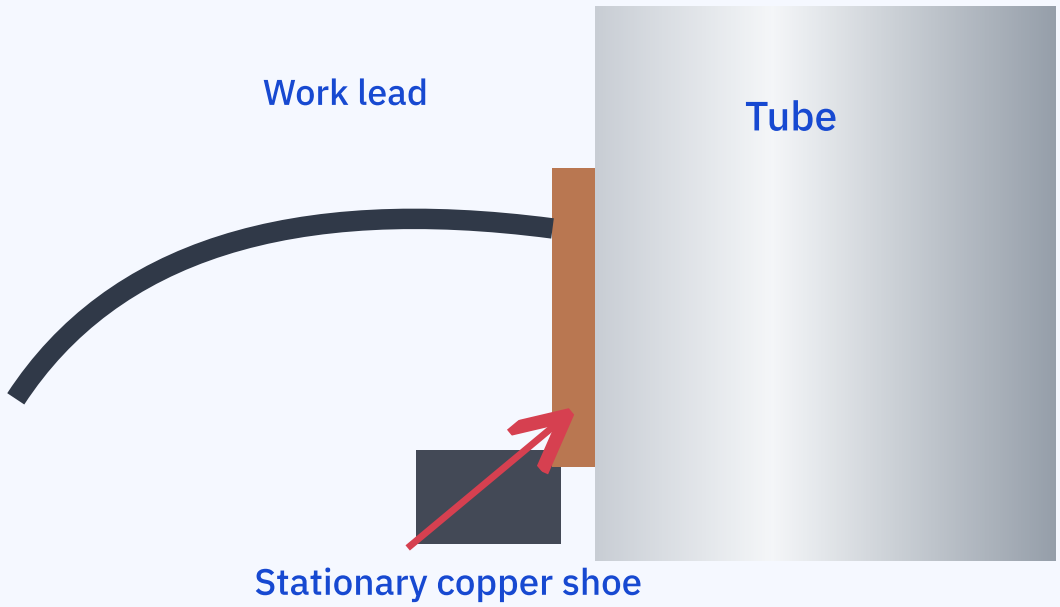

5 s settle + 20 s view + 5 s tail

1. With emission disabled, frame the copper shoe against the tube and show where the work lead attaches.
2. Start with a clear stationary view. During an already planned dry run, record the tube moving past the stationary shoe if the contact remains visible.
3. Keep your hand and the camera outside the moving mechanism. End with a settled view of the contact.

KEEP THE TAKE WHEN

It is clear that the tube moves while the shoe and work lead remain stationary.

In the edit: Shows how work contact is maintained through rotation.


SHOT 11 / 25 - DRY DEMONSTRATION

LASER DISABLED FOR CAMERA SETUP

Show the belt moving

Give the rotation mechanism its own readable detail.

CAMERA	RECORD
B - R50 V	30 s

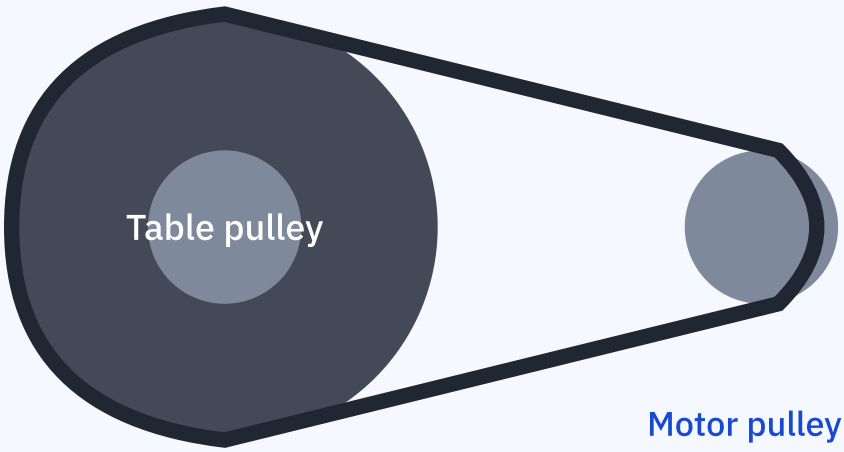

Frame both pulleys and the moving belt

5 s settle + 20 s motion + 5 s tail

1. Aim at the belt, motor pulley and turntable. Zoom B out, or back it away, enough to include their relationship.
2. Record twenty seconds of an existing dry run. Keep the camera fixed so the belt supplies all the movement.
3. Finish the take with a few seconds after the mechanism stops. Keep the lens, support and cables clear of the drive.

KEEP THE TAKE WHEN

The moving belt and table are sharp and their connection is understandable.

In the edit: A mechanism explanation and reusable process B-roll.


SHOT 12 / 25 - DRY DEMONSTRATION

LASER DISABLED FOR CAMERA SETUP

Show the pedal action

The pedal starts and stops rotation; it does not fire the laser.

CAMERA	RECORD
A - GoPro	**25 s**

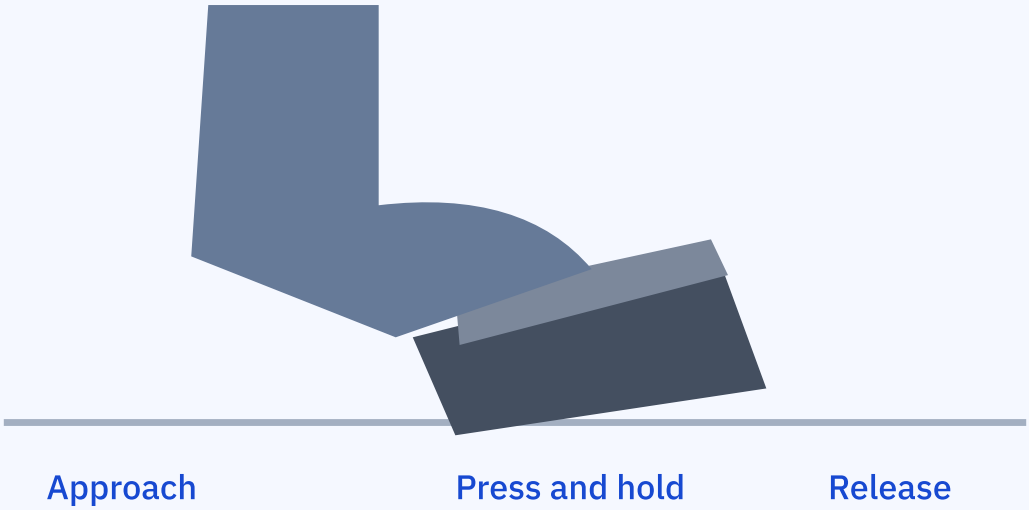

5 s clear + 15 s action + 5 s clear

1. Lower A to frame your foot and the whole pedal. Include enough floor to show the foot approaching and withdrawing.
2. With the laser disabled, record five seconds with the foot clear. Approach, press and hold, release, then withdraw.
3. Keep recording five seconds after the release. A separate dry lap shot shows the resulting table movement.

KEEP THE TAKE WHEN

The press, hold and release are distinct, with clean picture before and after.

In the edit: A cutaway explaining the rotation control.


SHOT 13 / 25 - DRY DEMONSTRATION

LASER DISABLED FOR CAMERA SETUP

Record one dry lap

Let the viewer see what moves and how steadily it moves.

CAMERA	RECORD
A - GoPro	**1 lap + 10 s**

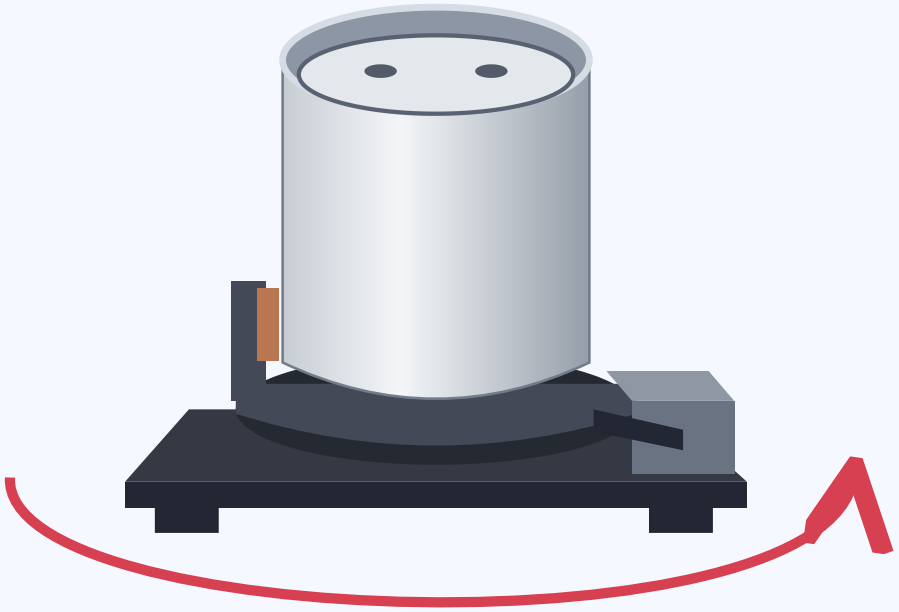

One complete dry lap - record the actual direction

5 s still + full revolution + 5 s still

1. Frame the tube, nest and a recognizable index or port feature from a fixed view. Keep the laser disabled and the cap secured by the normal procedure.
2. Record a complete revolution during the planned dry run. Keep hands and tools clear of the subject for the useful portion.
3. Note the actual speed and direction used. At nominal 8 mm/s, one lap is about 48.6 seconds; let the observed return determine the end of this take.

KEEP THE TAKE WHEN

The same reference returns to its start without a cut or camera move.

In the edit: Supports direction arrows, timing and the stationary-head explanation.


SHOT 14 / 25 - BEFORE THE ATTEMPT

LASER DISABLED FOR CAMERA SETUP

Record the actual settings

Collect legible values for the attempt being filmed.

CAMERA	RECORD
B - R50 V	**25 s / view**

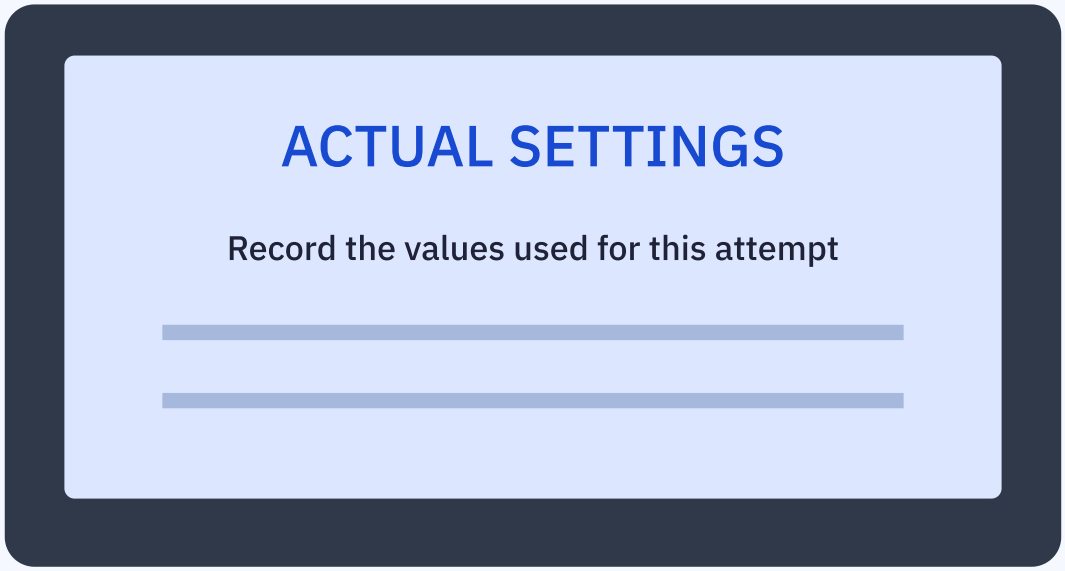

Square-on view - readable text - no scrolling midway

5 s settle + 15 s readable + 5 s tail

1. Aim square-on at the welder display. Adjust distance and light angle until numbers are sharp and screen reflections are controlled.
2. Record fifteen clear seconds of each relevant settings view. Change screens between takes, then remove your hand before each hold.
3. For a computer console, save a screen recording or screenshot of the actual status. Identify which attempt the settings belong to.

KEEP THE TAKE WHEN

Values are readable at full size and correspond to the recorded attempt.

In the edit: Parameter callouts without relying on narration to remember numbers.

SHOT 15 / 25 - ACTUAL WELDING

ACTUAL PROCESS - SEE PAGE 7

Record the whole attempt

Keep an uninterrupted record of what actually happens.

CAMERA

A - protected view

RECORD

Whole attempt



About 10 s before + full attempt + 10 s after

1. Use the active-process camera arrangement established on page 7. Rehearse the framing with emission disabled; include hands, the welding head and tube movement below shoulder level.
2. Start A and DJI audio before taking the working position. Clap once while both record, then carry out the normal welding procedure without camera adjustments.
3. Keep recording through the finish and immediate aftermath. If work stops unexpectedly, follow the normal procedure and retain the real sequence.

KEEP THE TAKE WHEN

The start, pass, finish and immediate response are present in one continuous recording.

In the edit: The main process sequence and an honest account of the attempt.


SHOT 16 / 25 - IMMEDIATELY AFTERWARD

LASER DISABLED FOR CAMERA SETUP

Record the fresh observation

Keep the first useful account while the experience is fresh.

CAMERA	RECORD
DJI audio	**30-60 s**

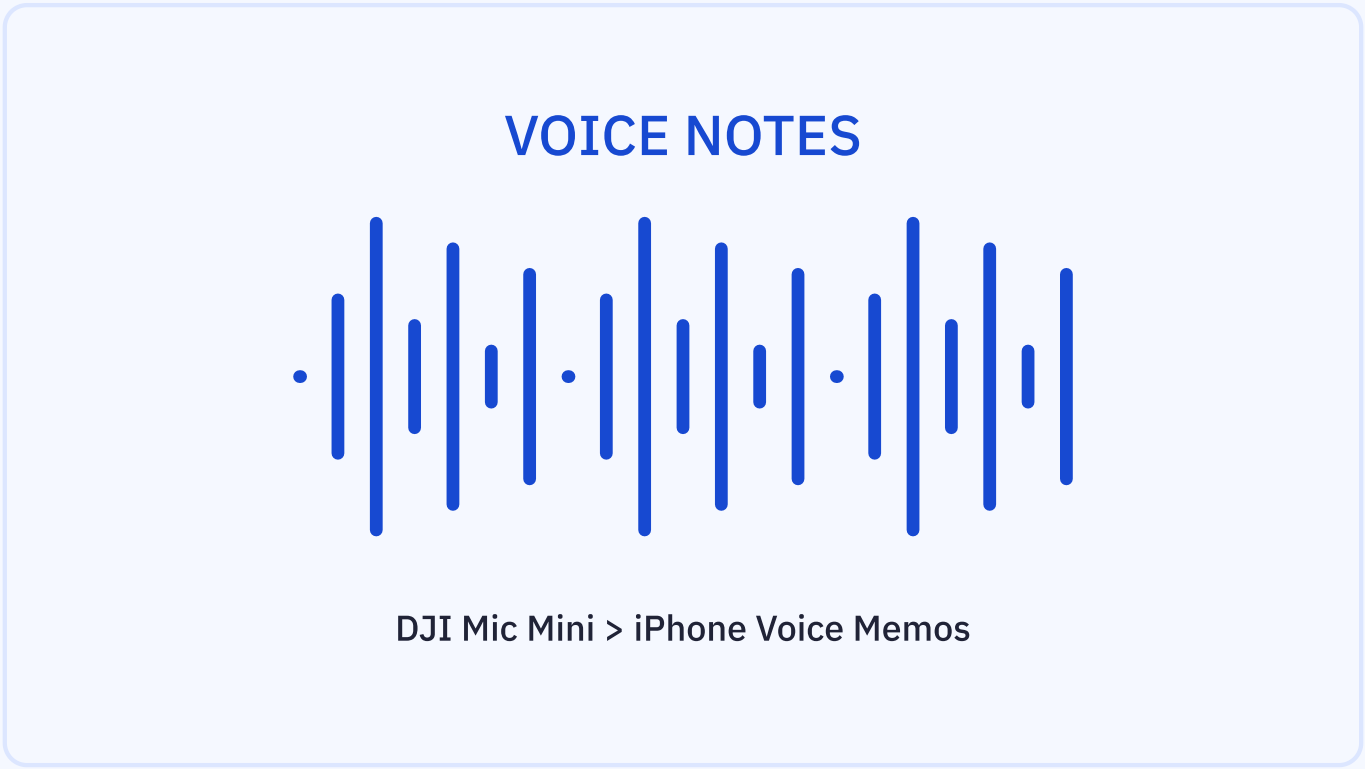

Pause briefly around each observation

1. Once the equipment is safely stopped, leave the DJI mic in place and record into iPhone Voice Memos. The camera can hold on the part or stop.
2. Say what you noticed: whether holding the head was easier, where the motion changed, and what happened at the finish.
3. Describe the observation separately from a suspected cause. Keep the account in your own voice; a later voiceover can be more concise.

KEEP THE TAKE WHEN

The observation is audible and identified with this attempt. Your face never needs to be filmed.

In the edit: Narration, a reaction over the result, or notes for the edit.


SHOT 17 / 25 - AFTER SAFE ACCESS

LASER DISABLED FOR CAMERA SETUP

Show the whole bead

Show what was completed around the circumference.

CAMERA	RECORD
B - R50 V	**One inspection lap**

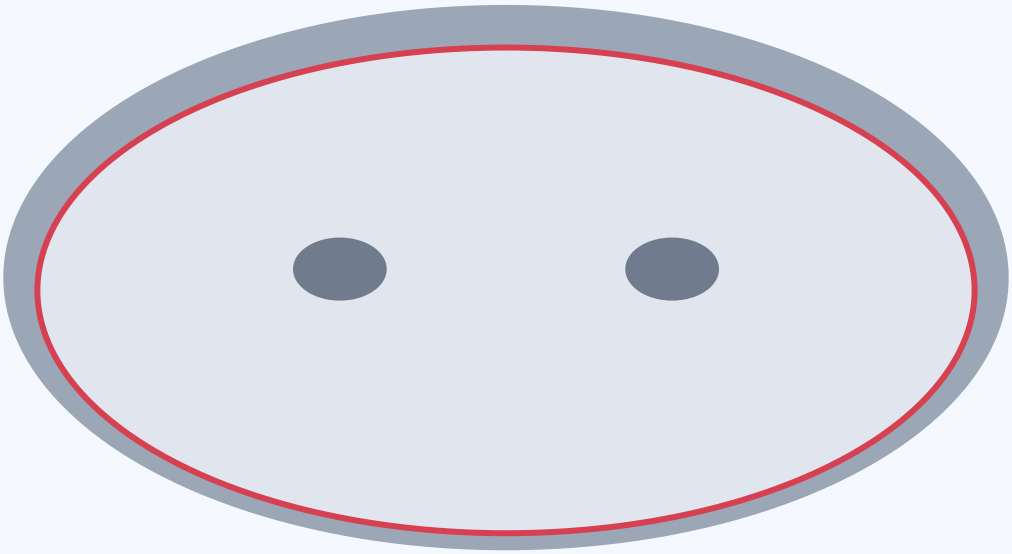

Whole cap and circular joint remain in frame

5 s still + complete useful sweep + 5 s still

1. With emission disabled and access safe, match the whole-cap view. Frame the whole joint and the same port references as before.
2. Record the circumference during a normal safe inspection rotation. Keep camera and light fixed; stop and refocus between takes if needed.
3. Leave a clear view at the end. Identify which closure and attempt the bead belongs to.

KEEP THE TAKE WHEN

The circumference is visible without a hand obscuring the bead.

In the edit: The overall result and context for the detail shots.


SHOT 18 / 25 - BEFORE DRESSING

LASER DISABLED FOR CAMERA SETUP

Match the joint detail

Give the edit the same picture with the weld completed.

CAMERA	RECORD
B - R50 V	40 s

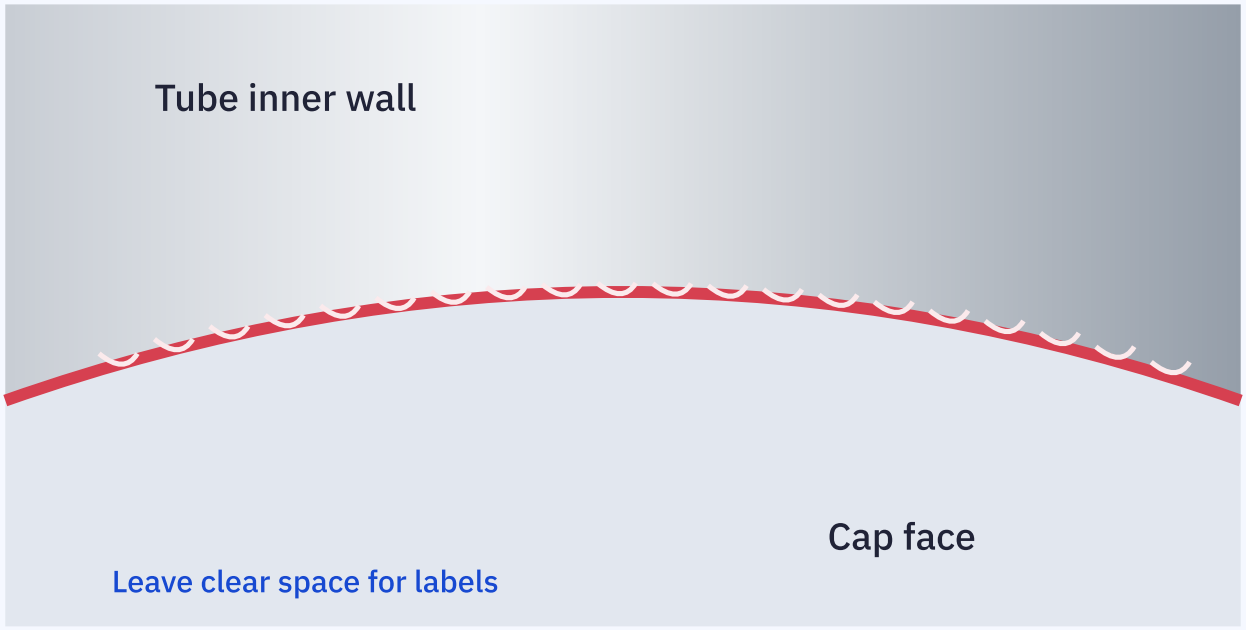

5 s settle + 30 s untouched + 5 s tail

1. Return B to the unwelded detail position. Match the viewing angle, approximate scale and light direction using the earlier still.
2. Focus on the actual bead, with adjacent wall and cap visible. Record thirty seconds with hands and tools clear.
3. Take a full-resolution still before dressing or cleaning changes the surface. Keep this image paired with the unwelded still.

KEEP THE TAKE WHEN

The two views can be compared directly and the actual bead is sharply visible.

In the edit: Before-and-after comparison, annotations and a closing detail.

SHOT 19 / 25 - BEFORE DRESSING

LASER DISABLED FOR CAMERA SETUP

Show start and finish

Capture the places where the continuous pass begins and closes.

CAMERA	RECORD
B - R50 V	30 s each



For each: 5 s settle + 20 s clear + 5 s tail

1. Locate the actual start. Record a stable closeup with enough surrounding bead to show its position, then take a still.
2. Locate the actual finish or overlap. Record the same duration at a similar scale and light angle, then take a still.
3. Say which is which at the start of each recording, then pause before the clean hold. If both occupy one area, record a wider locator view too.

KEEP THE TAKE WHEN

The clips are identified and each endpoint can be inspected without a pointer covering it.

In the edit: Explains the transition into and out of the continuous pass.


SHOT 20 / 25 - IF PRESENT

LASER DISABLED FOR CAMERA SETUP

Record any trouble spot

Preserve a visible issue before changing its appearance.

CAMERA	RECORD
B - R50 V	**30 s + still**

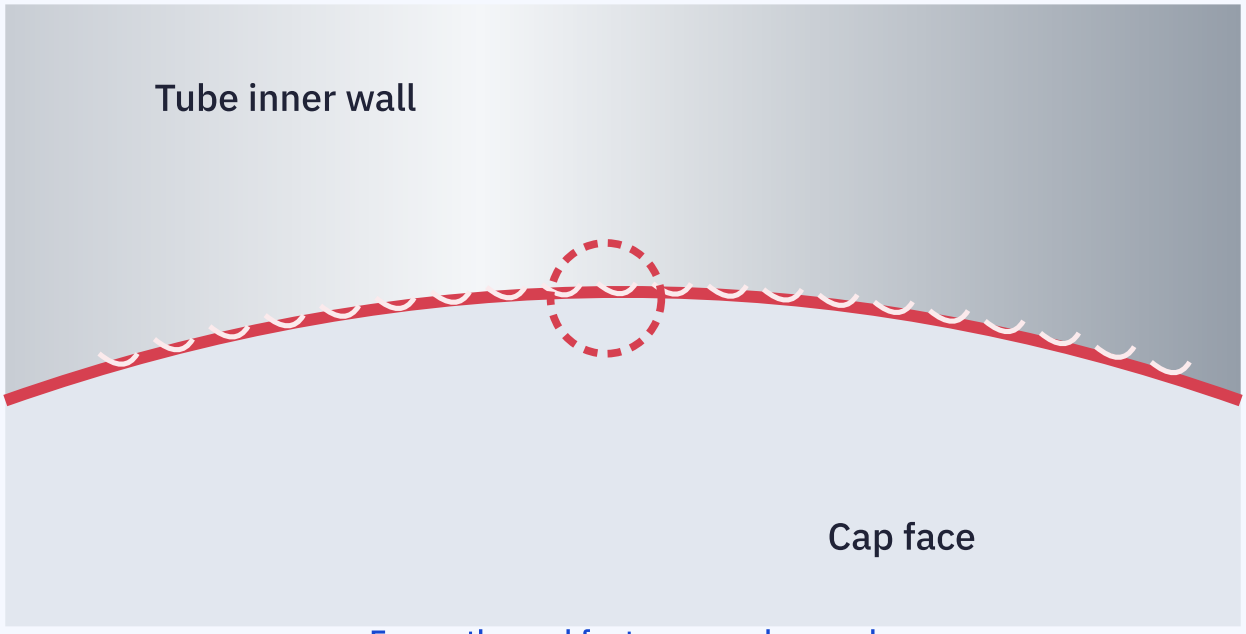

Frame the real feature you observed

5 s settle + 20 s detail + 5 s tail

1. If a real feature needs discussion, first show its position on the whole cap or bead. Keep the laser disabled and wait for safe access.
2. Record a sharp detail with directional light. Hold a clean view before using a separate pointing take.
3. Say what you can see and where it is. Photograph it before dressing or other alteration; follow the governing fabrication procedure for the next action.

KEEP THE TAKE WHEN

The feature has both a locator view and a sharp detail. Skip this page when there is no feature to show.

In the edit: An honest turning point, an inspection explanation or a question for the next attempt.


SHOT 21 / 25 - WHILE THE VESSEL IS OPEN

LASER DISABLED FOR CAMERA SETUP

Record the accessible root

Get the interior view before final closure removes access.

CAMERA	RECORD
B - R50 V	**30 s + still**

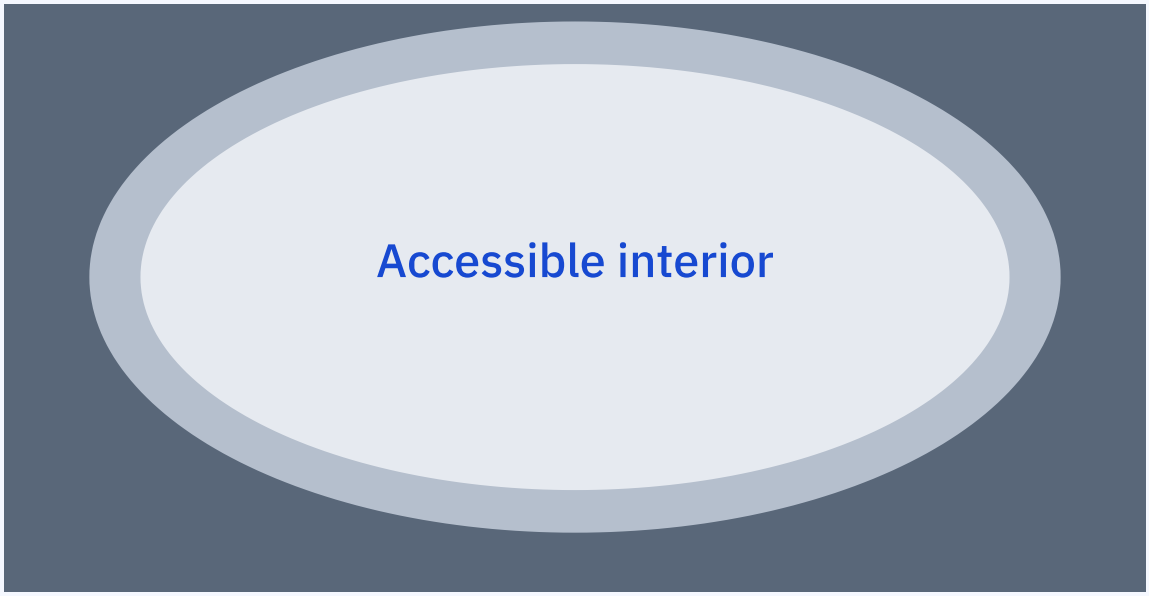

Capture while the opposite end is still open

5 s settle + 20 s view + 5 s tail

1. Capture this as soon as the real interior is accessible and safe to film, before final closure. Follow fabrication order even when this page appears later in the book.
2. Use a light through the open end and aim B at the actual root region. Keep the camera supported outside the vessel and refocus at that surface.
3. Record a wider interior locator, then a useful detail and still if visible. If the surface cannot be seen, keep the explanation within what the footage establishes.

KEEP THE TAKE WHEN

The visible interior is in focus and identifiable. Skip when the vessel is already closed.

In the edit: Shows the accessible underside and why closing order matters.


SHOT 22 / 25 - WHEN INSPECTION OCCURS

LASER DISABLED FOR CAMERA SETUP

Record the real inspection

Let inspection supply its own evidence.

CAMERA	RECORD
A, then B	**As performed**

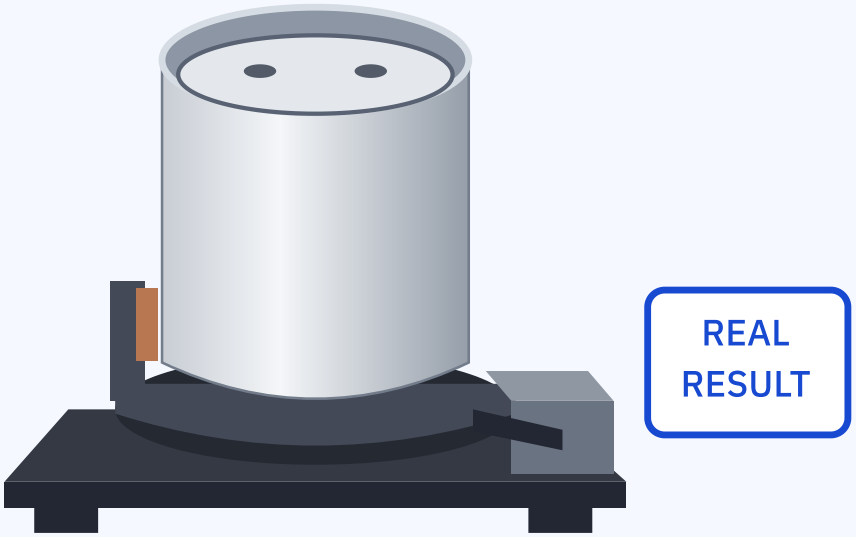

Show the procedure and the observed result

Whole useful event, plus clear result holds

1. Follow the pressure-vessel procedure. Frame the relevant work and instrument from A before the inspection begins.
2. Record the real event. With access safe, use B for the actual surface condition, instrument reading or other observed result.
3. Keep the result identified with this part and attempt. Describe only what the inspection establishes; a visual bead shot alone shows appearance.

KEEP THE TAKE WHEN

The result is legible and its connection to this part is clear. Skip when inspection belongs to a later session.

In the edit: A result sequence with the right scope for its claim.


SHOT 23 / 25 - CLOSING PICTURE

LASER DISABLED FOR CAMERA SETUP

Hold the finished assembly

Give the story a deliberate final image.

CAMERA	RECORD
A - GoPro	**30 s + still**

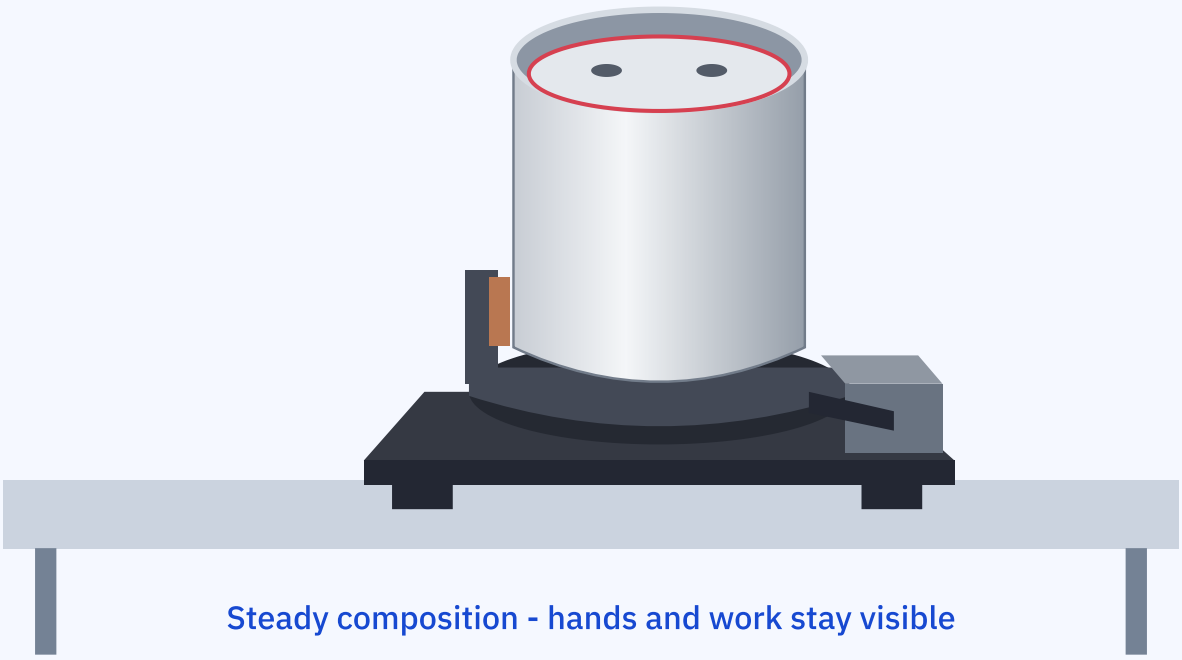

Steady composition - hands and work stay visible

5 s settle + 20 s clear + 5 s tail

1. Set A for a three-quarter view of the tube and rig or safely supported completed article. Remove unrelated objects from the immediate background.
2. Light the metal so the shape and finished joint read clearly. Record twenty seconds with hands out, then a separate take with one slow presentation movement if safe.
3. Take a full-resolution still with clear space near the top for thumbnail text. Keep faces and reflections outside the frame.

KEEP THE TAKE WHEN

The finished object is sharp and the clean hold has no interruption.

In the edit: Closing narration, a thumbnail and a future episode's recap.

SHOT 24 / 25 - REUSABLE B-ROLL

LASER DISABLED FOR CAMERA SETUP

Collect a quiet bench view

Capture a little atmosphere while the lighting is already set.

CAMERA	RECORD
A - GoPro	30 s



5 s settle + 20 s still + 5 s tail

1. Choose an empty lit bench, the waiting tube or prepared tools. Compose one clear subject and keep screens free of private messages.
2. Record twenty seconds without panning, walking through or adjusting the light. The edit can use a gentle crop later.
3. An extra twenty-second dry belt or tube hold can cover a longer explanation. Reuse the useful mechanism shots already captured.

KEEP THE TAKE WHEN

The picture holds continuously and suits a sentence about this work.

In the edit: A pause, title background or relevant picture under voiceover.

SHOT 25 / 25 - SOUND FOR THE EDIT

LASER DISABLED FOR CAMERA SETUP

Record the room tone

Give the audio edit a continuous shop background.

CAMERA	RECORD
DJI audio	**40 s total**



5 s settle + 30 s room tone + 5 s tail

1. Keep the DJI mic at its normal speech position and settings. Start Voice Memos with the shop in its normal safe idle sound state.
2. Wait five seconds, then stay silent and still for thirty seconds. Avoid walking, touching the mic or handling tools.
3. If the background changes substantially, capture that state separately. Save a few isolated pedal clicks and dry motor starts with silence around each.

KEEP THE TAKE WHEN

There are thirty uninterrupted seconds of the matching shop background.

In the edit: Smooths narration cuts and preserves the sound of the room.

FINISH THE SESSION

Save the original files

Keep the footage that makes later explanation possible.

1. Copy the R50 V's original files from its SD card through the card reader, and transfer the original GoPro clips, both at their recorded resolution. Save the original stills and the DJI Voice Memos audio alongside them. Make smaller edit copies separately.
2. Label the useful clips: unwelded joint, disabled head, dry lap, actual attempt, bead before dressing, endpoints, interior and room tone. Identify the closure and attempt number.
3. Keep matching unwelded and finished stills together. Note any actual speed, direction, settings and observations that will matter to narration.

Four voiceover prompts

What was difficult? What did the rotator let you control? What did you actually observe? What comes next? Record the concise answers after watching the footage.

Working references

Weld rotator build guide

Carbonator fabrication guide

The repository procedures hardware/assembly/weld-rotation-rig.md and hardware/assembly/pressure-vessel.md govern fabrication. This filming guide determines camera coverage; record the real procedure in its normal order.

The 48.6-second nominal lap comes from the rotator procedure at 8 mm/s. Record the actual direction and setpoint used. The guide assumes the kit on page 3 and the hands-only, below-shoulder process style requested for this video.