
SIEMENS


Blue Pennant Switchboard

Installation Instructions

Lug Landing Kit
Catalog No. PLL44, PLL46, and PLL48.

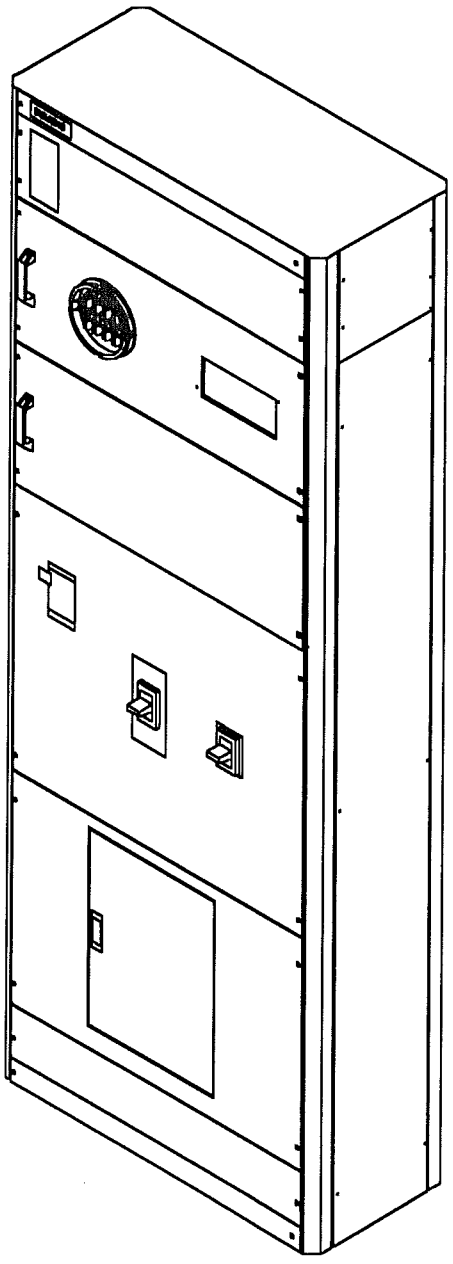

Assembly

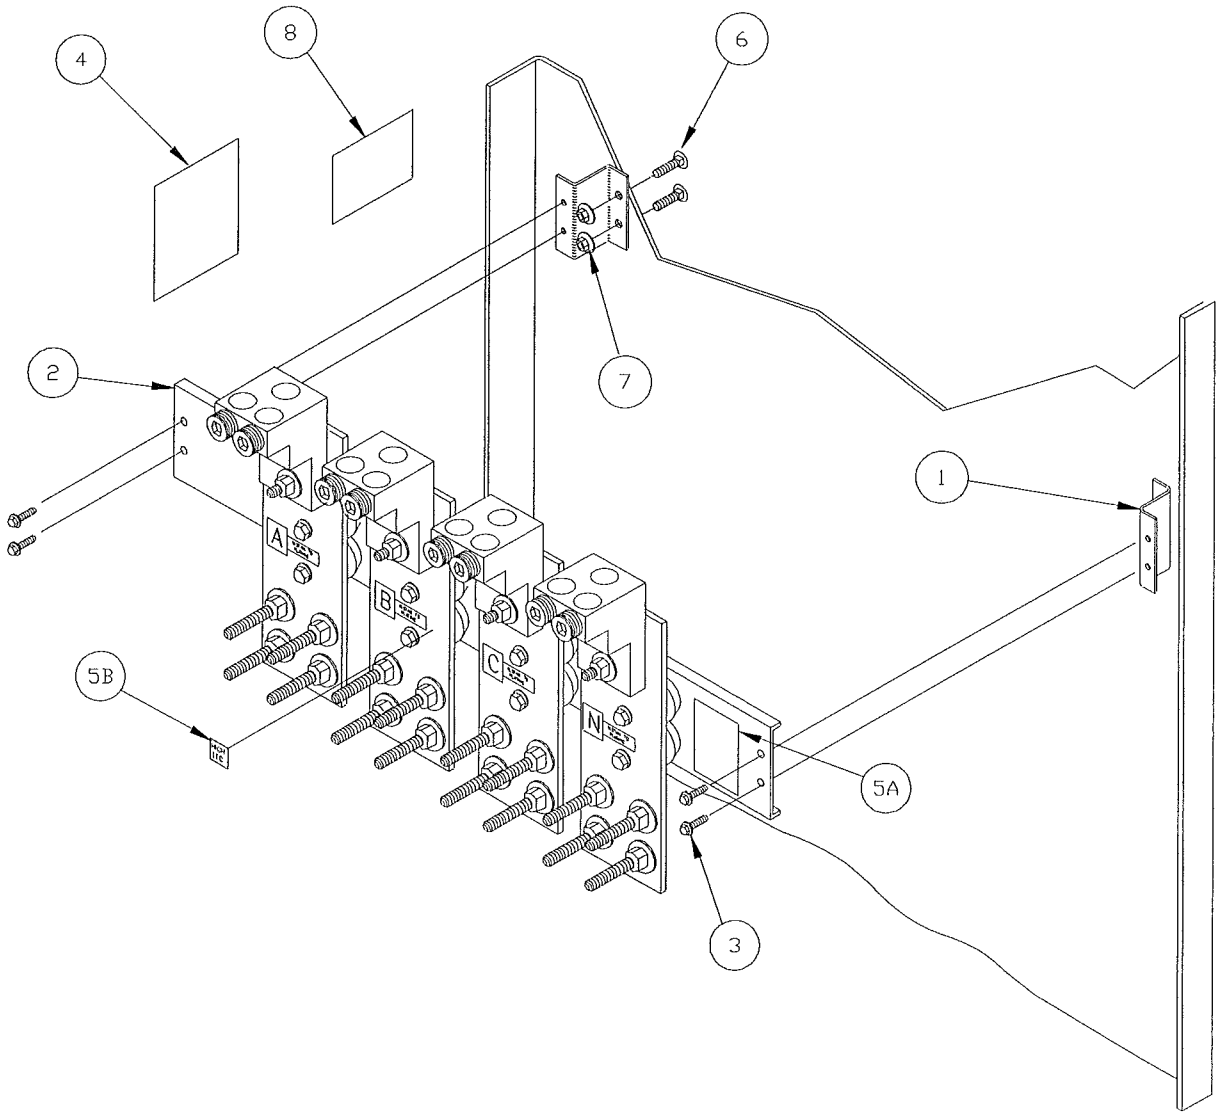


Contents

Key No.	Qty.	Description
1	1	Lug landing support bracket
2	1	Lug landing assembly
3	4	1/4 - 20 x 5/8 slotted hex washer head thread forming screw
4	1	Torque label
5A	2	Delta label (1 for b phase high leg & 1 for c phase high leg)
5B	1	High leg label
6	4	1/4 - 20 x 3/4 round head square neck bolt.
7	4	1/4 - 20 Belleville washer nut.
8	1	Lug landing kit label


The following instructions are for the installation of a lug landing kit in a Siemens type PUG and WPUG underground pull section. The parts provided in this kit will enable the connection of the conductors of a 1 phase 3 wire system, a 3 phase 3 wire system or a 3 phase 4 wire system.

It is important that all parts are oriented as shown. Failure to properly install the parts will cause misalignment of holes and possibly a reduction in the distance required for electrical insulation. Proceed as follows:

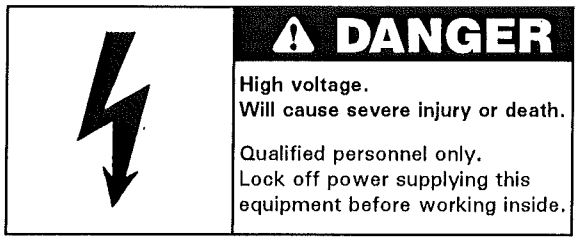

1. Install the lug landing assembly support bracket (1) at the location depicted below. These parts are to be secured to the rear of the pull section with the 1/4 - 20 x 3/4" carriage bolts and nuts provided. The parts are designed in a "Z" shape. The flange with the two 5/16" holes must be placed against the rear of the pull section while the other flange is pointed towards the outside of the pull section.
2. At this time, check the distribution system. If the system is 1 phase 3 wire or 3 phase 3 wire, remove the appropriate phase bar assembly from the lug landing assembly and discard. If the system is 3 phase 4 wire, proceed to step 3.
3. Attach the lug landing assembly to the support bracket installed during step 1 with the lugs facing upwards. To assemble, use the 1/4 - 20 x 5/8" thread forming screw (3) provided.
4. Apply the torque label (4), and the landing lug kit label (8) to the side sheet of the pull section. The torque label contains information on the required tightening torques for the various screws and nuts provided. The kit label displays the amperage rating, wiring configuration and catalogue number of the kit. Both labels should be located so that they will be visible after all cables are installed.
5. If the system being connected is a "High Leg Delta" system, choose the proper delta label and apply to the lug landing assembly where shown (5A). Discard the other delta label. Apply the "High Leg" label (5B) to the high leg phase.
6. Install the cables connecting the lug landing to the switchboard CT compartment lugs. Care must be taken to insure that the cables are connected to the proper phase.
7. For emergency service call 1-800-241-4453.

Location Dimensions

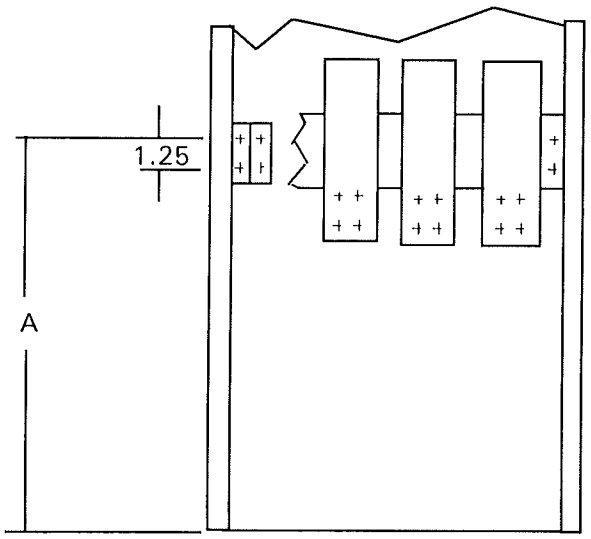

TYPE	A
PUG	48.56
WPUG	50.88