DEADFRONT MODIFICATIONS AND PANEL RE-ASSEMBLY (ref. to Figure 5):

16. Identify the deadfront area that will cover the 6" kit unit space. Measure the unit space locating dimension **D** directly from the deadfront end plate (as shown).

17. Remove any full width plate covering the deadfront area for the kit unit space.

18. For applications where either one or both breaker locations are left empty, locate the provision filler assembly (Item 6) onto the unused mounting location(s) on cover plate (Item 5). Insert two #8-32 x 3/8" screws (Item 12) into the holes in the corners of each filler assembly and thru the corners of the cover plate. On the rear of the filler assembly, place a nut (Item 13) on each of the screws. Tighten the nuts to the torque values on the back of the deadfront.

19. Fasten the deadfront plate (Item 5) with four #8-32 screws (Item 11) to the deadfront side rails.

20. If the installed kit does not completely fill the unit space of removed modules, a deadfront filler plate kit is required to cover unit space where no branch components are installed. Use kit **DFFP3** for 3" gaps and kit **DFFP6** for 6" gaps.

21. Replace the deadfront using the hardware removed during disassembly.

22. Tighten all hardware to the specified torque values on the back of the deadfront.

23. **Before energizing the panel**, ensure that the deadfront, barriers and fillers are all in place and secure, that the panelboard front cover is properly installed and that the door is closed / latched / locked.

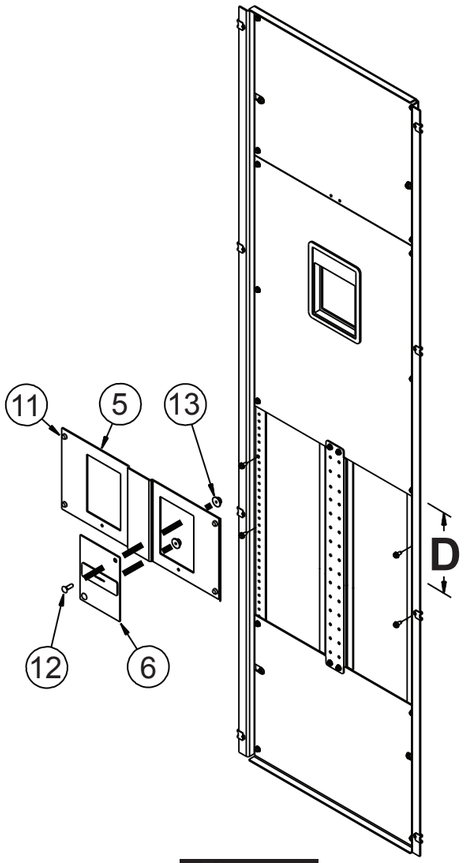


Figure 5

These instructions do not purport to cover all details or variations in equipment, or to provide for every possible contingency to be met in connection with installation, operation or maintenance. Should further information be desired or should particular problems arise, which are not covered sufficiently for the purchaser's purposes, the matter should be referred to the local Siemens sales office. The contents of this Instruction manual shall not become part of or modify any prior or existing agreement, commitment or relationship. The sales contract contains the entire obligation of Siemens. The warranty contained in the contract between the parties is the sole warranty of Siemens. Any statements contained herein do not create new warranties or modify the existing warranty.

Trademarks - Unless otherwise noted, all names identified by ® are registered trademarks of Siemens AG or Siemens Industry, Inc. The remaining trademarks in this publication may be trademarks whose use by third parties for their own purposes could violate the rights of the owner.

SIEMENS

BBKVA52P3T
P3 Panelboard Kit for Branch Mounting of Twin FAS (3VA52) Breakers

Installation Instructions

THESE INSTALLATION INSTRUCTIONS SUPERSEDE THE INSTRUCTIONS PROVIDED WITH THE CIRCUIT BREAKER FOR APPLICATIONS ABOVE 500V.

11-A-1167-01 Rev. 00

Installation Instructions

The following instructions are for the installation of a Siemens **3VA52** branch breaker kit for **250A MAX MFAS, HFAS** and **CFAS** breakers in Type P3 Panelboards. The parts provided in this kit connect a 2-pole **FAS** breaker to a 1-phase, 2 or 3-wire system or a 3-pole **FAS** breaker to a 3-phase, 3 or 4-wire system. This kit requires 6" of branch unit space. The deadfront will need a blank filler plate if this kit does not completely fill the unit space of any removed branch module(s). These deadfront filler kits are **DFFP3** for a 3" gap and **DFFP6** for a 6" gap. The breaker is **NOT** included with this kit and must be purchased separately. Be sure to choose the appropriate breaker for the system in use. For systems with no neutrals, disregard the neutral connection.



THIS KIT CONTAINS THE FOLLOWING ITEMS:

ITEM	DESCRIPTION	QTY	TORQUE
1	FAS P3 Top Barrier	1	N/A
2	FAS A/C-Phase Strap	2	N/A
3	FAS B-Phase Strap	1	N/A
4	350 kcmil Lug	2	N/A
5	P3 Cover Plate	1	N/A
6	Provision Filler Assembly	2	N/A
7	Screw Retainer	6	N/A
8	5/16"-18 x 3/4" Socket Head Screw	6	144 lb-in
9	#8-32 x 3-1/4" SRHMS	4	20 lb-in
10	1/4"-20 x 3/4" Thread-forming Screw	4	50/72 lb-in*
11	#8-32 x 3/8" Hex Washer Head Screw	6	30 lb-in
12	#10-24 x 5/8" RHSNB	4	20 lb-in
13	#10 Lock Nut	4	20 lb-in
14	1/4"-20 x 1" Thread-forming Screw	6	50/72 lb-in*

*** XX/YY lb-in, where XX is for ALUMINUM bus and YY is for COPPER bus**

NOTE: Separate instructions are provided for kit installation for each system and panel type. Each application uses some -- but not all -- of the above listed parts. Instructions for breaker installation are on pg. 3 and for panel re-assembly are on pg. 4.

PREPARE PANEL (ref. to Figure 1):

1. **Lock off all power supplying this equipment before working on it.**
2. Remove the panelboard front cover and deadfront.
3. This kit requires 6" of unit space. Determine the location where the kit is to be installed. The kit locating dimension **D** in Figure 1 must be a multiple of 3" (0", 3", 6", etc.). This measurement can be taken directly from a neutral barrier if present, or from a bus support in panels without a neutral. Note that 0.25" must be added to dimension **D** when taking measurements from the bus support (0.25", 3.25", 6.25", etc.).
4. If an existing branch module occupies the location chosen for this kit, remove all of its devices, components and parts.

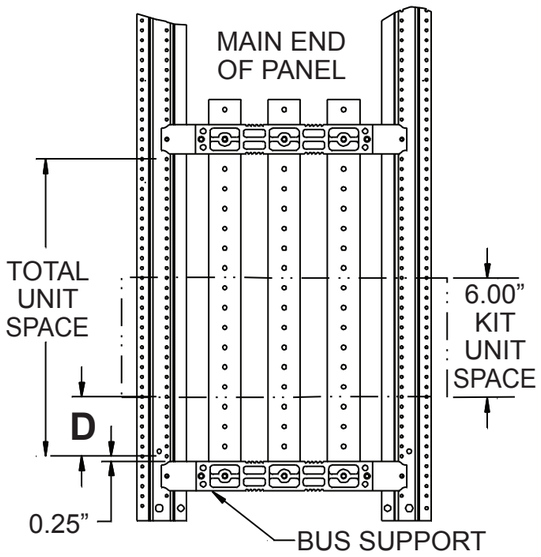


Figure 1

SCREW RETAINER ASSEMBLY (ref. to Figure 2):

5. Install a strap screw (Item 8) into the underside of a screw retainer (Item 7), pushing gently for a snug fit. Ensure that only the screw head is captured by the retainer; the screw washer should NOT be captured in the retainer plastic.
6. Next, slide the screw retainer assembly into a pole on the "ON"-side of the FAS breaker housing. When inserted properly, a gentle click can be heard and/or felt as the retainer clasp engages the breaker.
7. Repeat Steps 5 and 6 as needed (ONCE more for a 2-pole, TWICE more for a 3-pole).

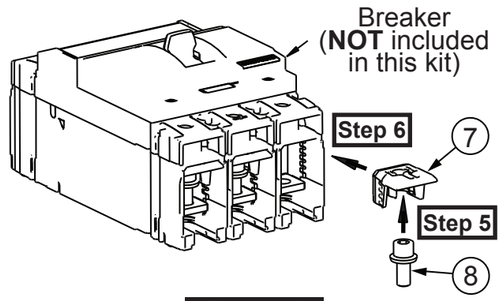


Figure 2

2 or 3-POLE FAS IN 3Ø PANELS (ref. to Figure 3):

FOR 3-POLE BREAKERS ONLY:
Fasten the dual-mount B-phase strap (Item 3) to the B-phase bus, vertically centered in the 6" unit space, using a pair of 1/4"-20 x 1" screws (Item 14).

FOR 2-POLE BREAKERS ONLY:
2-pole breakers will only connect to A and C phase. If connection to other than A and C phase is needed, install A, B and C-phase straps and use 3-pole breakers connecting cables to the required phases.

AFTER the above factors are taken into consideration, follow Steps 8 thru 15.

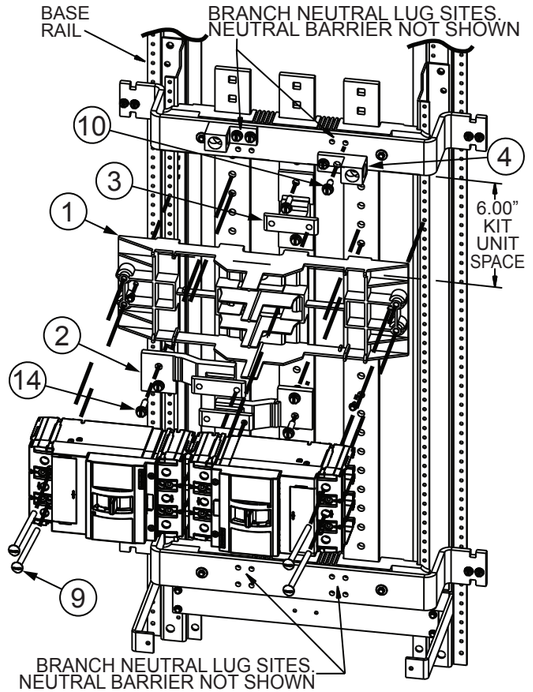


Figure 3

2-POLE FAS IN 1Ø PANELS (ref. to Figure 4):

8. Fasten the top barrier (Item 1) to the base rails in the center of the 6" kit unit space with two #8-32 screws (Item 11).
9. Fasten the two A/C-phase straps (Item 2), oriented as shown, to the panel bus with two 1/4"-20 x 1" screws (Item 14) per strap.
10. Keeping the straps aligned with each other and perpendicular to the panel bus, tighten all screws to the torque values specified on the back of the deadfront (or the table on Page 2).
11. Once all necessary screw retainer assemblies are in place (see Steps 5 thru 7), slide the breaker onto the top barrier (Item 1) so that the barrier's vertical walls penetrate between the "ON"-side poles on the breaker housing.
12. Position breaker properly, aligning the mounting holes on the "OFF"-side of the breaker housing with the top barrier (Item 1) mounting holes. Insert the two breaker mounting screws (Item 9) and hand-tighten for now.
13. Loosely fasten the screws (Item 8) from the retainer assemblies to the straps below them.
14. If this kit is installed in a panel with a neutral, fasten the branch neutral lugs (Item 4) to any of the eight sites on the upper or lower neutral cross bus with four 1/4"-20 x 3/4" screws (Item 10).
15. Tighten all screws to the torque values specified on the back of the deadfront (or the table on pg. 2).

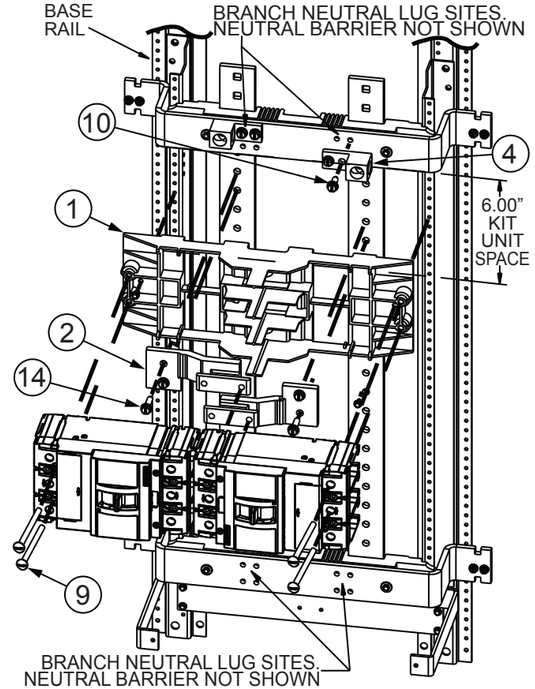


Figure 4

11-A-1167-01 Rev. 00