Fig. 3a
Close-up

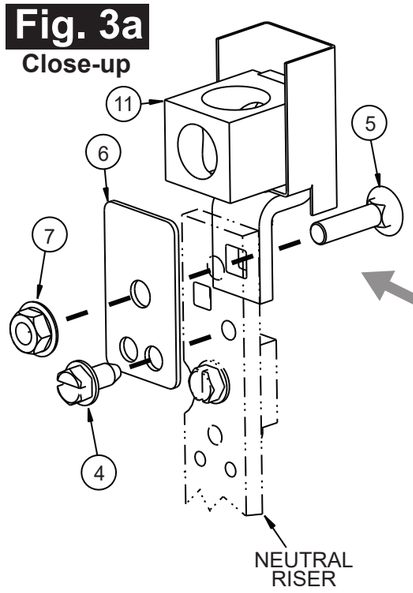


Fig. 3b
Close-up


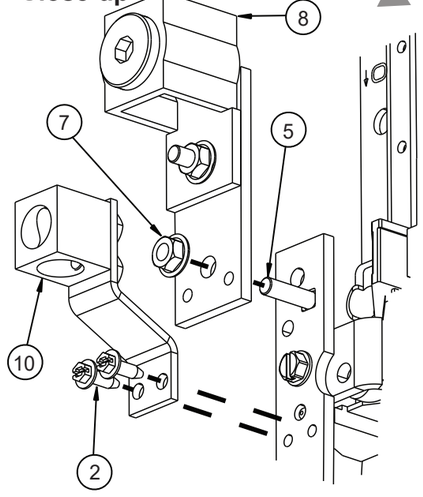


Fig. 3
P1-400
(Deadfront
not shown)

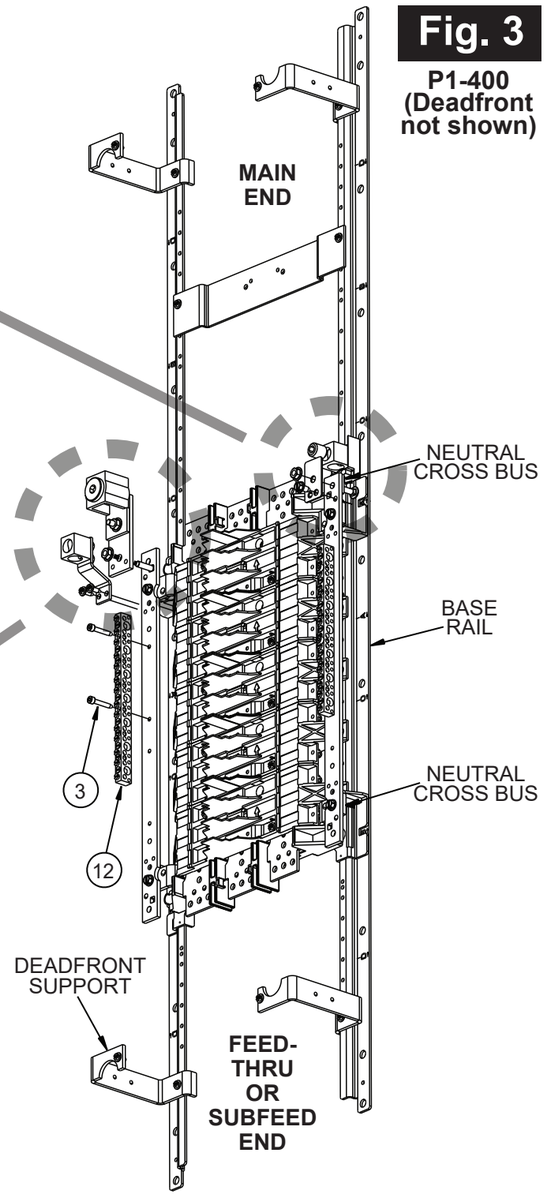

These instructions do not purport to cover all details or variations in equipment, or to provide for every possible contingency to be met in connection with installation, operation or maintenance. Should further information be desired or should particular problems arise, which are not covered sufficiently for the purchaser's purposes, the matter should be referred to the local Siemens sales office. The contents of this Instruction manual shall not become part of or modify any prior or existing agreement, commitment or relationship. The sales contract contains the entire obligation of Siemens. The warranty contained in the contract between the parties is the sole warranty of Siemens. Any statements contained herein do not create new warranties or modify the existing warranty.

Trademarks - Unless otherwise noted, all names identified by ® are registered trademarks of Siemens AG or Siemens Industry, Inc. The remaining trademarks in this publication may be trademarks whose use by third parties for their own purposes could violate the rights of the owner.


SIEMENS

CNLK42B or CNLK54B

Copper Neutral Lug Kit for P1 Panelboards

(for use in Revised P1 Panelboards ONLY) [1]

Installation Instructions

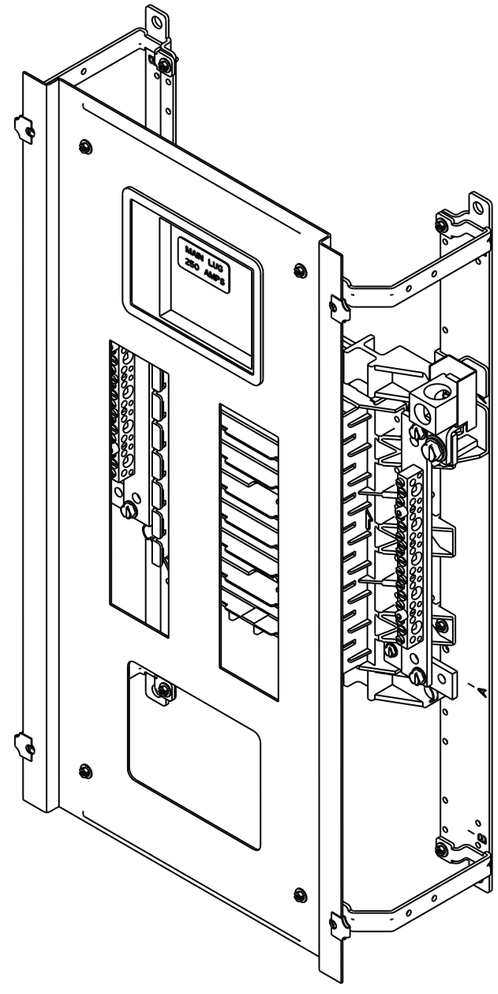

[1] To confirm, note the part number of the panel (marked on the interior label). If it ends in an "N" or a "T" it is a "Revised P1" and is compatible with this kit. (For example: P1E42MC250A is an Original P1; P1E42MC250AT is a Revised P1)

11-B-1033-01 Rev. 00

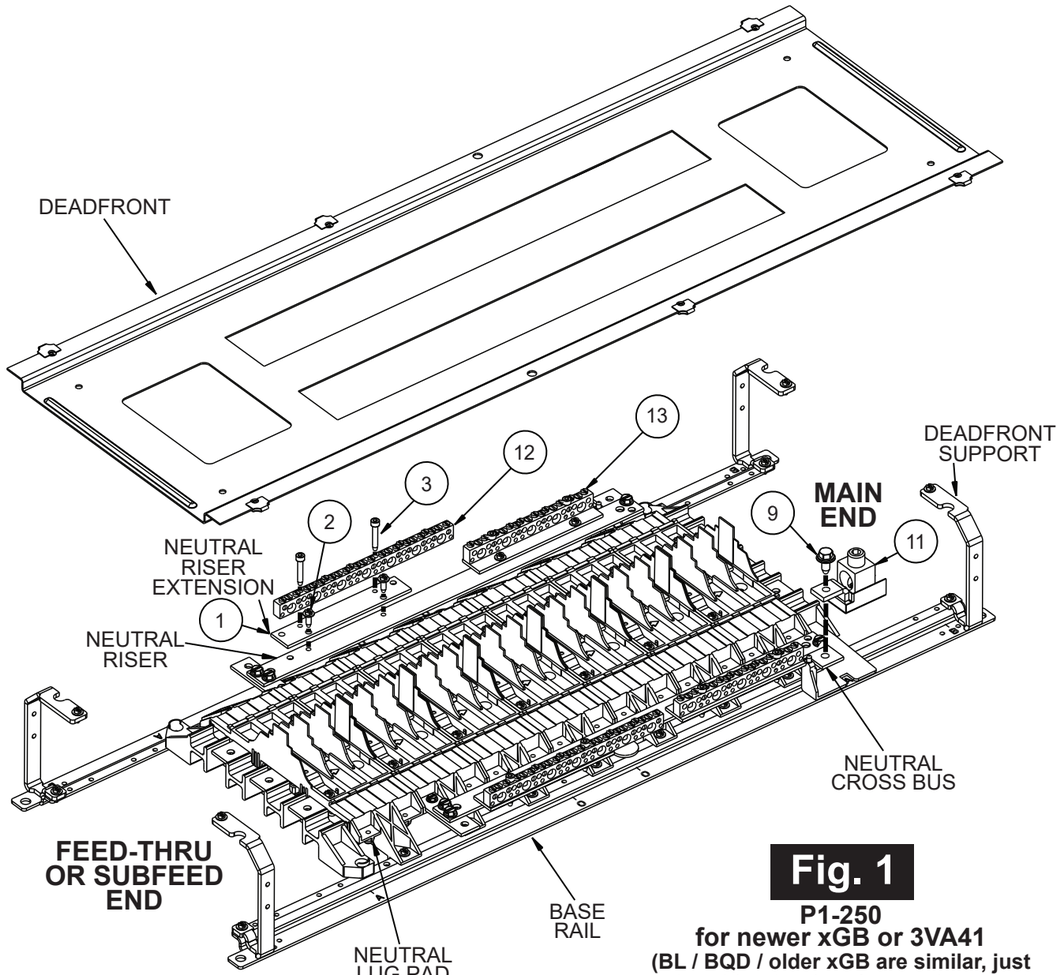


Fig. 1

P1-250
for newer xGB or 3VA41
(BL / BQD / older xGB are similar, just without the Neutral Riser Extensions)

THIS KIT CONTAINS THE FOLLOWING ITEMS:

ITEM	DESCRIPTION	QTY *	TORQUE (lb-in) (by material & thickness) ALUMINUM 3/16"	ALUMINUM 1/4"	COPPER 1/8"	COPPER 3/16"
1	RP1-250 NEUTRAL RISER EXTENSION, COPPER	4	N/A	N/A	N/A	N/A
2	#10-24 x 9/16" HEX WASHER HEAD SCREW, THREAD-FORMING	8 / 10	30	30	25	50
3	#10-24 x 1-1/8" SOCKET CAP SCREW, THREAD-FORMING	8	30	30	25	50
4	1/4"-20 x 1/2" HEX WASHER HEAD SCREW, THREAD-FORMING	1	30	50	50	72
5	1/4"-20 x 1" CARRIAGE BOLT	1 / 2	N/A	N/A	N/A	N/A
6	ANTITURN PLATE	1	N/A	N/A	N/A	N/A
7	1/4"-20 BELLEVILLE WASHER NUT	1 / 2	72	72	72	72
8	600 kcmil LUG ASSEMBLY, COPPER	0 / 1	N/A	N/A	N/A	N/A
9	5/16"-18 THREAD-FORMING SCREW	0 / 1	108	108	72	144
10	RP1 SERVICE GROUND ELECTRODE ASSEMBLY	0 / 1	N/A	N/A	N/A	N/A
11	250A NEUTRAL LUG ASSEMBLY, COPPER	1	N/A	N/A	N/A	N/A
12	NEUTRAL STRIP LUG, COPPER, LONG	2 / 4	N/A	N/A	N/A	N/A
13	NEUTRAL STRIP LUG, COPPER, SHORT	2 / 0	N/A	N/A	N/A	N/A

* If **QTY** has two values (for example: 8 / 10), the first number is for kit **CNLK42B** and the latter is for kit **CNLK54B**

Installation Instructions

The following instructions are for the installation of a Siemens neutral kit in a Revised P1 panelboard. The parts provided in this kit are for connection to a 1-phase 3-wire or 3-phase 4-wire system. The CNLK**B kits are for panels requiring **COPPER** mechanical connectors for 18, 30, 42, 54 or 66-circuits. For RP1-250A, use **CNLK42B** for 18, 30 or 42-circuit systems and **CNLK54B** for 54 or 66-circuit systems. For RP1-400A, use **CNLK54B** for all circuit sizes.



1. **Lock off all power supplying this equipment before working on it.**

2. Remove the deadfront.

3. Remove the existing Neutral Strip Lugs.

4. Install the new Neutral Strip Lugs:
   a. For BL / BQD, older xGB RP1-250 panels or any RP1-400 panels, install the Neutral Strip Lugs (Items 12 & 13) directly onto the Neutral Riser. Do not use Neutral Riser Extensions (Item 1).
   b. For 3VA41 / xGB RP1-250 panels, replace aluminum Neutral Riser Extensions with the copper ones from this kit (Item 1) using #10-24 hardware (Item 2). Install Neutral Strip Lugs (Items 12 & 13) onto the copper Neutral Riser Extensions.
   c. Use #10-24 x 1-1/8" hardware (Item 3) to fasten Neutral Strip Lugs to riser or the extensions.

For RP1-250 (refer to Figure 1):

5. Replace the line or main connector with the one 250A copper lug assembly (Item 11) provided. FEED-THRU or SUBFEED: Does not matter to which end of the panel the connector is mounted. NON FEED-THRU or SUBFEED: Install at main end ONLY in a panel without feed-thru or subfeed space. Position lug sub-assembly (Item 11) on top of the Neutral Cross Bus and attach with a 5/16"-18 thread-forming screw (Item 9).

For RP1-400 (refer to Figure 3):

5a. Main Lug (Item 8) - Determine which of the line neutral lug positions require the copper 600 kcmil lug to be installed. If there is an existing lug mounted there, remove it. Insert the 1/4"-20 x 1" carriage bolt (Item 5) through the square hole on the neutral riser from below, then place the 600 kcmil copper neutral lug assembly (Item 8) as shown. Finish installation using the 1/4"-20 belleville washer nut (Item 7). (Refer to Fig. 3b.)

5b. Service Ground Electrode Lug (Item 10) -- if required for service equipment applications -- position the lug assembly on top of the Neutral Riser and align the two thru-holes with those on the riser. Fasten using two #10-24 x 9/16" thread-forming screws (Item 2). (Refer to Fig. 3b.)

5c. 250A copper lug assembly (Item 11) - position lug assembly under the Neutral Riser and insert carriage bolt (Item 5) from beneath, as shown. Place the anti-turn plate (Item 6) onto the protruding stud and secure using the 1/4"-20 belleville washer nut (Item 7). Finish by installing one 1/4"-20 x 1/2" screw (Item 4) through the anti-turn plate into the riser. (Refer to Fig. 3a.)

6. Torque all connections to the values specified on the Hardware Tightening Torque label affixed to the rear of the deadfront.

7. Attach main cables to the lugs and branch cables to the Neutral Strip Lugs and torque all connections to the values specified on the device. If no values are specified, refer to the Hardware Tightening Torque label affixed to the rear of the deadfront.

8. **Before energizing the panel, ensure that all connections have been properly torqued, that the deadfront is installed and that all fillers are in place.**

11-B-1033-01 Rev. 00