
Fig. 3

P1-250
(for reference, without Neutral Riser Extensions)
(Deadfront not shown)

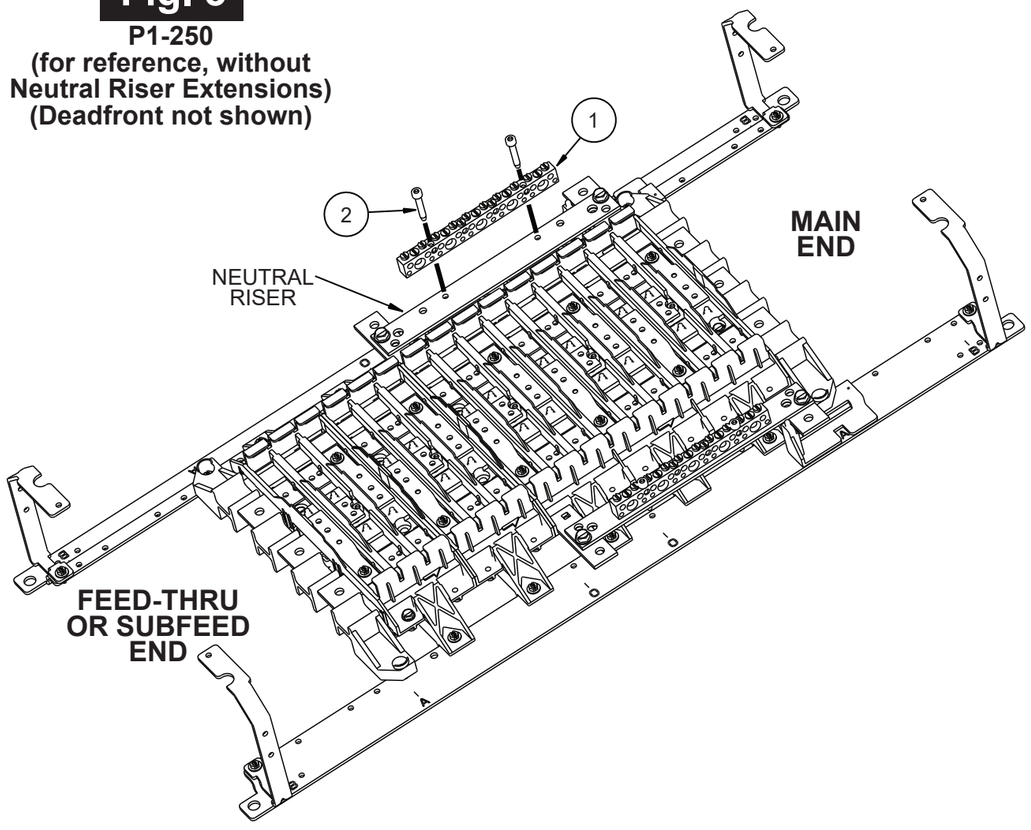

These instructions do not purport to cover all details or variations in equipment, or to provide for every possible contingency to be met in connection with installation, operation or maintenance. Should further information be desired or should particular problems arise, which are not covered sufficiently for the purchaser's purposes, the matter should be referred to the local Siemens sales office. The contents of this Instruction manual shall not become part of or modify any prior or existing agreement, commitment or relationship. The sales contract contains the entire obligation of Siemens. The warranty contained in the contract between the parties is the sole warranty of Siemens. Any statements contained herein do not create new warranties or modify the existing warranty.

Trademarks - Unless otherwise noted, all names identified by ® are registered trademarks of Siemens AG or Siemens Industry, Inc. The remaining trademarks in this publication may be trademarks whose use by third parties for their own purposes could violate the rights of the owner.


SIEMENS

LNLK5X12A or LNLK7X18A

1/0 Neutral Lug Kit for P1 Panelboards

(for use in Revised P1 Panelboard configurations ONLY) [1]

Installation Instructions

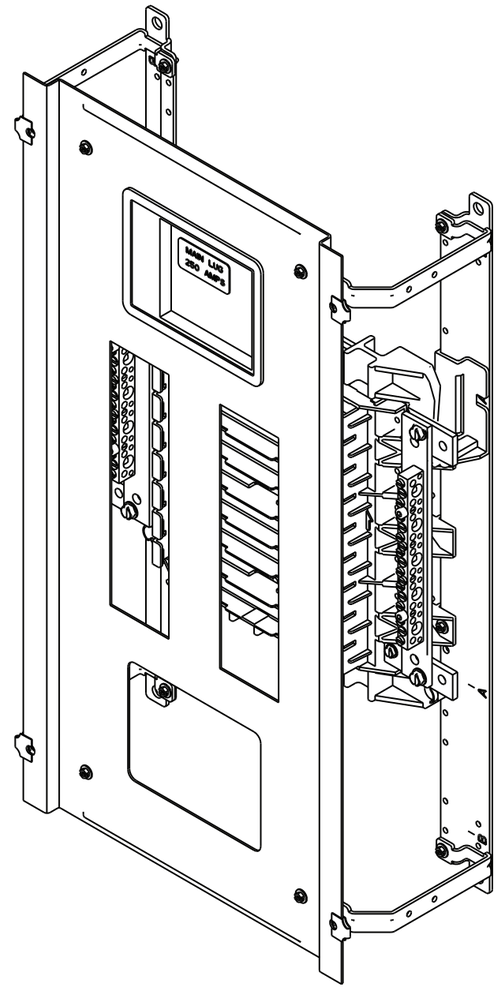

[1] To confirm, note the part number of the panel (marked on the interior label). If it ends in an "N" or a "T" it is a "Revised P1" and is compatible with this kit. (For example: P1E42MC250A is an Original P1; P1E42MC250AT is a Revised P1)

11-B-1036-01 Rev. 00

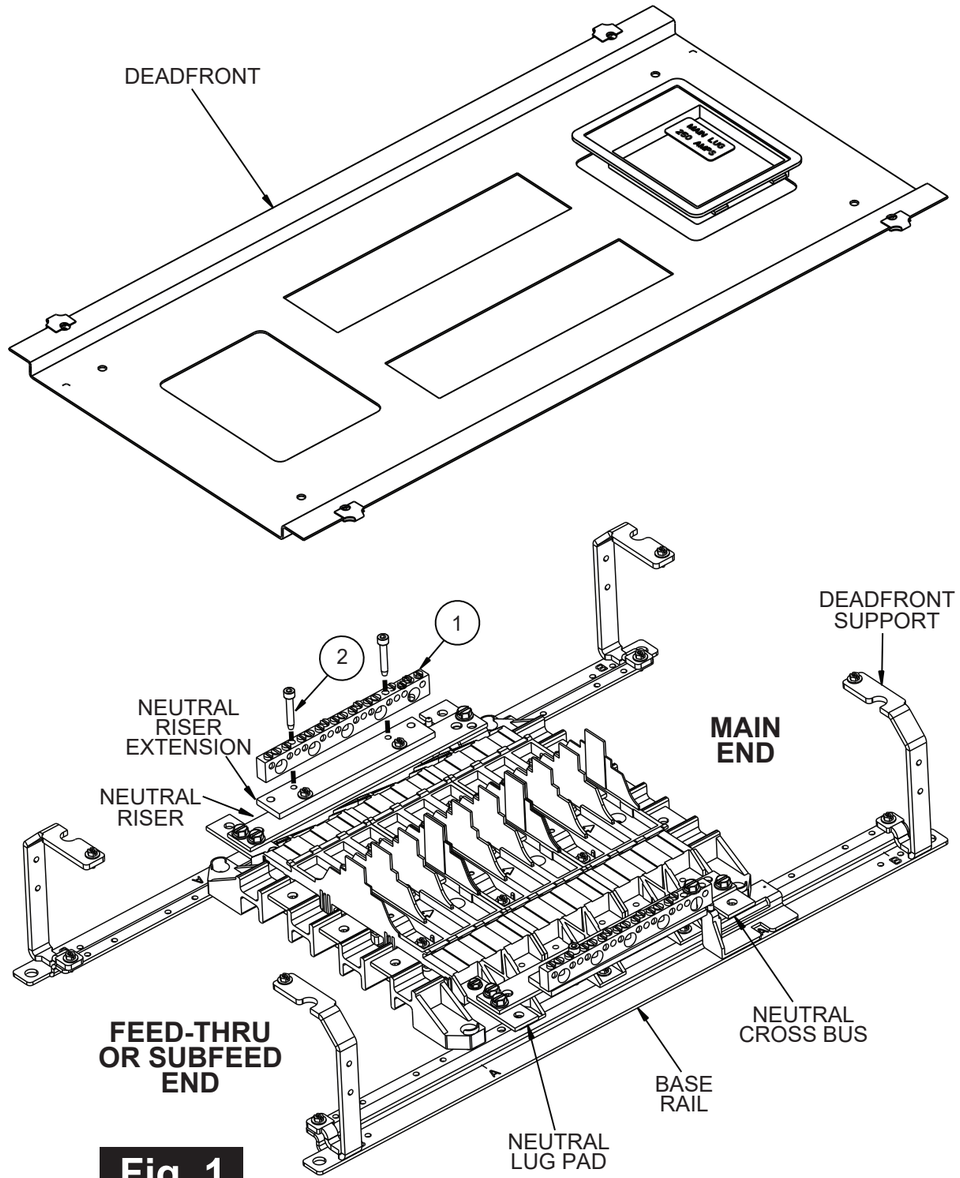


Fig. 1

P1-250
(for reference, with Neutral Riser Extensions)

THIS KIT CONTAINS THE FOLLOWING ITEMS:			TORQUE (lb-in) (by material & thickness)			
			ALUMINUM		COPPER	
ITEM	DESCRIPTION	QTY	3/16"	1/4"	1/8"	3/16"
1	1/0 NEUTRAL STRIP LUG	2	N/A	N/A	N/A	N/A
2	#10-24 x 1-1/8" SOCKET CAP SCREW, THREAD-FORMING	4	30	30	25	50

Installation Instructions

The following instructions are for the installation of a Siemens neutral kit in a Revised P1 panelboard. The parts provided in this kit are for connection to a 1-phase 3-wire or 3-phase 4-wire system. The **LNLK*X**A** kits are for panels requiring 1/0 mechanical connectors.



1. **Lock off all power supplying this equipment before working on it.**

2. Remove the deadfront.

3. Remove the existing Neutral Strip Lugs and replace with 1/0 Neutral Strip Lugs (Item 1) and hardware (Item 2) provided in this kit.
   NOTE: RP1-250 panels with Neutral Riser Extensions must have the 1/0 Neutral Strip Lugs attached to the Neutral Riser Extensions as shown in Fig. 1.
   RP1-250 panels WITHOUT Neutral Riser Extensions and RP1-400 panels have the 1/0 Neutral Strip Lugs mount directly to the Neutral Riser as shown in Fig. 2 & 3.

4. Torque all connections to the values specified on the Hardware Tightening Torque label affixed to the rear of the deadfront.

5. Attach branch cables to the Neutral Strip Lugs and torque all connections to the values specified on the device. If no torque values are specified on the connectors, refer to the Hardware Tightening Torque label affixed to the rear of the deadfront.

6. **Before energizing the panel, ensure that all connections have been properly torqued, the deadfront is installed and that all fillers are in place.**

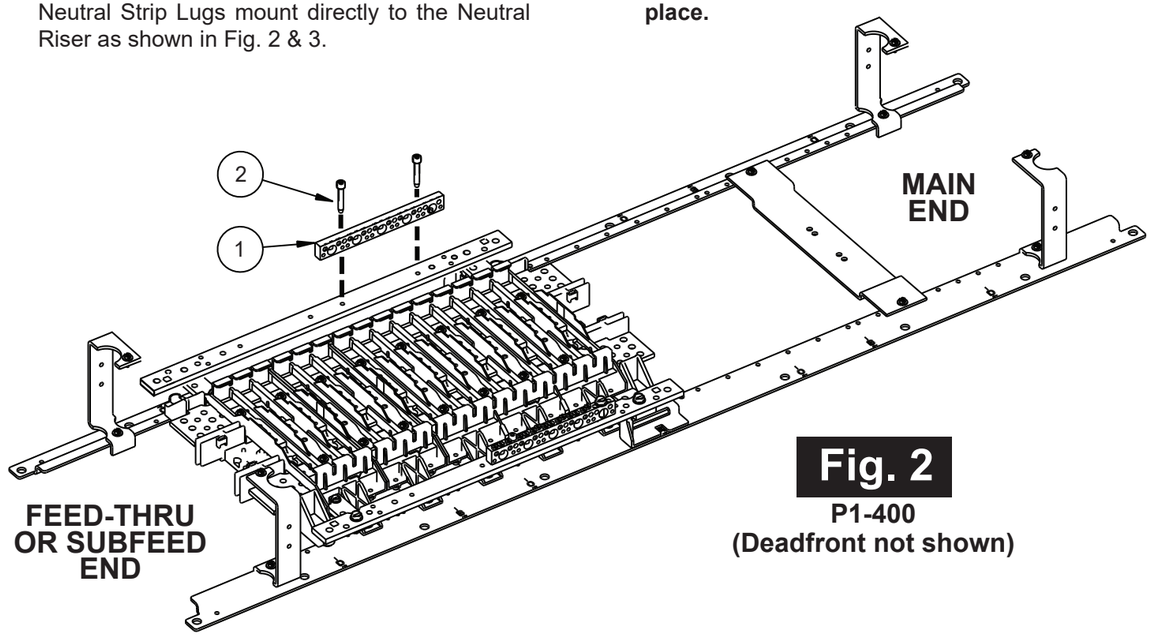


Fig. 2

P1-400
(Deadfront not shown)

11-B-1036-01 Rev. 00