TABLE OF CONTENTS

TABLE OF CONTENTS 1
TABLE OF FIGURES 2
PRODUCTION BOARD TEST PLAN 3
HOW TO DONWLOAD NECESSARY TOOLS 3
REQUIRED SOFTWARE TOOLS 3
REQUIRED HARDWARE TOOLS 3
HOW TO INSTALL THE TOOLS? 4
HARDWARE INSTALLATION 4
HOW TO USE THE TEST TOOLS 5
HOW CAN WE MAKE A TEST? 6
SETTING UP THE HARDWARE 6
HOW TO INSTALL AND CONFIGURE TWINCAT 7

TABLE OF FIGURES

Figure 1 Headers to interconnect Control Board and Interface Board 4
Figure 2 Image showing power input headers 4
Figure 3 On-board LED showing power state 4
Figure 4 Programming header and connections 5
Figure 5 Stepper motor connection headers 6
Figure 6 TwinCAT Start Page Menu View 7
Figure 7 Window showing compatible Ethernet Devices 7
Figure 8 Image showing driver successfully installed 8
Figure 9 Network settings properties option 8
Figure 10 Networking item view 8
Figure 11 Image showing option from where TwinCAT can be started in Run Mode 9
Figure 12 BIOS Menu in an HP System 9
Figure 13 Virtualization Technology (VTx) checkbox image 10
Figure 14 Screenshot showing location of Activate Configuration 10
Figure 15 Generate License Prompt Box 10
Figure 16 Screenshot showing login screen 11
Figure 17 Start button in TwinCAT 11
Figure 18 Main control window for testing firmware 11

PRODUCTION BOARD TEST PLAN

HOW TO DONWLOAD NECESSARY TOOLS

This section will cover the basic requirements from both software and hardware perspective which will allow us to power up the board, load the firmware and then test it.

REQUIRED SOFTWARE TOOLS

1. J-Link Commander (Select 32-bit Installer or 64-bit Installer depending on your OS)
2. J-Link serial port drivers (Although these are installed automatically upon plugging in, if not, please do a manual install)
3. TwinCAT (For sending EtherCAT commands)

REQUIRED HARDWARE TOOLS

1. Interface Board and Control Board PCBs
2. Power Supply 24V, 3A
3. J-Link Probe
4. J-Link probe converter (will be provided by eSpark for easy firmware upload)
5. Stepper Motor

HOW TO INSTALL THE TOOLS?

HARDWARE INSTALLATION

To install the hardware and make it ready for firmware upload, following steps are required:

1. Connect Interface Board with Control Board using interconnect jumpers provided on both boards as shown below

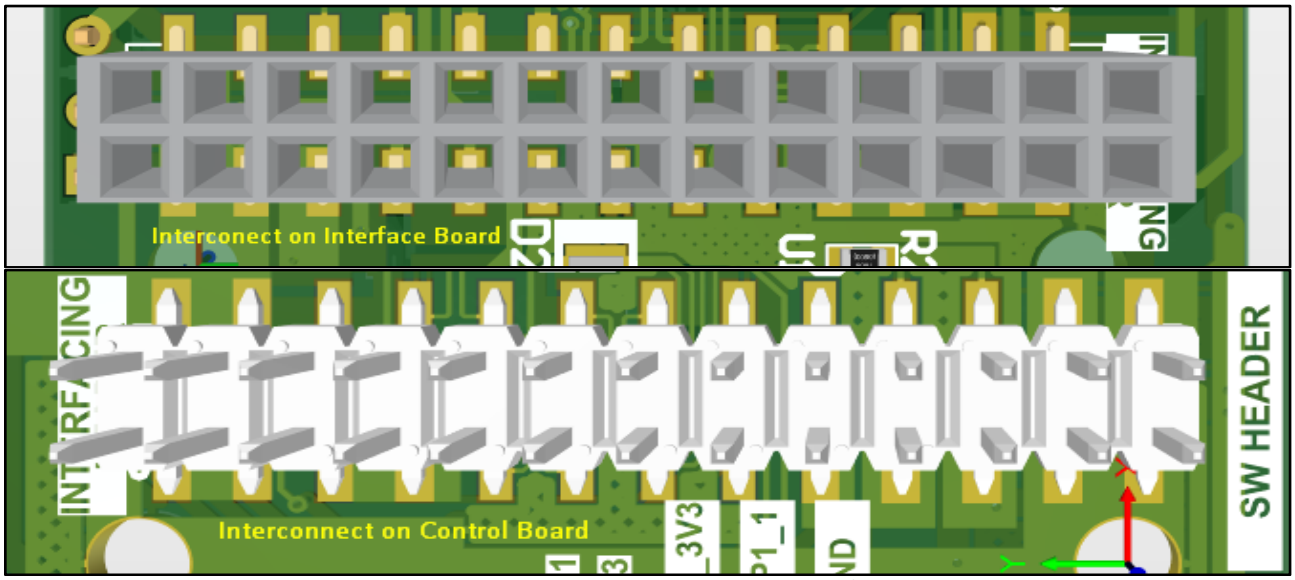


Figure 1 Headers to interconnect Control Board and Interface Board

2. Power up the board using adequate power supply mentioned in specifications above. The power input is to be applied on the headers shown in image below:

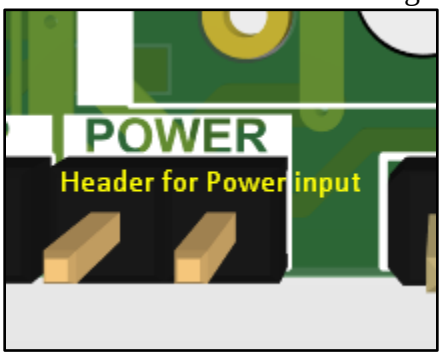


Figure 2 Image showing power input headers

3. Once the board is successfully powered up, an on-board test LED on the **Control Board** will light up indicating successful power up as shown below



Figure 3 On-board LED showing power state

4. Connect the provided J-link probe to the programming header as shown in the image below:

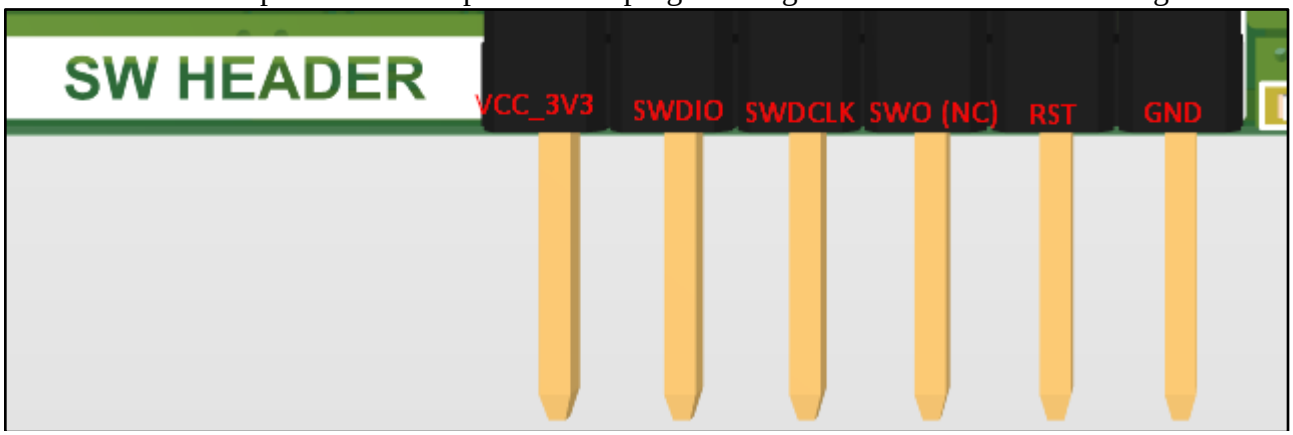


Figure 4 Programming header and connections

5. Once the programming probe is connected, launch **J-Link Commander** and run the **connect** command and choose **SWD interface with default settings**.
6. If the connection is successful, this means the processor is alive and working well.

HOW TO USE THE TEST TOOLS

1. After successfully connecting with the hardware using J-Link Commander, upload the provided **Final_Test.elf** file which is the final compiled code file for the project. To do this, run the command:

```
LoadFile <FileName> [<Addr(.bin only)>] [<noreset | reset>]
      loadfile <path\to\provided\elf\file> (Example)
```

2. After successful upload, the J-Link Commander will show **successfully loaded**.

HOW CAN WE MAKE A TEST?

SETTING UP THE HARDWARE

In order to prepare a test, follow the steps below:

1. Connect the stepper motor to the header labeled **MOTOR OUT**. Connections are also enlisted starting from left side:

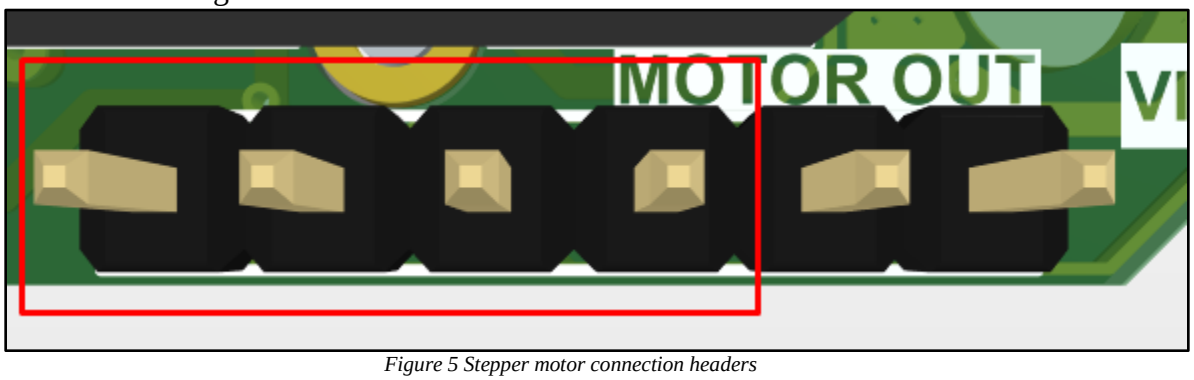


Figure 5 Stepper motor connection headers

   a. **MOTOR_A1 (Motor coil A1)**
   b. **MOTOR_A2 (Motor coil A2)**
   c. **MOTOR_B1 (Motor coil B1)**
   d. **MOTOR_B2 (Motor coil B2)**

2. Once the connections are done, power up the board and connect the Ethernet cable from **PC** to the board.
3. Observe the commands behavior of board on the **TwinCAT** software

HOW TO INSTALL AND CONFIGURE TWINCAT

1. Run the installation file.
2. The on-screen menu will guide with the installation process. Please note that we have to select **Complete Installation** option.
3. Once the installation is complete, launch TwinCAT software and go to **TwinCAT > Show Realtime Ethernet Compatible Devices…**

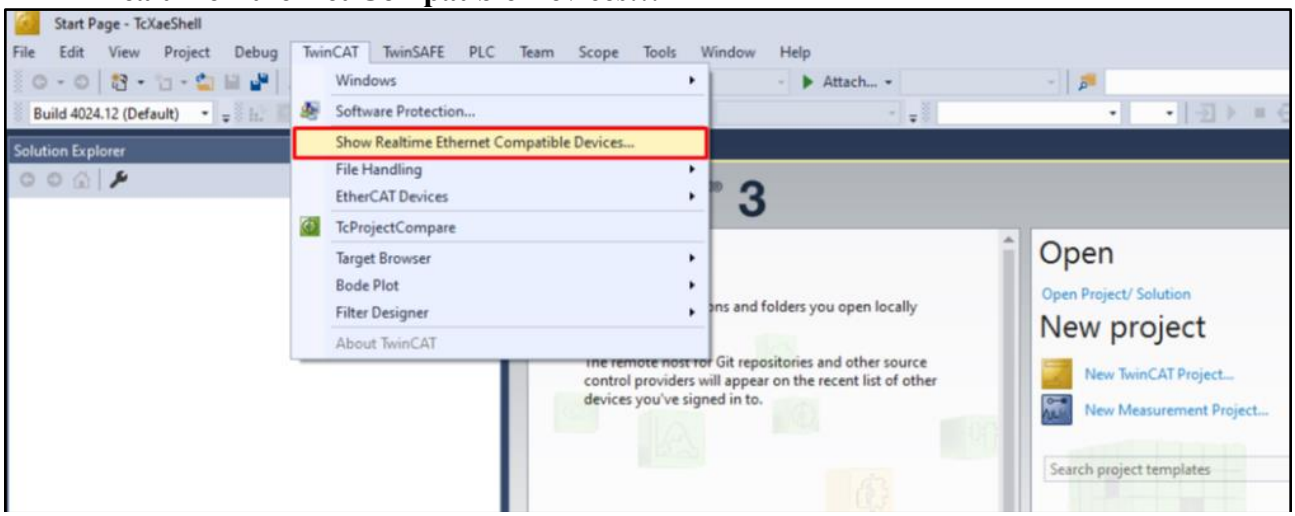


Figure 6 TwinCAT Start Page Menu View

4. The following window will open. Select the driver as shown and click **Install**

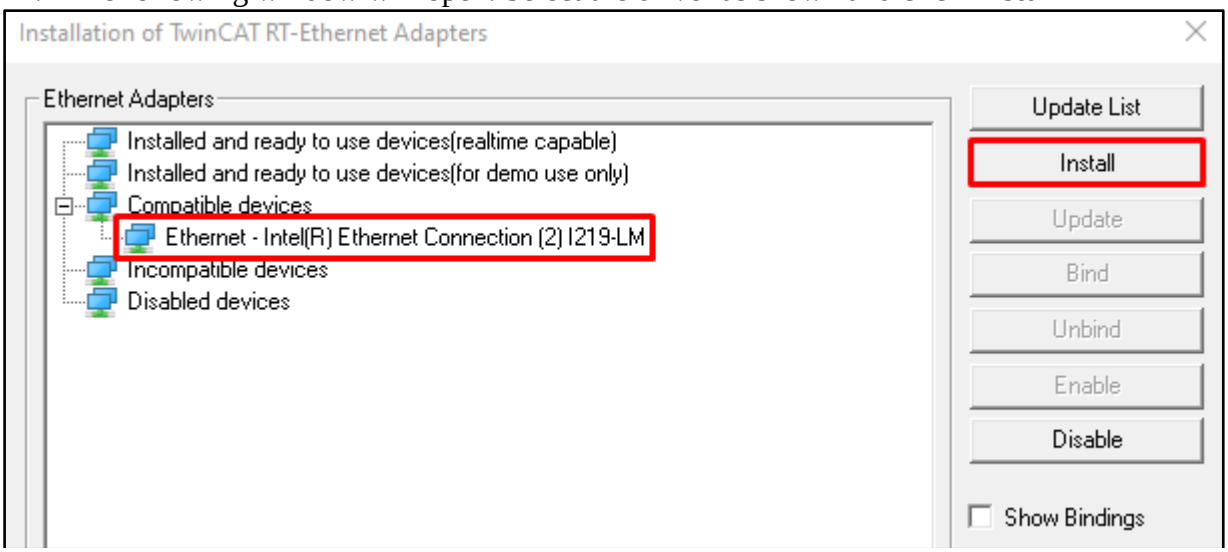


Figure 7 Window showing compatible Ethernet Devices

5. Once the driver is successfully installed, it will appear under installed devices as shown below:

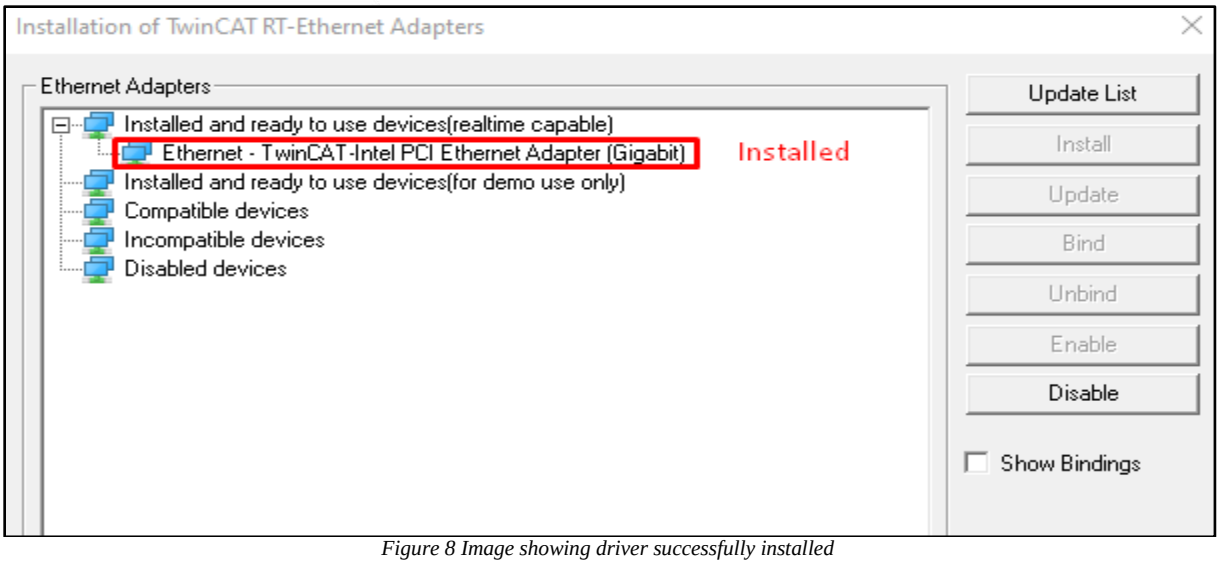


Figure 8 Image showing driver successfully installed

6. After verifying in TwinCAT, go to **Network Settings** in computer and open **Properties**

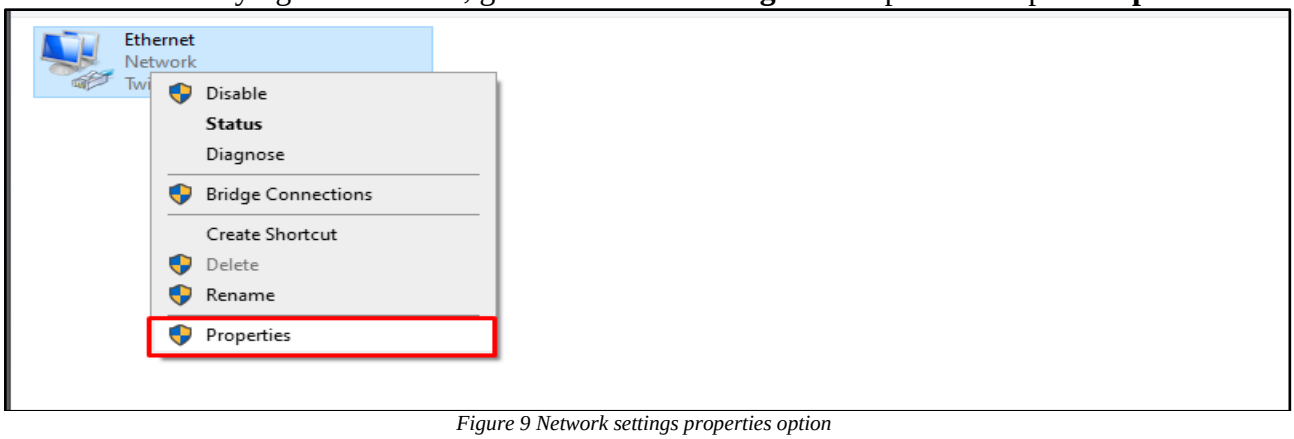


Figure 9 Network settings properties option

7. Disable all the items and only allow **TwinCAT Ethernet Protocol** to remain enabled

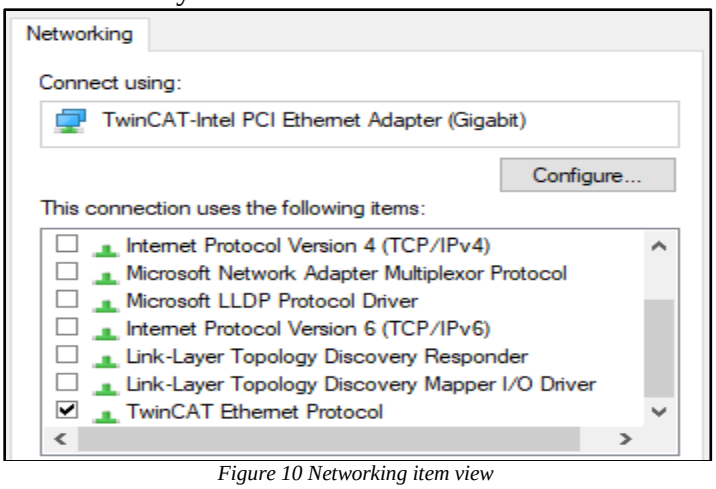


Figure 10 Networking item view

8. Open the provided **SendData TwinCAT Project**. The project file is located in the main

folder as **SendData.sln**. Please make sure the project is opened using **TwinCAT XAE Shell Software only**.

9. Once the project is opened, click the **Restart TwinCAT System** button as shown in the image below. This will restart TwinCAT in **Run Mode**.

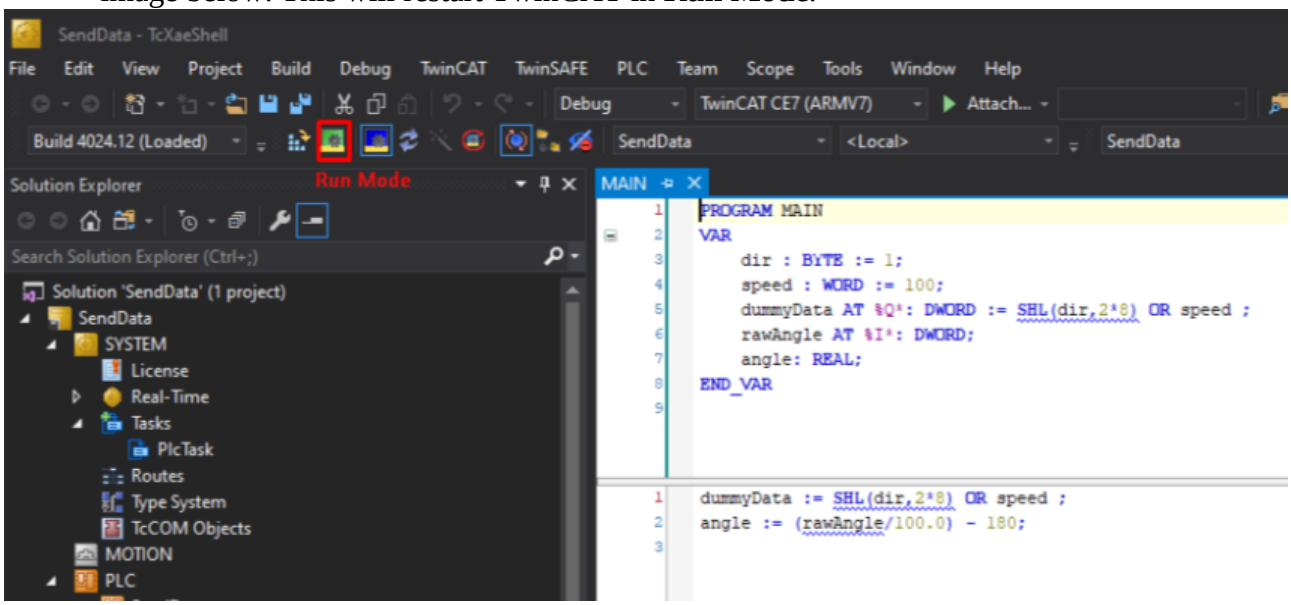


Figure 11 Image showing option from where TwinCAT can be started in Run Mode

10. If the system responds with following two errors, this means vt-x is disabled and has to be enabled from BIOS.
11. The setup assumes an **HP System** for explaining how to enter and enable vt-x (virtualization) from **BIOS**. When the computer restarts, press **ESCAPE** key to enter **BIOS Menu**.
12. Once inside the menu, the following options will appear:

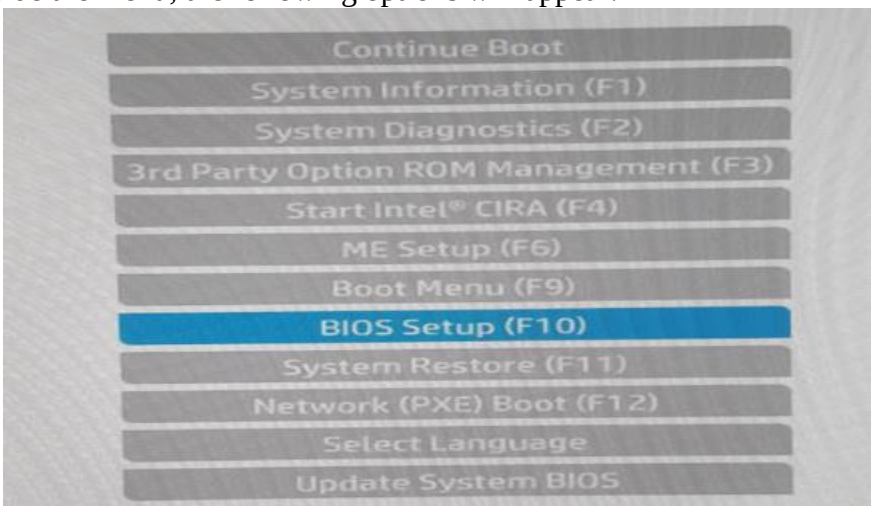


Figure 12 BIOS Menu in an HP System

13. Go to **Advanced > System Options** and enable **Virtualization Technology (VTx)**.

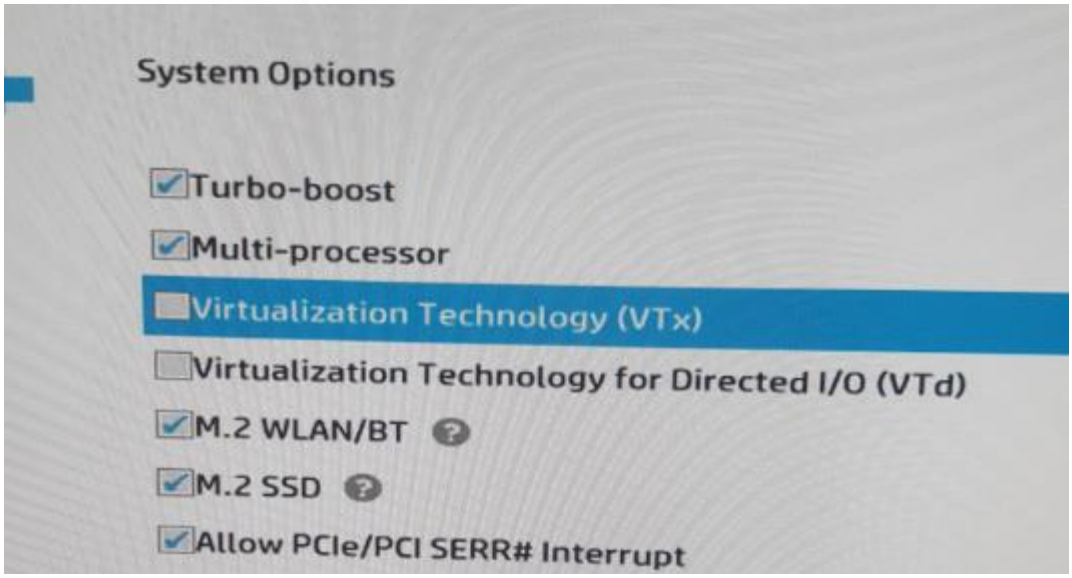


Figure 13 Virtualization Technology (VTx) checkbox image

14. After this, when windows opens, Go to **C:\TwinCAT\3.1\System** and find **win8settick.bat**. Run is as **Administrator** and reboot the machine.
15. When PC restarts again, launch **TwinCAT XAE Shell** and click on **Activate Configuration** as shown in the image below:

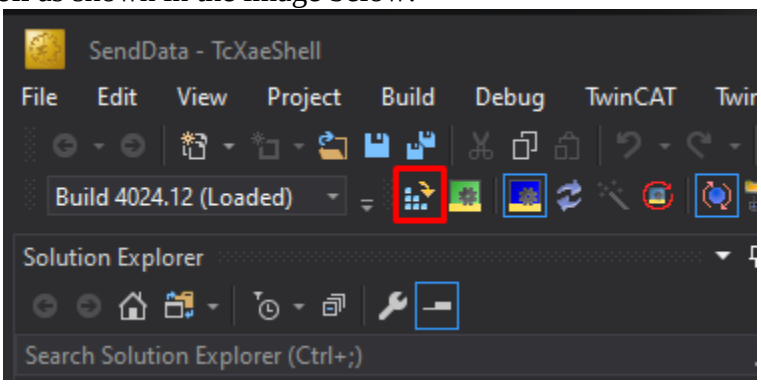


Figure 14 Screenshot showing location of Activate Configuration

16. A prompt will appear asking for generation of licenses. Click **Yes** to proceed.

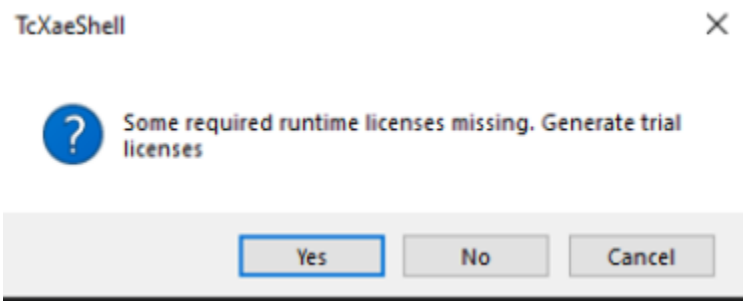


Figure 15 Generate License Prompt Box

17. Enter **Security Code** and press **O.K.** to proceed. After this, place the shared configuration

file **LAN9255.xml** at following location **C:\TwinCAT\3.1\Config\Io\EtherCAT**

18. After file placement, restart **TwinCAT XAE Shell** and repeat **Step 9**. After TwinCAT restarts, click **Login** as shown:

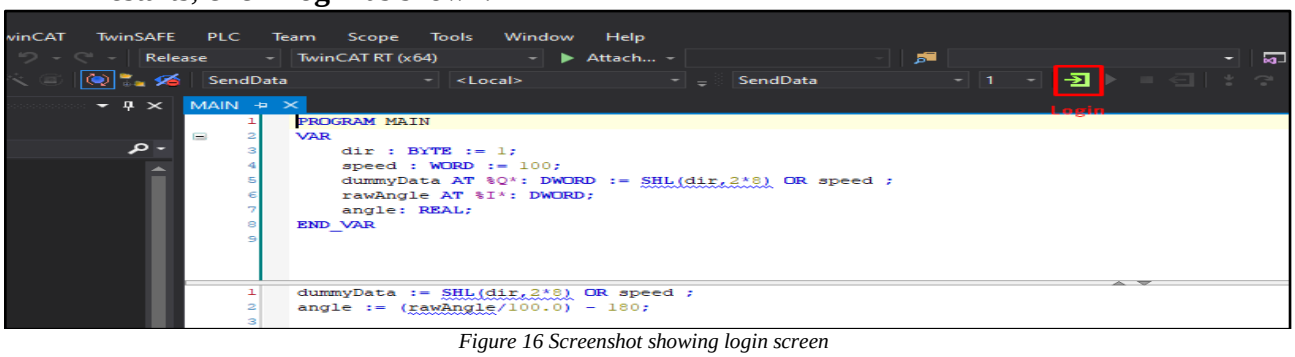


Figure 16 Screenshot showing login screen

19. After that, click **Start** button.

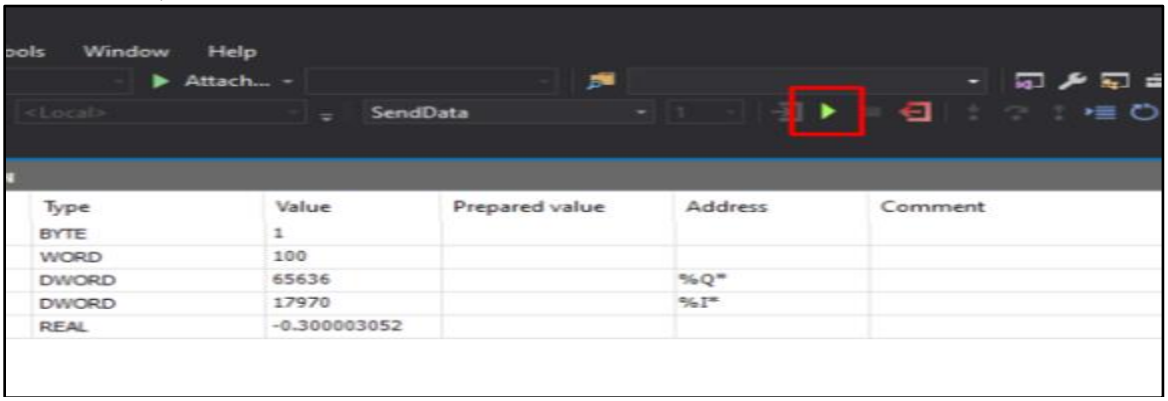


Figure 17 Start button in TwinCAT

20. Now you can control speed and direction by preparing it for another value and then write the values and simultaneously receive motor position in the angle variable

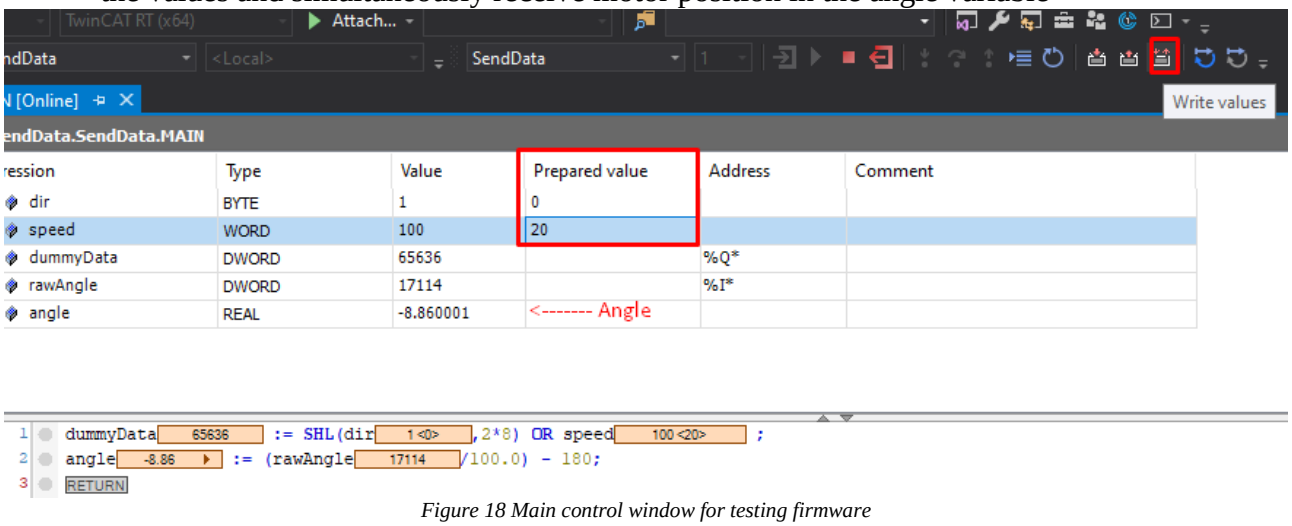


Figure 18 Main control window for testing firmware