
LienCAM Setup Sheet


Program: "03_Soft_jaws.gcode"
Units: mm

Setup: "Jaw 1 - G54" (G54)
  Work offset origin: X0 Y0 Z16 mm
  Stock: "Stock 1" size 80 x 18 x 16 mm
  Origin offset from stock min corner: X0 Y0 Z16 mm
  Workholding:
    Method: Vise
    Note: "Starter demonstration vise: jaw 1, 80 x 18 x 16 mm blank at Y 0 mm, G54. Close the vise on a 20 mm spacer below Z 8 mm. Secure both jaw blanks in place of the hard jaws before facing and cutting the grip recess. Mounting features: two 3 mm holes at local X 20 and 60, Y 3 mm, and 6 mm counterbores, 3 mm deep below the faced top. The holes clear the support ledge; vertical bolts span the gap to the vise base. Use temporary clamps clear of the paths while machining mounting features; spindle stopped and parked before fitting bolts. This demonstration vise uses vertical mounting; adapt hole locations to the actual vise. Keep bolts, clamps and spacer below the cutter paths."
    Vise: "Starter demonstration vise"


1. "Face 1"
   Tool: T2 "6 mm flat end mill" dia 6mm flute length 18mm
   Spindle: 10000 RPM
   Feed: cutting 800mm/min, plunge 150mm/min
   Z range: -0.5 to 15 mm
   NC lines: 4-25

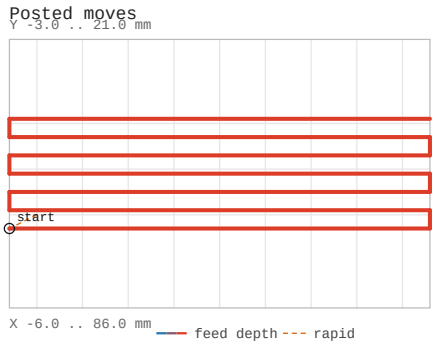


2. "Pocket 2"
   Tool: T2 "6 mm flat end mill" dia 6mm flute length 18mm
   Spindle: 10000 RPM
   Feed: cutting 800mm/min, plunge 150mm/min
   Z range: -8 to 15 mm
   NC lines: 26-783

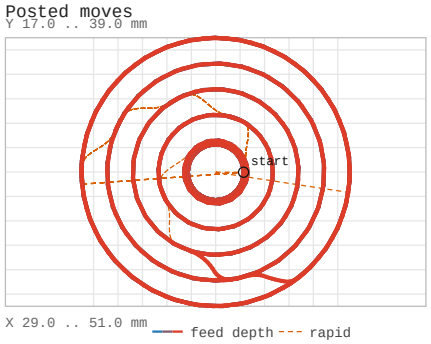

3. "Drill 3"
   Tool: T3 "3 mm drill" dia 3mm flute length 20mm
   Spindle: 10000 RPM
   Feed: cutting 180mm/min, plunge 150mm/min
   Z range: -16 to 15 mm
   NC lines: 784-800

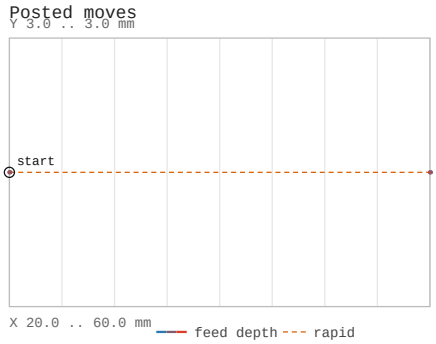


4. "Bore 4"
   Tool: T1 "3 mm flat end mill" dia 3mm flute length 12mm
   Spindle: 10000 RPM
   Feed: cutting 450mm/min, plunge 150mm/min
   Z range: -3.5 to 15 mm
   NC lines: 801-973

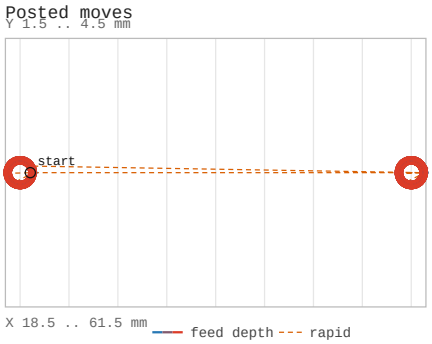


Setup: "Jaw 2 - G55" (G55)
  Work offset origin: X0 Y38 Z16 mm
  Stock: "Stock 2" size 80 x 18 x 16 mm
  Origin offset from stock min corner: X0 Y0 Z16 mm
  Workholding:
    Method: Vise
    Note: "Starter demonstration vise: jaw 2, 80 x 18 x 16 mm blank at Y 38 mm, G55. Close the vise on a 20 mm spacer below Z 8 mm. Secure both jaw blanks in place of the hard jaws before facing a nd cutting the grip recess. Mounting features: two 3 mm holes at local X 20 and 60, Y 3 mm, and 6 mm counterbores, 3 mm deep below the faced top. The holes clear the support ledge; vertical bo lts span the gap to the vise base. Use temporary clamps clear of the paths while machining mount ing features; spindle stopped and parked before fitting bolts. This demonstration vise uses vert ical mounting; adapt hole locations to the actual vise. Keep bolts, clamps and spacer below the cutter paths."
    Vise: "Starter demonstration vise"


5. "Face 1"
   Tool: T2 "6 mm flat end mill" dia 6mm flute length 18mm
   Spindle: 10000 RPM
   Feed: cutting 800mm/min, plunge 150mm/min
   Z range: -0.5 to 15 mm
   NC lines: 977-1003

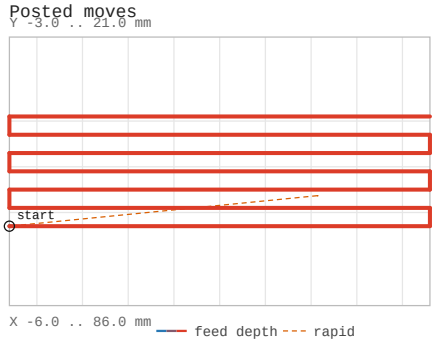


6. "Pocket 2"
   Tool: T2 "6 mm flat end mill" dia 6mm flute length 18mm
   Spindle: 10000 RPM
   Feed: cutting 800mm/min, plunge 150mm/min
   Z range: -8 to 15 mm
   NC lines: 1004-1669

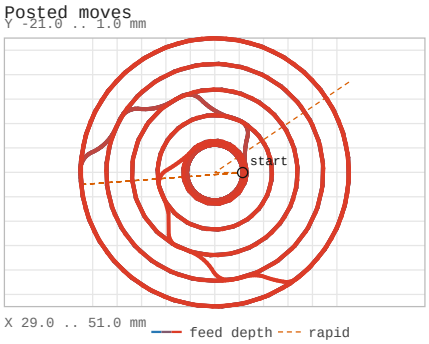

7. "Drill 3"
   Tool: T3 "3 mm drill" dia 3mm flute length 20mm
   Spindle: 10000 RPM
   Feed: cutting 180mm/min, plunge 150mm/min
   Z range: -16 to 15 mm
   NC lines: 1670-1686

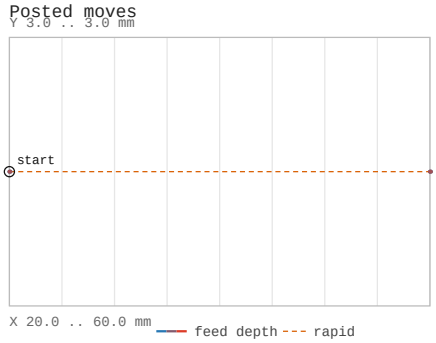

8. "Bore 4"
   Tool: T1 "3 mm flat end mill" dia 3mm flute length 12mm
   Spindle: 10000 RPM
   Feed: cutting 450mm/min, plunge 150mm/min
   Z range: -3.5 to 15 mm
   NC lines: 1687-1859

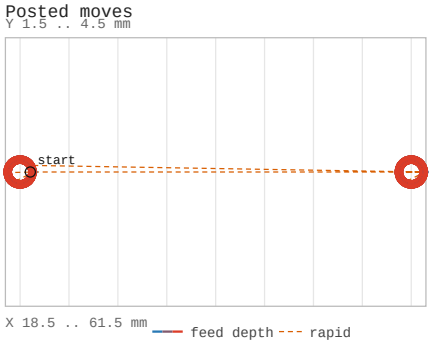

File: "03_Soft_jaws.gcode"
Bytes: 57335
SHA-256: f0c4e29623974f2c9d090f433fc75f6127e1290bed18bb988877061ca27b4c6e