

RESISTANCE MAN WALKER



INSTRUCTIONS

ELEKTRONIK HANNES JOCHRIEM

INH. HANNES JOCHRIEM
OBERFELDWEG 12
D - 83080 OBERAUDORF
MAIL: [INFO@EHAJO.DE](mailto:info@ehajo.de)
SHOP: [HTTPS://WWW.EHAJO.DE](https://www.ehajo.de)

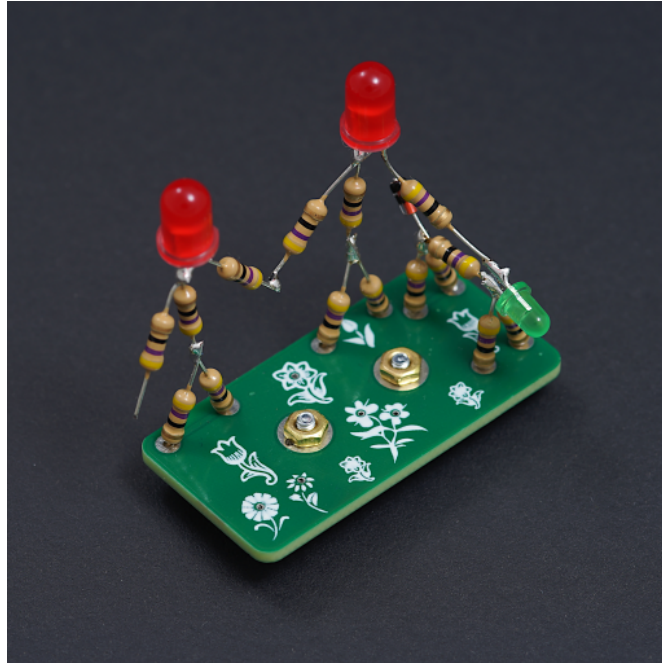

Contents

1	Risk Assessment and Disposal	2
1.1	Risk Assessment	2
1.2	Disposal Instructions	2
2	Basics	3
2.1	Soldering	3
2.2	Resistors	3
2.2.1	Exercises	4
2.3	Soldering LEDs	5
2.3.1	Exercises	6
3	Resistance man walker	7
3.1	Bill of Materials	7
3.2	Youtube-Video	7
3.3	Assembly instructions	7

1 Risk Assessment and Disposal

1.1 Risk Assessment

This kit is not suitable for children under 10 years of age. Assembly and use should always be supervised by an adult. Please note the following risks:

- Small parts can be swallowed. Keep the kit out of reach of small children.
- Tools such as tweezers or side cutters can cause injuries.
- The soldering iron becomes very hot and can cause burns.
- Use a fireproof surface to protect work areas.
- Flux can splatter during soldering. Wear protective goggles.
- Solder fumes can be harmful to health. Ensure proper ventilation.
- Incorrect assembly can result in malfunction. Follow the instructions.
- Mechanical damage can occur from improper handling.
- Components can be damaged by electrostatic discharge (ESD).
- Improper assembly can lead to short circuits.
- Wires on components are sharp and can cause puncture injuries.
- Use pliers to handle wires safely.
- Wires can break and fly off. Protect your eyes with goggles.

1.2 Disposal Instructions

We care about the environment! Here are some tips on how to dispose of our kit and its packaging responsibly:

- Electronic components and batteries must not be disposed of in household waste. Please take them to a collection point or recycling center.
- Our packaging is made of environmentally friendly materials. Recycle it in the appropriate bins.
- Separate plastic, paper, and other materials to facilitate recycling.



2 Basics

2.1 Soldering

Our soldering exercises are designed to teach you the basics of soldering step by step. Don't worry, no one becomes an expert overnight! Just like in many things, *"practice makes perfect."*

You can find a helpful video about common soldering mistakes on our YouTube channel:


<https://youtu.be/CPXZM8r8xFw>

Here are some important points in brief:

- The ideal **temperature** for the soldering iron should be around **350°C**. It is recommended to use lead-free solder.
- The choice of soldering tip should match the size of the component. A **1.6 mm chisel tip** is ideal for most solder joints – it works for SMD components of size 0805 and wires up to 1.5 mm².
- To protect yourself from solder splashes or flying wires when cutting, it's recommended to wear **safety glasses**.
- Use a **heat-resistant surface** to avoid burn marks on your table.

The right amount of solder is crucial. Make sure the solder covers both the component and the PCB. The soldering iron must touch both the **component** and the **PCB** at the same time so that both are heated properly.

The following image shows typical solder joints: On the left, too little solder was used, while on the right, a ball forms – this happens when only the wire is heated. A perfect solder joint (middle) forms a smooth curve and the solder flows to the bottom of the PCB.

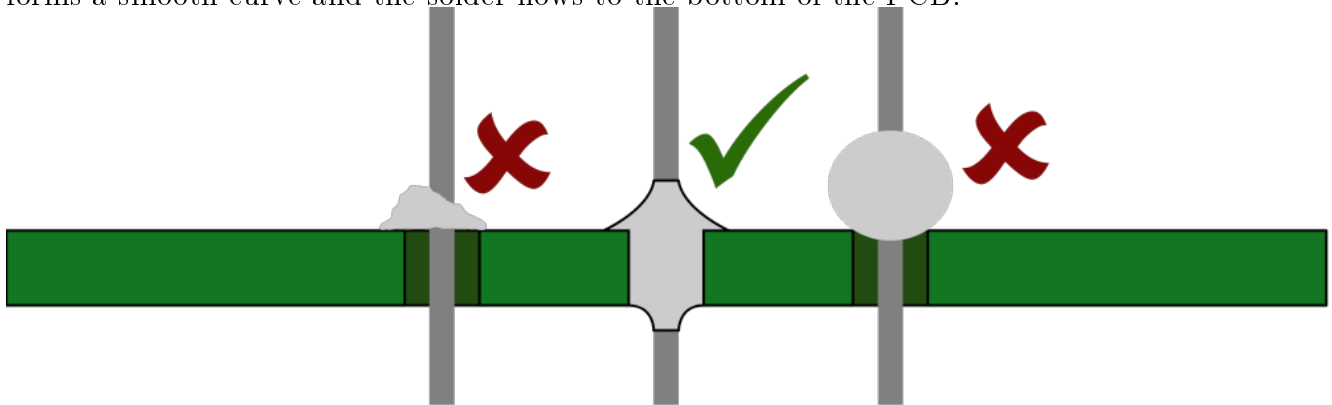

2.2 Resistors

Resistors are found in almost every circuit and are one of the three basic **passive components**, along with inductors and capacitors.

The job of a resistor is to **limit** the flow of current. The unit of resistance is the Ohm¹ (Ω). The relationship between current, voltage, and resistance is described by the well-known **Ohm's Law**:

$$U = R \cdot I$$
$$R = \frac{U}{I}$$

¹Named after the German physicist Georg Simon Ohm, born in 1789

The **resistance value** of a component can be read differently depending on its type: For SMD² components, the value is printed as a code, while for through-hole resistors, it's shown by color bands.

SMD resistors usually have a three-digit number like 471. The first two digits give the value, and the last digit shows the number of zeros. So, 471 means 47 followed by one zero, or 470Ω. A code like 683 means 68 followed by three zeros, or 68000Ω (68kΩ).

For through-hole resistors, the value is read using color bands. The following image shows how this works:

Farbe	1. Stelle	2. Stelle	(3. Stelle)	Multiplikator	Toleranz
Silber				x0,01	±10%
Gold				x0,1	±5%
Schwarz	0	0	0	x1	
Braun	1	1	1	x10	±1%
Rot	2	2	2	x100	±2%
Orange	3	3	3	x1.000	
Gelb	4	4	4	x10.000	
Grün	5	5	5	x100.000	±0,5%
Blau	6	6	6	x1.000.000	±0,25%
Violett	7	7	7	x10.000.000	±0,1%
Grau	8	8	8	x100.000.000	±0,05%
Weiß	9	9	9	x1.000.000.000	

4	7	x100	±5%	= 4k7Ω
6	8	0	x1	±0,1% = 680Ω

For SMD resistors, the resistance values can be identified based on their markings. The labeling works as follows: The first two digits indicate the value, and the third digit represents the number of zeros following the value. For example, a 220kΩ resistor is marked as "224," and a 470Ω resistor is labeled as "471".

Don't worry about damaging resistors when soldering—they are very heat-resistant and unlikely to get damaged. Also, it doesn't matter which way you solder them because resistors have no polarity. For the perfectionists: It looks neater if all the color bands face the same direction.

2.2.1 Exercises

A resistor can limit the flow of current, which is often useful when you don't want the current to go over a certain value.

The following two examples show how to calculate the resistance using Ohm's law. Ohm's law is:

$$U = R \cdot I \quad \text{or} \quad R = \frac{U}{I}$$


Example 1:

Let's say we have a circuit with a voltage of $U = 12V$ and a current of $I = 2A$. To calculate the resistance, we put the values into the formula:

$$R = \frac{U}{I} = \frac{12V}{2A} = 6\Omega$$

So, the resistance in this circuit is 6Ω.


²Surface Mount Device

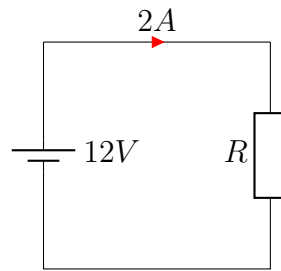**Example 2:**

In another example, the voltage is $U = 9V$ and the current is $I = 0.5A$. The resistance is calculated as:

$$R = \frac{U}{I} = \frac{9V}{0.5A} = 18\Omega$$

So, the resistance in this circuit is 18Ω .

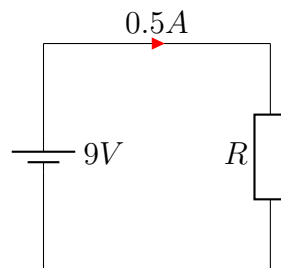

As you can see, it's easy to calculate the resistance when you know the voltage and current.

Calculation examples:


- A resistor with $R = 470\Omega$ is connected to a $5V$ power source. What is the maximum current? (Answer: $10.6mA$)
- A power supply of $24V$ should deliver a maximum current of $200mA$. What resistor do you need? (Answer: 120Ω)
- What is the voltage of a power supply if it provides a current of about $7mA$ through a 470Ω resistor? (Answer: $3.3V$)

2.3 Soldering LEDs

A light-emitting diode (LED) is an electronic component that emits **light** when current flows through it.


The correct **polarity** of the LED is crucial. If it is soldered onto the board the wrong way, it will not light up and might even be damaged.

The LED has two terminals: the **anode** (positive, +) and the **cathode** (negative, -). You can distinguish between them by the length of the legs. An easy way to remember is: "*Minus is always shorter*" – the shorter leg marks the cathode. For SMD LEDs, the cathode is often marked with a colored dot on the top or a diode symbol on the bottom.

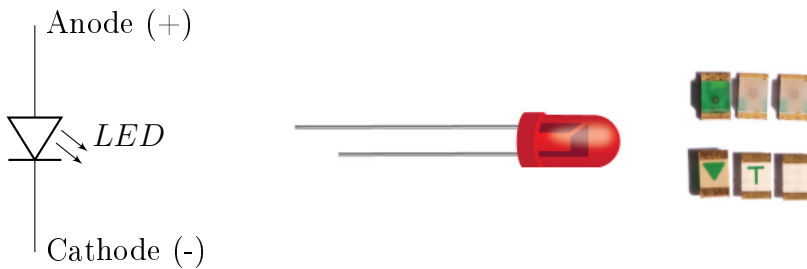

An LED should never be operated without a **current-limiting resistor**. This resistor limits the maximum current flowing through the LED and protects it from overloading and potential damage. Always check the LED's datasheet to determine the correct values.

Example for calculating a current-limiting resistor:

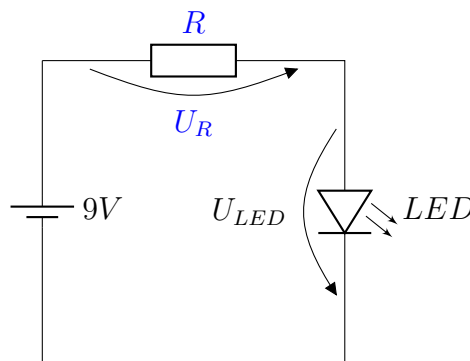

Let's say we have an LED that lights up at a voltage of $U_{LED} = 2V$ and requires a maximum current of $I_{LED} = 20mA$. The supply voltage is $U_S = 9V$.

Since 2V are dropped across the LED, the remaining 7V are left for the resistor, as calculated by Kirchhoff's voltage law:

$$U_R = U_S - U_{LED} = 9V - 2V = 7V$$

The current flowing through the LED is the same as the current through the resistor. So, we can calculate the resistor's value using Ohm's law:

$$R = \frac{U_R}{I_{LED}} = \frac{7V}{0.02A} = 350\Omega$$

Thus, the required resistor is 350Ω . Since resistors come in standard values (called E-series), you often need to round up. The closest available value would be 360Ω .

You can also find a video on how to calculate the current-limiting resistor for LEDs on our YouTube channel:

<https://youtu.be/p0dt-6F-EZg>

2.3.1 Exercises

The answers are rounded to standard E-series resistor values!

- You have a low-current LED running at $I = 2mA$ and requiring a voltage of $2.5V$. You want to power it with $5V$. What current-limiting resistor do you need? (Answer: 1300Ω)
- A blue LED requires $4V$ and a current of $17mA$. What resistor should you use to power it with $12V$? (Answer: 470Ω)

3 Resistance man walker

3.1 Bill of Materials

The following components are required for assembly:

- 1x PCB
- 15x Resistors
- 2x Red LEDs
- 1x Green LED
- 1x Diode 1N4148
- 1x Circular battery clip
- 1x Square battery clip
- 2x M2 screws
- 2x M2 brass nuts

3.2 Youtube-Video

Please see following Youtube-Video for step-by-step instructions:


https://youtu.be/Q_I4y-qWvg0

3.3 Assembly instructions

The LEDs are the most critical components in this kit. **Make sure to pay attention to their polarity when soldering them.** Details can be found in the basics chapter.


1. Assemble the dog's legs:

Insert the resistors for the legs through the corresponding pads, solder them on the underside, and cut off any excess wire:

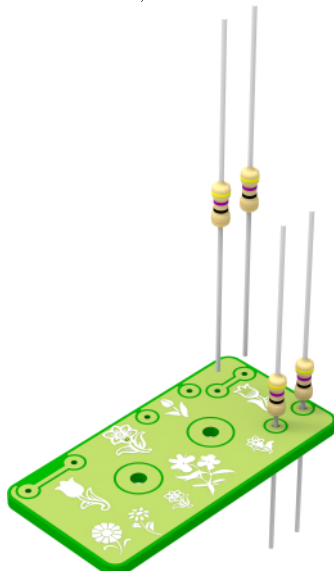


2. Assemble the dog's body:


Bend the resistors crosswise and place the dog's body on the crossing points. Solder the intersections and cut off any excess wire:

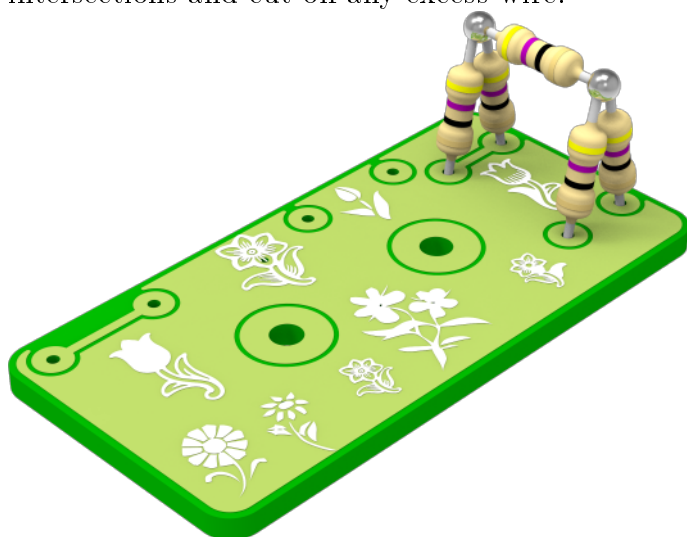**3. Assemble the figurine's legs:**

Insert the legs through the pads, solder them on the underside, and cut off any excess wire:

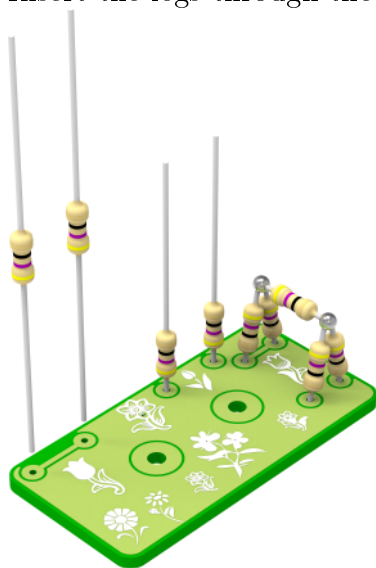
**4. Assemble the figurine's feet:**

Bend the feet crosswise, solder them at the intersections, and cut off any excess wire:

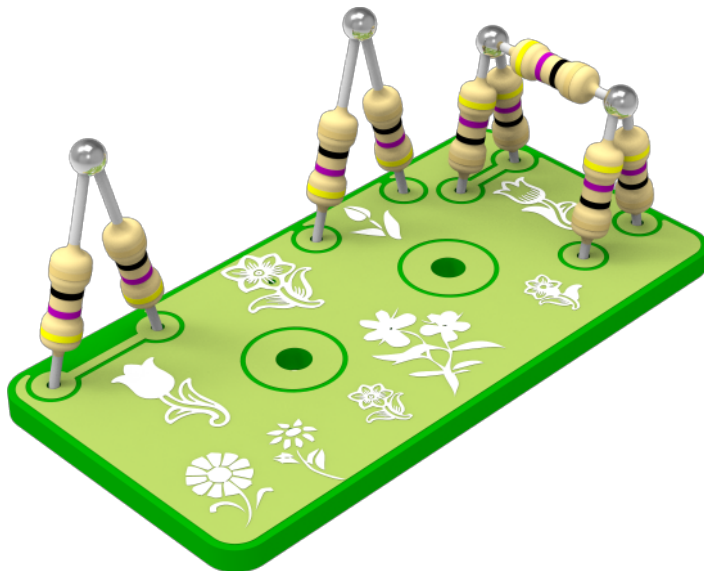

5. Solder the torso:


Cut the resistors to the appropriate length (about 5mm of wire on each side):

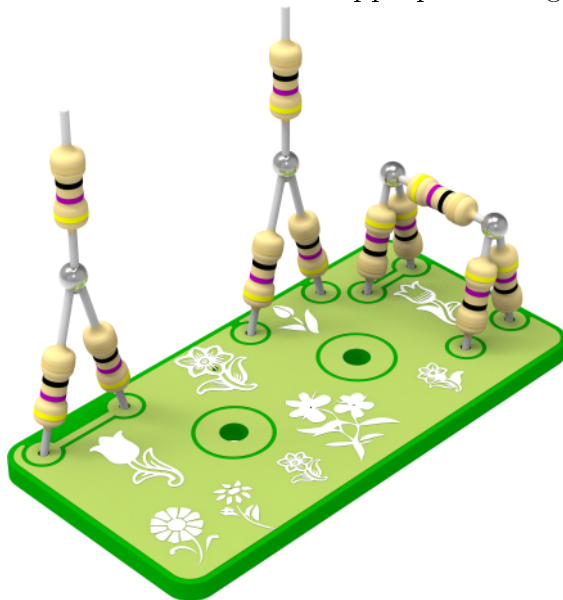


6. Solder the heads:

Pay attention to the polarity of the LEDs! The flat side of the LED casing is the negative pole (cathode). This side also has the shorter leg. The anode (longer leg) is the positive pole.

Solder the red LEDs using the **anode**, and solder the dog's head using the **cathode**:

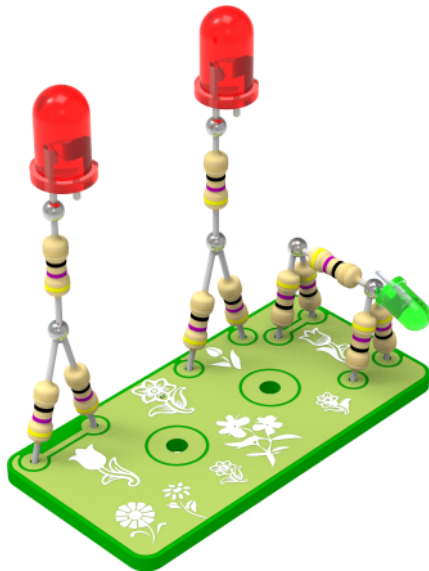


Additional images for LED polarity:

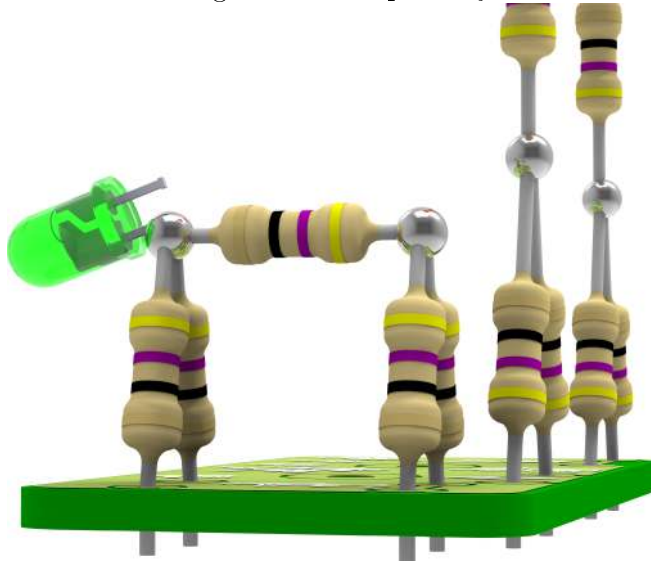

7. Solder the dog's tail and leash:


Solder the dog's tail to your desired length. Connect the left arm of the figurine to the dog

as a leash. Finally, solder the arms between the figurines. Cut off all excess wires:

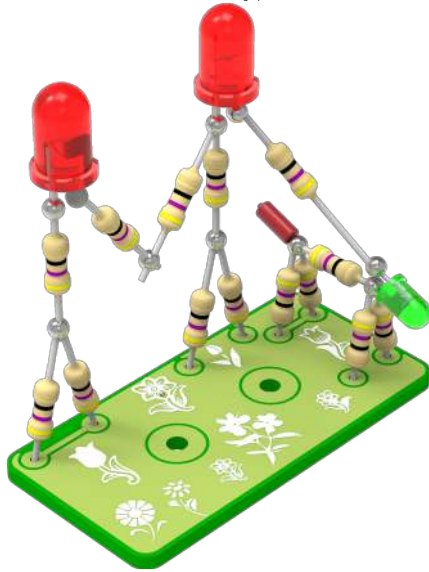


8. Right arm of the left figurine:

Solder the right arm of the left figurine:

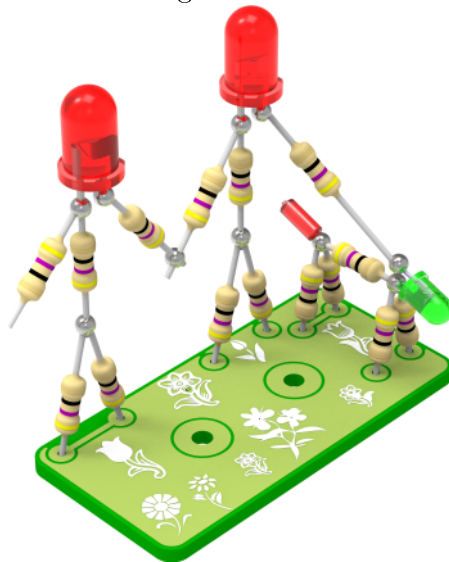

9. Mount the battery clips:

Attach the battery clips with the supplied screws. Ensure the square contact is mounted on the positive pole and the circular contact on the negative pole:

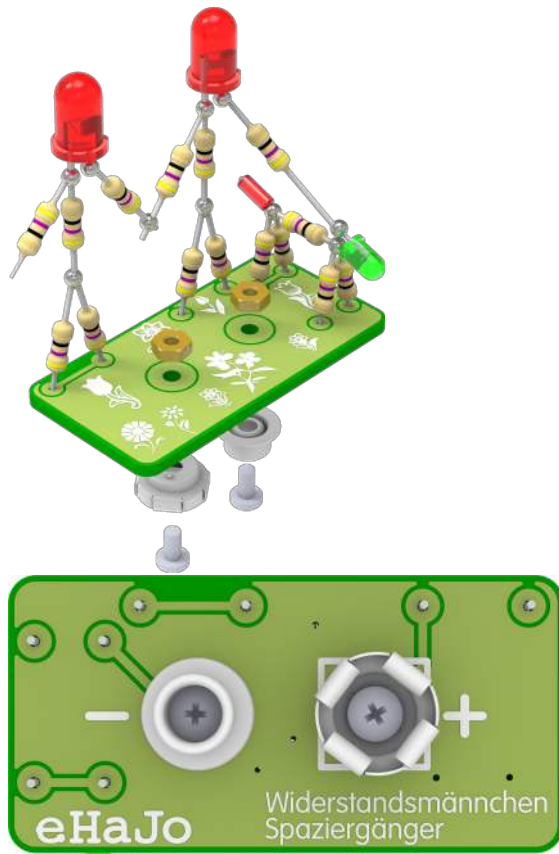

Check all solder joints before use and ensure the correct polarity when connecting the battery!