

 PT. MNA SERANG	WORKING INSTRUCTION	WI/MNA-E&I-19-005	
		Dept.	ENGINEERING
	CABLE REPAIR MAINTENANCE	Section	E&I
		Revision	0
		Effective Date	
		Page	1 of 1

Penggantian Kabel/Cable Replacement




Kupas kabel tembaga dengan menyesuaikan panjangnya dengan panjang penghubung Cu-Al . *(Strip the Cu cable by adjusting with Cu-Al connector length.)*



PVL1300DB

Lakukan crimping menggunakan peralatan hidrolik PVL1300DB dengan tekanan yang tetap pada Cu-Al transition connector. *(Do a crimping use a hydraulic tool with constant*

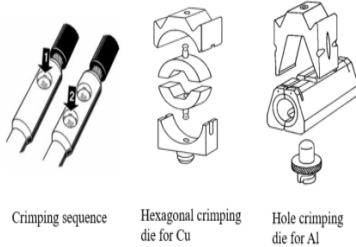

Crimping sequence

Hexagonal crimping die for Cu

Hole crimping die for Al



Kedua Cu-Al ends harus di crimp sendiri-sendiri dengan bahan mold yang sesuai *(Both Cu-Ai ends must be crimped individually with its own matched molds .)*

Untuk crimping ujung satu harus dilakukan dua kali dimana crimping pertama harus dekat ke arah kabel. *(For one end crimping, do it twice which the first crimping would b near*



Crimping on Cu end

No. 2 Crimping on Al end

No. 1 Crimping on Al end

Hasil crimping kedua ujung konduktor Cu dan Al harus sesuai dengan seperti ilustrasi *(The result of both end Cu and Al crimping would be according with illustration)*

Letakkan hasil crimping dalam balutan PV.C silicon fiberglass sleeving *(Put the finished crimping on the PVC silicone fiberglass sleeving)*



Tutupi hasil crimping dengan heat shrinkable insulation sleeve dan gunakan hot air gun untuk membuatnya menyusut. *(Cover the finished crimping with heat shrinkable insulation sleeve and use hot air gun for shrinking the crimping.)*