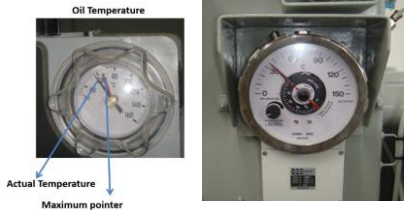
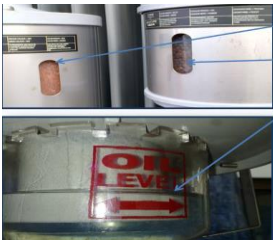


 PT. MNA SERANG	WORKING INSTRUCTION	WI/MNASRG-E&I-19-009	
		Dept.	ENGINEERING
	TRANSFORMER VISUAL CHECK PREVENTIVE MAINTENANCE	Section	E&I
		Revision	0
		Effective Date	
		Page	1 of 1

Instruksi / Instruction	
Pre-Action / Pre-Action	
	
Siapkan alat-alat bantu seperti vacuum cleaner, kunci pas, kuas, tang dan obeng panjang. (Prepare tools such as vacuum cleaner, spanner, brush, combination plier and long screw driver.)	Koordinasi dengan user plant (Coordinate with the plant user)
	
Gunakan PPE yang sesuai dengan parameter Arc-Flash.(Wear the appropriate PPE with Arc-Flash parameter.)	Periksa keadaan aktual oli dan temperature belitan yang ditunjukkan oleh jarum hitam.(Check actual oil and winding temperature which be shown by black pointer)
	
Atur nilai maksimum dari arus beban berdasarkan kapasitas trafo. (Set the maximum value of current loading according to the transformer capacity.)	Atur jangkaan minimum dan maksimum tegangan. Periksa nilai arus actual dan tegangan beban untuk tiap fasa. (Check all outlet cables, bus-bars and corresponding terminations inside outgoing cabinet.)
	
Cek warna dari silika apakah masih terang dan cerah. Ganti silika gel jika silika sudah rusak, warnanya akan menjadi lebih gelap dan berkabut. (Check the color of silica gel if still clear and bright. Replace the old silica gel if it is already damaged which indicated by murky and foggy color.)	Periksa volume oli dalam tabung pada bagian bawah breather. Tambah oli secara periodik apalagi ketika level oli sudah di batas bawah. (Check volume of oil in the tube at the bottom of breather. Top up the oil periodically whenever the oil level is down.)
	
Periksa kekencangan baut-baut pada HV-LV bushing, koneksi kabel ke bushing atau bus-bar dan koneksi grounding. (Check tightening of bolts on HV-LV bushing, cable connection to bushing or bus-bar and grounding connection.)	Kencangkan baut-baut yang sudah longgar dan beri tanda pada mur dan baut yang sudah dikencangkan. (Tight the loosen bolts and give some marks on the bolts and nuts that are already tightened.)