


First step: Inform the workshop operation content, inform the operation purpose, and sign the work ticket.




Second step: Confirm the energy level of the power distribution cabinet.

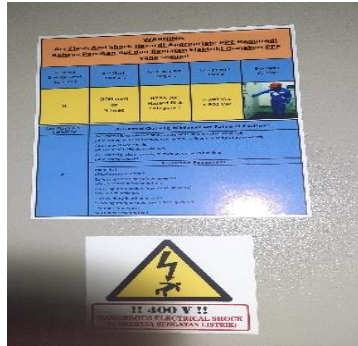

Third step: Choose the appropriate PPE (protective clothing, protective mask, arc flash-proof gloves, earplugs). PPE is required to be tested and within the validity period.



Fourth step: Please refer to the "Emergency Rescue-Electric Shock Accident" document. The guardian should have sufficient training (for example: how to rescue cardiopulmonary resuscitation, the use of automatic defibrillators).

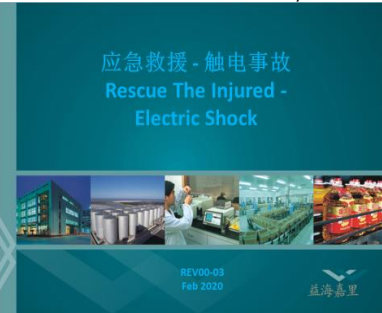


Fifth step: Make sure to cut off the power supply in an emergency. ("Electrical isolation point")



Sixth step: The TOR replacement should be led by an electrician, assisted by an employee who has the ability to rescue personnel from electric shock, and prepare insulating rods on site.



Seventh step: Attention should be paid to "restrict access to the boundary".

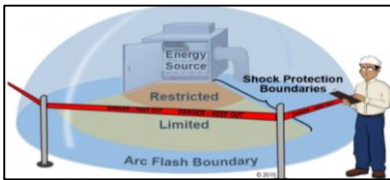


Nominal System Voltage Range, Phase to Phase ^a	Limited Approach Boundary ^b		Restricted Approach Boundary ^b ; Includes Inadvertent Movement Adder
	Exposed Movable Conductor ^c	Exposed Fixed Circuit Part	
<50 V	Not specified	Not specified	Not specified
50 V-150 V ^d	3.0 m (10 ft 0 in.)	1.0 m (3 ft 6 in.)	Avoid contact
151 V-750 V	3.0 m (10 ft 0 in.)	1.0 m (3 ft 6 in.)	0.3 m (1 ft 0 in.)
751 V-15 kV	3.0 m (10 ft 0 in.)	1.5 m (5 ft 0 in.)	0.7 m (2 ft 2 in.)
15.1 kV-36 kV	3.0 m (10 ft 0 in.)	1.8 m (6 ft 0 in.)	0.8 m (2 ft 7 in.)
36.1 kV-46 kV	3.0 m (10 ft 0 in.)	2.5 m (8 ft 0 in.)	0.8 m (2 ft 9 in.)
46.1 kV-72.5 kV	3.0 m (10 ft 0 in.)	2.5 m (8 ft 0 in.)	1.0 m (3 ft 3 in.)


Eighth step: Ensure all circuit breakers are turned down and zero voltage measured on termination point.




Ninth step: Loose all screws of termination and remove the existing TOR.

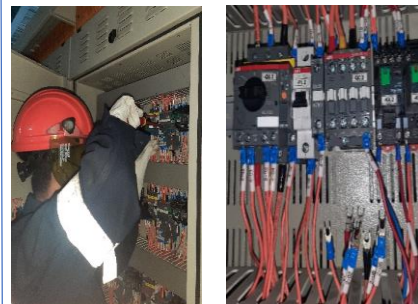

Tenth step: Replace and install the new one. Ensure all screws are proper tightened.

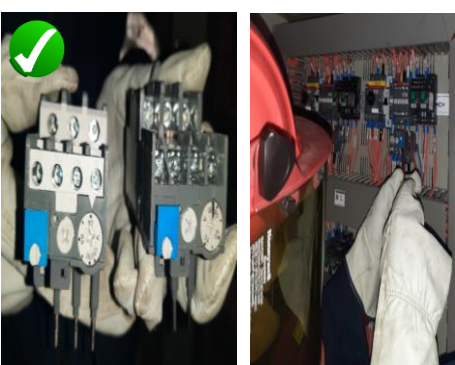

Eleventh step: Set the recommended current based on motor nameplate and mark the indicator with permanent marker.

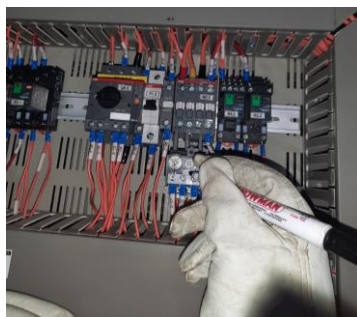

The twelfth step: Inform the completion status of workshop work and replacement results.

