

Red riceNota9 5GNo charging, no power on (caused by damage to the inline seat)

[Machine Model]Red riceNota9 5G

[Failure phenomenon]No charging, no power


[Maintenance process]Receive a red riceNota9 4G version of the machine, the fault is described as not charging.



Red riceNota9 5GNo charging, no powerFigure 1

We took out the machine to detect and found that the fault of the mobile phone actually turned on the charging mark when plugging in the charger, but pressing the power-on button did not turn on.


After communicating with the customer, we will continue to repair and remove the motherboard. The bright lightning logo generally does not recognize the battery, or the tail plug-in board. There is a problem with the wiring. We first test whether the tail plug 5V has been sent to the motherboard. Plug in the charger and wiring. The measurement tail plug 5V has been sent to the motherboard, and Although the resistance value of BAT_ID is different from that in the drawings, it is not very big, so we give priority to the BAT_THERM line.

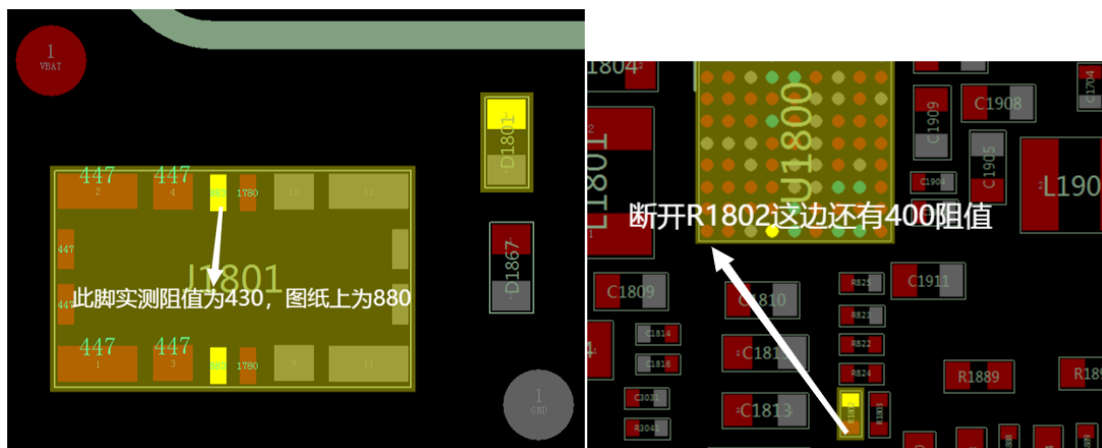

Red riceNota9 5GNo charging, no powerFigure 2

According to the point run diagram, this signal is directly sent to the charging IC after passing through a resistance R1802. There is only one grounded protective diode in the middle line, so we directly deduct this diode, and the measured resistance value is still more than 400. The resistance value of the measured resistance R1802 through the battery seat is 400, but the resistance value of the charging IC is more than 500. This resistance value is obviously wrong, because the battery seat itself certainly has no resistance value, and This is obviously unreasonable. We disconnected this resistance and measured it again. After removing the

resistance R1802, the resistance value on the side of the battery seat is still more than 400, and the charging IC side is still more than 500. Then the problem arises. The battery seat will certainly not produce a resistance value. There is a resistance value indicating that there is a problem with the

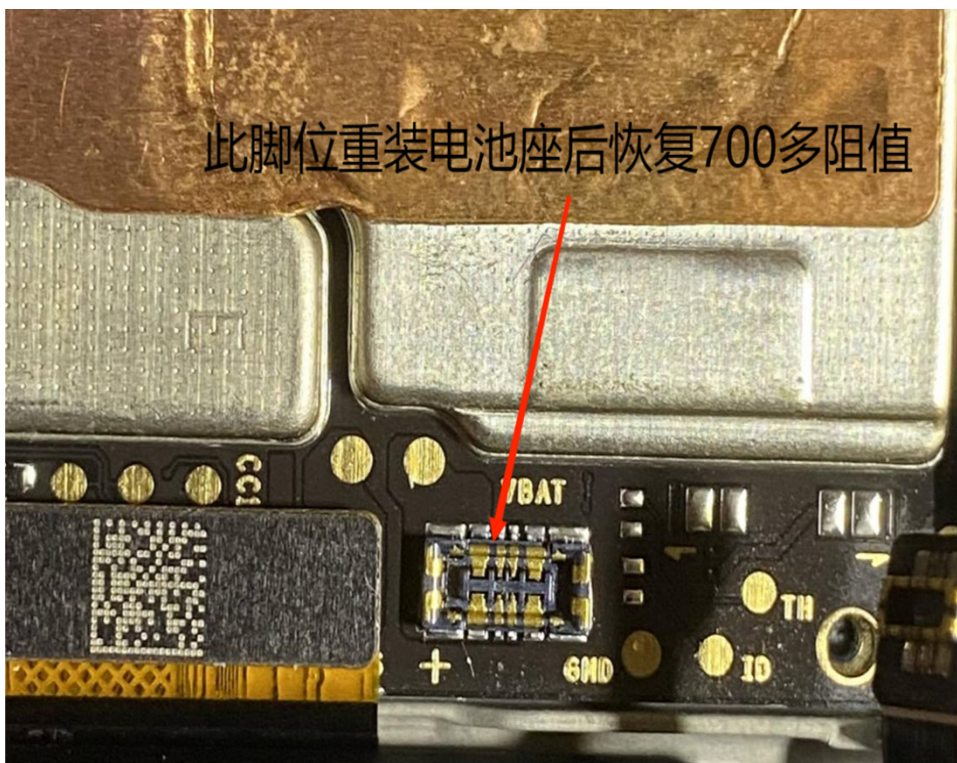

Red riceNota9 5GNo charging, no powerFigure 3

At this time, you can press the power-on button to enter the system, and the charging current is normal.



Red riceNota9 5GNo charging, no powerFigure 4

[Repair Results] Install the motherboard into the mobile phone, turn it on and test it. The mobile phone is turned on normally into the system, measuring charging, WiFi, sound, Compass, vibration, Telephone And other functions Normally, the repair is over here.