


ZS630KL KIRIN

Baseband Trouble shooting

For EMS WINGTECH

Sam Lee
Jerome Zou

Block diagram(1/1)

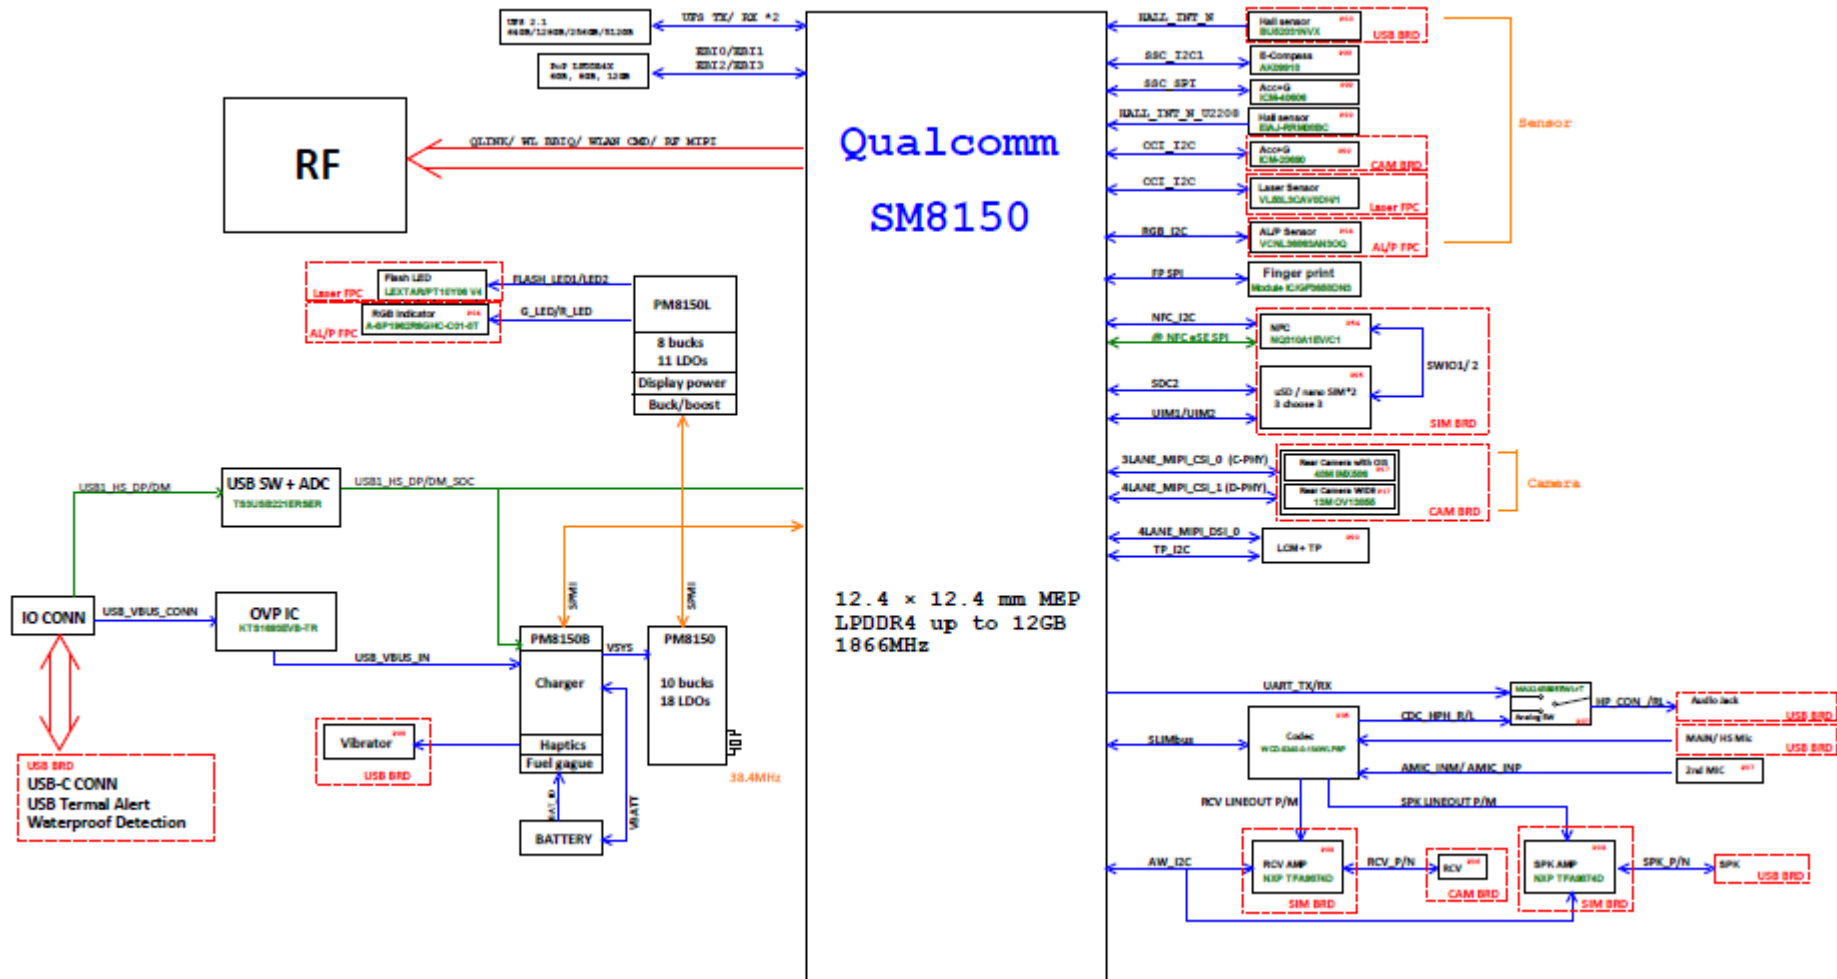

Back side (1/3) – MB & USB SB




Back side (2/3) – SIM SB




Back side (3/3) – CAM SB

Back side

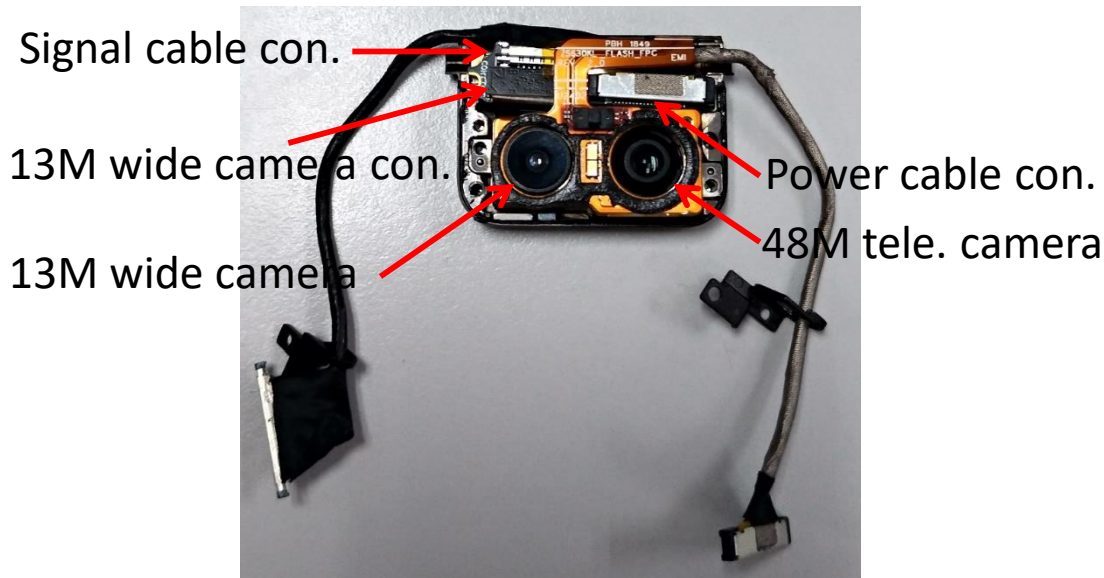

Front side

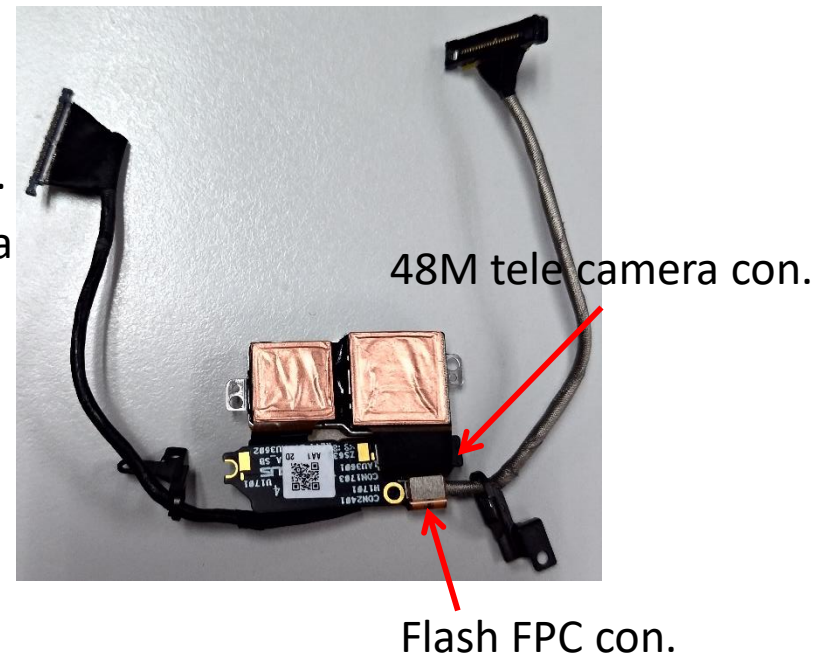

MB (1/2) - Bottom

2nd MIC (AU3701)



RF area

2nd Hall sensor (U2208)




PM8150L (PU9101)



PM8150 (PU8401)




OVP IC (PU8002)




RF area

RF area

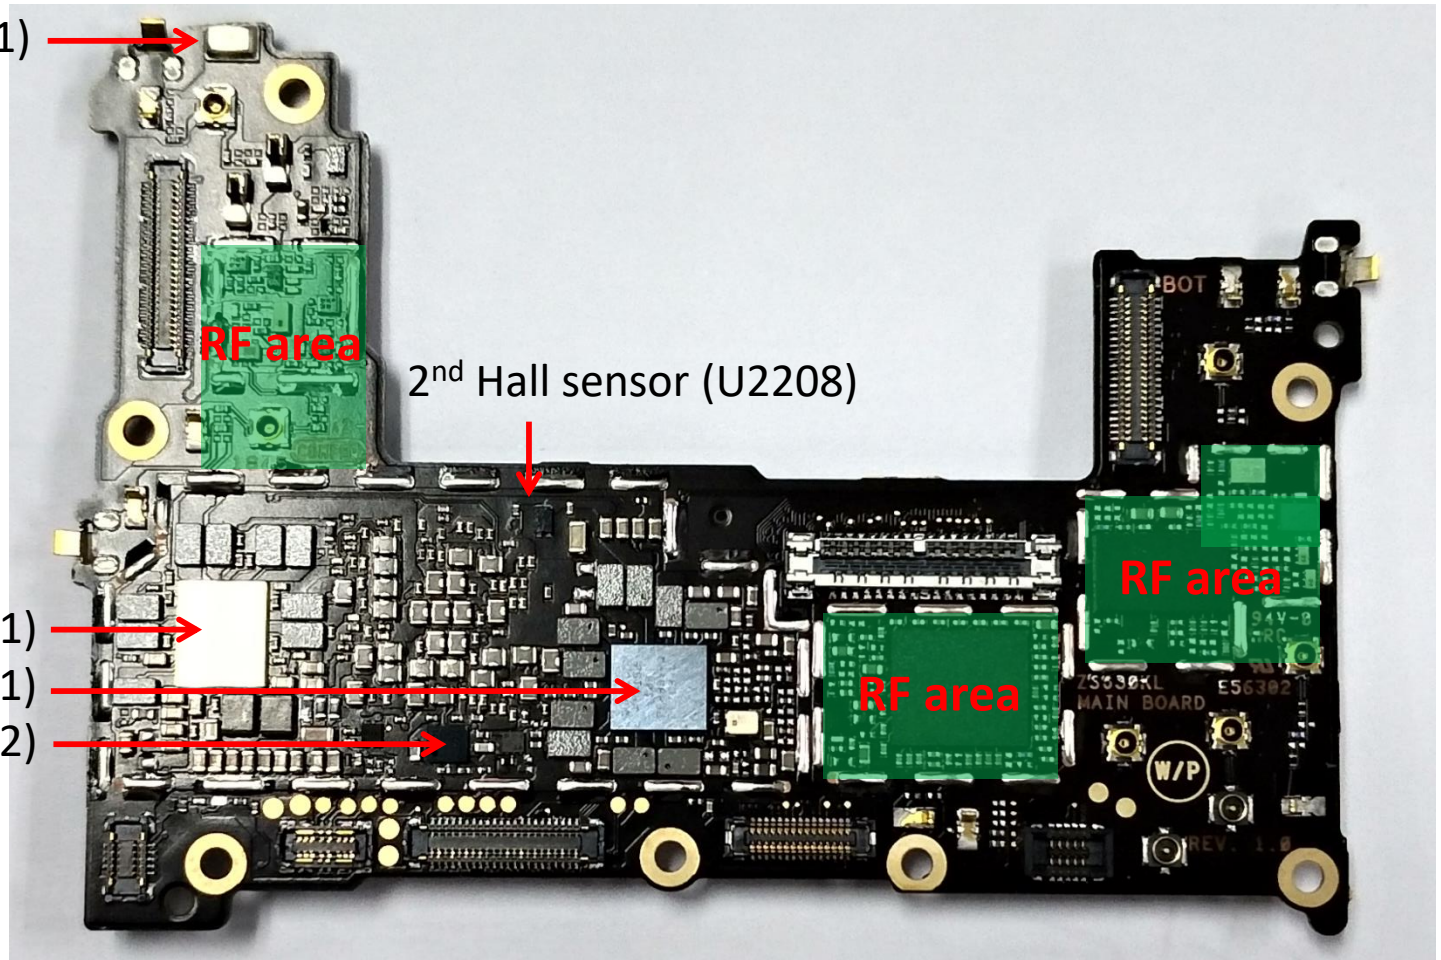

MB (2/2) - Top

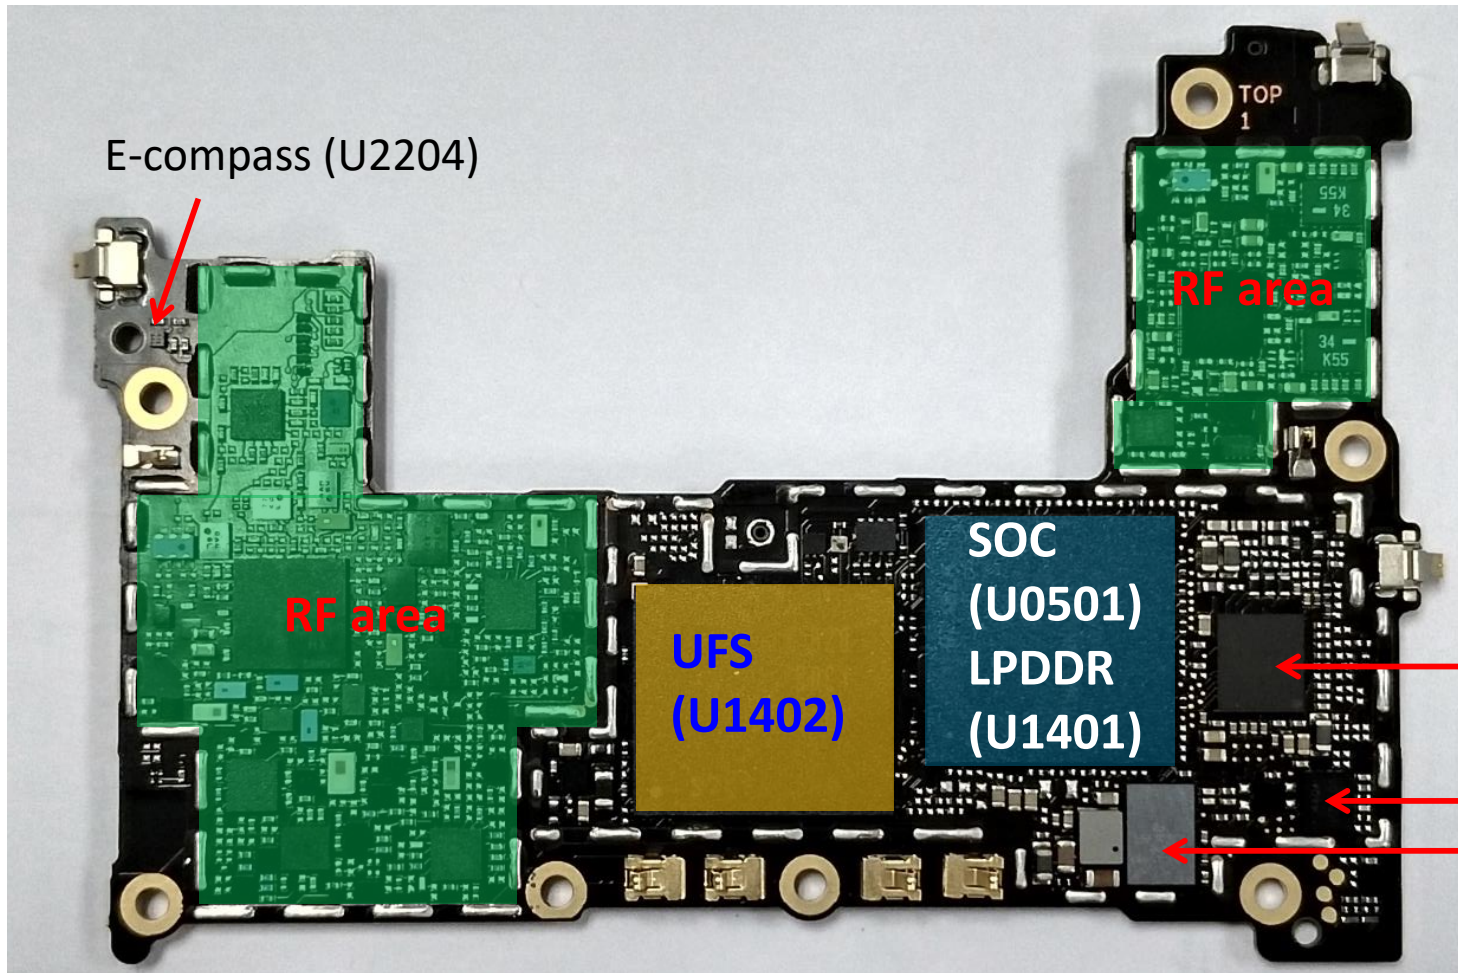

SB (1/1)

SIM SB - Top

Camera LDO (PU9501 、 PU9503 、 PU9505 、 PU9508 、 PU9509)

RCV AMP: NXP TFA9874D (AU0801)

Motor DRV: DRV8835 (U0301)


SIM/SD CARD

RF area

Motor MCU: MSP430FR2311 (U0201)

SPK AMP: NXP TFA9874D (AU0802)

CAM SB - Bottom

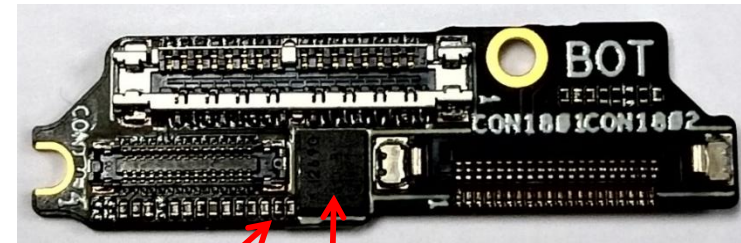

2nd G+G (U2201)

Camera LDO (PU1701)


FPC (1/1)

Prox. FPC - Top

Flash LED (LED2401)


Flash LED (LED2402)

Proximity Sensor (U0401) Indicator LED(LED0401)

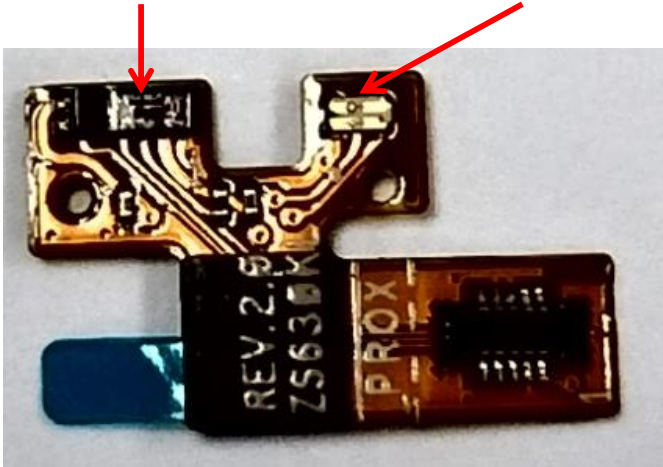

Flash FPC - Top

Laser sensor (U2402)

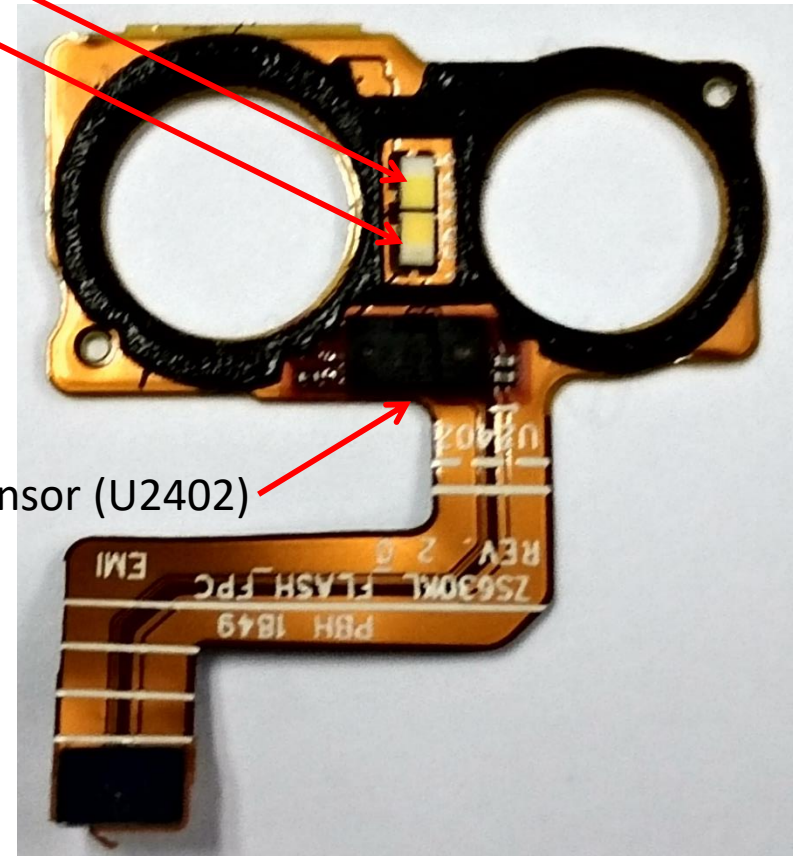

Power ON Fail(1/3)

Check whether the battery voltage is correctly sent to the PCB or not.

-> Check T9609 和 PCON9601

If the battery voltage is correctly sent to the PCB, Check VPH_PWR.

If the voltage of VPH_PWR is not correct,

-> Check PL9001.1

1. If PL9001.1 is short to GND


Check the SMT status according to x-ray:

MB: CON1601, CON1602, CON1603, U4603, U4701, U4807, PQ8002, PU8401, PU9101, U6120, U6117.

SIM SB: U0501, AU0801, AU0802. USB SB: U0504. And all the passive components which connect to VPH_PWR.

2. If PL9001.1 is not short to GND

Check the status of the component PL9001

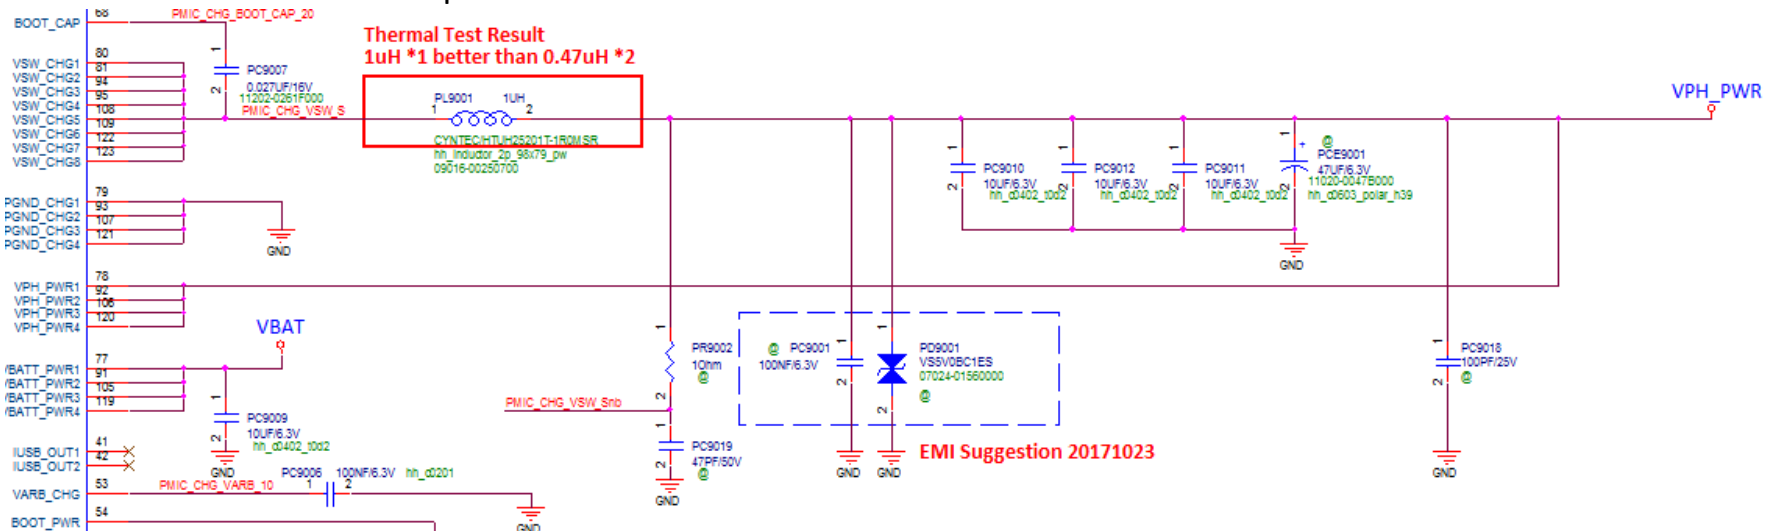

Power ON Fail(2/3)

The voltage of VPH_PWR is near to VBAT, but MSM_PS_HOLD is 0 V.


-> 1. Check SIDE KEY FPC

- (1) Confirm SIDE KEY FPC is normal.
- (2) Press the power key and confirm the voltage of C2113.2 is 0V.

If not, check the SMT status of R2103 and CON2101.

2. If SIDE KEY FPC is work normally, check the power on sequence.

- (1) Measure all the power rails of power on sequence, confirm the voltage are right
If any power rail is short to GND, then check the status of all the component on the trace
- (2) If all of the power rail are not short to GND, but one or more power rail is 0V or it has wrong voltage.
Check the status of all the component on this power rail.
- (3) If the status of all the component on this power rail are normal.
Reheat or replace PMIC (PU9001, PU8401 and PU9101) step by step.
 - (i) Reheat PU9001
 - (ii) Reheat PU8401
 - (iii) Reheat PU9101
 - (iv) Replace PU9001 to a new one
 - (v) Replace PU8401 to a new one
 - (vi) Replace PU9101 to a new one

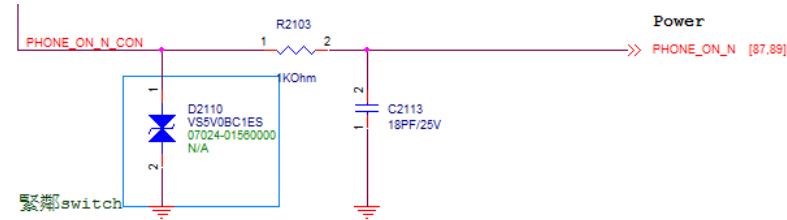

f the boot procedure for hardware is complete and MSM_PS_HOLD(T1911) will be 1.8V.



If the LCD is still black and has not view, It will be two possible issue will be occur:

1. UFS Fail
2. LCM Fail

Power ON Fail(3/3)

Power on sequence

sequence	net	test point	layer	normal diode(V)
1	VBAT	T9603.1	BOT	0.4699
2	VPH_PWR	PCE9001.1	BOT	0.3315
3	VREG_BOB	PC9105.1	BOT	0.4823
4	VREG_S5A_2P0	PC8408.1	BOT	0.4507
5	VREG_S6A_0P9	PC8505.1	BOT	0.4385
6	VREG_S4C_0P75	C1357.1	BOT	0.2826
7	VREG_L4A_0P75	PC8613.1	BOT	0.4253
8	VREG_S8C_1P3	PC9806.1	BOT	0.4314
9	VREG_S3A_0P8	C1211.1	BOT	0.3737
10	VREG_S6C_S7C_0P75	C1323.1	BOT	0.0305
11	VREG_S5C_0P75	CE1353.1	BOT	0.3456
12	VREG_L3C_1P2	PC9303.1	BOT	0.3872
13	VREG_L8A_0P75	PC8608.1	BOT	0.4203
14	VREG_S4A_1P8	PC8407.1	BOT	0.2886
15	VREG_XO	PC8717.1	BOT	0.5363
16	VREG_L11A_0P8	PC8610.1	BOT	0.5118
17	VREF_MSM_1P2	C1101.1	BOT	0.4485
18	SLEEP_CLK	T0502	TOP	0.4752
19	VREG_L5A_0P875	PC8606.1	BOT	0.2816
20	VREG_L18A_0P9	R1208.2	BOT	0.5413
21	VREG_L12A_1P8	PC8611.1	BOT	0.4269
22	LN_BB_CLK1	R8702.1	BOT	0.7816
23	VREG_S1C_1P1	C1156.1	BOT	0.1955
24	VREG_S2A_0P6	CE1204.3	BOT	0.2472
25	VREG_L2A_3P1	C1213.1	BOT	0.4533
26	VREG_L10A_2P95	C1401.1	BOT	0.3708
27	VREG_L9A_1P2	PC8609.1	BOT	0.4719
28	VREG_L6C_2P9	C1312.1	BOT	0.6353
29	VREG_S10A_0P75	C1138.1	BOT	0.2407
30	MSM_RESIN_N	T0504	TOP	0.5018
31	MSM_PS_HOLD	T1911	TOP	0.4987

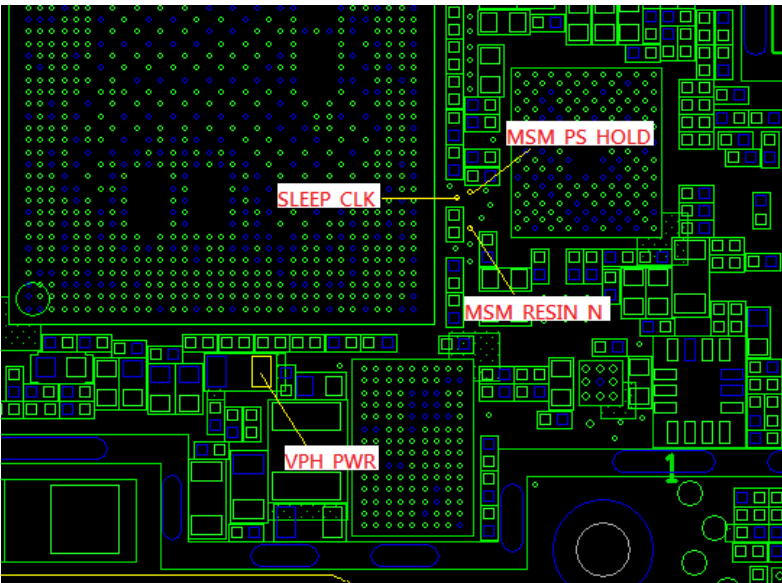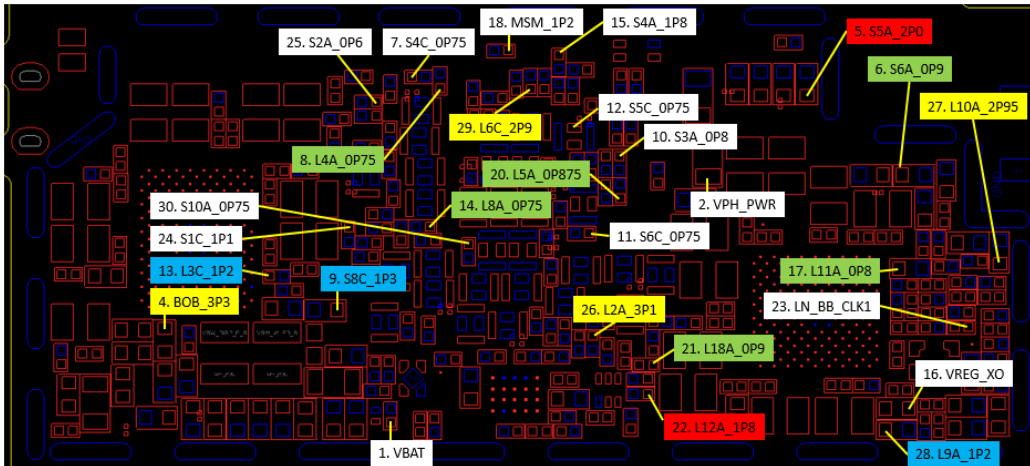

UFS Fail

1. Check the voltage of UFS

Power rail	NET name	Test point	Voltage
VCC	VREG_L10A_2P95	C1402.1	2.95
VCCQ2	VREG_S4A_1P8	C1406.1	1.8

2. If the voltage is normal, reheat or replace the IC (UFS and CPU) step by step.

(i) Reheat U1402 (UFS)

(ii) Reheat U0501(CPU)

(iii) Swap U1402

(iv) Swap U0501

LCM Fail

Check LCM module first, then check SMT status of CON2001.

Then check the power status.

- VREG_DISP_P_CONN : Check the voltage of C2001.1 is normal or not.

If it's abnormal, check R2006, PC9208 & PC9209.

- VREG_DISP_N_CON : Check the voltage of C2002.1 is normal or not.


If it's abnormal, check R2008, PC9210 & PC9211.

- LCD_1P8 : Check the voltage of C2009.1 is normal or not.

If it's abnormal, check R2003.

If the above steps are confirmed normal, but the voltages are still under the exception, reheat PU9001 and PU8401 sequentially.

If the problem is still not solved, swap PU9001 and PU8401 sequentially.

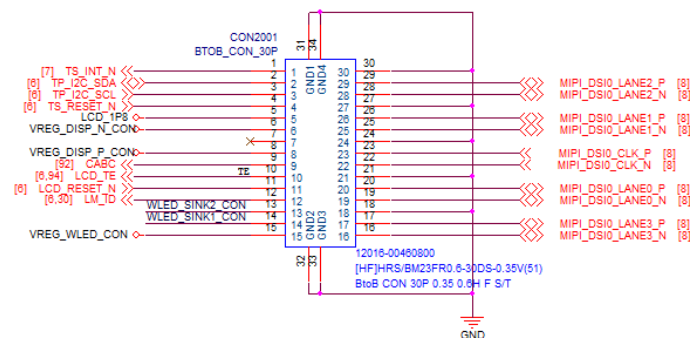

Backlight fail

若Check LCM module first, then check SMT status of CON2001.

Then check the power status.

- WLED_SINK1 : Check the voltage of L2002.1 is normal or not.

If it's abnormal, check L2002.

- WLED_SINK2 : Check the voltage of L2001.1 is normal or not.

If it's abnormal, check L2001.

- VREG_WLED_CON : Check the voltage of C2007.1 is normal or not.

If it's abnormal, check R2007, C2006, PC9202, PC9203, PL9201 and PD9201.

If the above steps are confirmed normal, but the voltages are still under the exception, reheat PU9101.

If the problem is still not solved, swap PU9101.

Google Key fail


Check LCM module first, then check SMT status of CON2101.

Then check the power status.

■ GOOGLE_KEY_CON : Check the voltage of C2115.1 is normal or not.
If it's abnormal, check R2104 , D2111 , C2115.

If the above steps are confirmed normal, but the voltages are still under the exception, reheat U0501.

If the problem is still not solved, swap U0501.

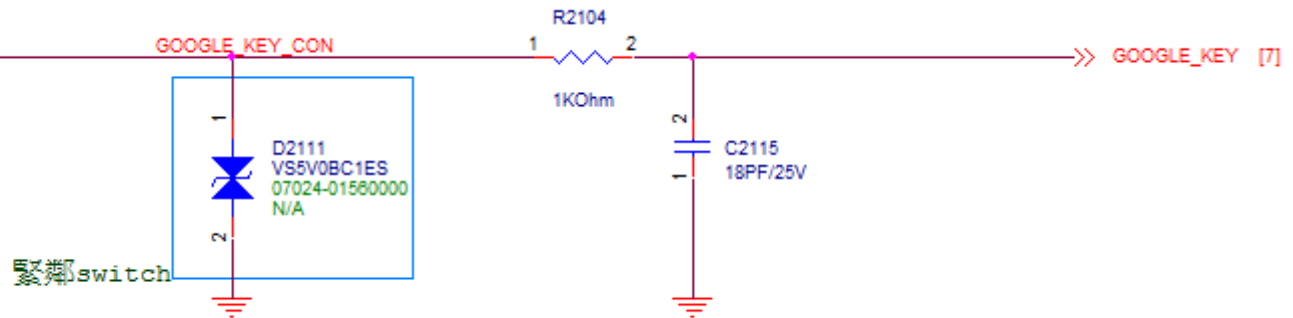

Touch Fail


Check LCM module first.

1. Check SMT status of CON2001.
2. Check the part of LCM fail page.
3. Check the status of TP_I2C_SDA, and check SMT status of R0602.
4. Check the status of TP_I2C_SCL , and check SMT status of R0601.
5. Check the status of TS_RESET_N. If it's abnormal, the failure is caused by U0501.
6. Check the status of TS_INT_N. If it's abnormal, the failure is caused by U0501.

If the above steps are confirmed normal, but the failure is still existing.

Reheat U0501 and PU9101 sequentially.


If the problem is still not solved, swap U0501 and PU9101 sequentially.

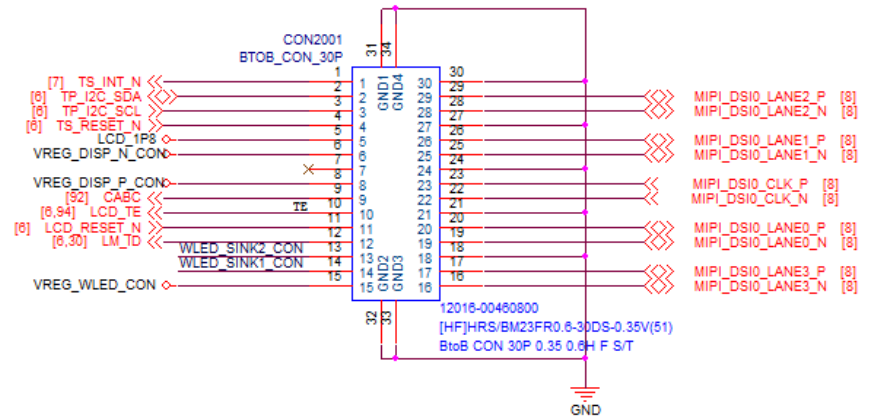

1st G+G Sensor Fail


1. Check the voltage of VREG_L8C_1P8 by measuring C2204.1.
2. If the voltage is abnormal, check VREG_L8C_1P8 connected capacitors first.
3. If the above components are normal, but VREG_L8C_1P8 is still 0 V. Check it's short to GND or open.
If it's short to GND, find the fail items.
If it's open, reheat PU9101 first, then swap PU9101.
4. If VREG_L8C_1P8 is normal, check U2205 by x-ray.
5. Measure SSC_SPI_CLK, SSC_SPI_MOSI, SSC_SPI_MISO, SSC_SPI_CS_N and GYRO_INT1/2 signals are normal or not.
6. If the above steps are done but the failure is still existing, swap U2205.

Gyroscope + G Sensor

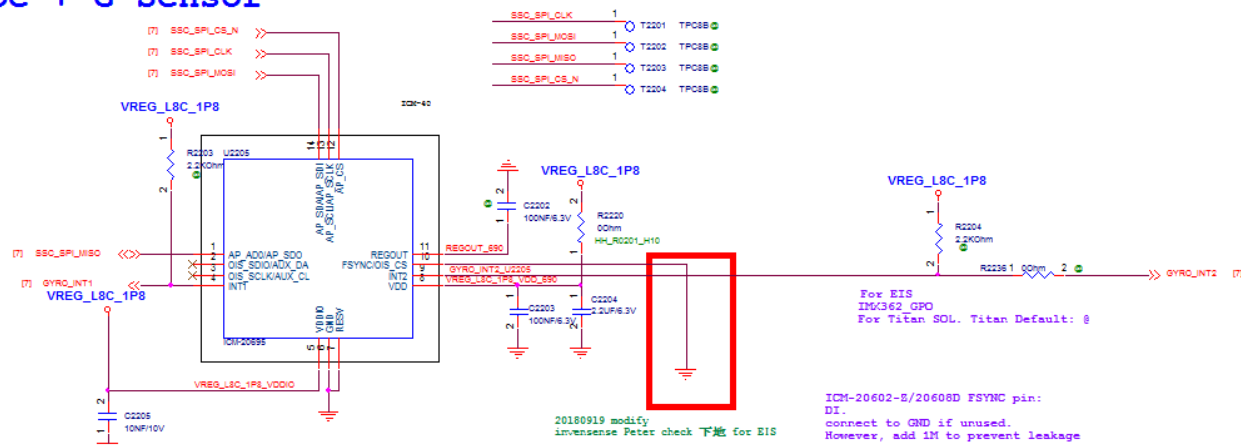

E-compass Sensor Fail

1. Check the voltage of VREG_L8C_1P8 by measuring C2209.1.
2. If the voltage is abnormal, check VREG_L8C_1P8 connected capacitors first.
3. If the above components are normal, but VREG_L8C_1P8 is still 0V.
Check it's short to GND or open.
If it's short to GND, find the fail items.
If it's open, reheat PU9001 first, then swap PU9001.
4. If VREG_L8C_1P8 is normal, check U2204 by x-ray.
5. Measure SSC_I2C1_SCL & SSC_I2C1_SDA signals are normal or not.
6. If the above steps are done but the failure is still existing, swap U2204.

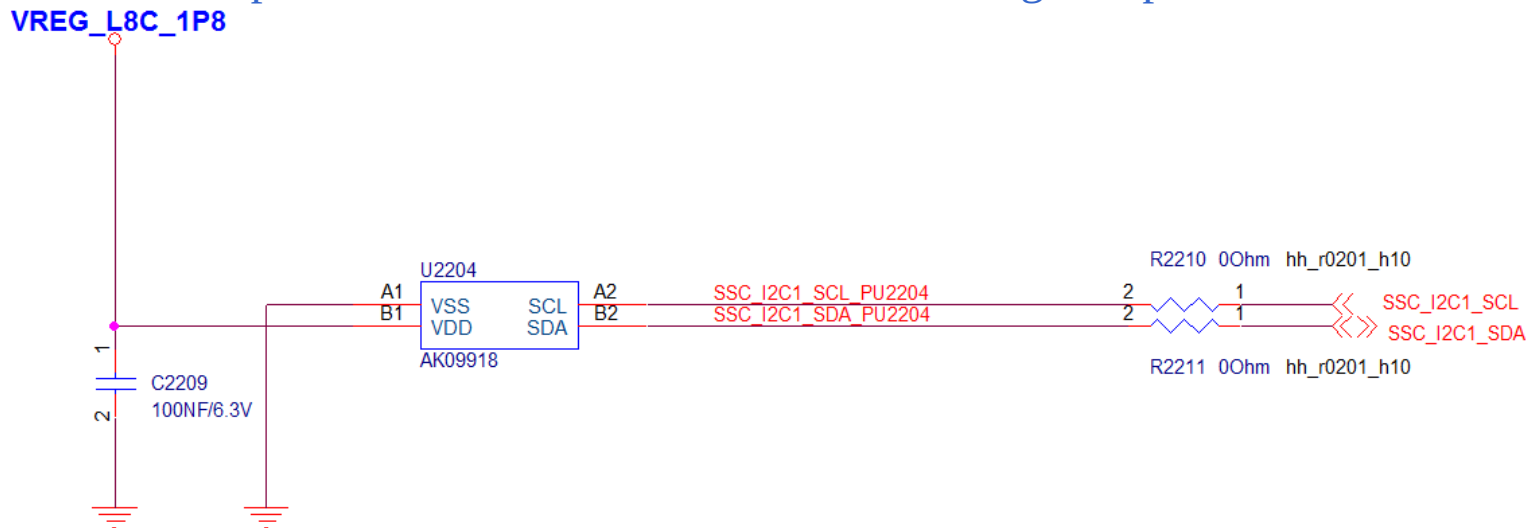


Proximity Sensor Fail

1. Check the voltage of VREG_L7C_3P0 by measuring C0401.1.
2. If the voltage is abnormal, check VREG_L7C_3P0 connected capacitors first.
3. If the above components are normal, but VREG_L7C_3P0 is still 0V.
Check it's short to GND or open.
If it's short to GND, find the fail items.
If it's open, reheat PU9101 first, then swap PU9101.
4. Check the voltage of VREG_L8C_1P8 by measuring C0402.1.
5. If the voltage is abnormal, check VREG_L8C_1P8 connected capacitors first.
6. If the above components are normal, but VREG_L8C_1P8 is still 0V.
Check it's short to GND or open.
If it's short to GND, find the fail items.
If it's open, reheat PU9101 first, then swap PU9101.
7. If VREG_L7C_3P0 & VREG_L8C_1P8 is normal, check U0401 by x-ray.
8. Measure ALPS_I2C_SCL, ALPS_I2C_SDA & PS_INT_N signals are normal or not.
9. If the above steps are done but the failure is still existing, swap U0401.

Finger Print Fail

1. Check the voltage of FP_3P0 by measuring C2301.1.
2. If the voltage is abnormal, check PU9501 and FP_3P0 connected capacitors first.
3. If the above components are normal, but FP_3P0 is still 0V. Check the voltage of VREG_BOB by measuring PU9506.1.
Check it's short to GND or open.
If it's short to GND, find the fail items.
If it's open, reheat PU9101 first, then swap PU9101.
4. If FP_3P0 is normal, check SMT status of CON2301.
5. Measure FPS_SPI_MOSI & FPS_SPI_MISO & FPS_SPI_CLK & FPS_SPI_CS_N & FPS_RST_N & FPS_INT_N & FP_ID signals are normal or not.
6. If the above steps are done but the failure is still existing, reheat U0501 first, then swap U0501.

Driver IC GF5228DN2+GF128A
(ID pin NC)

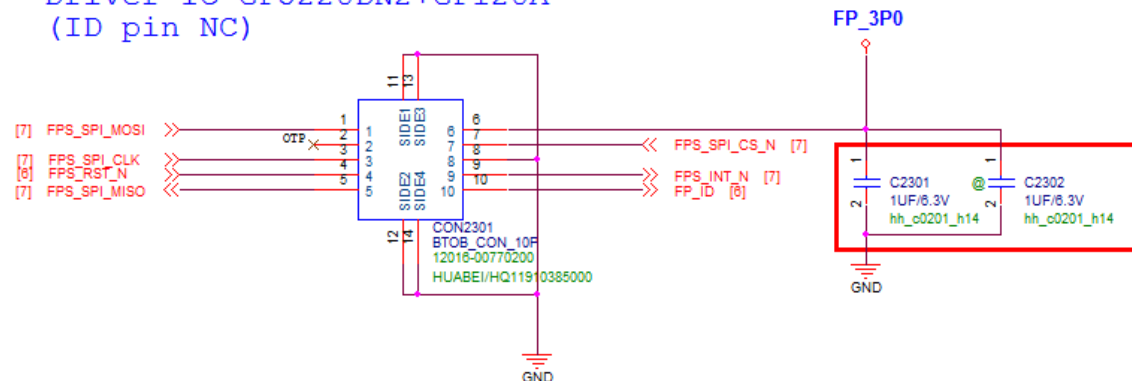

48M Tele. Camera Fail

1. Check Power cable, Signal cable, SIM FPC1, SIM FPC2, 48M camera is normal.
Check the status of CAM SB CON1703, CON1801, CON1802;
SIM SB CON0602, CON0603, CON0605; MB CON1602, CON1603, CON1701.
2. Check the voltage of MCAM0_DVDD_T_1P1 by measuring CAM SB C1703.1.
If it's short to GND, find the fail items. If not, check the components between MB PU8401 to SIM SB PU9505 to CAM SB CON1703.
3. Check the voltage of MCAM0_DOVDD_T_1P8 by measuring CAM SB C1701.1.
If it's short to GND, find the fail items. If not, check the components between MB PU9101 to CAM SB CON1703.
4. Check the voltage of MCAM0_AVDD_T_2P8 by measuring CAM SB C1702.1.
If it's short to GND, find the fail items. If not, check the components between MB PU9101 to SIM SB CON0605 to CAM SB PU1701 to CAM SB CON1703.
5. Check the voltage of MCAM0_AVDD_T_1P8 by measuring CAM SB C1726.1.
If it's short to GND, find the fail items. If not, check the components between MB PU9101 to SIM SB PU9508 to CAM SB CON1703.
6. Check CCI_I2C_SCL0 & CCI_I2C_SDA0 signals and connected components, If it's abnormal, find the fail items.

If the above steps are confirmed normal, but the failure is still existing. Reheat CAM SB PU1701, SIM SB PU9505, PU9508, MB PU8401, PU9101, U0501 sequentially.

If the problem is still not solved, swap CAM SB PU1701, SIM SB PU9505, PU9508, MB PU8401, PU9101, U0501 sequentially.

13M Wide Camera Fail

1. Check Power cable, Signal cable, SIM FPC1, SIM FPC2, 13M camera is normal.
Check the status of CAM SB CON1702, CON1801, CON1802;
SIM SB CON0602, CON0603, CON0605; MB CON1602, CON1603, CON1701.
2. Check the voltage of MCAM1_AVDD_W_2P8 by measuring CAM SB C1708.1.
If it's short to GND, find the fail items. If not, check the components between MB
PU9101 to SIM SB PU9503 to CAM SB CON1702.
3. Check the voltage of MCAM1_DVDD_W_1P2 by measuring CAM SB C1705.1.
If it's short to GND, find the fail items. If not, check the components between MB
PU8401 to SIM SB PU9501 to CAM SB CON1702.
4. Check the voltage of MCAM1_DOVDD_W_1P8 by measuring CAM SB C1712.1.
If it's short to GND, find the fail items. If not, check the components between MB
PU9101 to CAM SB CON1702.
5. Check CCI_I2C_SCL1 & CCI_I2C_SDA1 signals and connected components, If it's
abnormal, find the fail items.

If the above steps are confirmed normal, but the failure is still existing.

Reheat SIM SB PU9501, PU9503, MB PU8401, PU9101, U0501 sequentially.


If the problem is still not solved, swap SIM SB PU9501, PU9503, MB PU8401, PU9101,
U0501 sequentially.

SIM/SD Card Fail

1. Check SIM FPC2, SIM tray, SIM 1 / 2, SD card is normal.
Check the status of CON2501~2504, CON0603 and MB CON1603.
2. If SIM 1 fail, measure SIM SB C2506.1 whether there is power supply. If not, check the status of SIM SB C2506, C2507, D2504, R2513.
3. If SIM 2 fail, measure SIM SB C2508.1 whether there is power supply. If not, check the status of SIM SB C2508, C2509, D2509, R2507.
4. If SD card fail, measure SIM SB C2501.1 whether there is power supply. If not, check the status of SIM SB C2502, D2518, U2501.
5. If the above check without exception, but it's still no powered. Reheat SIM SB U2501 first. If the problem is still not solved, swap SIM SB U2501.
6. Check whether the SIM SB R2510.1 will fall from 1.8V to 0V after SIM tray is inserted. If not, check the status SIM SB CON2504, R2514, D2517, C2503, R2515, R2510, PQ8002.
7. Check SDC2_CLK while inserting SD card. Measure MB C0503.1 to make sure if clock signal appear. If not, check the status of MB R0507, C0503, U0501.
8. Check UIM1_CLK and UIM2_CLK while inserting the dual SIM. Measure whether the MB T0707 and T0705 have clock signal or not. If not, check the status of MB D1601, D1604, U0501.

Vibrator Fail

1. Check IO FPC and Vibrator is normal.
2. Check the status of USB SB PAD0901, PAD0902, CON0201 and MB CON1601.
3. Check whether the USB SB PAD0901, PAD0902 are in contact with Vibrator.
4. Check the status of USB SB R0901, R0902, C0901, C0902.
5. If the problem is still not solved, reheat PU9001 first, then swap PU9001.

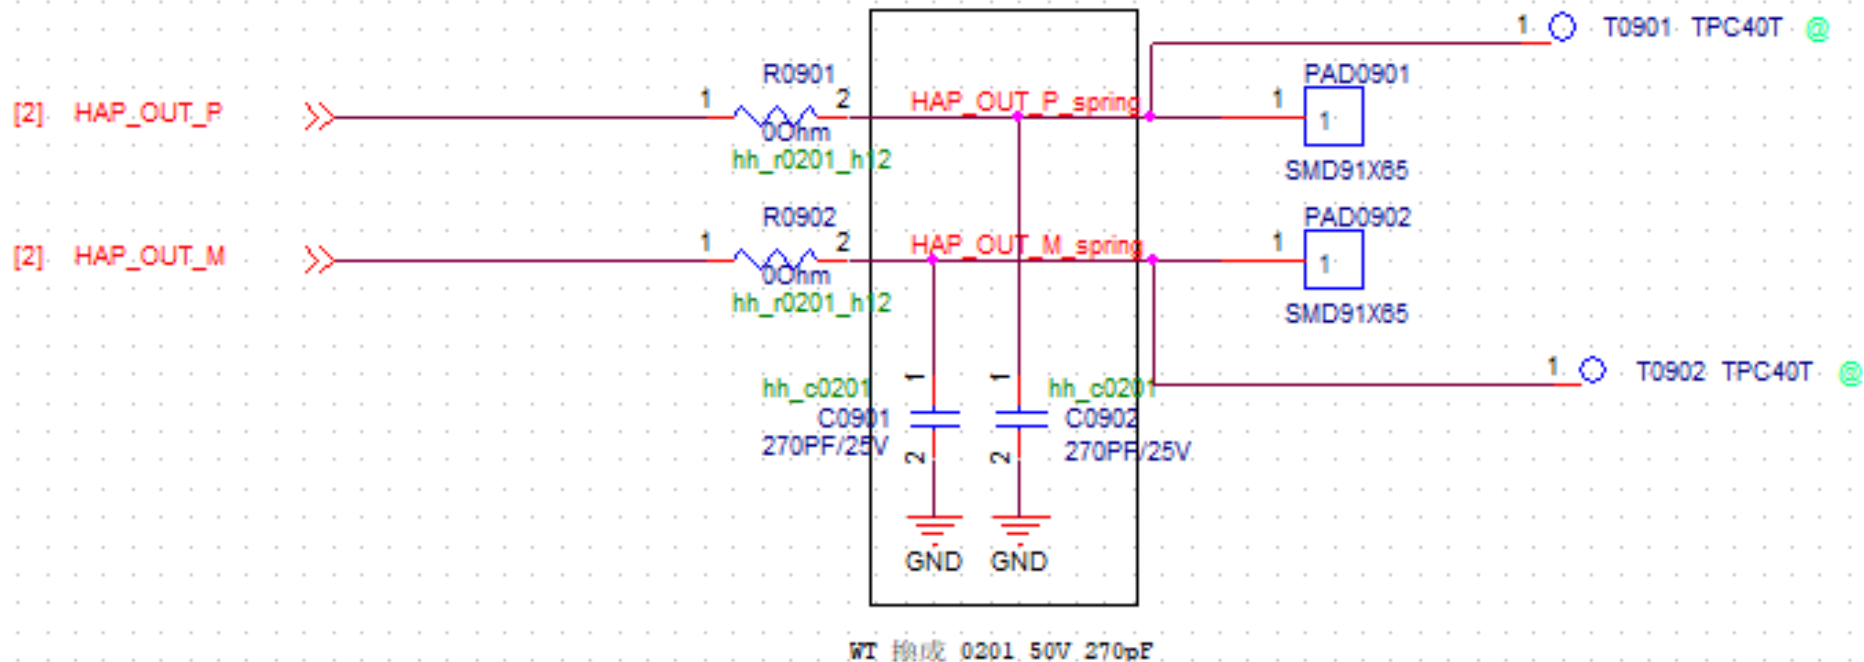


VOL Key Fail



1. Check CON2101 and Side key FPC are normal.
2. Check the status of MB D2108, R2101, C2105, D2109, R2102, C2111.
3. Press the “DOWN” button to check whether the MB C2111.2 pull LOW or not.
4. Press the “UP” button to check whether the MB C2105.2 pull LOW or not.

應放bottom side/shielding外/易接觸

Buttons

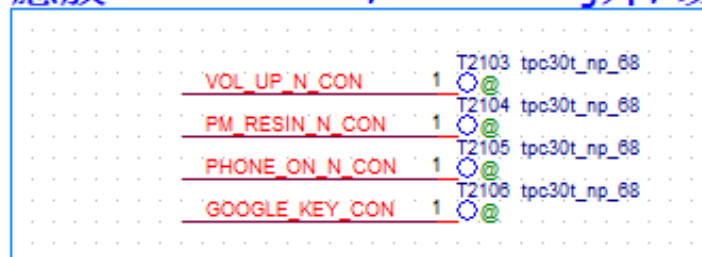

For Board-Level Test

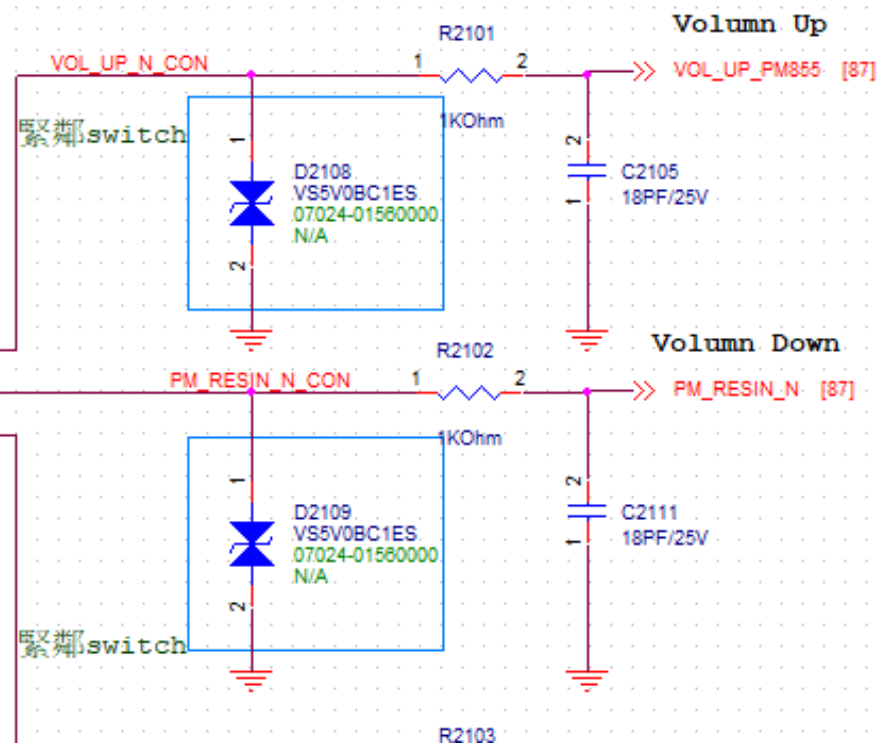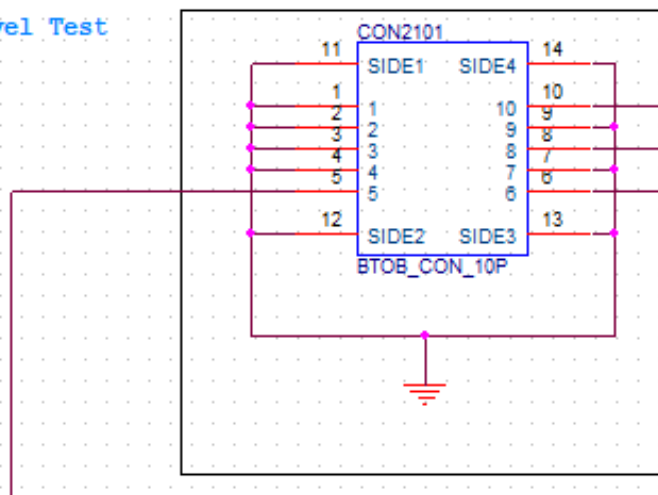

Motor Fail

1. Check SIM FPC1, SIM FPC2, Motor FPC are normal, then confirm problems occurred in SIM SB or MB.
 - If problems occurred in SIM SB:
 1. Check the status of SIM SB CON0602, CON0603, CON0604.
 2. Measure SIM SB C0507.1 whether there is power supply. Check the voltage of C0508.1 is 5 V. If not, check the status of SIM SB C0501, C0503, C0508, C0301, C0304, CE0301, CE0302, CE0303. Check the voltage of C0504.1 is 3.3V. If not, check the status of SIM SB C0504, D0501, C0201, C0202, C0305.
 3. If power supply of 5V and 3.3V are normal, Check the status of R0602, R0603, R0209, R0203, R0206, R0207, R0208, R0303~R0314, C0312~C0315.
 4. If the above steps are confirmed normal, but the failure is still existing. Reheat SIM SB U0202, Q0201, Q0202, Q0203, U0201, U0301 sequentially. If the problem is still not solved, swap SIM SB U0202, Q0201, Q0202, Q0203, U0201, U0301 sequentially.
 - If problems occurred in MB:
 1. Check the status of MB CON1602, R0618, R0619.
 2. If the above steps are confirmed normal, but the failure is still existing. Reheat MB U0501 first, then swap MB U0501.

2nd G+G Sensor Fail

1. Check Signal cable is normal, then confirm problems occurred in CAM SB or MB.
 - If problems occurred in CAM SB:
 1. Check the status of CAM SB C2202, CON1801.
 2. Check the voltage of C2203.1 is 1.8V. If not, check the status of C2203~C2206.
 3. If the above steps are confirmed normal, but the failure is still existing. Reheat CAM SB U2201, then swap U2201.
 - If problems occurred in MB:
 1. Check the status of MB PC9301, R0611, R0612, CON1701.
 2. If the above steps are confirmed normal, but the failure is still existing. Reheat MB PU9101, U0501, then swap PU9101, U0501.

Indicator LED Fail

1. Check SIM FPC1 is normal, then confirm problems occurred in Prox. FPC, SIM SB or MB.

- If problems occurred in Prox. FPC:


1. Check the status of Prox. FPC LED0401, CON0301.
2. If the failure is still existing, swap Prox. FPC LED0401.

- If problems occurred in SIM SB:

1. Check the status of SIM SB CON0601, CON0602.

- If problems occurred in MB:

1. Check the status of MB CON1601, PU9101.
2. If the failure still exist, reheat MB PU9101 first, then swap MB PU9101.

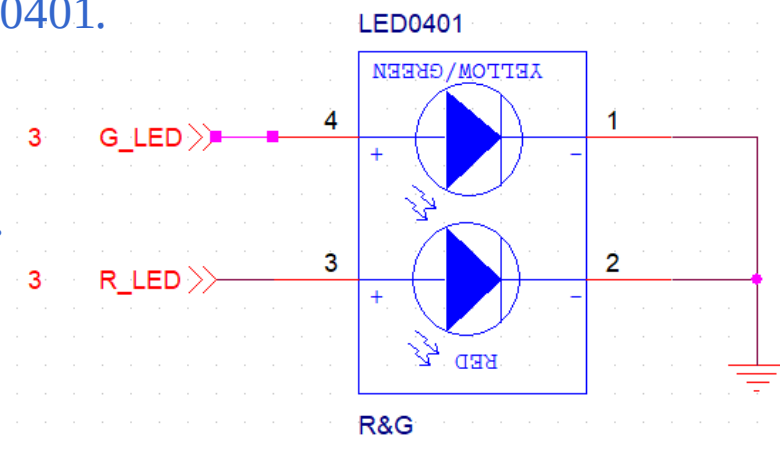

Flash LED Fail

1. Check SIM FPC1 and Power cable are normal, then confirm problems occurred in Flash FPC, CAM SB, SIM SB or MB.
 - If problems occurred in Flash FPC
 1. Check the status of Flash FPC LED2401, LED2402, CON2401.
 2. If the failure still exists, swap Flash FPC LED2401, LED2402.
 - If problems occurred in CAM SB
 1. Check the status of CAM SB CON2401, CON1802.
 - If problems occurred in SIM SB
 1. Check the status of SIM SB CON0602, CON0605.
 - If problems occurred in MB
 1. Check the status of MB CON1602, PU9101.
 2. If the failure still exists, reheat MB PU9101 first, then swap MB PU9101.

Laser Sensor Fail

1. Check SIM FPC1, Power cable, Signal cable are normal, then confirm problems occurred in Flash FPC, CAM SB, SIM SB or MB.

- If problems occurred in Flash FPC:

1. Check the status of Flash FPC C2401, C2403, R2401, CON2401.
2. Check the voltage of C2401.1 is 3V. If not, check the status of C2401, C2403.
3. If the failure still exists, swap Flash FPC U2402.

- If problems occurred in CAM SB:

1. Check the status of CAM SB R2402, CON2401, CON1801, CON1802.

- If problems occurred in SIM SB:

1. Check the status of SIM SB CON0602, CON0605.

- If problems occurred in MB:

1. Check the status of MB PR9301, R0611, R0612, CON1701.
2. If the failure still exists, reheat MB PU9101, U0501 first, then swap PU9101, U0501.

Receiver Fail


1. Check Receiver, Power cable, Signal cable, SIM FPC1, SIM FPC2 are normal.
2. Check whether the CAM SB AU3601, AU3602 are in contact with Receiver.
3. Check the status of CAM SB CON1801, CON1802, D3601, D3602; SIM SB AL0802, AL0803, AC0807, AC0808, CON0602, CON0603; MB R0617, R0624, CON1602, CON1603, CON1701.
4. Check the voltage of SIM SB AC0809.2 is 1.8V. If not, check the status of SIM SB AC0805, AR0809.
5. Measure SIM SB AC0802.1 whether there is power supply. If not, check the status of SIM SB AC0801, AC0802, AL0801.
6. If the above steps are confirmed normal, but the failure is still existing. Reheat SIM SB AU0801.
7. If the problem is still not solved, swap SIM SB AU0801.

Speaker Fail

1. Check Speaker, IO FPC, SIM FPC1, SIM FPC2 are normal.
2. Check whether the USB SB AU0801, AU0802 are in contact with Speaker.
3. Check the status of USB SB AL0801, AL0802, CON0201;
SIM SB AL0805~0808;
MB R0617, R0624, CON1601, CON1602, CON1603.
4. Check the voltage of SIM SB AC0818.2 is 1.8V. If not, check the status of SIM SB AC0818, AR0810.
5. Measure SIM SB AC0811.1 whether there is power supply. If not, check the status of SIM SB AC0810, AC0811, AL0804.
6. If the above steps are confirmed normal, but the failure is still existing. Reheat SIM SB AU0802.
7. If the problem is still not solved, swap SIM SB AU0802.

Main Mic Fail


1. Check IO FPC is normal, then confirm problems occurred in USB SB or MB.
 - If problems occurred in USB SB:
 1. Check the status of USB SB CON0201.
 2. Measure USB SB AC0607.1 whether there is power supply.
 3. Check the status of USB SB AL0607, AC0607, AL0608, AC0608, AR0603, D0608.
 4. If the above steps are confirmed normal, but the failure is still existing. Please swap USB SB AU0601.

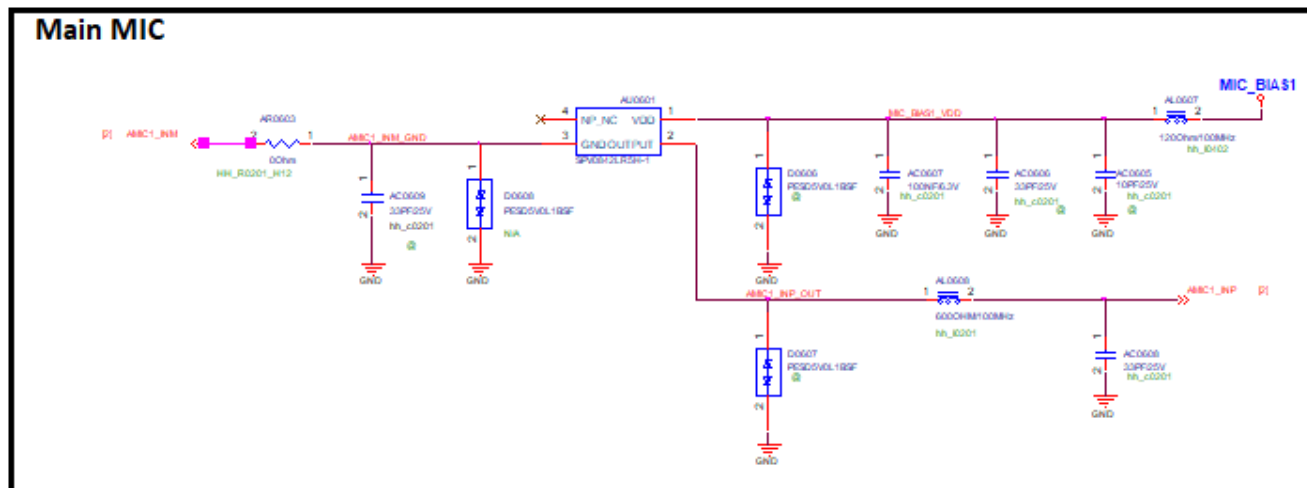

Main Mic Fail

■ If problems occurred in MB:

1. Check the status of MB CON1601.
2. Check the status of MB AL3511, AL3512, AR3520, AR3515.
3. Check the voltage of MB AC3541.1 is 3.3 V and MB AC3521.2 is 1.8 V.
4. If the above steps are confirmed normal, but the failure is still existing. Reheat MB PU3501, then swap MB PU3501.

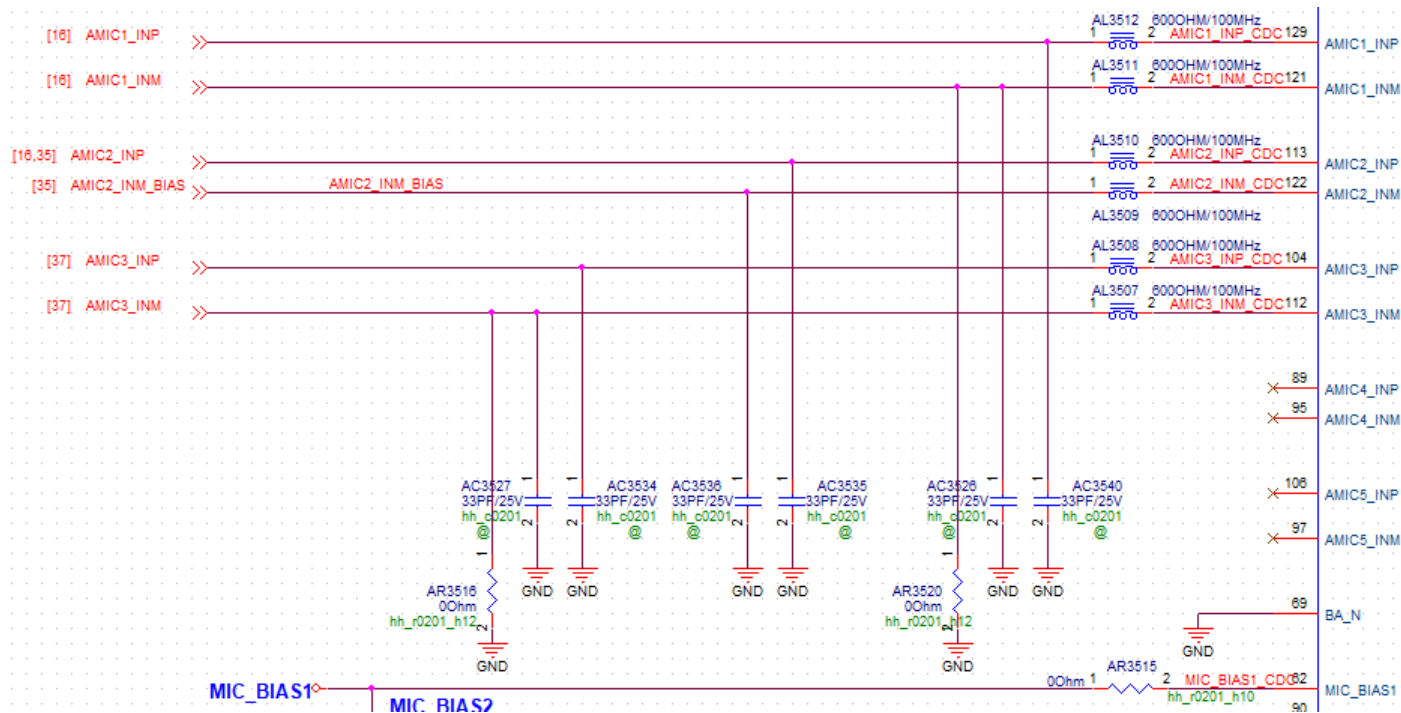


2nd Mic Fail

1. Measure MB AC3702.1 whether there is power supply.
2. Check the status of MB AL3701, AC3702, AL3703, AC3705, AR3701, D3701.
3. Check the status of MB AL3507, AL3508, AR3516, AR3502.
4. Check the voltage of MB AC3541.1 is 3.3 V and MB AC3521.2 is 1.8 V.

If the above steps are confirmed normal, but the failure is still existing.

Reheat MB PU3501, then swap MB AU3701. If the problem is still not solved, swap MB PU3501.

2ND MIC

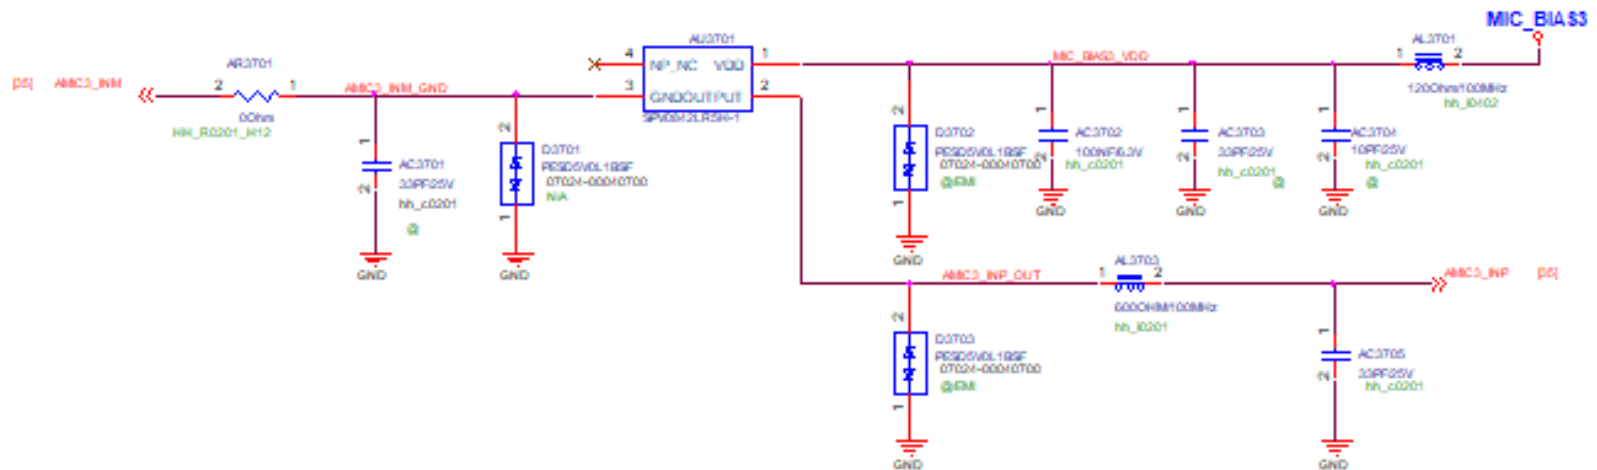

Headset Fail (L/R)

1. Check IO FPC is normal, then confirm problems occurred in USB SB or MB.

■ If problems occurred in USB SB:

1. Check the status of USB SB CON0201, AL0602, AL0604, AL0605, D0602, D0604, AR0601, AL0603, D0601.
2. If the above steps are confirmed normal, but the failure is still existing. Please swap USB SB AJ0601 ◦

■ If problems occurred in MB:

1. Check the status of MB CON1601, AR3703, AR3704, AR3507, AR3509, D3504, D3505, AR3508, AR3510.
2. Check the voltage of MB AC3541.1 is 3.3 V and MB AC3521.2 is 1.8 V.
3. If the above steps are confirmed normal, but the failure is still existing. Please reheat MB PU3501 first, then swap MB PU3501.

Headset Fail (Mic)

1. Check IO FPC is normal, then confirm problems occurred in USB SB or MB.
 - If problems occurred in USB SB:
 1. Check the status of USB SB CON0201, AL0602, AL0606, AC0604, D0605, AR0601, AL0603, D0601.
 2. If the above steps are confirmed normal, but the failure is still existing. Please swap USB SB AJ0601 ◦
 - If problems occurred in MB:
 1. Check the status of MB CON1601, AL3509, AL3510, AC3532, AR3518, AR3517, AC3538, AR3508, AR3510.
 2. Check the voltage of MB AC3541.1 is 3.3 V and MB AC3521.2 is 1.8 V.
 3. If the above steps are confirmed normal, but the failure is still existing. Please reheat MB PU3501 first, then swap MB PU3501.

Headset Fail (Hook Det)

1. Check IO FPC is normal, then confirm problems occurred in USB SB or MB.

- If problems occurred in USB SB:

1. Check the status of USB SB CON0201, AL0602, AL0609, D0603, AR0601, AL0603, D0601.
2. If the above steps are confirmed normal, but the failure is still existing. Please swap USB SB AJ0601 ◦

- If problems occurred in MB:

1. Check the status of MB CON1601, AR3508, AR3510.
2. Check the voltage of MB AC3541.1 is 3.3 V and MB AC3521.2 is 1.8 V.
3. If the above steps are confirmed normal, but the failure is still existing. Please reheat MB PU3501 first, then swap MB PU3501.

Q&A
