


Apple mobile phone general disease repair experience

1、 6

1. Short circuit in main supply

Short circuit of main supply: c5202_RF

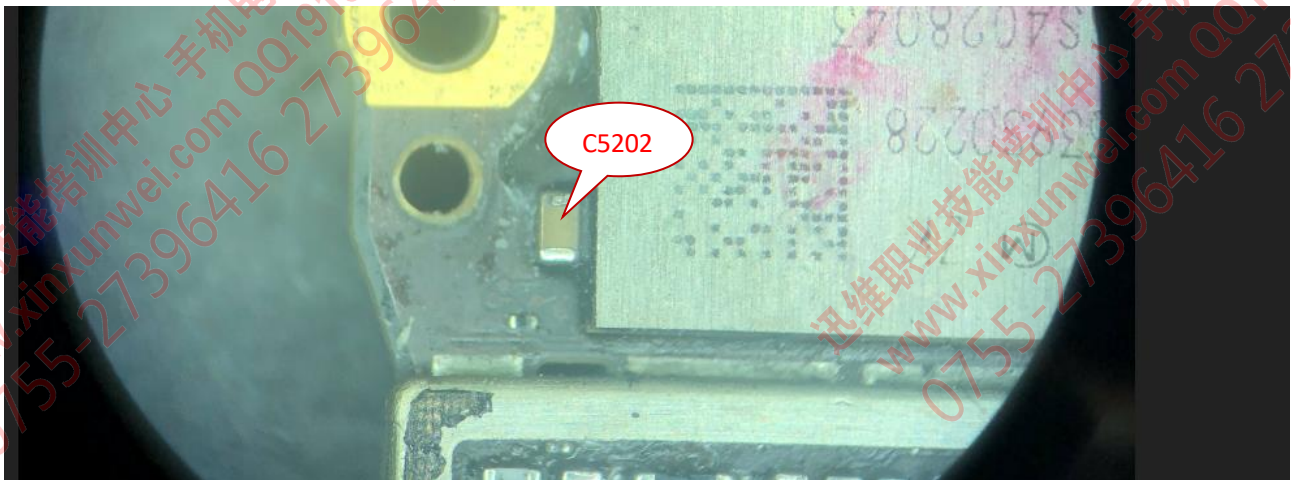

Main supply short circuit c1597 c1552




2、 1.8SDRAM powering short circuit:

C1293



U5411

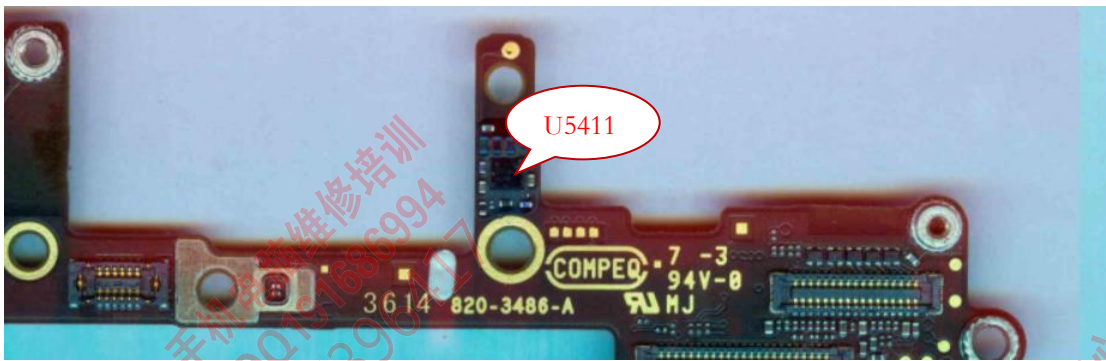


3、Short circuit in hard disk 3V supply:

C0634



4、1.2SDRAM short circuit:

C1214 C1216

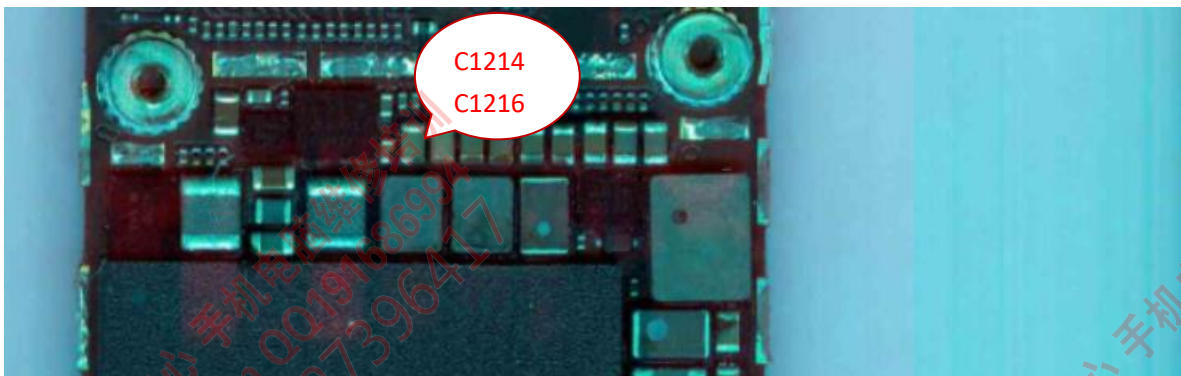

5、PP1V8 has a ground resistance value around 30 and most of them are CPU short circuits.

Leakage: mostly fingerprint, the guide photoreceptor sensing is problematic from filtering capacitance supplied at 3V. USB chips are also prone to bad.

二、Machine general disease after a 6-generation fall


- 1、The WiFi 14 angle reset and broken line resistance value is more than 600, normal about 450.

May fly from the r5208 RF fly line to the c5215 RF reset point or to the test point.

3、 6-generation repair experience:

1. Post not taken: 2.85 conversion tube is in problem, can fly main supply to test is not a conversion tube problem.


Normal use can only fly hard disk 3V. Fly main supply will cause taking a dark place where the flower screen has a vertical bar.

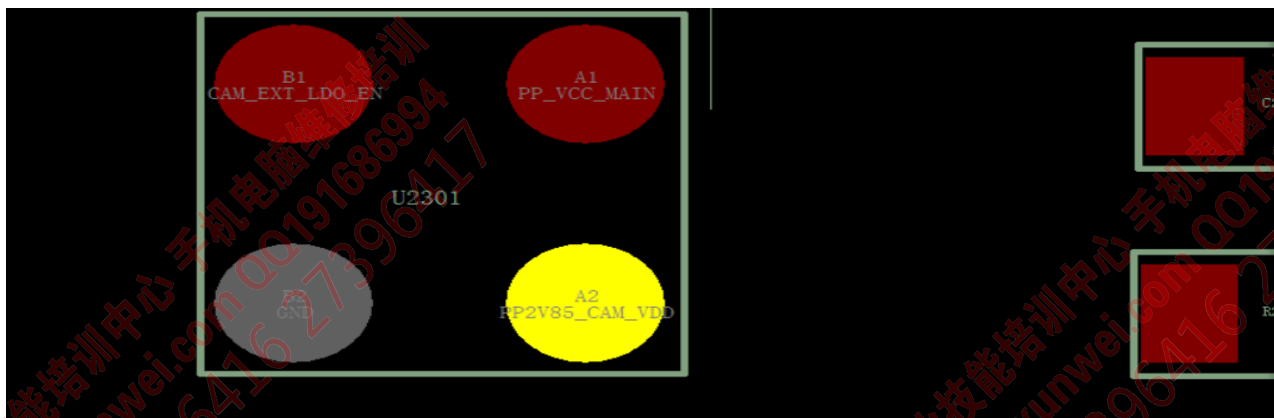



U2301] [PP2V85_CAM_VDD] [阻值(502)] [电压(2.85V (相机打开时))]

2. No touch: change to black to touch the chip, no to see if the screw post is screwed, there is a touch synchronization signal on the edge of the screw post, the synchronization signal will break after the screw is screwed. The drag value can't be measured, only the line can be tested broken.

3. No service no signal: after the band break line problem is excluded, most of them are the radio-frequency has a problem replacing the radio-frequency chip. 4, no charge: a shortcharge tube, no change replacing the chip, USB chip. Exchange discharge capacitance, charge inductor.

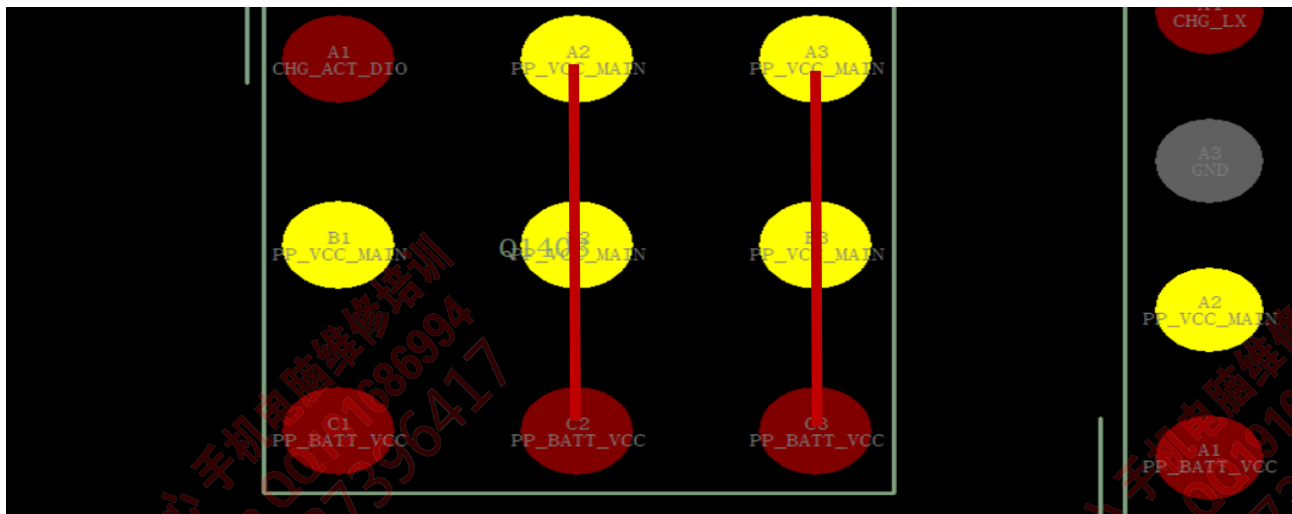


5. 6 generation left screw post wringing causes the no display, 6p is the right screw post wringing no display also galvanizes around 80mA.

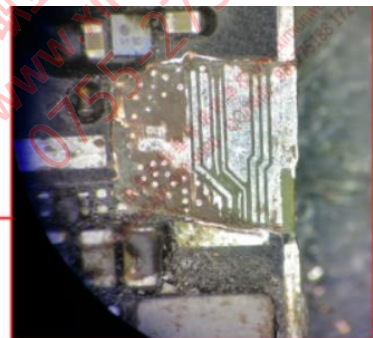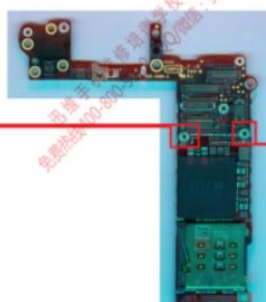


6. 6p general disease is more than 6 one M1 corner broken wire other failure repair same, no touch M1 corner broken

wire, fly wire

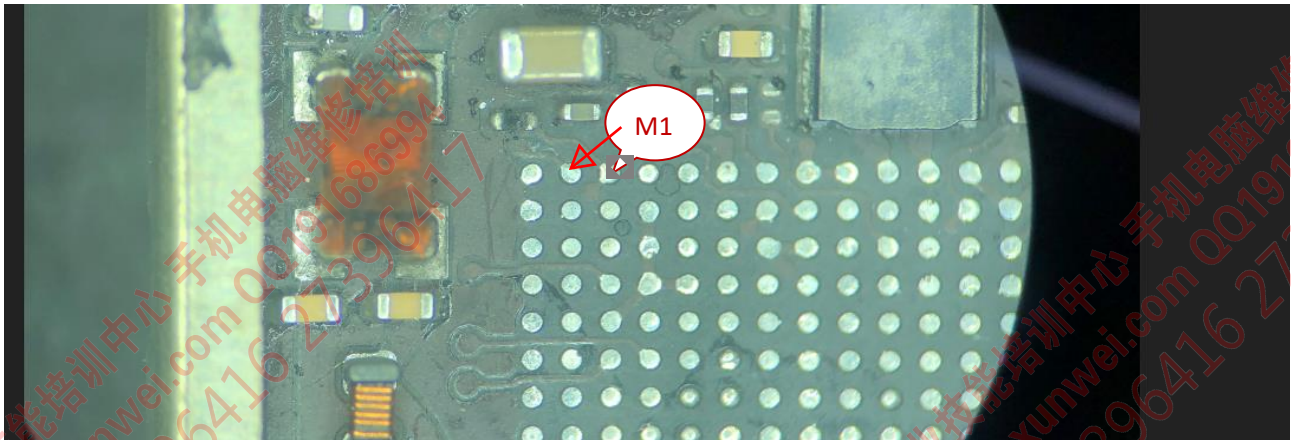

4. 6S comorbidity experience


1. Sometimes nil when no service signal, problems with RF

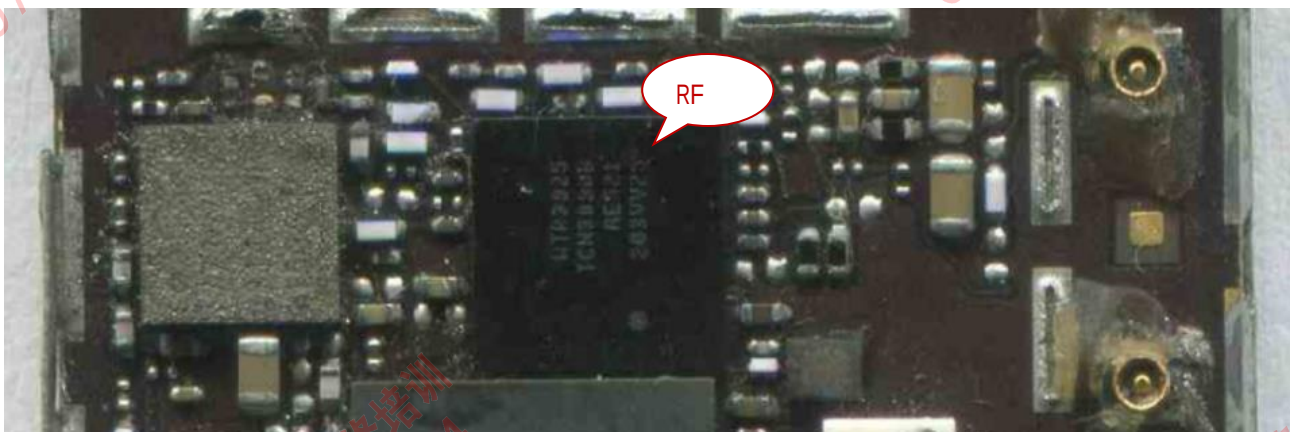


2. Not charged: charge induces bad




3. WiFi signal difference: there is a problem with the filter next to WiFi.

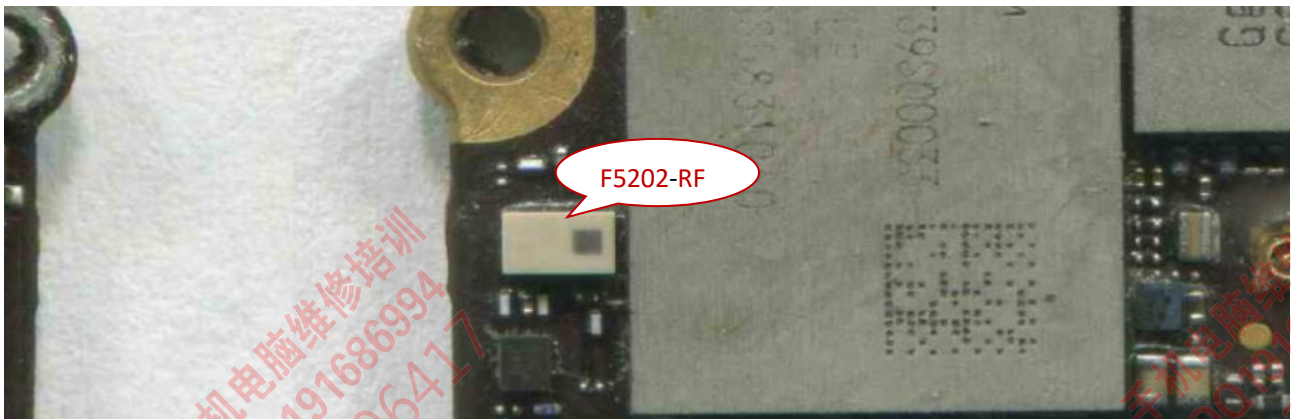


4. Removing WiFi requires hard disk unbinding, and removing WiFi can also easily cause problems with white apple restart from logical patch empty welding, most if it is the WiFi that causes white apple restart, mostly by blowing the logical patch empty welding.

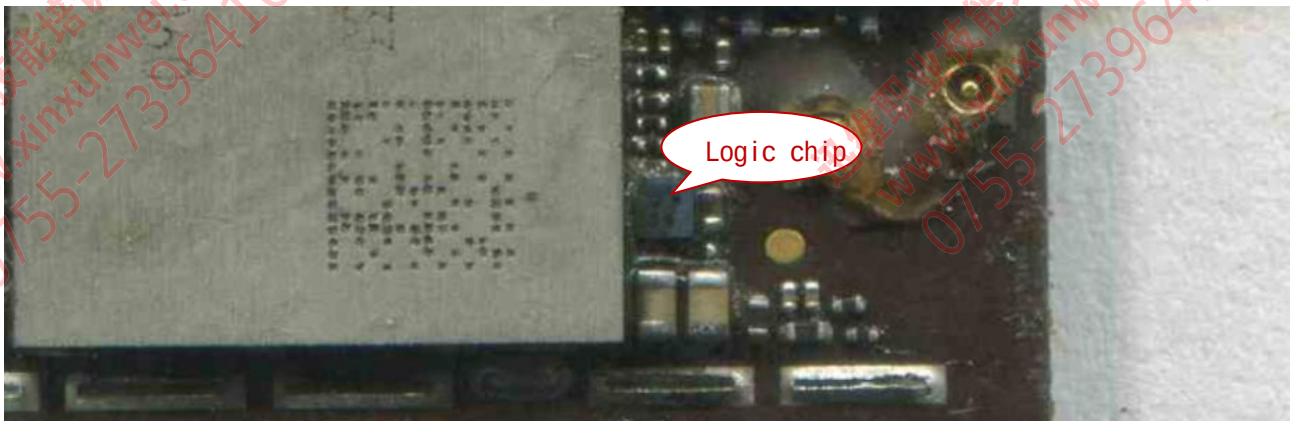

5. The unlit or yin-yang screen of the 6S mostly resulted from damage to the feedback inductor fl4211 fl4212.

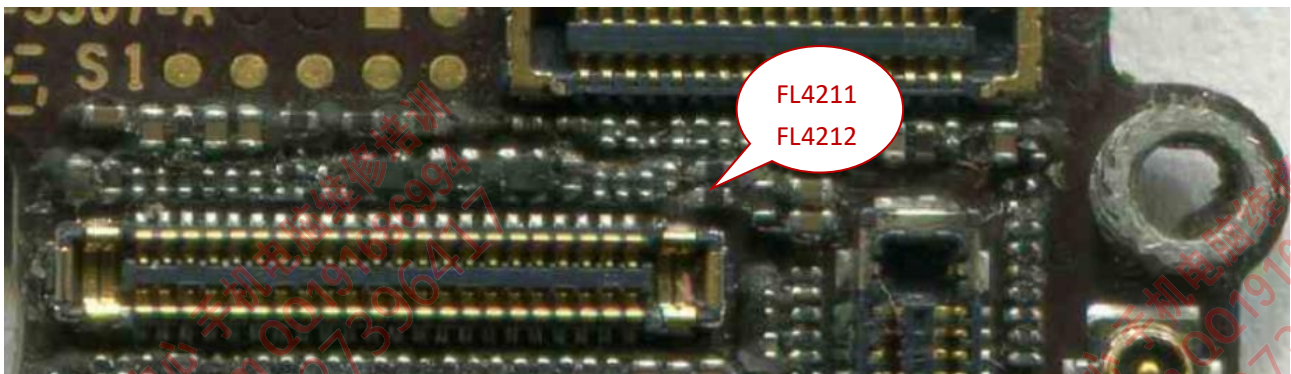


6. 6S water intake easily shows chip damage, i2c0 bus pull resistance corrosion r0900r0901, bus pull corrosion also causes power on 60mA or 100mA zeroing cycles, and does not recognize the cover current is almost the same with direct replacement.

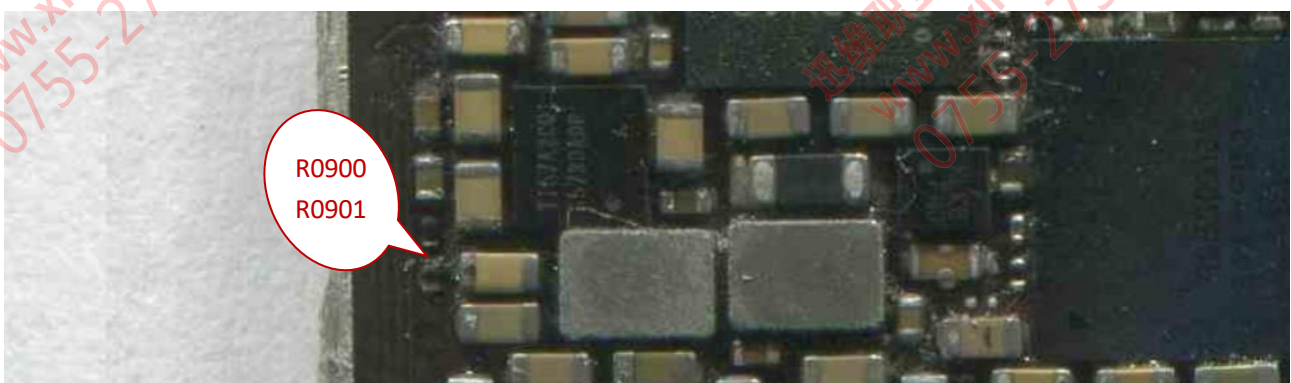


7. 3V short circuiting of 6S hard disks generally results from c1515 damage at the lower right corner of hard disks.




8. The short main supply is generally bad two capacitances c5283 ÷ RF c5284 ÷ RF on WiFi edge.

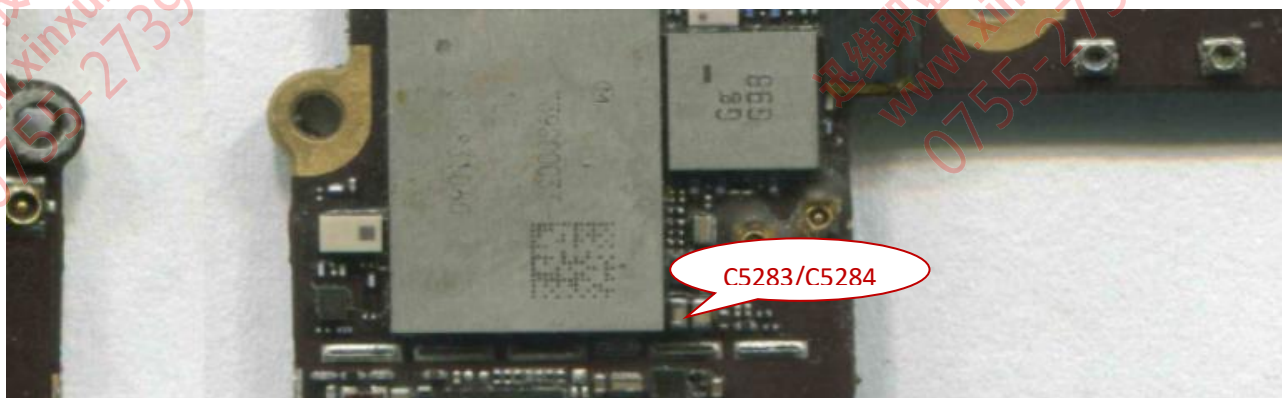

9. After a 6S fall, there will be brush report error 4013 or - 1 mostly with a fall back weld, or S1 S2 S3 S4 with a power supply inductor fall to weld the fall off angle

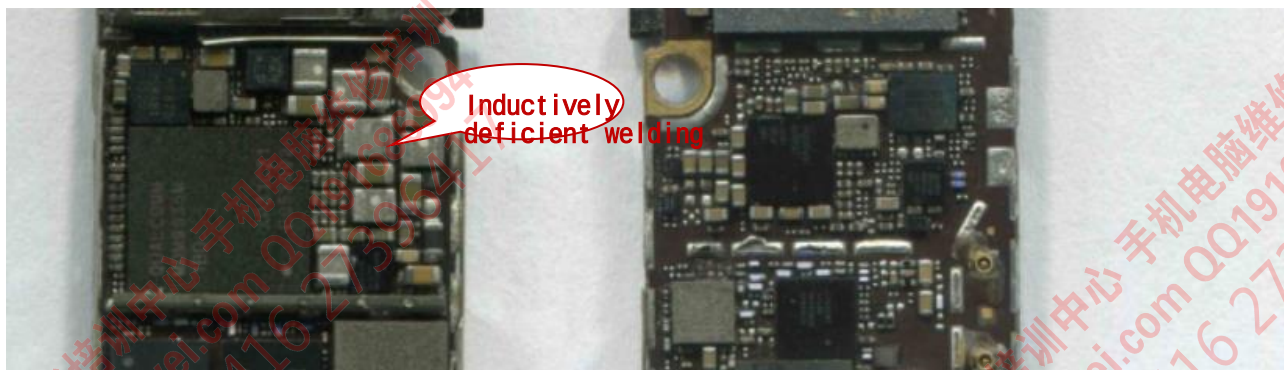

10. Most of the 6S leakage was the USB management chip's bad.

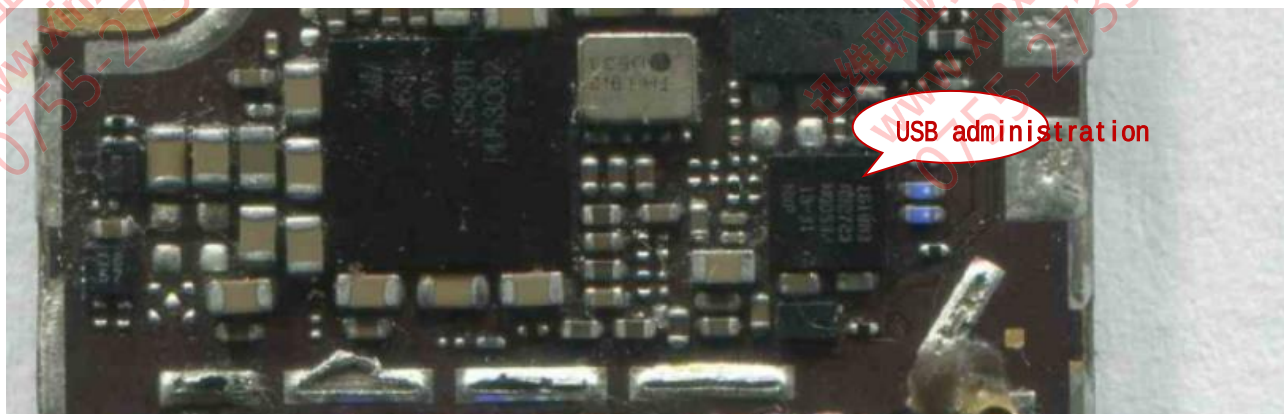

11. No card reading



12. 6S, 6sp headphone with murmur silent:



13. 6S, 6sp battery detects bad feet boot restart brush error:



14. 6S, 6sp connected PCs were able to charge and play charger was unreactive




15. 6S, 6sp dormant change not wake shotgun blow l2020, l2021




5、7 generation the general disease experience


1. 7 generation three network band is easy to be bad, S1 S2 S3 S4 S5 is easy to short circuit. Like this case, the band power can be removed first, if also the short basic band is bad, the band is bad and cannot brush, not enter and not go to the table. The ldo3 short circuit is generally the size of the RF chip is bad, the general situation is the size RF band power supply is replaced together, the band power 83 8893 98 to be connected and grounded.

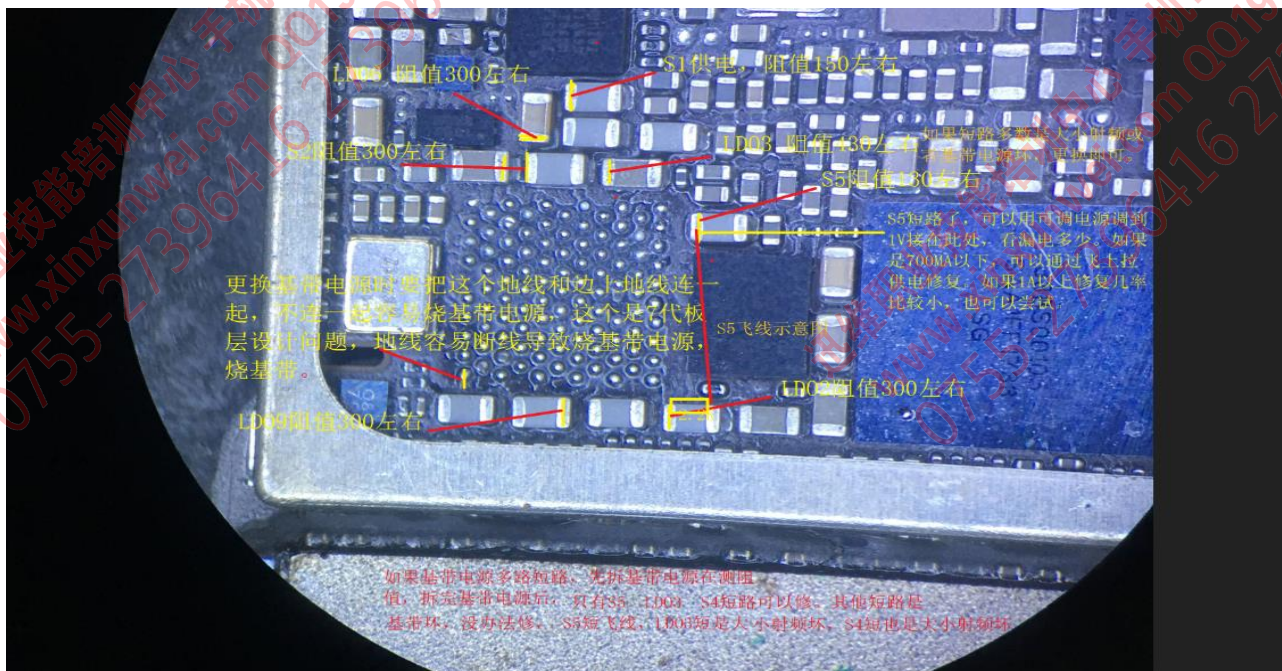


2. The broken machine in 7 generations, easy to cover short circuit. The c1874c1823 upper cover supply resistance value was measured to judge.

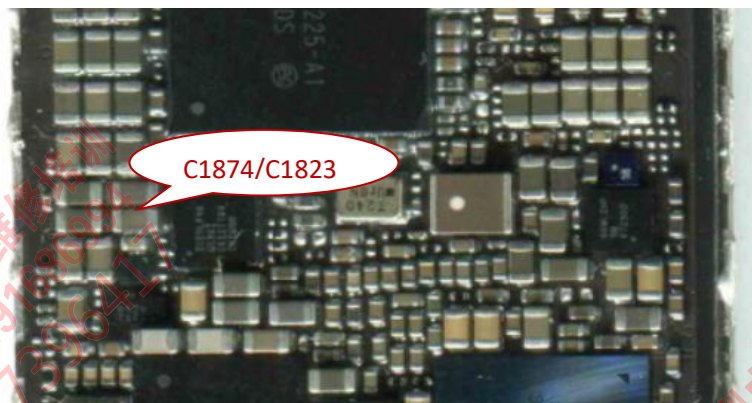


3. Broken machine white apple restart, inductively empty welding near CPU

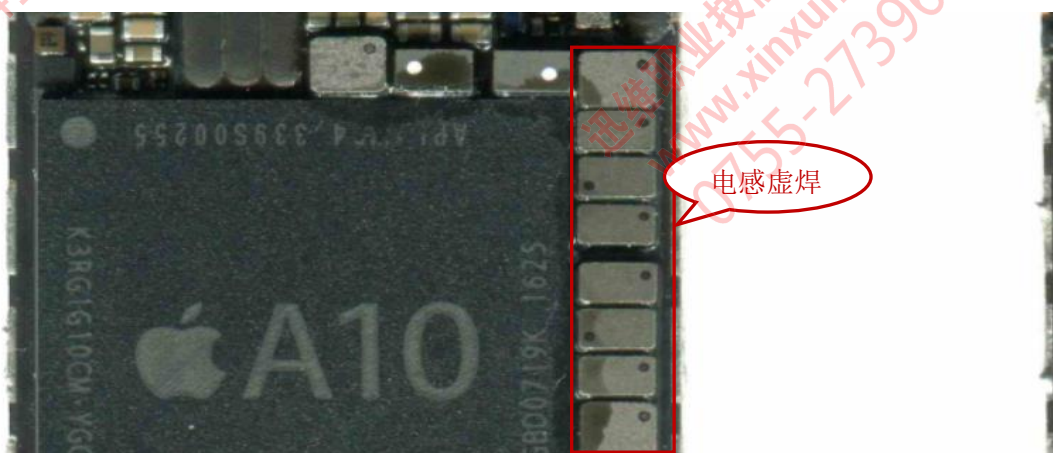

4. Audio disconnection

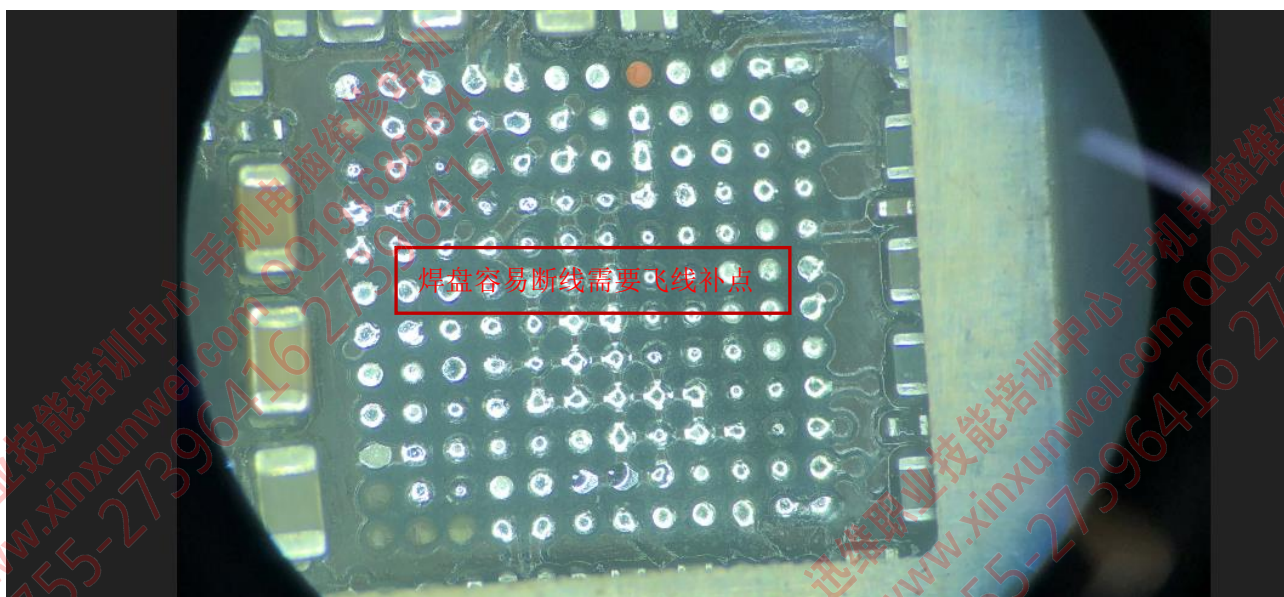


5. Broken machines WiFi easily chips or pads fall away.wifi sometimes does not.

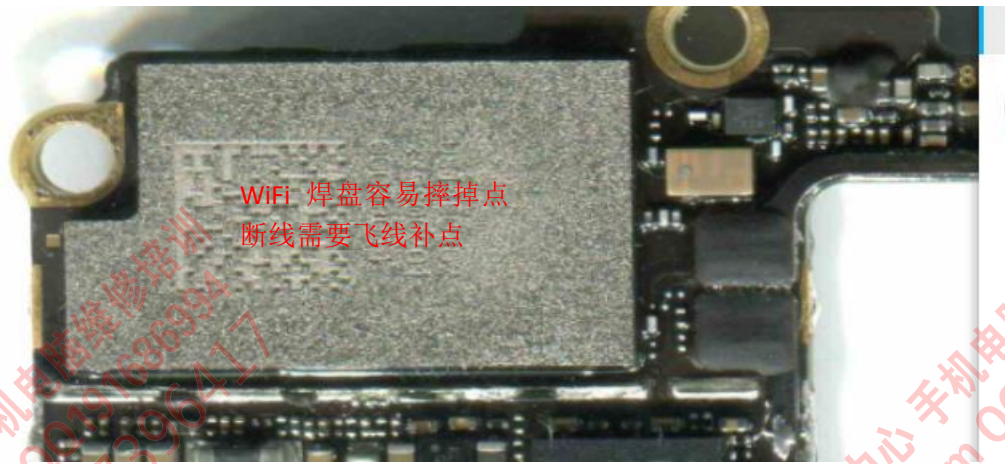


6、7-generation repair experience

1. Vibration free / no external release / most are chip I2S bus has a problem or bus control tube has a question u4805 u4806

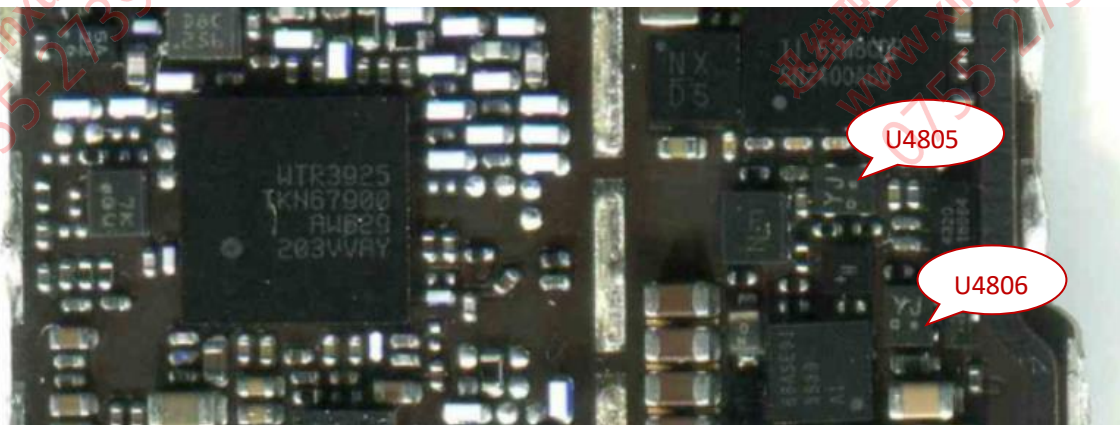


2. 7 generation white apple reboot summary: (front camera line arrangement, tail plug out, switch line arrangement, band with short circuit audio disconnection adjacent to CPU inductively empty weld. Upper cover short circuit, battery no data, system bad.) Problems that happen not to get up to 45 hundred ma current. Can 1A multi-entry not to go system card desk is audio off wire, on getting desk restart is CPU inductively empty weld. 2 minutes reboot such as getting desk is battery no data.

3. Unassembly induced restart, mostly by pulling the resistance off the I2C bus or touching r4710 when removing the screws that insert near

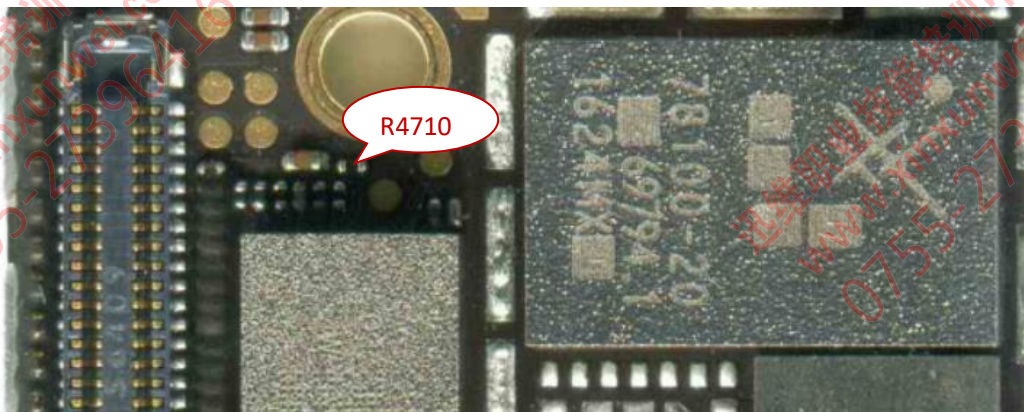


3. 7 the poor easy contact of the battery holders above will also cause a reboot, not charging the motherboard battery holders in the middle

Detect corners to challenge externally.

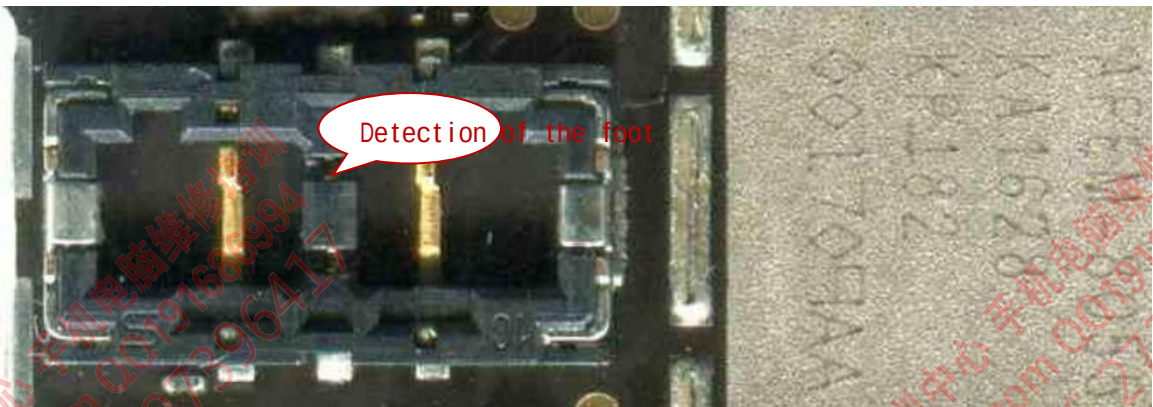


4. Fingerprints vibrate and ringtones do not vibrate. This is a problem with software settings, which can be caused by vibration in auxiliary functions. Move off.

5. Easy low current identified by H3 K5 on generation 5 and 8 boards bottom, problems on boards bottom require moving boards

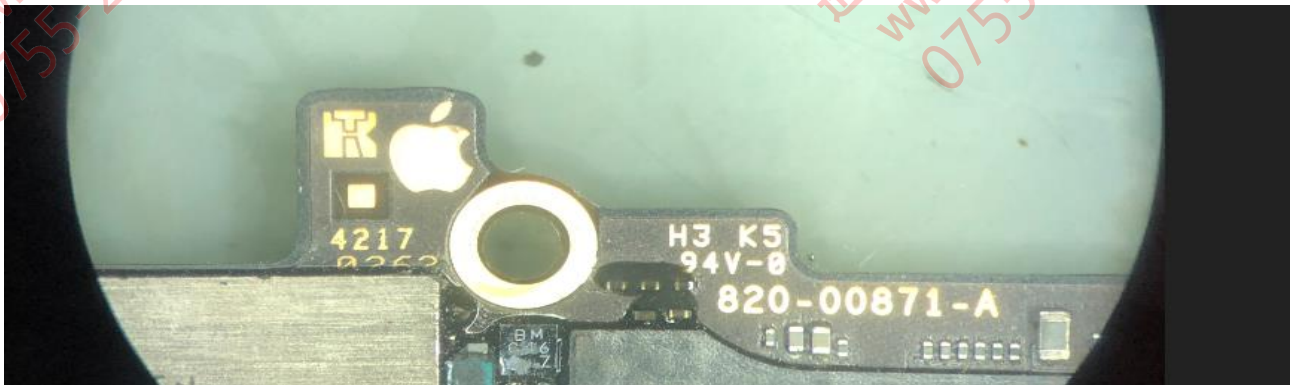


6. 8P soleplate PC-V0 identifies that the soleplate is prone to small currents.

7, 8 8P without charging Most of them are directly replaced by bad charging chips without replacing the USB at first.

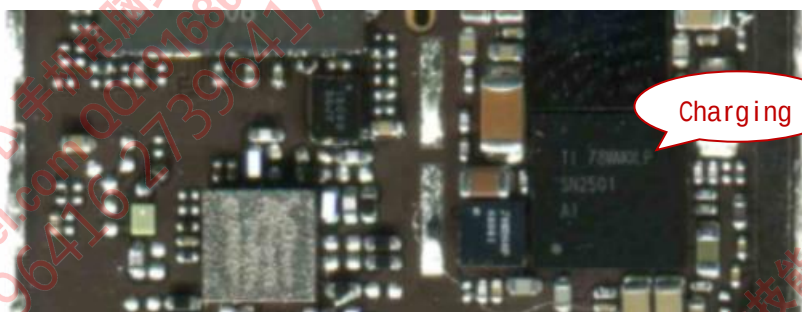


8, 8, and 8P radio frequencies break down easily resulting in no service

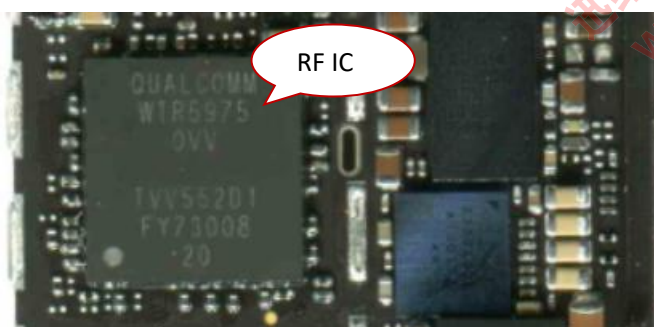

9, 8, and 8P amplifiers are prone to line breakage, virtual solder dropouts causing no service card skipping




10. X is liable to break mid-level lines when it falls. To layered flying lines, it is also liable to cause no face. The face ID lens is liable to break and cannot be repaired.11.X does not charge, most of which is caused by damage to the charging inductance.L3340 L3341

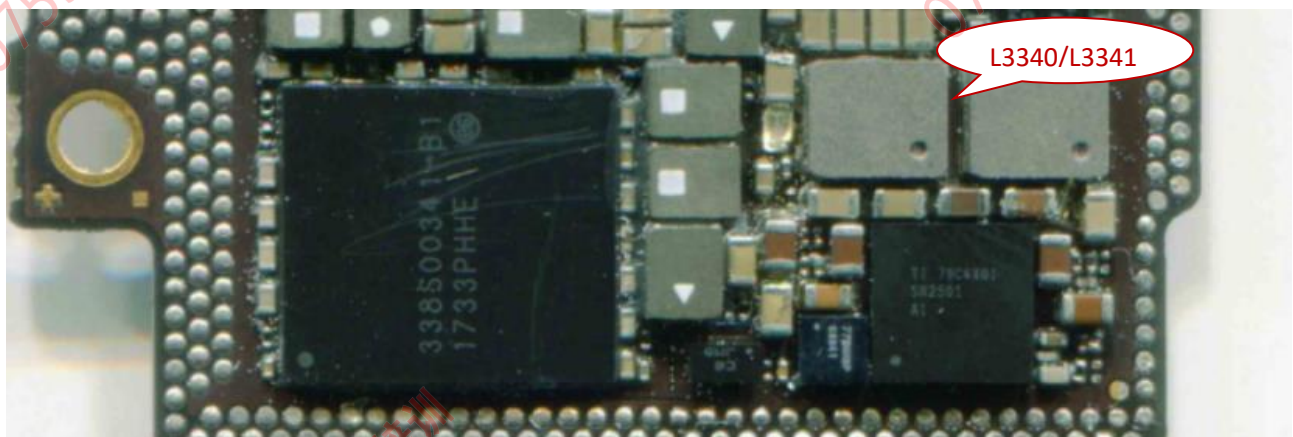

12. X-screen restart is a GPU temporary power supply inductance problem L2780.



13. X-handset with ringtone and no handset is a direct replacement for big audio problems.

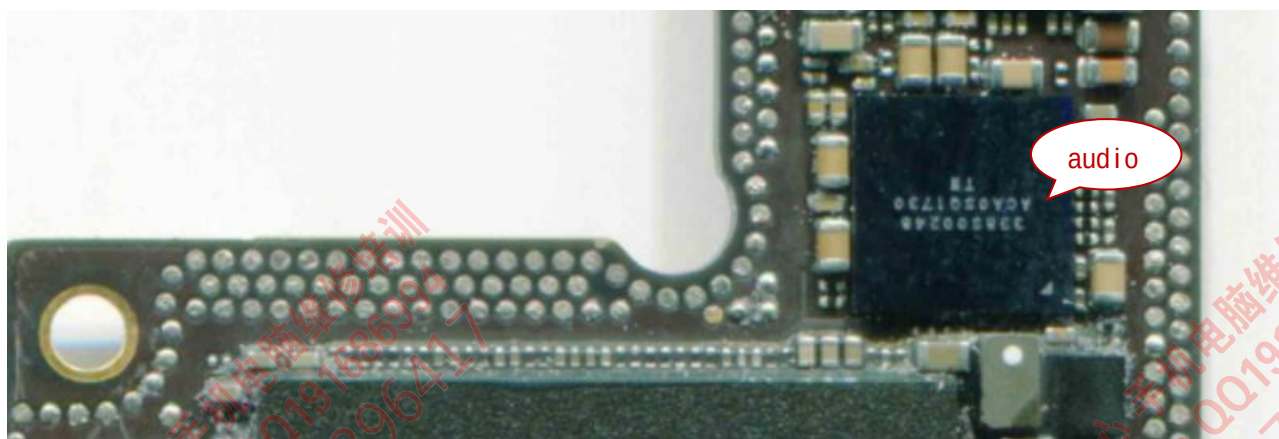

迅维职业技能培训中心 手机电脑维修培训
www.xinxunwei.com QQ191686994
0755-27396416 27396417

迅维职业技能培训中心 手机电脑维修培训
www.xinxunwei.com QQ191686994
0755-27396416 27396417

迅维职业技能培训中心 手机电脑维修培训
www.xinxunwei.com QQ191686994
0755-27396416 27396417

迅维职业技能培训中心 手机电脑维修培训
www.xinxunwei.com QQ191686994
0755-27396416 27396417