


iPhoneX Facial Failure Classification

1: Blocking the dot matrix will prompt IPHONE to move a little higher. Figure



2: Block floodlight as well as infrared camera failure. Not prompted as shown

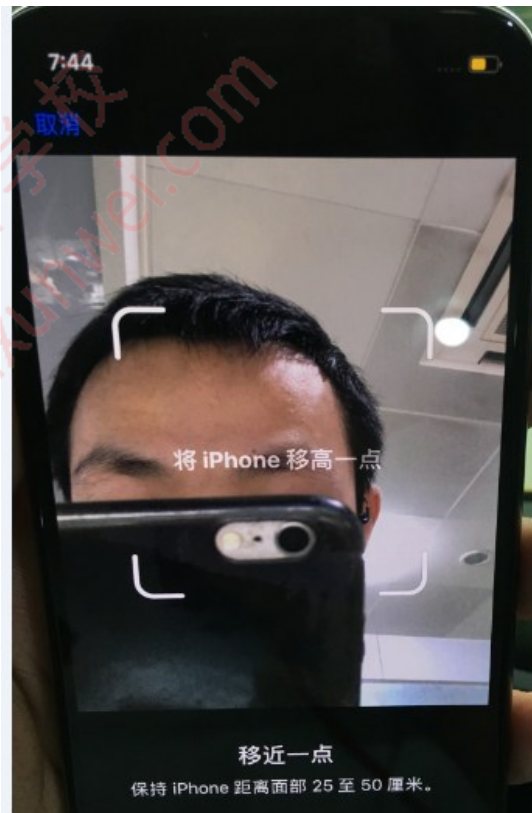

3: According to the workflow: First out 1.8V 3.3V power supply. Infrared camera without 1.8V 3.3V power supply can not directly self-check the device prompt that the face ID can not be used. Figure




4: The infrared camera on signal is not normal. It is also a hint that the face ID cannot be activated.

5: Disconnect the FL4650 floodlight status signal. No error will be reported. It will be prompted as shown in the diagram



6: Disconnected dot matrix status signal FL4556 face is recognizable and can be turned on. You will be prompted to move higher and farther. Figure

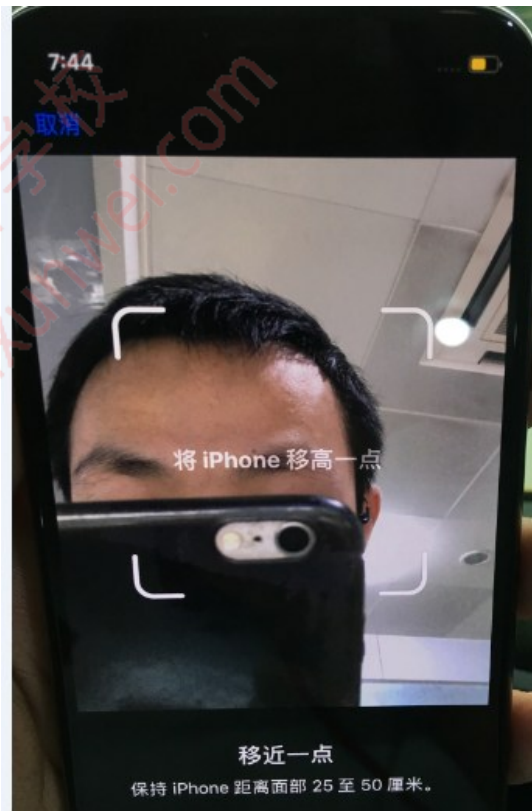

7: Disconnect the flash signal R4563, no error will be prompted. But the input interface cannot record. Figure



8: After the dot matrix temperature control FL4555 is removed, it is grounded by 2.2K resistance. Power on will not prompt for error. The input interface will indicate a high temperature. Figure

