

确认故障现象

Call status to send murmur: During the call, the other party heard a murmur;
Intermittent call status: When talking, the voice heard by the other party is intermittent;
Call status: When talking, the other party hears a low voice and can't hear clearly.

维修思路

1. When disassembling the machine for maintenance, pay attention to disconnecting the battery FPC connector first, and then carry out relevant maintenance operations;
2. Check the sub-board number. If it is a machine before 1711, it must replace the sub-board (1711 and later).
3. Cross-verify whether the motherboard is faulty. If it is confirmed that the motherboard is faulty, perform the motherboard replacement operation. And clean the main MIC rubber sleeve

And dust and sundries in the MIC opening of the back cover;




其他问题
分析解决

料号：Material name: after-sales sub-board component-Redmi mobile phone 4X;; 58A131110003;

确认故障现象

Loss of baseband signal: Unable to read baseband information such as IMEI number (view steps: settings-about mobile phone-status information-IMEI information);
Unable to read SIM card: Insert SIM card without signal.

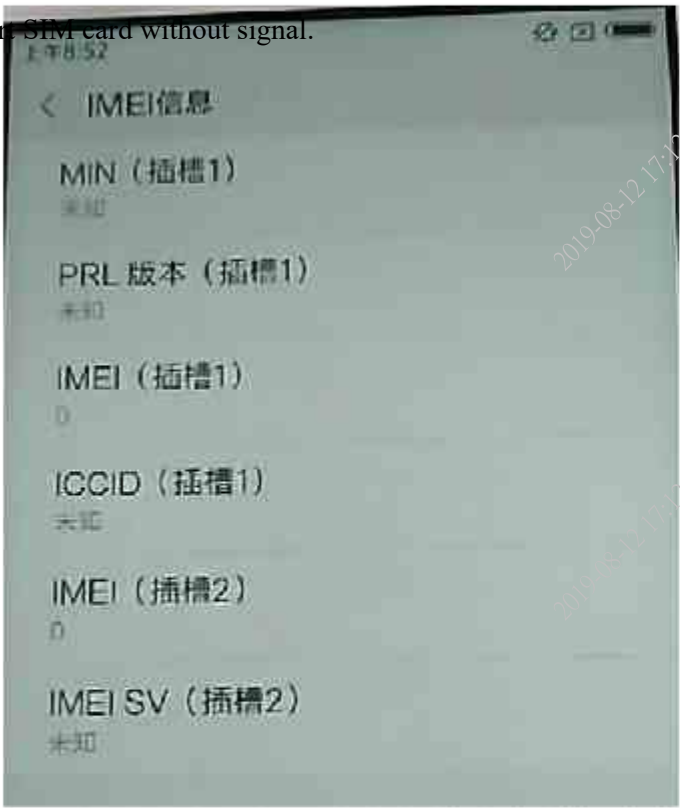

维修思路

1. First, troubleshoot the software, and upgrade the deep brush machine to the latest user version. For detailed steps, please refer to "Qualcomm Platform Core Platform Series Product Brushing Guide V02".
2. Cross-validate the motherboard. If it is confirmed that the motherboard is faulty, replace the motherboard.



52A130A10003 ;

52A130A20003 ;

Material name: after-sales motherboard component-Redmi mobile phone 4X (2G + 16G); After-sales motherboard component-Redmi mobile phone 4X (3G + 32G);

其他问题
分析解决

确认故障现象

非通话状态扬声器杂音：扬声器播放音频、看视频等场景出现杂音现象；

维修思路

- 1.将手机系统刷机至最新MIUI版本；
- 2.如若刷机无效，清理扬声器防尘网和后盖扬声器开孔内的灰尘和异物；
- 3.交叉验证扬声器组件和主板组件，确认是否为扬声器单体故障。如若确认为扬声器单体故障，执行更换扬声器组件维修操作。



其他问题

物料名称：红米手机4X_喇叭音腔BOX组件； 料号：485070001036；