



Redmi 5 & Redmi 5 Plus First Sample

Analysis and sharing

Special training

- 1 TOP Fault Case**
- 2 FAQ**
- 3 Matching Relationship of**
- 4 Fault code**
- 5 Prototype**

- 1 **TOP Fault Case**
- 2 **FAQ**
- 3 **Matching Relationship of**
- 4 **Fault code**
- 5 **Prototype**

- Fault of different color points/flower screens/missing marks/black spots: replace the front shell assembly after sale
- Flower screen, black screen and flash screen: Eliminate liquid corrosion and replace the front shell assembly after sales

➤ **Poor appearance of battery cover**

- Scratch/deformation/damage/paint loss of battery cover: Judge according to appraisal documents, user Do not accept communication area processing

➤ **Touch screen failure**

- Touch screen failure: LCD connector deformation or assembly is not in place
- Touch screen partial failure/misalignment/self-operation: replace after-sales front shell assembly


➤ **Voice quality problem**

- The call status is silent: the sound inlet hole is blocked

● **Intermittent call/murmur/low sound: special analysis of collection prototype**

➤ **Switching failure**

- Do not boot: Motherboard bad more; Some users brush Redmi 5 Plus, which is solved after deep brushing
- Automatic shutdown/non-startup (Kabaimi): There are many defects in the motherboard

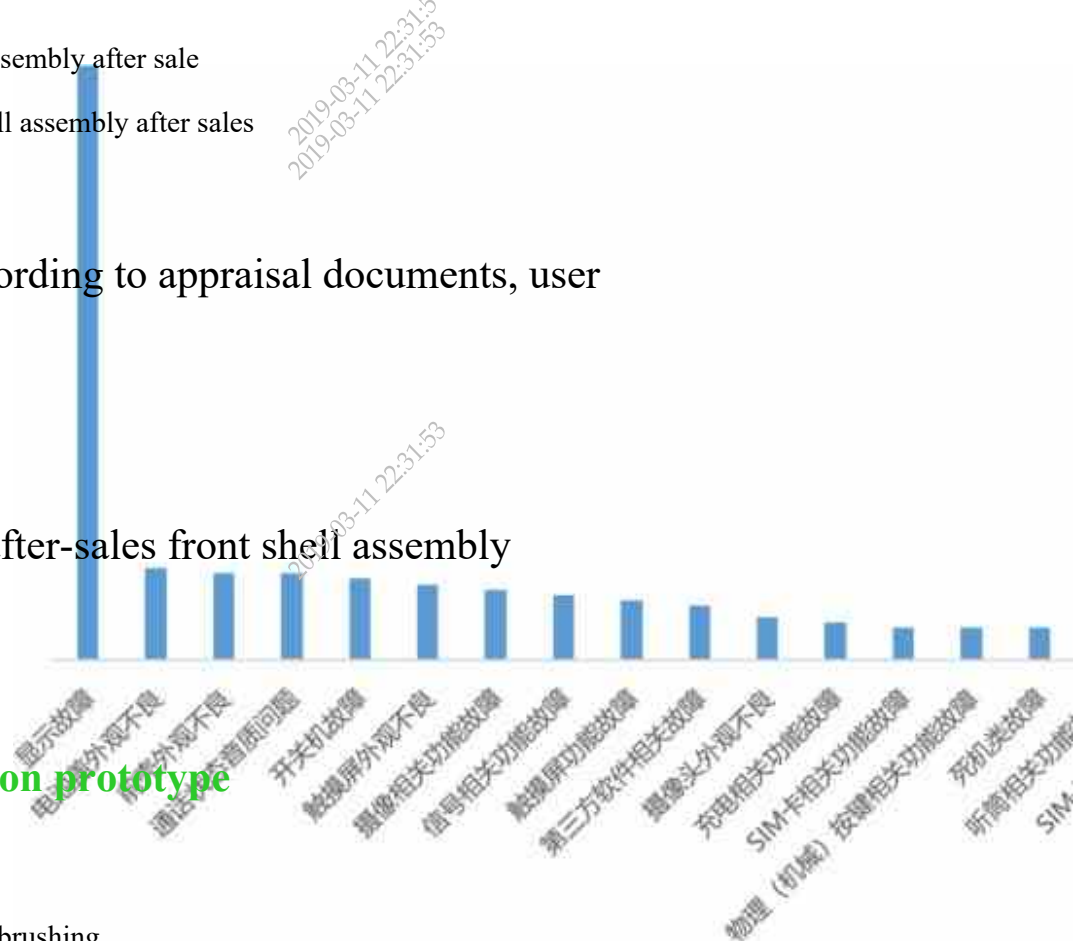

- Camera or photo can't focus/camera photo screen: replace camera assembly

➤ Signal problem

- Weak signal: special analysis of collection prototype

➤ Poor appearance of front shell

- Front shell deformation: 18: 9 ratio, the screen is easy to bend and deform, and the appearance is not good. Judge that the user does not accept the communication area processing

➤ Crash failure

- Startup crash/standby crash, etc.: caused by software BUG, brush the machine to V9.2. 0.3. NDACNEK stable version (2017/12/19) and subsequent versions

➤ Charging failure

- Do not charge: The main board charging IC is damaged, replace the main board to solve the problem



➤ Poor

- Scratch: After detection, it is TP protective film scratch, which is not a product problem

➤ Display related function failures

- Screen flash: the latest version of the brush machine is improved
- The phone will not light up when it leaves the face: 12.29 development version has been optimized
- Stain: Replace after-sale front shell assembly
- Different color points: Judge according to the authentication documents, and the user does not accept it
Communication area processing

➤ Switching failure

- Do not boot: Motherboard more bad, part of the machine according to the side key FPC after repair
Complex
- Don't start the card white rice: there are many bad motherboards, so replace the after-sales motherboard components

➤ Crash type fault

- Startup crash: Bad motherboard, replace after-sales motherboard components

点状缺陷 Dot defect	$D \leq 0.10\text{mm}$	Ignored(not allow pitting)
	$0.10\text{mm} < D \leq 0.15\text{mm}$	$N \leq 2 \quad DS \geq 10\text{mm}$
	$D > 0.15\text{mm}$	不允许 Not allowed

Application crash: caused by skew and short circuit of shrapnel of small plate horn

点状缺陷 Dot defect	缺陷尺寸(mm) Defect size	允许数 Number allowed
	$D \leq 0.10\text{mm}$	忽略不计(麻点不允许) Ignored(not allow pitting)
	$0.10\text{mm} < D \leq 0.20\text{mm}$	$N \leq 2 \quad DS \geq 10\text{mm}$
	$D > 0.20\text{mm}$	不允许 Not allowed

Appearance inspection standard V02 for millet LCM & CTP

2019-03-11 22:31:53

Appearance inspection standard of red rice LCM & CTP V02

2019-03-11 22:31:53



- No charging: USB interface contact core is crooked, replace the bottom small board assembly
- Under-charged: 0% to 4% charged for 20 minutes, the charging current is close to 0mA, and the motherboard is replaced to solve the problem

➤ Touch screen function failure

- Touch screen self-operation: caused by sticking film, try to remove the sticking film. E
- Touch screen virtual key failure: analysis only appears when APP is loaded for the first time, which is a normal phenomenon. Speech explanation
- Occasionally, local failure occurs in the process of playing the game, and the rest screen machine to the latest version for improvement

➤ Third-party software failure

- Third-party application stuck after installation: improvement after brushing v9.2. 1.0 (NEGCNEK) version
- Flash back of third-party application: it can't be solved by brushing the machine to the motherboard components

➤ Voice quality problem in call state

- Voice murmur: unclear voice, uncomfortable listening to music, OTA to the latest version

➤ Signal function failure

- Weak 4G signal: caused by coaxial line damage, replace and repair
- 4G No Signal: There are many bad motherboards, so replace the after-sales motherboard components



- 1 **TOP Fault Case**
- 2 **FAQ**
- 3 **Matching Relationship of**
- 4 **Fault code**
- 5 **Prototype**

2

FAQ分享--红米5 Plus

为什么红米5 plus开启护眼模式后存在拖影情况？

产品

手机/平板

服务

通用知识

FAQ

感谢您对小米产品的支持！红米手机中的护眼模式能有效降低屏幕的蓝光，从而降低使用手机时眼睛的视疲劳。为了照顾不同的客户需求，护眼模式为用户提供了多个级别自由调节。如果您觉得不适应，可长按护眼模式图标（也可以在设置-显示-护眼模式），将护眼模式级别调节到您认为比较舒服的程度即可。

红米5 plus玩王者荣耀有时卡顿如何处理？

产品

手机/平板

服务

通用知识

FAQ

首先需要您排除网络环境的问题，您也可以尝试如下设置，已获得更好的游戏体验：

游戏内部设置：打开王者荣耀里面---设置---高帧率模式设置为关；画面质量设置为中或低，粒子质量设置为中或低，即可获得良好的游戏体验。手机设置：设置—更多设置--开发者选项---强制进行GPU渲染设置为开启，提升视觉效果，但开启此选项后可能会导致电池待机时间短，建议及时关闭。

2

FAQ分享--红米5 Plus

为什么我的手机使用电信3G业务使用数据流量上网非常慢？

产品

手机/平板

服务

FAQ

您好，感谢您对小米产品的支持！目前中国电信重点发展4G业务，对于其3G的维护力度越来越低，从而导致电信用户使用3G业务时上网比较慢，建议用您更换成电信4G业务，上网速度会明显提升。

为什么红米5 plus正常模式（非护眼模式）下的拖影会有拖影情况

产品


手机/平板

服务

通用知识

FAQ

感谢您对小米产品的支持！目前手机产品大多采用LCD液晶显示屏，在快速滑动屏幕都会出现拖影的现象，这是由于液晶分子在画面切换时需要几毫秒的转动时间，是正常范围。另外，冬天在户外使用手机，包括iPhone在内的所有液晶屏手机的拖影现象都会明显加重。红米5 Plus采用了成本最高的负性液晶技术，具有对比度高，亮度高，省电的优点，您可以放心使用。

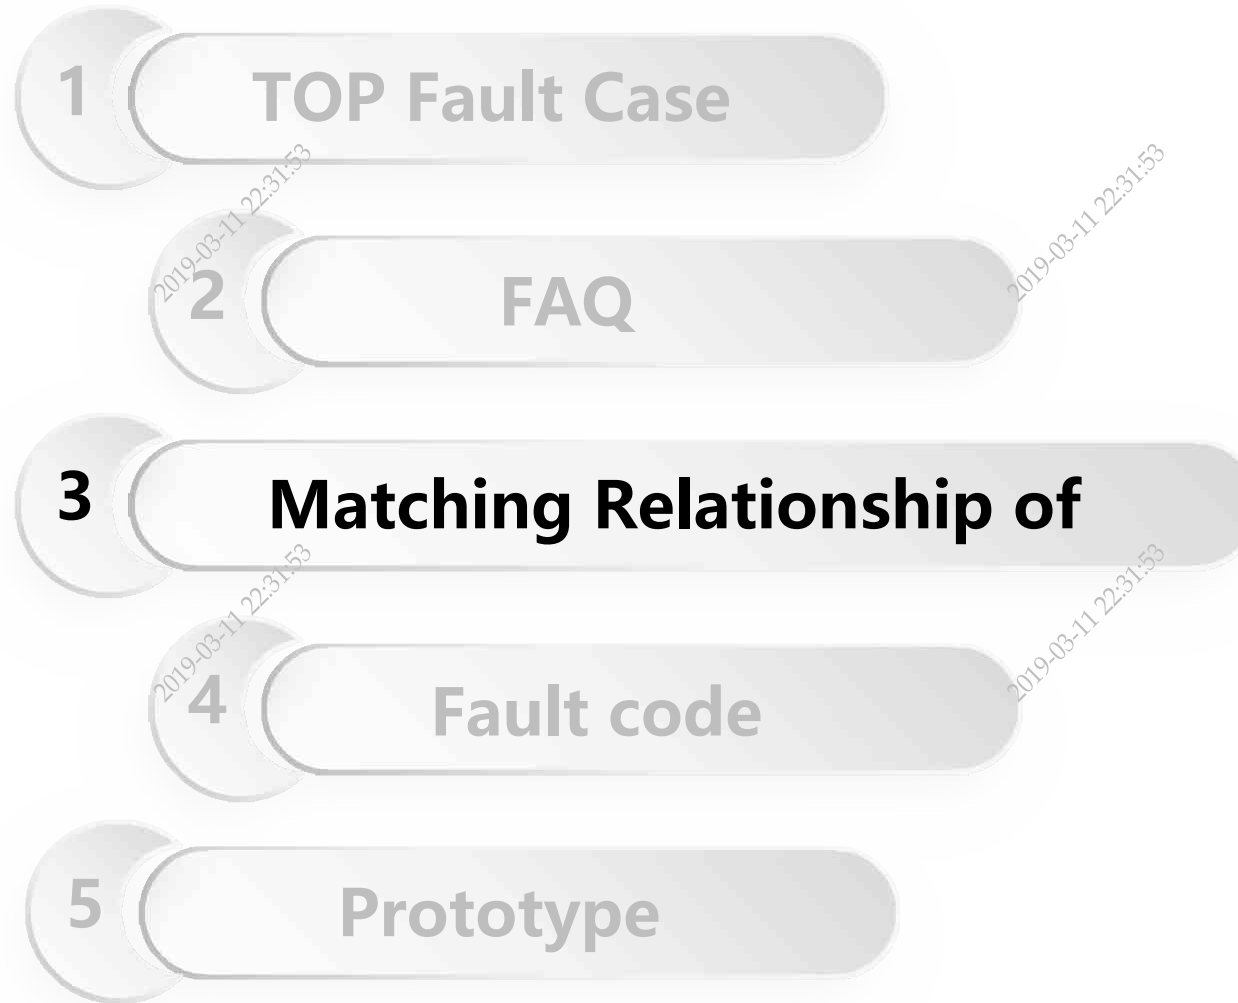

3 Matching Relationship of Specific Materials-R

具体匹配关系如下：

匹配关系	旧版电池盖 (无导电泡棉)	新版电池盖 (有导电泡棉)
旧版主板 (有弹片) 580E70110004 (3+32G版本) 580E70220004 (4+64G版本)	√	×
新版主板 (无弹片) 580E70710003 (3+32G版本) 580E70820003 (4+64G版本)	×	√

为方便一线操作，售后备件将提供有弹片和无弹两种备板，一种能匹配两种主板的电池盖。

当遇到换板业务时，需要特别看下电池盖是否带泡棉，规则如下：

1. 电池盖不带泡棉，必须申请**带弹片**售后主板组件：580E70110004 (3+32G版本)，580E70220004 (4+64G版本)。
2. 电池盖带泡棉，必须申请**不带弹片**售后主板组件：580E70710003 (3+32G版本)，580E70820003 (4+64G版本)。

当遇到换电池盖业务时，直接申请对应颜色的售后备件电池盖物料即可。

务必按照匹配关系申请对应物料更换，详细参考《红米5Plus 一二级维修指导》文件执行！


匹配关系	旧版电池盖 (无导电泡棉)	新版电池盖 (有导电泡棉)
旧版主板 (有弹片)	√	×
新版主板 (无弹片)	×	√


红米5Plus主板&电池盖新旧版本区分图		
机型	区分方法	图片标识
红米5Plus	新主板（主板不带弹片） 对应售后主板组件料号： 580E70710003（3+32G版本） 580E70820003（4+64G版本）	
红米5Plus	旧主板（主板带弹片） 对应售后主板组件料号： 580E70110004（3+32G版本） 580E70220004（4+64G版本）	
红米5Plus	新版电池盖（有导电泡棉）	
红米5Plus	旧版电池盖（无导电泡棉）	

3 Matching Relationship of Specific Materials-R

- When replacing the front shell assembly, you should pay attention to the type of auxiliary plate. If you use a green oil auxiliary, you should pay attention to the type of auxiliary plate
Plate, need to add 2 conductive foam in the USB contact point position of the new front housing assembly.

- Conductive foam material number: 320509700031.
- Note: This foam must be pasted, otherwise it will cause signal problems.

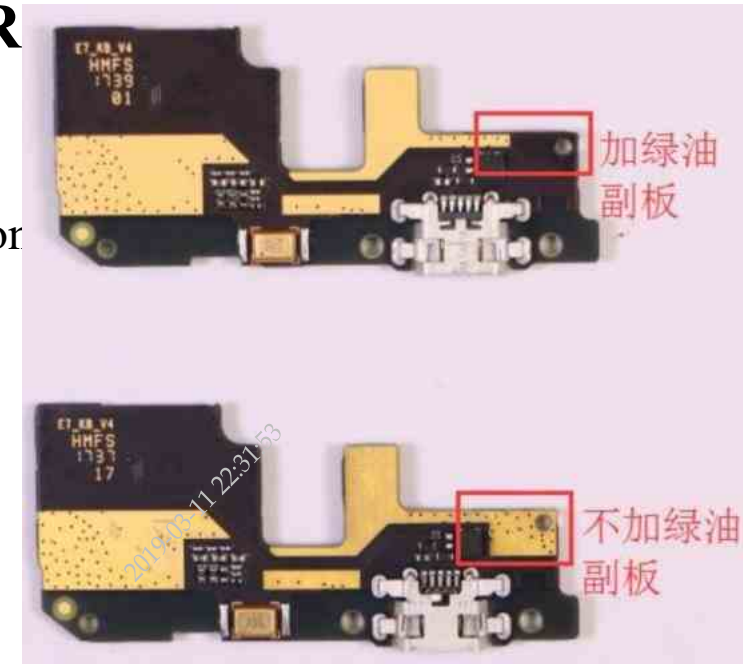

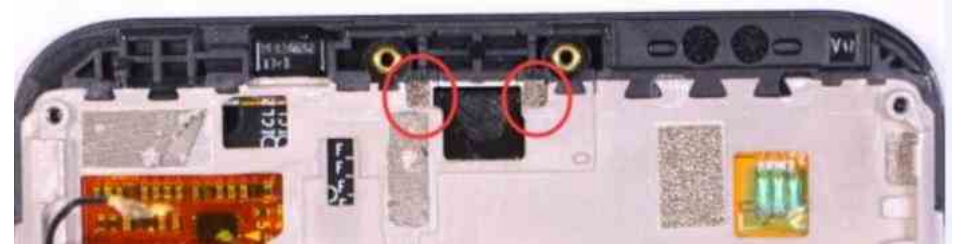

3

Improvement of Deep Brush Point-Redmi 5

● Before improvement: The motherboard must be disassembled before deep brushing can be carried out.

● After improvement: it can pass through deep without disassembling the motherboard.


Brush points for deep brushing.

After improvement



Before improvement



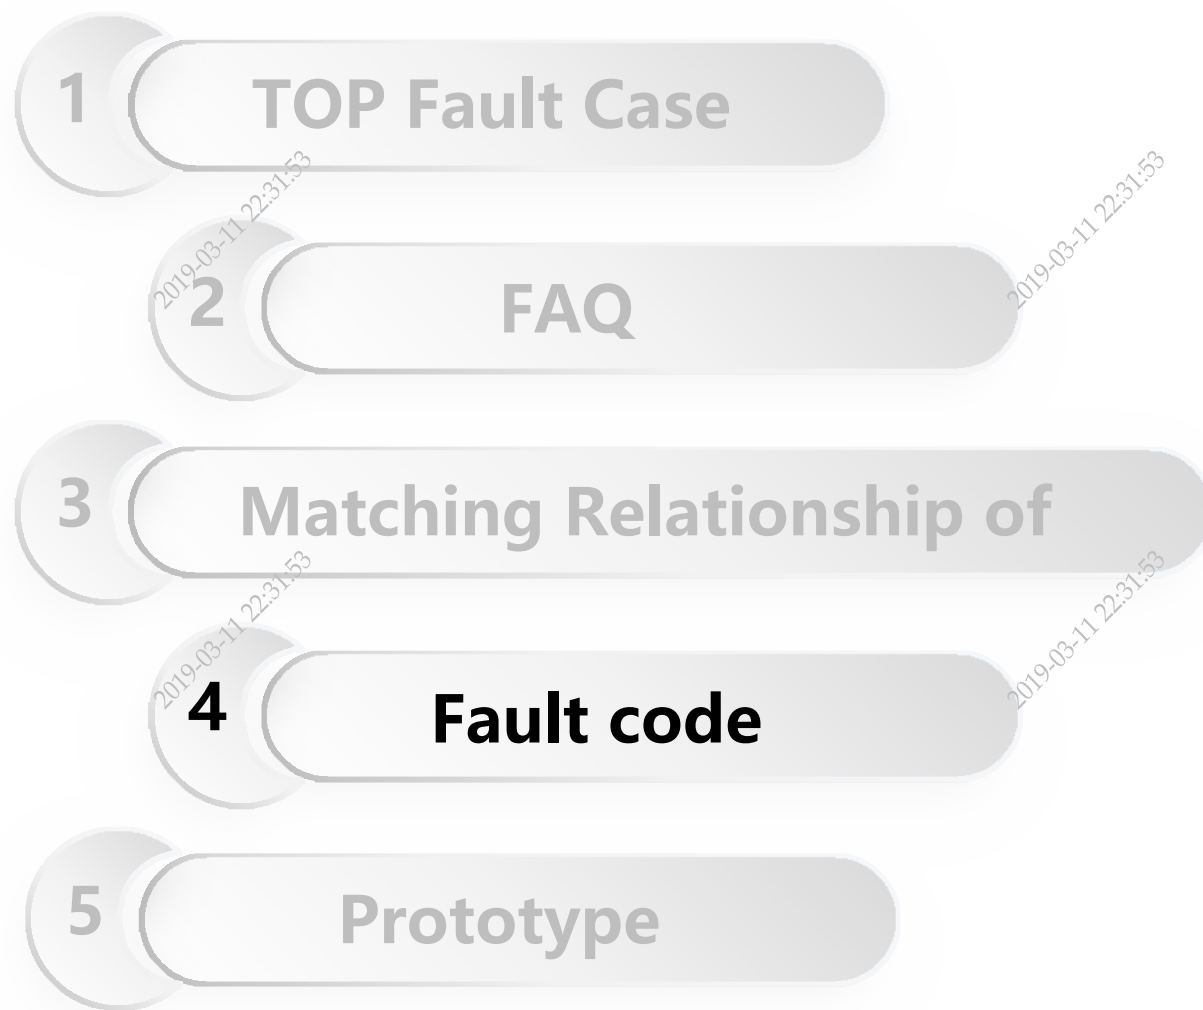

4

故障代码录入

Network point	Model	Real fault	Enter Level 3 fault	Enter Level 2 Malfunction
Shanghai Oriental Pearl Store	Red rice 5Plus	Pay a return visit to the user, indicating yesSell in advance on the 10th, and then ask for The user goes back to return the goods, and the mobile phone is fine	Poor appearance of label	The appearance of the label is not Good
Zhuhai Yangming Plaza Store	Red rice 5Plus	Macao users can't use one card and two numbers, and their mobile phones are fine	Application failure	Application fault
Beijing	Red	Return visit to the user: The user wants	Poor appearance	The

Name of organization	Model	Fault phenomenon	Failure cause
Shenzhen fengxiu technology co., ltd	Red rice5	It depends on the bending of the machine screen, is it solitary, and the mobile phone screen is not Is face to face,	(OPJ1307) Poor appearance,
Shenzhen fengxiu technology co., ltd	Redmi 5	Mobile phone bending	(MPCOM 1907) Battery Cover Scratches,
Beijing millet delivery repair center(Foxconn)	Redmi 5	The customer said that the mobile phone bent and went to the outlet for detection No	(MPCOM 1906) Battery Cover Damage,
Beijing millet delivery repair center(Foxconn)	Redmi 5	The mobile phone is bent	(MPCOM0204) Front shell transformer Form,
Beijing millet delivery repair center(Foxconn)	Redmi 5	My friend in the store said that your mobile phone is so bent that it is obvious If it is abnormal, don't apply for toughened film for the new machine Change your cell phone	(MPCOM 2001) MI LOGO has poor appearance,
Henan Hengqi Electronic Equipment Sales Limited Company	Redmi 5	Inner screen crack of fuselage bending deformation	(MPCOM0104) Touch Screen Damage,
Shanghai Xinling Communication Technology Co., Ltd	Redmi 5	Customers receive commodity motherboard deformation. Special case approved Pass	(MPCOM2302) Motherboard Transformer Form,
Jinan Character Electronic	Redmi	Fuselage deformation	(MPCOM0204) Front

4

Fault code entry

) Problem: In the work order

integration system, the paint falls off the middle frame of Xiaomi 6, and there is no scratch or bump on the fuselage. Which fault code should be entered (

A: Paint off the battery cover B: Touch screen damage C: Deformation/knock/scratch of the front shell D: Paint off the front shell

Answer: The middle frame of D Xiaomi 6 is on the front shell assembly, which eliminates the paint loss of the battery cover and the damage of the touch screen, and the front shell has no deformation/knock/scratch, so the front shell should be selected for paint loss

Question: In the work order integration system, the red rice Note5A battery body bulges and leaks liquid. Which fault code should be entered ()

A: Battery bulge/deformation B: Battery leakage C: Battery damage D: Battery heat loss

Answer: B the battery is damaged and leaks, but there is no heat loss, so it is necessary to enter the battery leaks, and follow the entry principle: the appearance problem exists at the same time and the most serious item is recorded

Question: In the work order integration system, the Xiaomi Note3 battery body has an undamaged bulge. Which fault code should be entered ()

A: Battery bulge/deformation B: Battery leakage C: Battery damage D: Battery heat loss

Answer: A battery appears bulge, but not damaged, so there will be no leakage and damage, and there is no heat loss of the battery, so it is necessary to enter battery bulge/deformation

Problem: In the work order integration system, because the earpiece dust-proof net is blocked by foreign matter, the earpiece sound is small, which fault code should be entered ()

A: Bad appearance of dust-proof net B: Plugging hole of front shell C: Plugging hole of battery cover D:

Low sound of earpiece

Answer: A earpiece sound is small because the dust-proof net is blocked by foreign bodies, and the appearance of the dust-proof net entered is poor, which is emphasized in the training

Problem: In the work order integration system, after cross-verification, it is confirmed that the charging is slow due to the data line. Which fault code should be entered ()

A: Slow charging of data cable B: No charging of data cable C: No charging D: Slow charging

Answer: A the new version of the fault code lists accessory faults as separate items, including poor appearance of accessories and poor performance caused by accessories. The problem stem has been expressed as caused by data lines

4

Fault code entry

故障代码

服务 / 通用知识 / 故障代码

文档详情

工单一体化小米手机平板故障代码录入讲解培训-180124.pdf

产品

手机/平板

服务

技术培训

专项讲解

通用知识

故障代码

工单一体化小米手机平板故障代码录入讲解培训-180124



售后技术组
未知星球

1月24日



笔记本四核增强版 诊断思路 故障代码录入讲解

口令直播回放 | 2107人看过

工单一体化小米手机平板故障代码V01_20180123.xlsx

工单一体化小米手机平板故障代码录入讲解培训-180124.pdf

关于米家电饭煲产品 功能自检故障代码介绍的技术公告V01.pdf

TSATMA6B关于小米网络收音机故障代码发布的公告V01.pdf

关于Yeelight床头灯故障代码发布的公告V01.pdf

语音体感遥控器故障代码公告V01.pdf

关于小米电视3S-65吋-平面（影院版）环绕声配件故障代码发布公告

关于小米盒子新版故障代码发布的公告.pdf

关于九号平衡车故障判定公告V01.pdf

关于小米空气净化器2故障代码发布的公告V01.pdf

Live broadcast number: 20528470

Password: 180124 (date)

- 1 **TOP Fault Case**
- 2 **FAQ**
- 3 **Matching Relationship of**
- 4 **Fault code**
- 5 **Prototype**

5 Key matters needing attention during sample collection period

[Http://kbs.be.xiaomi.com/f/viewThread.do?TId=9204](http://kbs.be.xiaomi.com/f/viewThread.do?TId=9204)

红米5	电池鼓包，漏液（不拆电池）	持续收集	套机	黄彪	全渠道
红米5	摄像/拍照不对焦	持续收集	套机	黄彪	全渠道
红米5	充电故障	持续收集	套机	黄彪	全渠道
红米5	开关机故障	持续收集	套机	黄彪	全渠道
红米5	通话状态音质问题	持续收集	套机	黄彪	全渠道
红米5	信号问题	持续收集	套机	黄彪	全渠道

红米5 Plus	触屏破损	持续收集	机头	张琪	全渠道
红米5 Plus	显示色彩异常（拖影）（稳定复现）	持续收集	机头	张琪	全渠道
红米5 Plus	显示花屏（稳定复现）	持续收集	机头	张琪	全渠道
红米5 Plus	显示条纹（稳定复现）	持续收集	机头	张琪	全渠道
红米5 Plus	闪屏（稳定复现）	持续收集	机头	张琪	全渠道
红米5 Plus	黑屏（稳定复现）	持续收集	机头	张琪	全渠道
红米5 Plus	触屏完全失效，触屏自动操作，触屏局部失效（稳定复现，偶尔出现的按公告处理，不收集）	持续收集	机头	张琪	全渠道
红米5 Plus	电池鼓包，漏液（不拆电池）	持续收集	机头	张琪	全渠道
红米5 Plus	附件坏品（充电器，数据线）	持续收集	物料	张琪	全渠道

2019-03-11 22:31:53

2019-03-11 22:31:53

2019-03-11 22:31:53

2019-03-11 22:31:53

2019-03-11 22:31:53

2019-03-11 22:31:53



Q&A