

Maintenance of Redmi note5 Restart repeatedly no Baseband Version no serviecs

[fault model]Redmi note5

[fault phenomenon]

When this machine comes, it starts Restart repeatedly. If it doesn't enter the second interface, the current can reach 700mA, which means that the kit and chip are basically self checked. Don't be silly to see Xiaomi and Restart repeatedly to dry the



package

After brushing a functional system, we found that no Baseband Version has no WiFi



Baseband wifi is available after IF is changed.




Card insertion found that the card can be read,no serviecs, manual operator failed.


[failure analysis]

The search operator of Qualcomm model failed, or the call prompted to turn off the flight mode and open ANT, all of which resulted in the chip on RFFE Related circuit being damaged or not working properly.

[maintenance process]

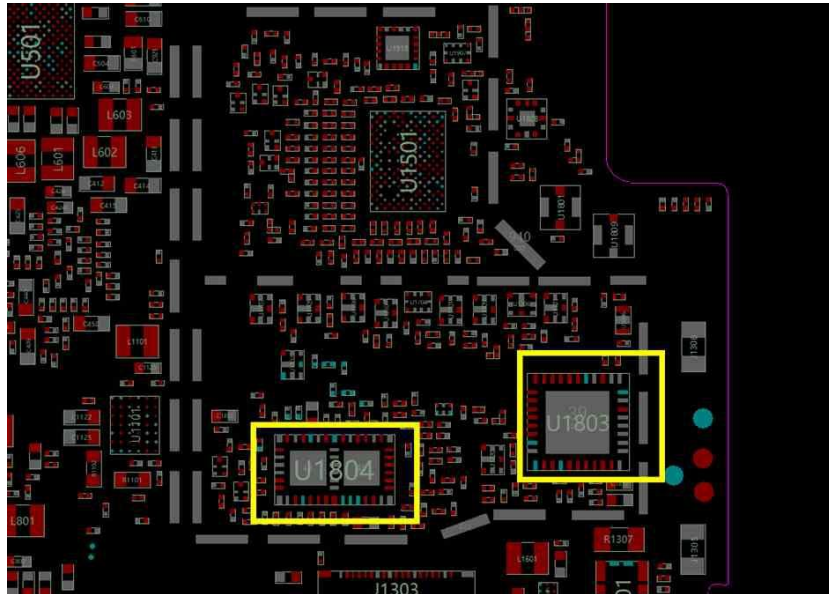





At first, we measured power amplifier and ANT Switch VCC, and they were all normal. Redo the two chips

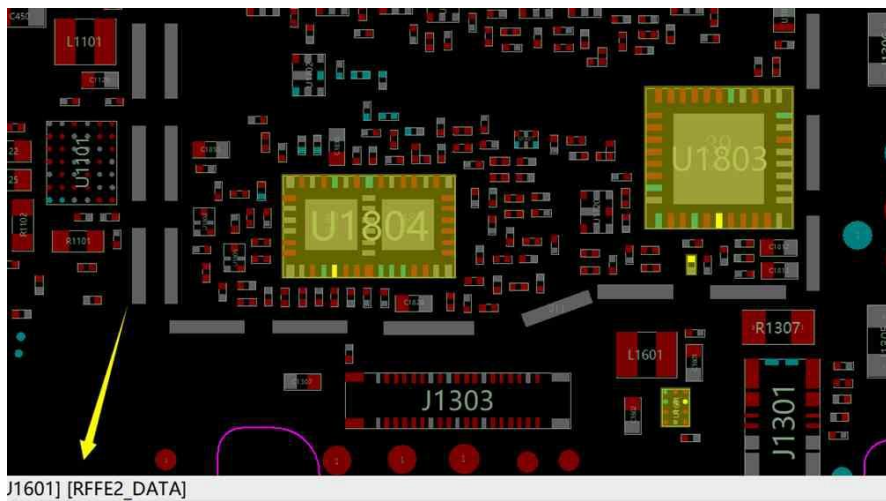


J1601] [RFFE2_DATA]

and the fault remains the same.

This RFFE2 bus involves three chips, including power amplifier power supply, which have been dismantled and redone.

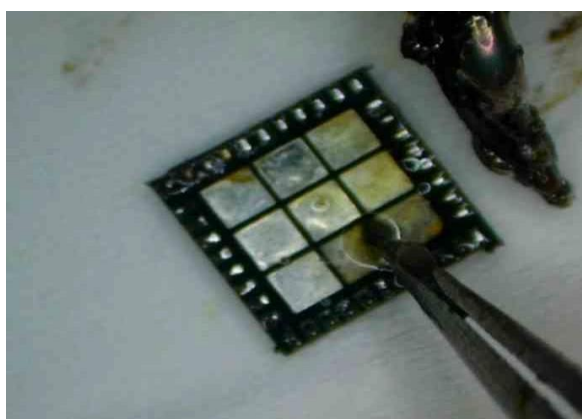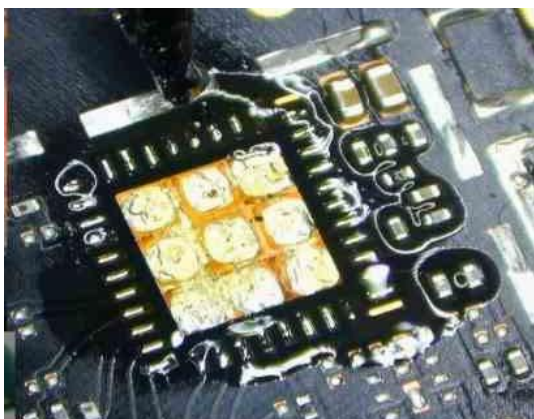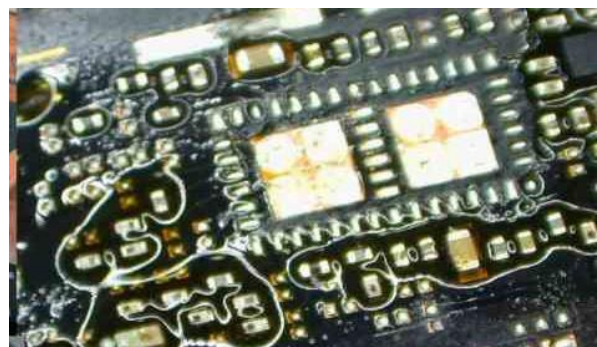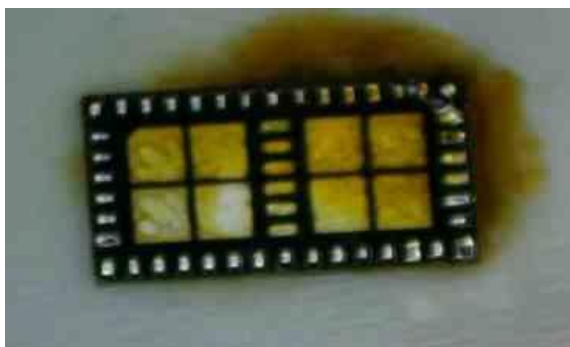


The traditional Hand solder dragging PAD and chip pin always feel that the tin dots are not

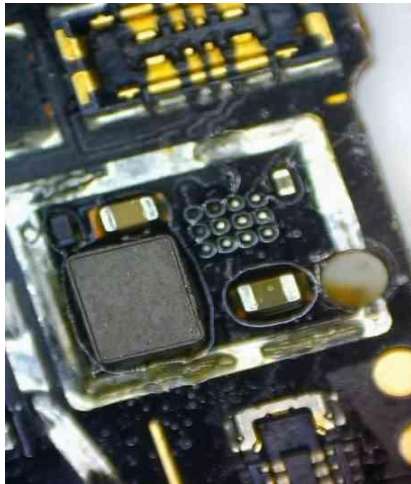


uniform.



Or the failure of searching operators manually, so the failure of replacing all signal chips is still the same.

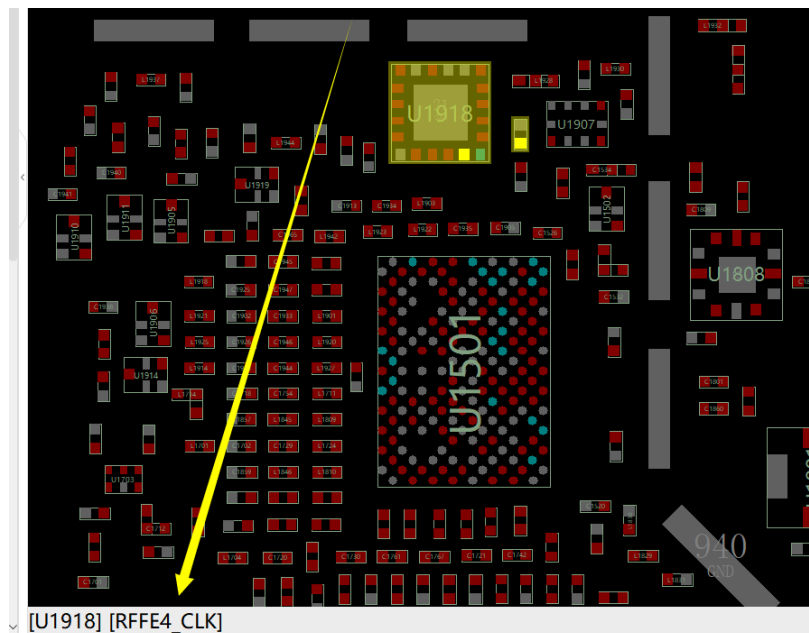



Looking at the drawings, it is found that the bottom pin of DRX diversity receiver on IF is equipped with RFFE4 bus, which will theoretically lead to the inability to search for operators, so it was dismantled and redone, and the bottom pin bus was tested to be normal.

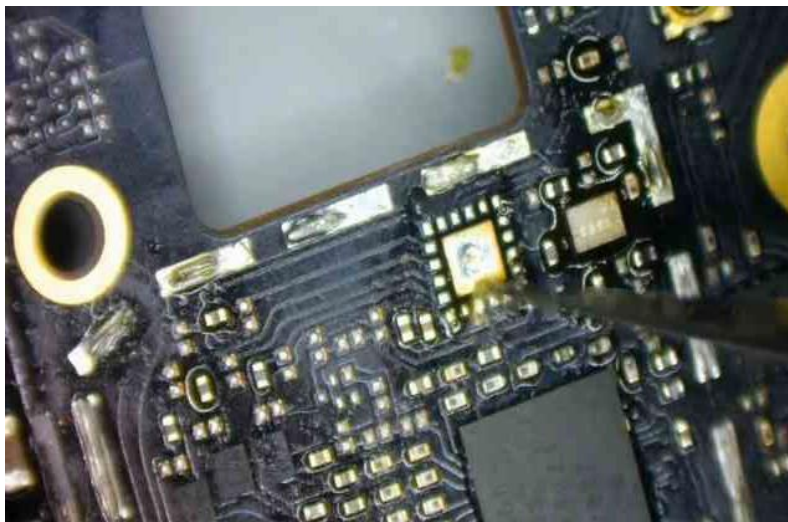

When reloading DRX, use the method of dialing tin to make every solder spot of pin full, and then observe whether ANT Switch is not installed properly, and some spots are Inveracious Soldering. I wish I could use the method of dialing tin to make Reballing work once, but I can't pull it down. This stupid machine only sells the whole fish for 199.

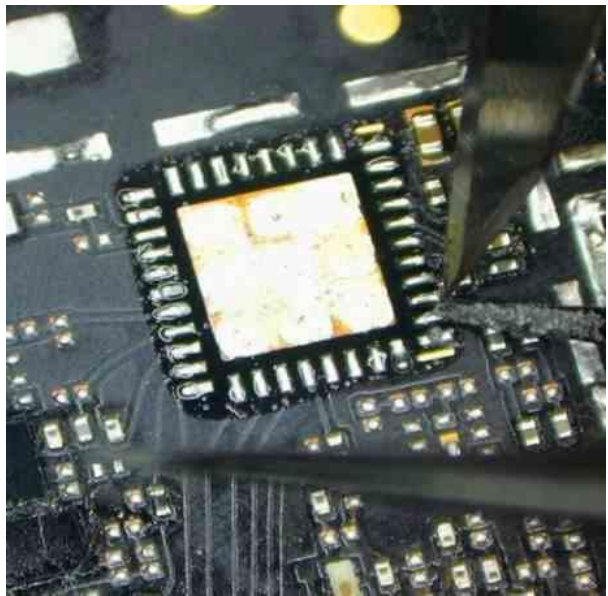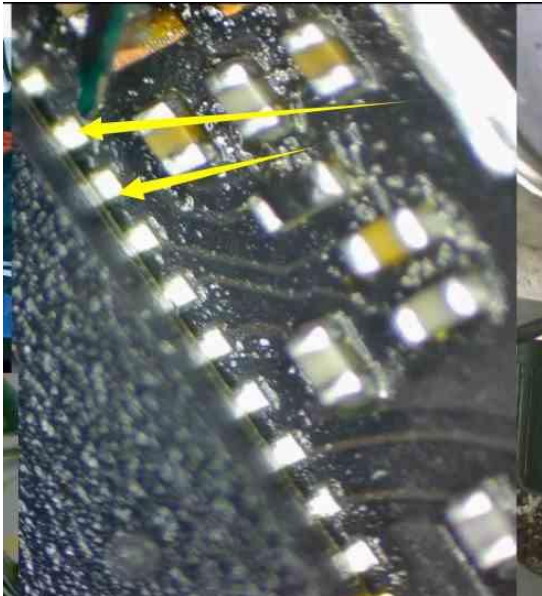

Get some tin paste on the tips of tweezers, and operate at the tips of tweezers.

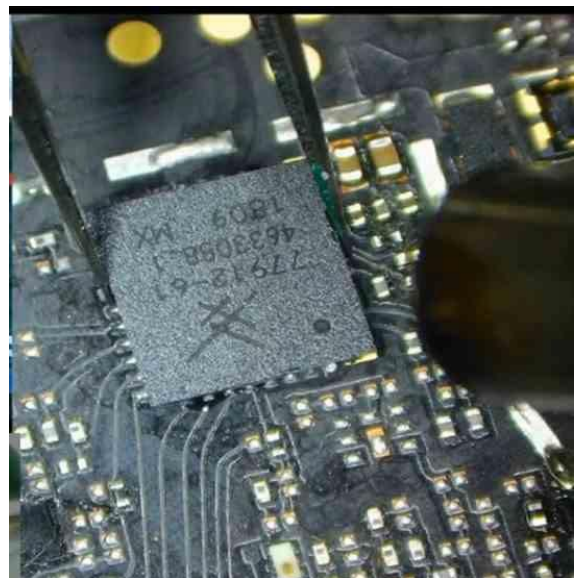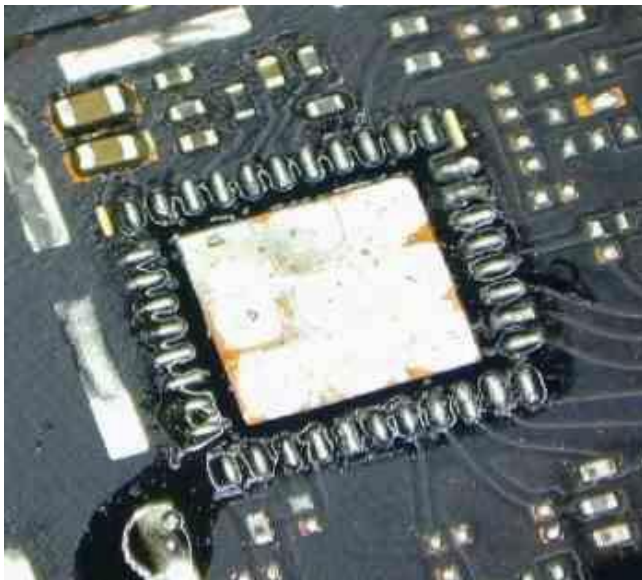

Every last point is much higher than Hand solder add solder. The victory or defeat is in this trembling.

[Maintenance result] Boot test, perfect repair, because the back shell is not installed and the



signal in the house is weak.