

Repeated restart of Redmi Note5 without baseband and service maintenance

[Failure Model] Redmi Note5



"Failure phenomenon"

When this machine comes, it is turned on and restarted repeatedly. It does not enter the second interface. The current can reach 700ma, indicating that the kit and chip are basically self-tested. Don't be silly to see Xiaomi restart repeatedly and dry




the kit

After brushing a function into the system, I found no baseband and no WiFi

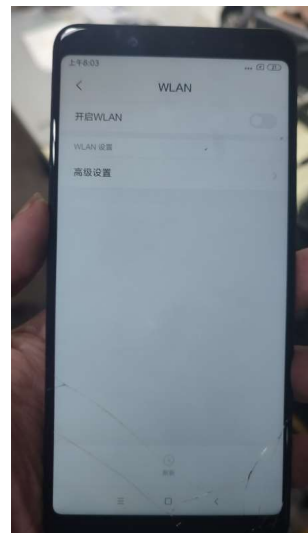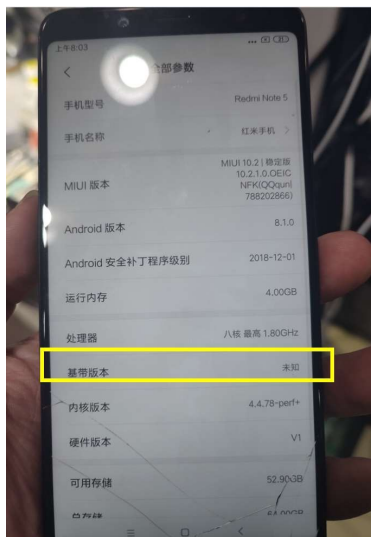

After changing the IF, the baseband WiFi is available

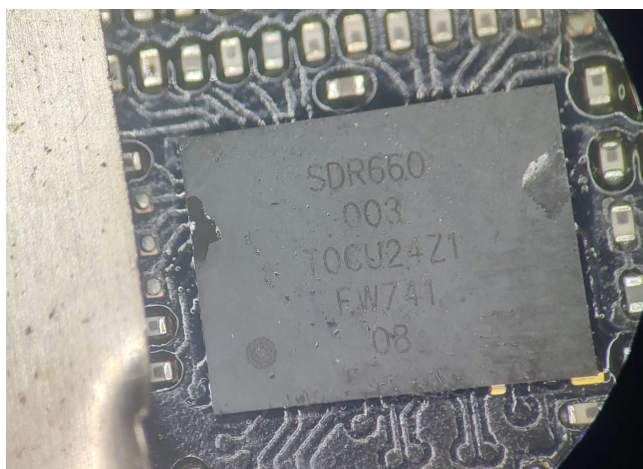


Card insertion found that card can be read, no service, manual operator failed

[Fault Analysis]

Qualcomm failed to search the operator, or called to prompt you to turn off the flight mode, and the antenna was being turned on, all of which were damaged or not working properly on the chip on the RFFE path

"Maintenance process"




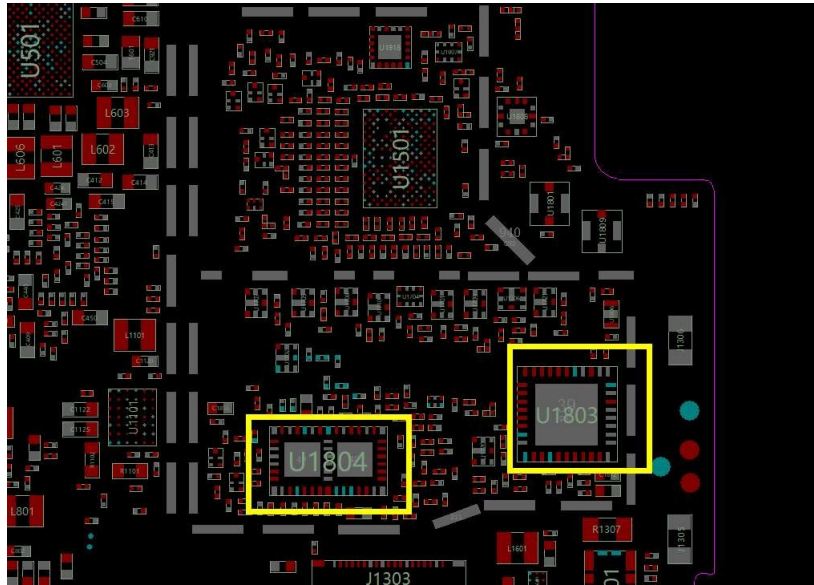


First, we measure the power supply of power amplifier and antenna switch, and they are all normal. Redo the two chips and




the failure remains the same

This RFFE2 bus involves three chips including power amplifier power supply, which is disassembled and redone

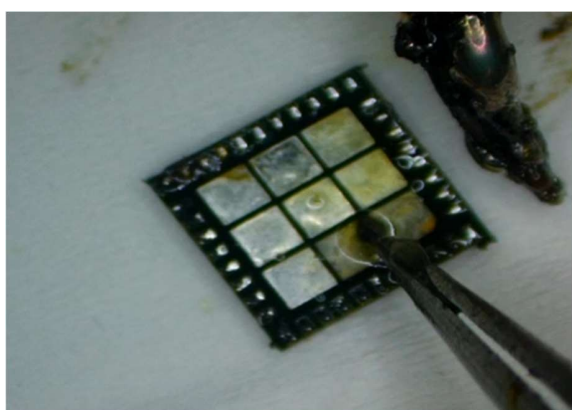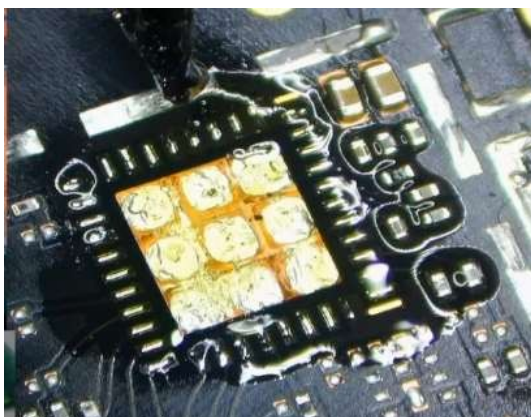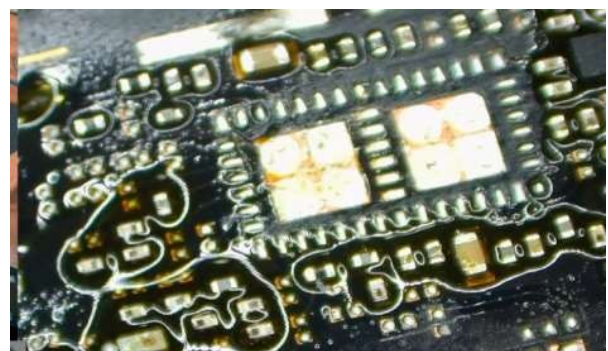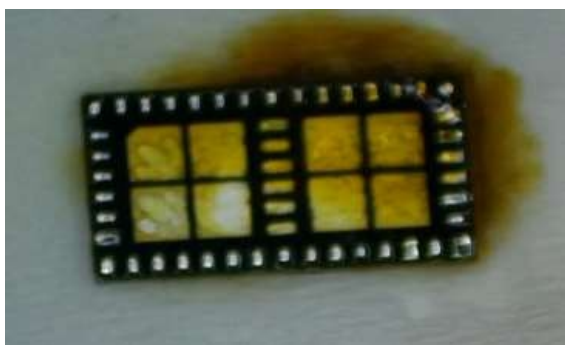


The traditional soldering iron drag pad and chip pin position always feel that the tin point is not


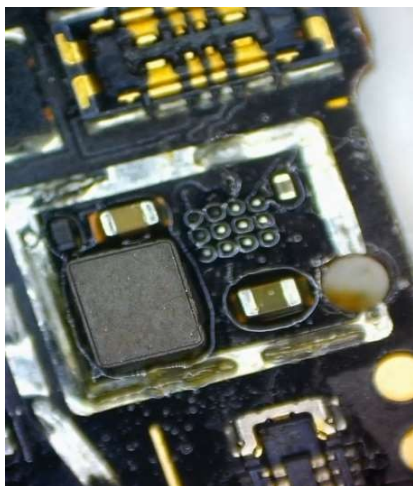


uniform when planting tin in the way of soldering iron drag pad and chip pin position

Or the failure of manually searching the operator and replacing all the signal chips is still the same


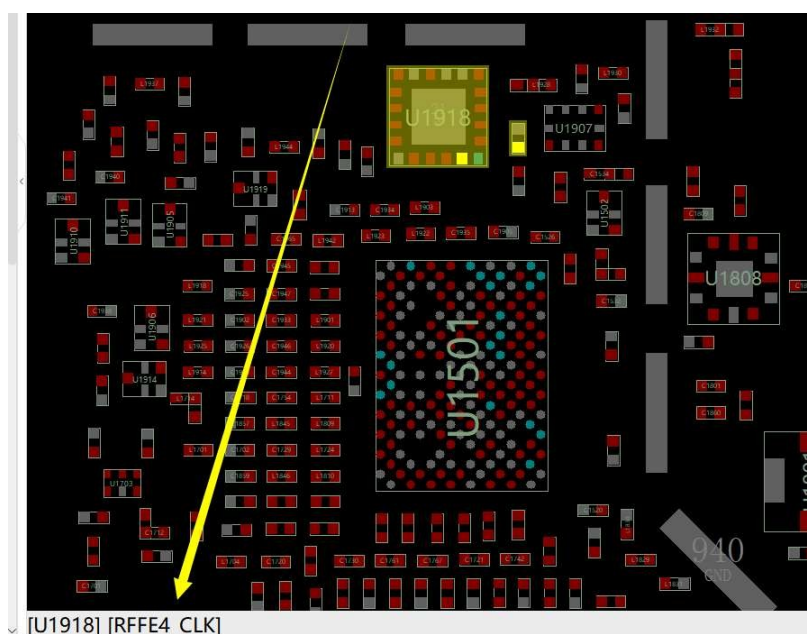


Looking at the drawing, it is found that the DRX diversity receiver on the intermediate frequency has RFFE4 bus on the foot, which will theoretically lead to the inability to search the operator, so it is disassembled and redone, and the foot bus is also normal after testing

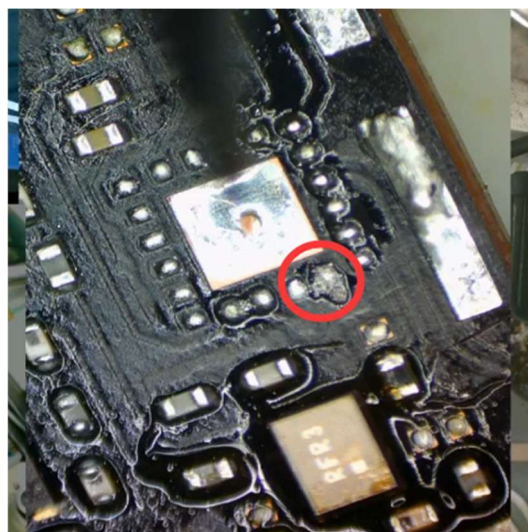
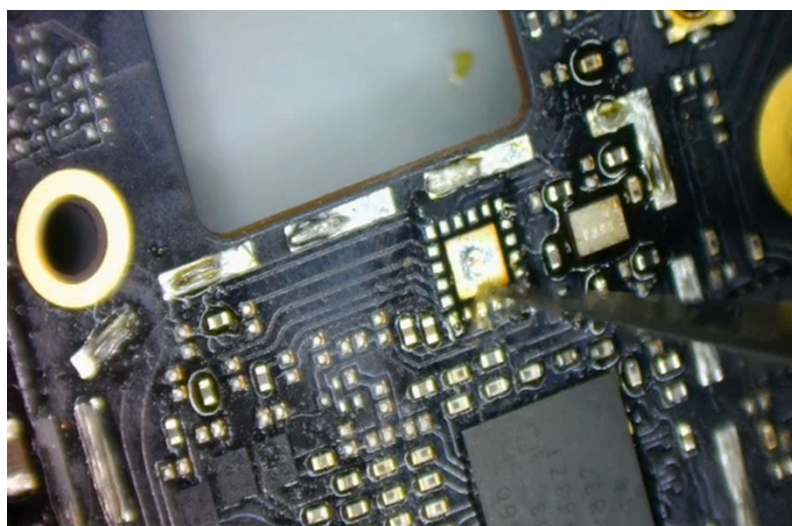


When reloading DRX, use the method of plucking tin to make the tin points of each welding foot full, and then observe whether the antenna switch will not be installed well, and some points will be welded in vain. I want to use the method of plucking tin to replant it again. Can you pull it down? This broken machine is

only sold 199

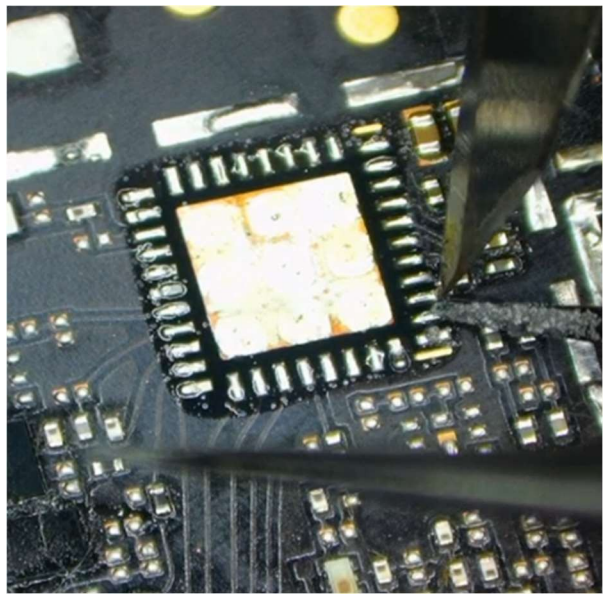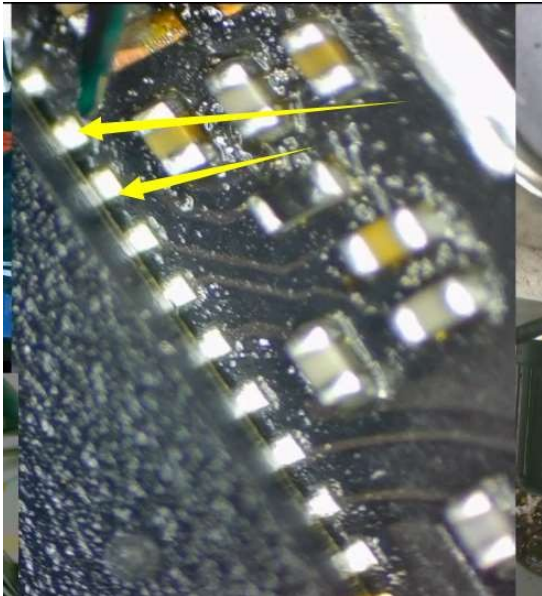

Get some tin paste on the tip of tweezers and operate it on the tip of the knife

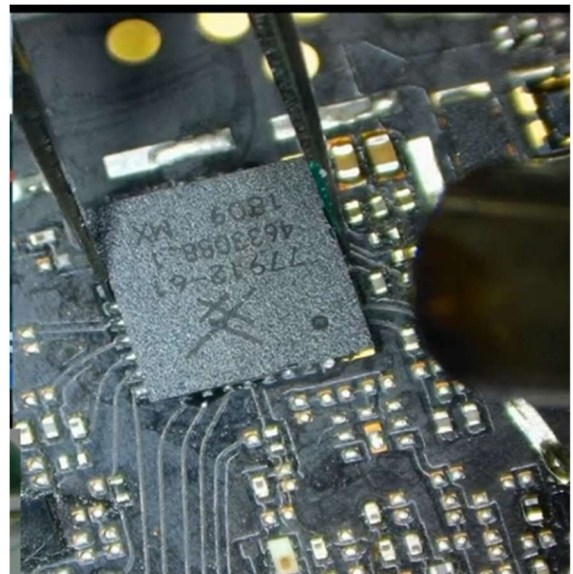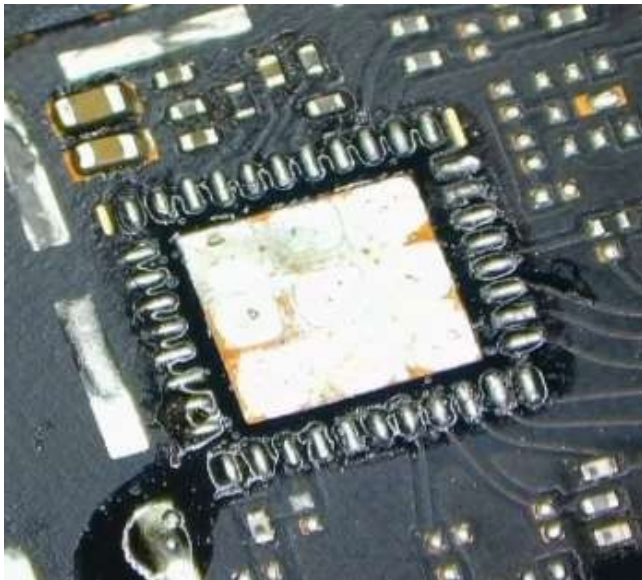

In the end, every point is much higher than the tin on the soldering iron. Win or lose in this shiver

[Maintenance result] Start-up test, perfect repair, because there is no back shell and the signal in the house is weak

