


Redmi not e5A for Android repair does not touch.

Careful observation of the motherboard shows that the parts above the interface of the display screen are dropped, and the ground angles of the dropped parts are all grounded diode value. It is suspected that the dropped parts are resistors, and there is also a resistor diode value next to it, which is 2K.

We found a 2K and put it back, and the problem was solved.

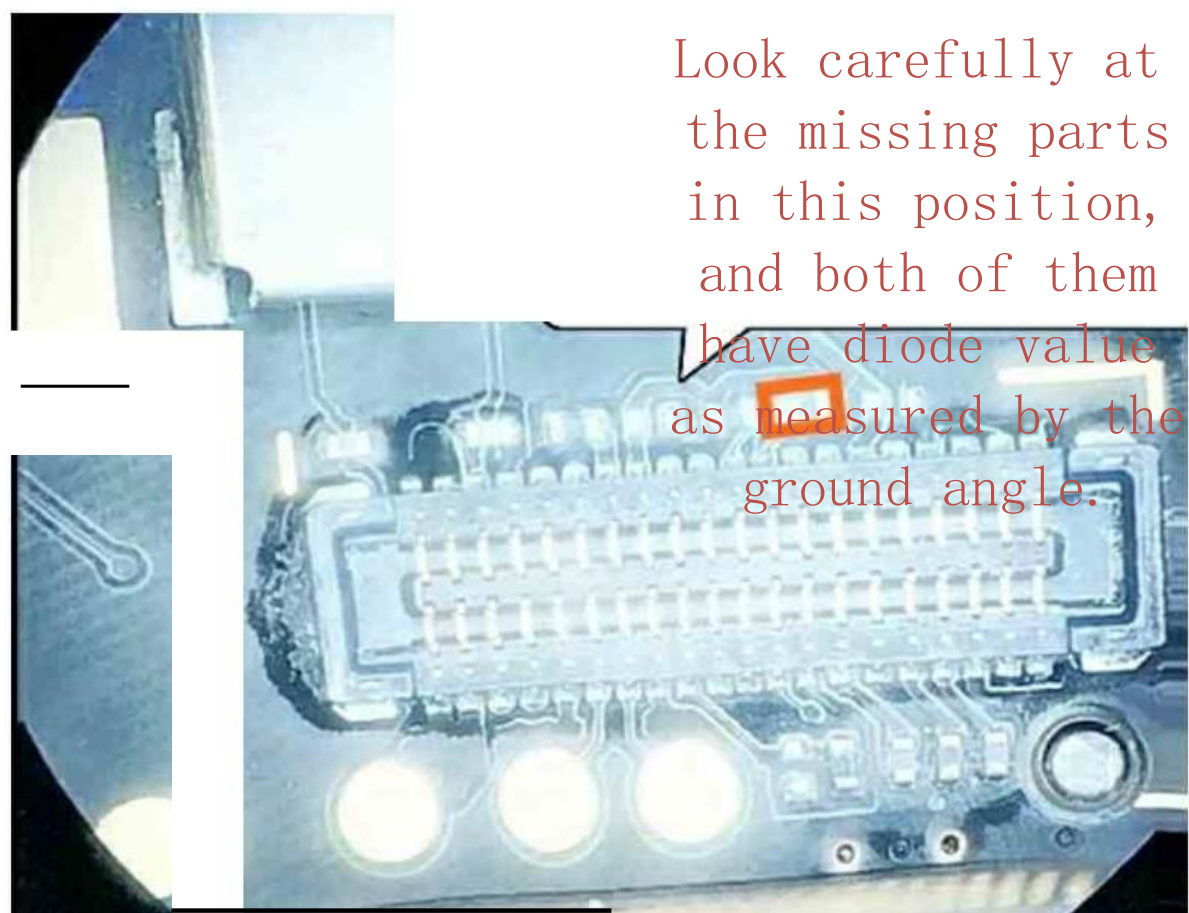

三 stretch I Pan Fei I 0:: | 邑6j L. | -



.o. diode value of R1007

Through schematic, we know that R1 007 and R1 008 are both pull-up resistors of touch, and diode value is the same, so it can't be short-circuit, but can only be replaced by 2K diode value, otherwise it will affect the touch!

