

SIB (Service Information Bulletin)

Model	K4 2017 series
Revision	Revision 1.0
Date	27th Jul 2017

Revision History

No	Date	Revision	Country / buyer	Contents	Target	Type	Issue	Page
1	27 th Jul 2017	1.0	Global / All	Service Information	Service Center	H/W	No power on Guide	Page 2

SIB (Service Information Bulletin)

LGE Internal Use Only

No Power on Guide

Model	K4 2017 series	Revision	Rev 1.0	Date	27 th Jul 2017	Country	Global	Buyer	All	Type	H/W
Contents	☒ Service Information ☐ Guide ☐ Notification					Target	☒ BRC ☐ DSC ☐ ASC ☐ CIC				

Detail Guide

※ This document should be translated to language of each country


1. Introduce

- Sometimes K4 2017 series Model has occurred from external electrical damage.

2. Repair Guide

- If Phone is No Power-on (overcurrent),
should add OVP circuit and replace with new PMIC.

Location no	As-is	To-be
U901	DNI	EAN64971401 (IC, OVP)
C930	DNI	EAE65046201 (Capacitor)
C931	DNI	EAE64621606 (Capacitor)
R913	DNI	EBC64155608 (Resistor)
R910 / R910	EBC64155605	Remove

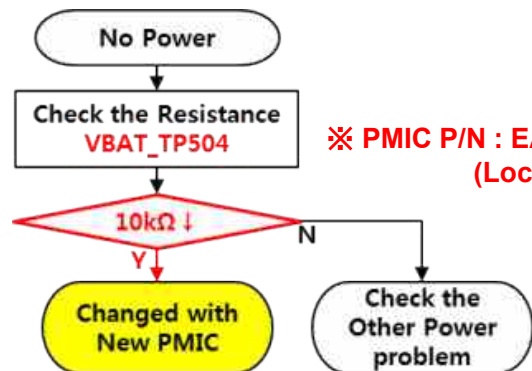


※ PMIC P/N : EAN63748001
(Location no : U401)


<Test Point of K4 2017 series>



<Main PCB Bottom Surface>

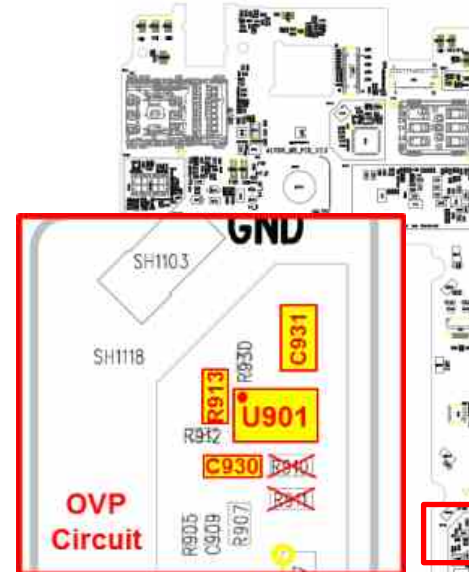

<Main PCB Top Surface>

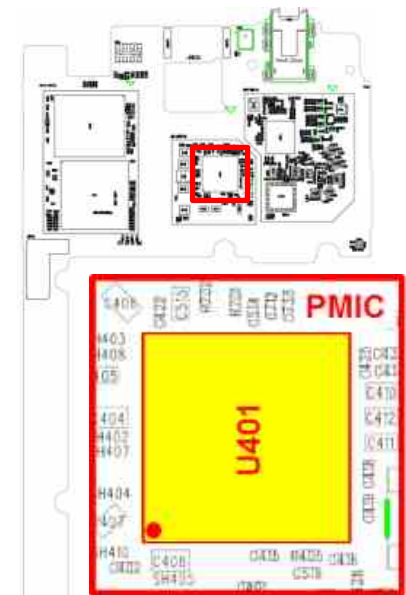

3. Applied Model

- LGX230, LGX230AR, LGX230DS, LGX230DSF, LGX230F, LGX230H, LGX230K, LGX230YK, LGX230Z