

SERVICE BULLETIN

from: TRIO-KENWOOD COMMUNICATIONS, INC.

55

SUBJECT: TS-180S LOW 40M ALC

DATE 9/14/79

Some operators may experience intermittent reduction or loss of ALC, especially after several minutes transmit time.


On the LPF unit X51-1180-00, change C14, C17 from 470pF to 390pF. Check ALC level and adjust if necessary, per section 4-6 ALC meter adjustment, TS-180S Service Manual.

New Part: CM93D2H390J 390pf + 5% 500V mica or ceramic

Please notate your Service Manual

JEB/yn

▼ LPF UNIT (X51-1180-00)

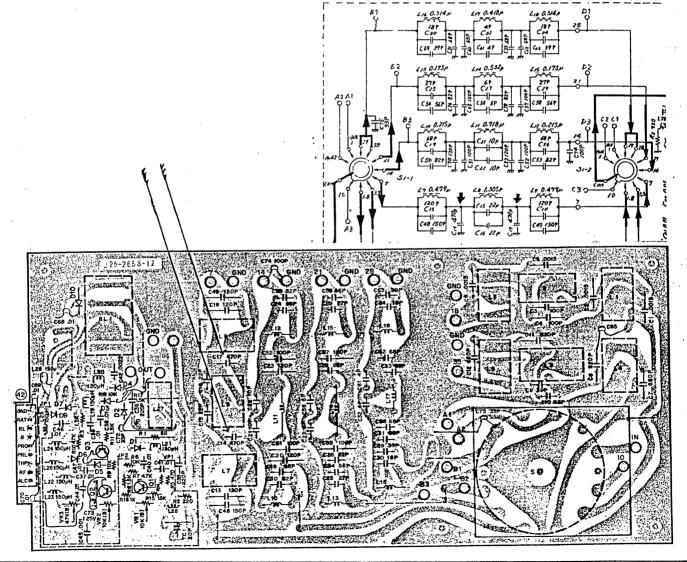

TRIO-KENWOOD COMMUNICATIONS, INC.

1111 WEST WALNUT STREET - COMPTON, CALIFORNIA 90220 MAILING: P.O. BOX 7065 - COMPTON, CALIFORNIA 90224