



PLATING POSTERS

www.platingposters.com

PLATING POSTERS INC • METAL FINISHING REFERENCE SERIES

ELECTROLESS NICKEL

PHOSPHORUS GRADE

LOW PHOSPHORUS

LOW-P

~2–5% P

MID-P

~6–9% P

HIGH-P

~10–13% P

THE COMPLETE TRAINING MANUAL

*A full training course for the brand-new operator — from “what is plating?” to a signed certificate of completion. Low-phosphorus electroless nickel (Ni-P, ~2–5% P) — a hard, wear-resistant alloy that plates with **no electric current at all**. Assumes you know nothing. Teaches you everything — including the chemistry that can run away on you and a tank that runs near boiling.*



OPERATOR TRAINING & CERTIFICATION

EDITION 1.0 • 2026 • BEGINNER-FRIENDLY STYLE

Training reference only. The electroless nickel bath runs **near boiling** (~85–95 °C / 185–203 °F) — a serious burn and scald hazard — and uses nickel salts (a skin sensitizer) and sodium hypophosphite (an oxidizer-incompatible reducing agent). Always verify exact parameters against your chemistry supplier’s Technical Data Sheets (TDS), customer specifications, current Safety Data Sheets (SDS), and applicable OSHA, EPA, REACH, and local regulations before production use. Specs commonly referenced: ASTM B733, AMS 2404, MIL-C-26074.

WELCOME ABOARD

IF YOU DON'T KNOW A BATH FROM A BEAKER, YOU'RE IN EXACTLY THE RIGHT PLACE — AND THIS PROCESS WORKS IN A WAY THAT SURPRISES ALMOST EVERYONE

Welcome. If you're holding this manual, you're about to learn how to run — or at least understand — an **electroless nickel plating line**, specifically the **low-phosphorus (Low-P)** version. Maybe you started this week. Maybe you've been racking parts for a year and finally want to know *why* you do the things you do. Either way, you're in the right place, and we're glad you're here.

Here is the most surprising thing we can tell you up front, and we'll repeat it because it's the key that unlocks this whole process: **electroless nickel plating uses NO electricity**. No rectifier. No anodes. No current. Nothing plugged in to drive the plating. If you've seen a zinc or chrome line — racks of parts wired to a humming power supply — forget that picture for now. Electroless nickel grows a metal coating using **chemistry alone**. That's not a typo, and it's not a simplification. It's the defining fact of this trade.

The second most important thing: **this manual assumes you know nothing about plating, chemistry, or metal finishing**. That's not an insult — it's a promise. Every term gets defined the first time we use it. Every step explains not just *what* to do but *why* it matters. Nobody is born knowing what "autocatalytic" or "metal turnover" means. You learn it. We're going to teach it.

This manual is written in the spirit of the *plain-language* guides — friendly, plain-spoken, and patient. We'd rather over-explain than leave you guessing in front of a tank of near-boiling chemistry.



REMEMBER

You do not need to memorize this manual. You need to *understand* it. Understanding sticks. Memorizing fades by Friday — and on a hot bath that can chemically "run away," the understanding is what keeps you (and the tank) safe.

• HOW TO USE THIS MANUAL

The manual follows the **line itself**, station by station, in the order a part actually travels: inspect and rack it, clean it, rinse it, activate it, rinse it, plate it in the electroless nickel bath, rinse it, (optionally) bake it, then dry and inspect it. Reading it in order matters — the order of a plating line is never random, and neither is the order of this book.



TIP

Read the Fundamentals (Part One) all the way through *before* you read any individual station chapter. The station chapters assume you already understand the big picture Part One gives you — especially the idea of plating with *no current*. It's the difference between reading a recipe when you already know how to cook versus the very first time you've stepped into a kitchen.

THE ICONS — YOUR FRIENDLY MARGIN HELPERS



TIP

A shortcut, a trick of the trade, or a smarter way to do something — the kind of thing a 20-year veteran would lean over and tell you.



REMEMBER

A core idea worth locking in. If you forget everything else on the page, don't forget these. They're the load-bearing ideas.



HEADS-UP

A safety warning. Read every single one. On an electroless nickel line these keep your skin, eyes, and lungs intact — the bath runs near boiling and the chemistry has real hazards. We use them *liberally*.



TECHNICAL STUFF

Deeper chemistry or theory for the curious. Optional. Skip these and you can still run the line. Read them and you'll understand it on a deeper level.



FUN FACT

A bit of interesting trivia to make the science stick.

TWO MORE THINGS YOU'LL SEE AT EVERY STATION

Each station chapter ends with a **Teach-Back** checklist (sometimes paired with a "Top Mistakes" card) — the things you must say out loud, unprompted, before you're cleared — and a bordered **Sign-Off** box your *trainer initials* once you've demonstrated the skill safely. Treat the Teach-Back as your study guide and the Sign-Off as the gate you must pass.

— FIND YOUR WAY

TABLE OF CONTENTS

READ FRONT-TO-BACK THE FIRST TIME · KEEP ON THE SHELF FOREVER AFTER

PART ONE — FRONT MATTER & FUNDAMENTALS

Welcome Aboard & How to Use This Manual	2
Learning Objectives	4
Ch 1 · What Is Plating?	5
Ch 2 · What Is <i>Electroless</i> Plating? (No Current)	6
Ch 3 · What Is Low-Phosphorus Electroless Nickel?	8
Ch 4 · The Low-P / Mid-P / High-P Family	10
Ch 5 · How an Electroless Nickel Line Works	11
Ch 6 · Why the Order Matters (Walking the Line)	12
Ch 7 · The Chemistry Inside the Bath	13
Ch 8 · Personal Protective Equipment (PPE)	15
Ch 9 · Emergency & First-Response	16
Ch 10 · The Safety Philosophy of a Hot EN Line	17

PART TWO — STATION BY STATION

Station 01 · Inspection & Racking	18
Station 02 · Soak Clean / Degrease	20
Station 03 · Rinse (The Firewall)	22
Station 04 · Acid Activation / Etch	23
Station 05 · Rinse (The Guard Rinse)	25
Station 06 · Electroless Nickel Plate (Low-P) — The Main Tank	26
Station 07 · Post-Plate Rinse	30
Station 08 · Post-Bake (Hardness &/or H ₂ Relief)	31
Station 09 · Dry / Final Inspection	33

PART THREE — ACROSS THE LINE

Bath Chemistry Control: MTO, Replenishment, pH, Stabilizer, Loading	34
Bath Decomposition: Causes, Warning Signs & Recovery	36
Heat Treatment for Hardness & H ₂ -Embrittlement Relief	37
The Thickness-Uniformity Advantage	38
Rinsing & Water Management	39
Waste & Environmental (Nickel, Phosphite, Chelated Metals)	40
Quality Checks & Troubleshooting Quick-Index	41
Glossary — Every Term, Plain and Simple	43
Operator Training Matrix (Template)	45

PART FOUR — COMPLETION TEST, ANSWER KEY & CERTIFICATE

Completion Test (20 Questions)	46
Answer Key	48
Certificate of Completion	49



REMEMBER

This manual is a training and reference tool — **not** a substitute for your facility's written procedures, your supplier's TDS/SDS, or your supervisor's instructions. When this manual and your shop's official procedure disagree, **follow your shop's official procedure and ask your supervisor.**

WHAT YOU'LL BE ABLE TO DO

LEARNING OBJECTIVES

MASTER THIS AND EVERY STATION CHAPTER CLICKS INTO PLACE

By the time you finish this manual, you should be able to confidently:

1. **Explain what plating is** in plain language — growing a thin, bonded layer of one metal onto another part.
2. **Explain what makes electroless plating different from electroplating** — it uses **no electric current at all**; the metal is deposited by a chemical (autocatalytic) reaction driven by a reducing agent in the bath.
3. **Describe what low-phosphorus electroless nickel does** and why a shop chooses it — a hard, wear- and abrasion-resistant Ni-P alloy with excellent thickness uniformity and good resistance in alkaline/caustic service.
4. **Explain electroless nickel's headline advantage** — it plates **uniformly on every surface at once**, including bores, blind holes, and complex shapes, with no current-density map to manage.
5. **State the central control idea of this line**: because there's no current to adjust, you control the deposit by managing **bath chemistry and temperature** — nickel, hypophosphite, pH, stabilizer, loading, and **metal turnovers (MTO)**.
6. **Name the stations of the line in order** and explain *why* the order can't be rearranged.
7. **Explain why the bath can “decompose”** (plate itself / the tank), what causes it, what warns you, and how to respond.
8. **Place Low-P in the family** (Low-P vs Mid-P vs High-P) and explain why a shop picks each.
9. **Explain post-plate heat treatment** for hardness development and for hydrogen-embrittlement relief on high-strength steel.
10. **Recognize the hazards** — the near-boiling bath, nickel sensitization, hypophosphite/oxidizer incompatibility and phosphine-gas risk, and the pH chemicals — and the correct PPE and emergency response for each.




REMEMBER

You are not expected to hit all of these on day one. Plating is a craft. But the *safety* objectives (#10) and the *no-current* concept (#2) are the foundation everything else stands on — get those first.

• THE LINE AT A GLANCE

The whole Low-P electroless nickel line in one strip. Don't memorize it yet — just feel the rhythm: **Inspect/Rack** → **Soak Clean** → **Rinse** → **Acid Activate** → **Rinse** → **EN BATH (Low-P)** → **Rinse** → **Post-Bake** → **Dry/Inspect**.



REMEMBER

Notice the pattern: **a rinse follows the working tanks**, and there is **no rectifier anywhere in this strip**. The “main event” — the EN bath — does its work with heat and chemistry, not electricity. That single difference reshapes the whole line.



FUN FACT

Electroless nickel was discovered by accident. In the 1940s, chemists Abner Brenner and Grace Riddell were studying ordinary electroplating and noticed nickel depositing *more* than the current alone could explain. The “extra” nickel was being laid down by a chemical reducing agent — and the electroless process was born from spotting an anomaly nobody else stopped to question.

CHAPTER 1

WHAT IS PLATING?

THE TRUE BEGINNER'S PRIMER — SO FAR BACK WE DON'T EVEN ASSUME YOU KNOW WHAT PLATING IS

THE ONE-SENTENCE VERSION

Plating is coating a part with a thin, tightly-bonded layer of metal to give it properties the bare part doesn't have. That's the whole idea. Now let's unpack it.

Imagine a steel valve, a bolt, or a hydraulic part. Steel is strong and cheap, but it's relatively soft on the surface, it rusts, and it wears. You want to give that part a thin, hard, even skin of **nickel alloy** — a coating that resists wear and corrosion and follows every contour of the part exactly. You can't paint that on evenly. Instead, we grow a metal layer directly onto the steel, atom by atom, chemically bonded to it. That's plating.

• TWO FAMILIES OF PLATING

There are two big ways to grow that metal layer, and the difference between them is the heart of this manual:

- **Electroplating (with current)** — the kind you may have seen on a zinc or chrome line. A power supply (**rectifier**) pushes electric current through a tank, and that current drives metal out of the bath and onto the part. The part is wired up as the **cathode**; metal anodes or dissolved metal feed the bath. The metal goes where the current goes.
- **Electroless plating (no current)** — *this manual*. **No rectifier, no anodes, no current.** The metal is deposited by a **chemical reaction** happening right at the part's surface. Because there's no current to steer, the metal lands *everywhere on the part equally*. We'll spend all of Chapter 2 on exactly how this works, because it's so different from what most people expect.



REMEMBER

Whenever this manual says “plating,” it means the **electroless** kind unless it explicitly says “electroplating.” On this line there is **no electricity driving the deposit**. If you came from a current-driven line, that's the first habit to unlearn.



TECHNICAL STUFF

In *every* kind of plating, the chemistry is a “redox” (reduction-oxidation) reaction: metal ions in the bath (positively charged) gain electrons and turn into solid metal on the part. The only question is *where the electrons come from*. In electroplating, they come from the rectifier (electricity). In **electroless** plating, they come from a chemical **reducing agent** dissolved in the bath. Same destination, completely different engine.



FUN FACT

The word “electroless” literally means “without electricity.” It's one of the few places in the metal-finishing trade where the name tells you exactly what's special about it — most plating names tell you the metal, but this one tells you the *method*.

WHAT IS ELECTROLESS PLATING?

PLATING WITH NO CURRENT, NO ANODES, NO RECTIFIER — DRIVEN BY CHEMISTRY ALONE

We put this chapter near the front on purpose. Almost everything that makes an electroless nickel line *different* — how you control it, why it covers so evenly, why it can “run away” — flows from this one idea. Read it slowly.

• THE CORE IDEA: AUTOCATALYTIC DEPOSITION


In the electroless nickel bath, two main ingredients matter most:

- **A source of nickel** — nickel dissolved in the water as positively-charged **nickel ions** (Ni^{2+}). (An *ion* is just an atom carrying an electric charge.)
- **A reducing agent** — in this process, **sodium hypophosphite**. A reducing agent is a chemical that’s eager to *give away electrons*.

Here’s the magic. When a properly prepared part is dipped into the hot bath, the hypophosphite reacts **right at the part’s surface**, handing electrons to the nearby nickel ions. Those nickel ions grab the electrons and turn into solid nickel metal, sticking to the part. A little phosphorus from the hypophosphite gets built into the deposit too — which is why the coating is a **nickel-phosphorus (Ni-P) alloy**, not pure nickel.

Now the part that makes it “electroless.” The reaction needs a **catalytic surface** to happen on. Steel, nickel, and certain other metals *are* catalytic — they kick-start the reaction. And here’s the beautiful part: **freshly deposited nickel is itself catalytic**. So once the first layer of nickel forms, *it* catalyzes the next layer, which catalyzes the next, and so on. The coating literally builds on itself.

That self-sustaining, self-catalyzing reaction has a name: **autocatalytic deposition**. “Auto” = self; “catalytic” = speeds up the reaction. The deposit catalyzes its own growth.

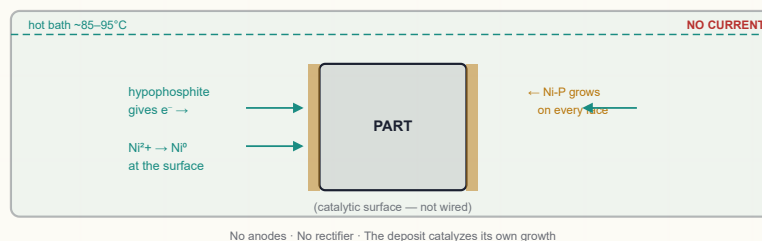

★ REMEMBER

The three words that unlock this whole line: **autocatalytic** (the deposit grows itself, with no current), **reducing agent** (hypophosphite, the chemical that supplies the electrons), and **Ni-P alloy** (the coating is nickel *plus* phosphorus, not pure nickel). Lock these in.

⚙️ TECHNICAL STUFF

Why does the reaction only happen *on the part* and not all through the tank? Because it needs a catalytic surface to proceed. In the open solution, nickel ions and hypophosphite mostly leave each other alone. It’s the catalytic metal surface that lets them react. This is also the seed of the danger: if *anything else* in the tank becomes catalytic — a speck of nickel dust, a roughened tank wall, an overheated spot — the reaction can start happening *there* too. That’s the beginning of “bath decomposition” (Chapter 7 and Part Three).

• NO CURRENT MEANS NO CURRENT-DENSITY MAP

On an electroplating line, operators worry constantly about **current density** — how much current lands on each part of the surface. Current crowds onto edges and points and starves recesses and bores, so the coating comes out thick on corners and thin (or missing) inside holes. Operators fight this with anode placement, robbers, and careful racking.

Electroless nickel has none of that. Because there's no current, there's no current-density map to manage. The chemical reaction proceeds at essentially the same rate on **every catalytic surface in contact with fresh, hot bath** — the outside, the inside of a bore, the bottom of a blind hole, the threads, the flat faces. They all plate at nearly the same rate, at the same time.



REMEMBER

This is **electroless nickel's headline advantage: superb thickness uniformity**. A complex part — bores, blind holes, internal passages, sharp corners — comes out coated *evenly all over*, something an electroplated coating can almost never achieve. If a customer needs "exactly 25 µm everywhere, including inside that deep hole," electroless nickel is often the only practical answer.



TIP

When someone asks "why electroless instead of electroplate?", the shortest honest answer is: "*Because it coats everything evenly — even the places current can't reach.*" That one sentence explains most of why this process exists.

• SO WHAT DO YOU CONTROL INSTEAD?

If there's no rectifier to turn up or down, what does the operator actually control? **The bath's chemistry and its temperature.** Specifically:

- **Temperature** — the reaction is strongly temperature-driven. Too cool and it barely plates; too hot and it can run away. (Typical ~85–95 °C.)
- **Nickel concentration** — the metal being deposited; it gets used up and must be replenished.
- **Hypophosphite (reducing agent)** — also used up and replenished.
- **pH** — drifts down as the bath works; corrected with ammonia or caustic.
- **Stabilizer** — a *trace* additive that keeps the reaction from happening where it shouldn't.
- **Loading** — how much surface area you put in per gallon (or liter) of bath.

You'll meet all of these in Chapter 7 and Part Three. For now, just absorb the shift in mindset.



REMEMBER

On an electroplating line you turn a *knob* (the rectifier). On an electroless line you manage a *recipe* (chemistry + temperature). There is no knob. The bath plates as fast as the chemistry and heat tell it to — your job is to keep that recipe in range.



TECHNICAL STUFF

Because the reaction proceeds on *every* catalytic surface at once, the deposit also forms inside long, narrow internal passages that an electroplating current could never reach evenly. The only practical limit is getting *fresh, hot bath* into those passages (and letting gas bubbles escape) — which is why agitation and part orientation still matter, even with no current. It's a fluid problem now, not an electrical one.



FUN FACT

Electroless nickel is so good at coating internal surfaces that it's used to plate the *insides* of pipes, valves, molds, and even firearm bores — geometries where you simply cannot hang an anode. The chemistry goes where the current can't.

CHAPTER 3

WHAT IS LOW-PHOSPHORUS ELECTROLESS NICKEL?

A HARD, WEAR-RESISTANT NI-P ALLOY — AND WHAT THE “PHOSPHORUS PERCENT” ACTUALLY BUYS YOU

IT’S AN ALLOY, AND THE PHOSPHORUS PERCENT DEFINES IT

Every electroless nickel deposit is a **nickel-phosphorus alloy** — nickel with some phosphorus mixed in, co-deposited from the hypophosphite. The **amount of phosphorus** (by weight) is the single most important thing about an EN deposit, because it changes the coating’s properties dramatically. The industry sorts EN into three families:

- **Low-phosphorus (Low-P): ~2–5% P** — *this manual*.
- **Mid-phosphorus (Mid-P): ~6–9% P**
- **High-phosphorus (High-P): ~10–13% P**

Low-P is the **hard, wear-fighting** member of the family. Its low phosphorus content gives it a **microcrystalline** structure (fine crystal grains) rather than the near-amorphous “glassy” structure of High-P — and that structure is what makes Low-P hard.

★

REMEMBER

The phosphorus percent is the EN deposit’s “personality.” Low-P (~2–5%) = hard, wear-resistant, good in alkaline service. High-P (~10–13%) = maximum corrosion resistance, near-amorphous, non-magnetic. Same family, very different jobs. We’ll compare them head-to-head in Chapter 4.

WHAT LOW-P ELECTROLESS NICKEL GIVES A PART

PROPERTY	WHAT IT MEANS ON THE FLOOR
High as-deposited hardness	Typically ~700 HV as-plated — already hard before any heat treatment.
Even higher after heat treatment	Bake ~1 hour at ~400 °C and hardness rises to ~900–1000+ HV , rivaling hard chrome.
Excellent wear / abrasion resistance	Hard, fine-grained surface survives sliding, rubbing, and abrasion.
Good resistance in alkaline / caustic	Low-P holds up well against alkaline and caustic environments better than High-P.
Superb thickness uniformity	Like all EN, it coats every surface evenly — bores, blind holes, complex shapes.
Good solderability & uniformity	Useful in electronics and precision work.

Where you’ll see Low-P EN: parts that must resist **wear and abrasion** — molds and dies, valves, pump components, hydraulic parts, fasteners, gears, sliding/bearing surfaces, parts that run in **alkaline or caustic** environments, and precision components where even thickness over a complex shape matters.

⚠

HEADS-UP

The same bath that plates this hard, useful coating runs **near boiling (~85–95 °C)**, contains **nickel salts** (a known skin/respiratory **sensitizer**), and uses **hypophosphite** (a reducing agent that is dangerous around oxidizers and can release toxic **phosphine gas** if mishandled or if a bath overheats/decomposes). The deposit is benign; the *bath* must be respected. Full Part One safety chapters follow.

• THE ONE PLACE LOW-P IS *NOT* THE BEST CHOICE

Low-P's hardness and alkaline resistance come with a trade-off: its **corrosion resistance in acidic and chloride (salt) environments is lower** than high-phosphorus EN. Its fine-grained, microcrystalline structure has more grain boundaries for acid/chloride attack to follow than High-P's near-amorphous structure.



REMEMBER

Low-P is the hardness/wear/alkaline champion; it is NOT the acid/chloride corrosion champion. If a customer's part lives in salt spray, seawater, or acidic chemicals, that's a **High-P** job, not Low-P. Picking the wrong phosphorus class is a real-world quality failure — match the deposit to the service environment.



TECHNICAL STUFF

As-deposited, Low-P is **microcrystalline and magnetic**. High-P, by contrast, is **near-amorphous** (no real crystal structure — like glass) and **non-magnetic**. That amorphous, grain-boundary-free structure is exactly why High-P resists acid/chloride corrosion so well, and why Low-P doesn't match it there. Structure drives properties; phosphorus drives structure.



FUN FACT

A High-P electroless nickel coating is, structurally, closer to *glass* than to ordinary metal — it has no real crystal grains. Low-P is the opposite: a true fine-grained crystalline metal. Two coatings from the *same* family of bath, sitting at opposite ends of the materials-science spectrum, just because of a few percent of phosphorus.

• SPECS YOU'LL HEAR NAMED

Low-P EN work is commonly written to industry specifications. You don't memorize their contents, but you should recognize the names:

- **ASTM B733** — the standard specification for autocatalytic (electroless) nickel-phosphorus coatings; classifies by phosphorus content, thickness, and heat treatment.
- **AMS 2404** — aerospace material spec for electroless nickel plating.
- **MIL-C-26074** — a military spec for electroless nickel coatings.

Many EN deposits are also valued because they're **RoHS-friendly** (no regulated heavy metals like hex chrome or cadmium in the coating itself). Always confirm the exact class, thickness, and heat-treat the customer's print calls for.



TIP

When a customer print just says "ASTM B733," read further — that spec covers *all* phosphorus classes and several thickness/heat-treat combinations. The class and the heat-treat condition on the print are what tell you whether you're actually running a Low-P job. Don't stop reading at the spec number.

CHAPTER 4

THE PHOSPHORUS FAMILY

WHY A SHOP PICKS LOW-P, MID-P, OR HIGH-P — THREE COUSINS, THREE JOBS

You've met Low-P. To really understand it, you need to see it next to its cousins. We'll build Mid-P and High-P manuals next; here's the head-to-head so you understand *why* a shop reaches for Low-P.

PROPERTY	LOW-P (~2–5%)	MID-P (~6–9%)	HIGH-P (~10–13%)
Structure	Microcrystalline	Mixed	Near-amorphous
As-deposited hardness	High (~700 HV)	Moderate	Lower
Hardness after heat treat	~900–1000+ HV	High	Moderate
Wear / abrasion resistance	Excellent	Good	Moderate
Corrosion in acid/chloride	Lower	Good	Best
Corrosion in alkaline/caustic	Good	Moderate	Lower
Magnetic?	Yes (magnetic)	Slightly	No (non-magnetic)
Pick it when...	Hardness, wear, alkaline service, solderability, uniformity	All-around general purpose	Max corrosion (salt/acid), non-magnetic needs

★

REMEMBER

Two-sentence summary you can repeat: “**Low-P for hardness, wear, and alkaline service. High-P for maximum corrosion resistance, especially acid and salt, and for non-magnetic needs.**” Mid-P sits in between as the general-purpose choice. The customer’s *service environment* decides which cousin you run.

⚙️

TECHNICAL STUFF

Phosphorus content is set mainly by **bath chemistry and pH**, which is why Low-P, Mid-P, and High-P are usually *different baths*, not just the same bath run differently. Low-P baths tend to run at the higher end of the EN pH range and use chemistries tuned to keep phosphorus low; High-P baths run more acidic (lower pH) to drive phosphorus up. You won’t switch a Low-P tank to High-P by turning a dial — it’s a different formulated bath.

💡

TIP

When a traveler just says “electroless nickel” with no phosphorus class, **stop and ask**. “EN” alone is ambiguous. The phosphorus class changes hardness, corrosion behavior, and whether the part will even perform in service. Never guess the class.

☀️

FUN FACT

Because High-P EN is non-magnetic, it’s used to coat parts in and around sensitive magnetic instruments and hard-disk components — while Low-P’s magnetism is no problem (and sometimes an asset) for the rugged wear parts it’s built for. The same family quietly serves both the gentlest electronics and the toughest machinery.

CHAPTER 5

HOW AN ELECTROLESS NICKEL LINE WORKS

A LINE IS A SYSTEM, NOT A PILE OF SEPARATE TANKS

An electroless nickel line is a **sequence of stations** a part travels through in a strict order. Each station does one job and prepares the surface for the next. Parts are typically **racked** (hung on a fixture) or run in **baskets/barrels** depending on size and shape — but unlike an electroplating rack, the rack here carries **no current**; it just holds the parts and lets fresh bath reach every surface.

• THE WHOLE LOW-P ELECTROLESS NICKEL SEQUENCE

#	STATION	THE ONE THING IT DOES	TEMP	NOTES
01	Inspect / Rack	Check the part; hold it so bath reaches all surfaces	Ambient	No current — rack just positions
02	Soak Clean	Remove oil, grease, shop soil	~60–80°C	Often alkaline soak
03	Rinse	Wash off cleaner (the firewall)	Ambient	—
04	Acid Activate / Etch	Remove oxide; “wake up” surface for catalysis	Amb–warm	Acid dip; Al needs zincate
05	Rinse	Wash off acid (guard rinse)	Ambient	Protects the EN bath
06	EN Bath (Low-P)	Autocatalytic Ni-P deposition	~85–95°C	Main event; near-boiling; no current
07	Rinse	Wash off bath chemistry	Ambient	Recover/contain nickel + phosphite
08	Post-Bake (optional)	Develop hardness and/or relieve hydrogen	~190–400°C	Purpose sets the temperature
09	Dry / Final Inspect	Dry; verify thickness, adhesion, etc.	—	XRF/coulometric thickness



HEADS-UP

Notice the bath temperature: the EN tank runs **~85–95 °C (185–203 °F)** — **near boiling**. This is the defining physical hazard of the line. A splash, a dropped part, or a steam burst can cause serious **scald burns**, and the hot tank gives off **steam/vapor** you shouldn’t breathe. Treat the EN tank with the same respect a cook gives a vat of boiling oil.

• A LINE IS A SYSTEM, NOT A PILE OF SEPARATE TANKS



REMEMBER

Every station either protects the next or poisons it. There is no neutral step. A part that leaves the cleaner still oily won’t plate (or will skip-plate). A part that drags acid into the EN bath upsets its chemistry. A part that drags cleaner or contamination into the bath can **trigger decomposition**. What you do (or fail to do) early shows up as a defect — or a ruined bath — later.



TIP

Think of the EN tank as the crown jewel *and* the temperamental heart of the line. Everything *before* it (inspect, rack, clean, rinse, activate, rinse) exists to make sure only a perfectly clean, oxide-free, contamination-free part enters it. Everything *after* it (rinse, bake, dry, inspect) exists to finish and prove the coating. The whole line orbits that one hot, chemically delicate tank.

CHAPTER 6

WHY THE ORDER MATTERS

EACH STATION SETS UP THE NEXT, AND THE SEQUENCE IS LOCKED BY CHEMISTRY — AND BY PROTECTING THE BATH

INSPECT / RACK FIRST

Because you must confirm the part, its material, and the spec (Low-P? thickness? heat-treat?) before any chemistry — and rack it so fresh bath reaches every surface (trapped air in a blind hole = a bare spot, even on a no-current line).

CLEAN BEFORE ACTIVATE

Because the activator and the EN bath both need *bare, oil-free metal*. Plate over oil and you've plated over oil — or worse, you skip-plate and drag soil into the bath. The free, foolproof **water-break test** tells you when cleaning is done.

RINSE BETWEEN CLEANER AND ACTIVATOR

Because the alkaline cleaner and the acidic activator are chemical opposites; carry one into the other and you waste chemistry and weaken the activation.

ACID ACTIVATE RIGHT BEFORE PLATING

Because freshly cleaned steel grows an invisible oxide film in minutes, and the EN reaction needs a fresh, catalytic surface to start on. The acid activation strips the oxide and “wakes up” the surface so autocatalytic deposition initiates evenly the moment the part hits the bath.



REMEMBER

No activation, no initiation. On an electroless line, if the surface isn't fresh and catalytic, the autocatalytic reaction won't start — you get **skip-plating** (bare patches) or no deposit at all. Activation has to come right before the bath.

RINSE BEFORE THE EN BATH (THE GUARD RINSE)

This rinse is special. It's the last thing protecting the **delicate, expensive EN bath** from dragged-in acid and contamination. A poorly rinsed part carries activator acid and dissolved metals straight into the bath, dropping its pH and seeding trouble.

PLATE, THEN RINSE, THEN (OPTIONALLY) BAKE, THEN DRY AND INSPECT

In that order, because you must **rinse** to stop bath chemistry from spreading and to recover nickel; you **bake** (when required) to develop hardness and/or drive out hydrogen *before* the part goes to service; and you **inspect last** to prove thickness and quality before it ships.



TECHNICAL STUFF

The recurring villain that justifies all the rinses is **drag-out** (the film of solution clinging to a part as it leaves a tank) and its mirror, **drag-in** (that film contaminating the next tank). On an EN line, drag-*in* to the bath is uniquely dangerous: the EN bath is a finely balanced chemistry, and dragged-in contamination (acid, foreign metals, cleaner) can poison it or trigger decomposition. The guard rinse (Station 05) exists specifically to protect the bath.



HEADS-UP

A part dropped or “parked” between the activator and the EN bath will **re-oxidize** and then **skip-plate** — and re-running it wastes hot bath time. Move activated parts promptly into the bath.

CHAPTER 7

THE CHEMISTRY INSIDE THE BATH

COMPLEXANTS, STABILIZERS, MTO, LOADING — THE WORDS THAT RUN AN ELECTROLESS LINE

The EN bath is more than “nickel and hypophosphite in hot water.” A working bath is a carefully balanced team of ingredients. Understanding what each does is what separates an operator who *runs* the bath from one who just *watches* it.

• THE CAST OF THE BATH

INGREDIENT	WHAT IT IS	WHAT IT DOES
Nickel source (e.g., nickel sulfate)	The metal	Supplies the Ni^{2+} ions that become the coating. Used up as you plate.
Reducing agent (sodium hypophosphite)	The “engine”	Supplies electrons to reduce nickel to metal; co-deposits the phosphorus. Used up as you plate.
Complexants / chelators (organic acids)	“Metal handlers”	Hold the nickel in solution so it doesn’t precipitate; control its release; buffer pH.
Stabilizers (trace — ppm)	“Traffic cops”	Suppress the reaction <i>everywhere except the part</i> — keep it from plating the tank, dust, or itself.
Buffers / pH adjusters (ammonia, caustic, acid)	pH control	Keep pH in the narrow working window as it naturally drifts down.



REMEMBER

Nickel and hypophosphite are consumed and must be replenished; complexants hold the metal and steady the chemistry; stabilizers (trace) keep the reaction *on the part and nowhere else*. Those three roles are the whole story of bath control.

COMPLEXANTS / CHELATORS — THE METAL HANDLERS

If you just dumped nickel into hot, reaction-ready solution, it would precipitate out as solid junk and the reaction would happen all over.

Complexants (chelators) are molecules that “grab” each nickel ion and hold it in a stable, soluble form, releasing it in a controlled way right where it’s needed. They also help **buffer pH**. They’re a big reason the bath plates smoothly and predictably.



TECHNICAL STUFF

A *chelator* (from the Greek for “claw”) wraps around a metal ion like a claw, keeping it dissolved and controlled. This is wonderful for plating — but it becomes a headache in **waste treatment** (Part Three), because the same claw that keeps nickel dissolved in the bath also keeps it dissolved in your wastewater, making it harder to precipitate out and remove. The chemistry that helps you plate fights you at the drain.

STABILIZERS — TINY AMOUNTS, ENORMOUS POWER

Stabilizers are present in **trace amounts — often parts per million (ppm)** — but they’re the difference between a controlled bath and a disaster. Their job: keep the autocatalytic reaction happening **only on the parts**, and stop it from starting on random catalytic specks (dust, particles, roughened tank walls) where it would snowball. The catch is that stabilizer level is a knife-edge:

- **Too little stabilizer** → the reaction starts where it shouldn’t → **plate-out** on the tank and, in the worst case, **bath decomposition** (the bath plates itself).
- **Too much stabilizer** → the reaction is over-suppressed even on the parts → **slow plating, skip-plating, or no plating at all**.



HEADS-UP

Stabilizer is the most dangerous ingredient to guess at. A small overdose can *kill* the bath’s plating ability; a small underdose can let it *decompose*. Stabilizer additions are made by your lab/chemist to a tested target — **never** “eyeball” a stabilizer addition. When in doubt, stop and ask.

**REMEMBER**

Stabilizer: too little = decomposition risk; too much = no plating. It's measured in ppm and adjusted by the lab, not the operator's hand. Respect the knife-edge.

• METAL TURNS (MTO) — HOW YOU MEASURE BATH LIFE

An EN bath doesn't last forever. As you plate, you use up nickel and hypophosphite, build up byproducts (especially **phosphite** and dissolved salts), and the bath gradually gets "tired." We measure how much life a bath has used in **Metal Turns (MTO)**.

One MTO = the bath has plated out (and you've replenished) an amount of nickel equal to the bath's original nickel content. Plate out and replenish the tank's worth of nickel once = 1 MTO. Do it six times = 6 MTO. A typical Low-P EN bath has a useful life of about **6–10 MTO**. After that, accumulated byproducts (phosphite, etc.) degrade the deposit and the bath is dumped (treated as waste) and remade.

**REMEMBER**

MTO is the "odometer" of the bath. It counts how many times you've turned over the bath's nickel content. Bath life $\approx$ **6–10 MTO** for Low-P. This is the EN equivalent of the "amp-hours" an electroplater tracks — except here it measures *bath aging*, not part thickness.

**TECHNICAL STUFF**

Why doesn't the bath last forever if you keep replenishing nickel and hypophosphite? Because every reaction that deposits nickel also produces **orthophosphite** (a byproduct) that builds up in the bath. High phosphite changes the deposit, can cause roughness, and eventually makes the bath unworkable no matter how well you feed it. MTO is really a proxy for "how much byproduct has accumulated." There's no replenishing your way out of old age — past $\sim$ 6–10 MTO, you remake the bath.

• BATH LOADING — SURFACE AREA PER VOLUME

Loading is how much part surface area you put into the bath per unit of bath volume — measured as **ft²/gal** or **dm²/L**. It matters because all that surface is consuming nickel and hypophosphite at once.

- **Under-loaded** (too little area) → reaction may run "loose," stabilizer balance off, can encourage plate-out.
- **Over-loaded** (too much area) → bath depletes fast mid-run, plating rate drops, deposit quality suffers.

Every EN bath has a recommended loading range from the supplier. Staying in it keeps the chemistry stable and the deposit consistent.

**TIP**

Loading isn't just a "nice to know" number — it directly drives how fast your bath depletes during a run and how often you replenish. Plan your loads so the bath stays in its recommended ft²/gal (dm²/L) window. A wildly under- or over-loaded tank is harder to keep stable.

**REMEMBER**

The five things you control on an EN bath: temperature, nickel, hypophosphite, pH, and stabilizer — within a sensible loading and tracked by MTO. There's no rectifier. *This* is the control panel.

CHAPTER 8

PPE — YOUR DAILY ARMOR

THE GEAR THAT STANDS BETWEEN YOU AND A NEAR-BOILING, SENSITIZING, ACIDIC/ALKALINE LINE

An electroless nickel line works with **hot caustic cleaners, acids, nickel salts** (a sensitizer), **hypophosphite**, and — above all — a **near-boiling (~85–95 °C) plating bath** that throws steam and can scald. PPE is your *last* layer of protection (after engineering controls like ventilation), but it is essential.

★

REMEMBER
There is no part, no order, and no deadline worth your health. Scrap can be reworked. A scald burn or a nickel sensitization that ends your ability to work the line cannot.

• THE MASTER PPE SET (WEAR AT ALL CHEMICAL STATIONS)

- **Chemical splash goggles** — sealed goggles, not safety glasses. Glasses leave gaps; hot bath and acids find them.
- **Face shield** — *over* the goggles for any work at the hot EN tank, the cleaner, or the acid.
- **Chemical-resistant gloves** — rated for the acids, caustics, and nickel chemistry per the SDS (nitrile/neoprene/PVC). Inspect for pinholes before each use. **Heat-aware** at the EN tank — gloves must handle the temperature.
- **Chemical-resistant apron/suit** — full coverage, chest to below the knee. Critical at the hot tank, where a splash means a scald *and* a chemical burn at once.
- **Chemical-resistant boots** — closed, non-slip, splash-proof.
- **Respiratory protection** — per your shop’s program. Required where ventilation is degraded or where vapors/mists could be present (hot tank steam, acid fumes, nickel mist).

⚠

HEADS-UP — THE BATH IS NEAR BOILING
The single most common serious injury on an EN line is a **scald/thermal burn** from the ~85–95 °C bath: a splash, a dropped part flicking hot liquid, or steam. Apron, face shield, gloves, and *slow, deliberate movement* over the tank are your defenses. Never carry a load over the hot tank faster than you can control it.

⚠

HEADS-UP — NICKEL IS A SENSITIZER
Nickel salts can cause **skin sensitization and allergic dermatitis**, and nickel-bearing mist can sensitize airways. Once sensitized, a person can react to nickel for life. Keep nickel chemistry off your skin and out of your breathing zone — gloves, ventilation, and hygiene matter every shift, not just when there’s a splash.

💡

TIP
Put gear on *in order*: boots and apron first, then gloves, then goggles, then face shield (and respirator if required) last. Take it off in reverse, and rinse your gloves *before* removing them — this keeps contaminated gloves away from your face.

• STATION-BY-STATION HAZARD SUMMARY

STATION	PRIMARY HAZARD	WHY IT’S DANGEROUS
01 Inspect/Rack	Mechanical	Cuts/pinches; sharp edges
02 Soak Clean	Hot alkaline (caustic)	Chemical burns; hot splash; steam
03 Rinse	Residual cleaner	Mild irritant; slip hazard
04 Acid Activate	Strong acid	Burns; fumes; (on Al, zincate caustic)
05 Rinse	Residual acid	Mild irritant; slip
06 EN Bath (Low-P)	Near-boiling bath; nickel (sensitizer); hypophosphite; steam	Scald burns; sensitization; vapor; phosphine risk if mishandled
07 Rinse	Nickel/phosphite water	Sensitizer; slip
08 Post-Bake	Hot oven (190–400°C)	Severe thermal burns
09 Dry/Inspect	Residual chemistry; hot air	Mild burns; slip

⚠

HEADS-UP
Never eat, drink, smoke, vape, or apply cosmetics on the line. Hand-to-mouth contact is a route for ingesting nickel and other chemistry. Wash thoroughly before breaks and before leaving. Keep food and drink completely out of the work area.

CHAPTER 9

EMERGENCY & FIRST-RESPONSE

WHEN SECONDS COUNT — LEARN THIS COLD, BEFORE YOU EVER NEED IT

Know these *before* you need them. **Locate, before your first shift:** the nearest **emergency eyewash** (within ~10 seconds of every chemical station), the **safety shower**, the **fire extinguisher** and alarm, the **spill kit**, the **SDS binder**, and your shop's hot-work and burn-response procedures.

**HEADS-UP**

Eyewash and shower stations must always be unblocked. Never stack parts, totes, or supplies in front of them. The day you need one is the day you can't move boxes out of the way.

• FIRST RESPONSE BY HAZARD

SITUATION	WHAT TO DO — IMMEDIATELY
Hot bath splash / scald burn	Cool the burn with cool running water for at least 15–20 minutes ; do not apply ice or ointments; remove non-stuck contaminated clothing while cooling. Get medical attention for anything beyond a minor surface burn. Remember it's also a <i>chemical</i> burn — flush thoroughly.
Chemical on skin (acid/caustic/nickel)	Safety shower; flush at least 15 minutes . Remove contaminated clothing while flushing. Bring the SDS. Nickel contact on broken skin needs attention (sensitization risk).
Chemical in eyes	Eyewash; hold eyelids open and flush at least 15 minutes , rolling the eyes. Do not rub. Get medical attention immediately. Bring the SDS.
Suspected phosphine / acrid odor from the bath	Treat as a serious gas hazard: move to fresh air, alert others, increase ventilation, and report immediately . Do not lean over a decomposing/overheating bath. Follow your shop's emergency procedure.
Inhaled vapor/mist, feel ill	Move to fresh air immediately. Report it — don't "tough it out." Seek medical attention for anything beyond brief mild irritation.
Chemical spill	Alert others; keep people away. Clean only if trained and within your shop's "small spill" limits — otherwise evacuate and call trained spill response. Never let nickel/EN chemistry reach a floor drain.
Chemical swallowed	Do not induce vomiting unless the SDS directs it. Follow SDS first aid; call poison control / medical help immediately.

**HEADS-UP — PHOSPHINE GAS, THE HIDDEN HAZARD**

Sodium hypophosphite is a reducing agent. If an EN bath is badly mishandled, contaminated, allowed to **overheat**, or is **decomposing**, the chemistry can release **phosphine (PH₃)** — a toxic, flammable gas with a garlic/fishy odor (though you must **never** rely on smell to detect it). This is a key reason you keep the bath in its temperature range, keep it stable, and **ventilate**. If a bath is overheating or visibly decomposing (gassing hard, going dark, plating the tank), treat it as a potential gas hazard, get to fresh air, and follow your shop's emergency response.

**HEADS-UP — OXIDIZER INCOMPATIBILITY**

Keep hypophosphite and EN chemistry **far away from strong oxidizers** (nitrates, chlorates, peroxides, nitric acid, strong chlorine chemistry). Reducing agent + strong oxidizer can react violently (fire/explosion risk). Store and handle per the SDS; never mix EN chemistry with oxidizing chemicals or let them share a spill.

**HEADS-UP — A CRITICAL ACID-MIXING RULE, FOR LIFE**

When diluting acid, **always add ACID to WATER — never water to concentrated acid**. Adding water to concentrated acid releases heat so violently it can erupt acid into your face. Memory aid: *"Do as you oughta — add acid to water."*

CHAPTER 10

THE SAFETY PHILOSOPHY OF A HOT EN LINE

THE MINDSET THAT KEEPS YOU SAFE ACROSS A WHOLE CAREER

Rules and PPE are the *tools*. The philosophy is the *mindset* that makes them work. Five principles guide everything on this line.

1. THE TANK IS NEAR BOILING — TREAT IT LIKE IT

The biggest everyday hazard isn't exotic; it's a **~90 °C splash or steam burn**. Move slowly and deliberately over the EN tank, never rush a load, and never reach across a hot bath. Most burns come from haste, not accidents.

2. THE CHEMISTRY CAN RUN AWAY — KEEP IT IN ITS LANE

A stable EN bath plates only on the parts. A mistreated one (overheated, contaminated, stabilizer wrong) can **decompose** — plating itself, gassing, and posing a phosphine hazard. Respect temperature, cleanliness, and the lab's stabilizer/replenishment schedule. *You* keep the reaction in its lane.

3. CONTAINMENT BEATS CLEANUP

Let parts drain over the tank; don't fling racks or splash; keep oxidizers away from EN chemistry; protect drains. Most exposures aren't dramatic spills — they're drips, splashes, and dragged-out chemistry from sloppy handling.

4. HYGIENE IS A SAFETY CONTROL, NOT HOUSEKEEPING

No eating, drinking, smoking, or face-touching; wash before breaks; keep work clothes separate. With a **sensitizer** like nickel, hand-to-mouth and skin contact are real exposure routes — your habits protect you for the long term.

5. WHEN IN DOUBT, STOP AND ASK

The unsafe operator isn't the one who asks questions — it's the one who guesses. If the bath looks wrong (color changing, gassing hard, particles forming), a glove looks worn, the ventilation sounds weak, or a reading looks off, *stop and check*.

• THE HAZARD FAMILIES TO INTERNALIZE

HAZARDS, IN ORDER

- **Heat (the headline)** — near-boiling bath, hot cleaner, hot bake oven.
- **Reactive/toxic chemistry** — hypophosphite + oxidizer incompatibility; phosphine risk; nickel as a sensitizer.
- **Corrosives** — caustic cleaner and acid activator burn on contact and damage eyes.

DEFENSES, IN ORDER

- Face shield, apron, gloves, slow movement, burn first-aid, never rush over the tank.
- Keep bath in range and stable, separate from oxidizers, ventilation, PPE, hygiene.
- Goggles, face shield, gloves, apron; 15-minute flush; acid-to-water.



REMEMBER

Heat first, reactive chemistry second, corrosives third. If you can name the hazard family at the tank in front of you — and on this line the first one is almost always *heat* — you already know most of what you need to protect yourself.



REMEMBER

You now have the whole foundation: what plating is, what makes electroless plating different (**no current**), what Low-P EN is and where it's used, the phosphorus family, how the line works as one system, the bath chemistry (complexants, stabilizers, MTO, loading), what to wear, what to do in an emergency, and the safety mindset that ties it together. Every station chapter builds on this. Turn the page knowing the *why* — and especially the *danger* — and the *how* will make a lot more sense.

INSPECTION & RACKING

“THE COATING FOLLOWS THE SURFACE — SO THE SURFACE, AND HOW YOU HOLD IT, DECIDE EVERYTHING.”

★ **REMEMBER — THE PREP PROMISE**

By the time a part reaches the EN tank, most of whether it'll turn out right has already been decided — at *this* station and at cleaning. As the old-timers say: “*The plating bath gets the credit, but the prep does the work.*”

Purpose. Inspect the incoming part, confirm material and spec, and **rack/basket** it so fresh bath reaches *every* surface that must be coated.


The “Why”. Because the EN reaction is autocatalytic and current-free, the coating goes on **every catalytic surface the fresh bath touches** — which is wonderful for uniformity, but it means the rack’s only job is to **position the part for bath access and drainage**, not to carry current. Trapped air in an upward-facing blind hole, or parts nested against each other, can leave **bare or thin spots** even with no current involved. And you must verify the **substrate**: steel activates with an acid dip, but **aluminum and other non-catalytic substrates need special pre-treatment** (zincate — see Station 04), so identifying the material *here* changes the whole prep route.

ELECTROLESS NICKEL



Even thickness on faces, bore & blind hole

ELECTROPLATING

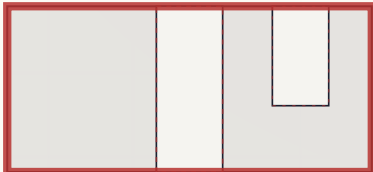

Thick edges, thin/bare in bore & recess

Make-Up & Key Parameters.

ITEM	SPEC / PRACTICE	WHAT TO WATCH
Incoming inspection	Per traveler / customer print	Confirm phosphorus class (Low-P) , thickness, and heat-treat requirement
Material ID	Steel? Aluminum? Other?	Aluminum needs zincate ; non-catalytic substrates need special activation
Heat-treat flag	High-strength steel?	Drives the mandatory H₂-relief bake (Station 08)
Racking/basket	Hold for full bath access & drainage	Avoid trapped air in blind holes; avoid part-to-part nesting
Significant surfaces	Mark surfaces that must hit thickness spec	These drive thickness verification (Station 09)



TECHNICAL STUFF — WHY ORIENTATION STILL MATTERS WITH NO CURRENT

On an electroplating line you orient parts for *current*. On an electroless line you orient them for *fluid* — so hot, fresh, reaction-ready bath can flow over and through every surface, and so hydrogen/gas bubbles formed during plating can escape rather than sit in a recess and block deposition. A bubble parked in a blind hole leaves a void in the coating. Orient to let bath in and gas out.

STEP-BY-STEP PROCEDURE

- 1. **Read the traveler first.** Note phosphorus class (confirm **Low-P**), required thickness, significant surfaces, and any **high-strength / heat-treat** flag.
- 2. **Identify the material.** Steel routes through the normal acid activation. **Aluminum** (or other non-catalytic substrate) routes through **zincate** prep — flag it now.
- 3. **Inspect the part** for damage, deep pits, prior coatings, or contamination that must be addressed first.
- 4. **Rack or basket** for full bath access and free drainage; orient blind holes/recesses so bath can enter and gas can escape.
- 5. **Confirm significant surfaces** are positioned and unobstructed.
- 6. **Send to cleaning promptly.**

DO

- Confirm the phosphorus class on every traveler.
- Catch the high-strength / heat-treat flag now.
- Identify aluminum and route it to zincate.
- Orient blind holes so bath enters and gas escapes.
- Mark and protect significant surfaces.

TOP MISTAKES

- Missing the phosphorus class (running Low-P when High-P was wanted, or vice versa).
- Missing the heat-treat flag → skipping the mandatory H₂-relief bake.
- Not identifying aluminum → steel route won't plate it.
- Trapping air in blind holes / nesting parts → bare or thin spots.
- Ignoring significant surfaces → no plan to verify thickness where it counts.

TEACH-BACK CHECKLIST

- ☐ Explain why the rack carries *no current* and what its real job is (position the part for bath access and drainage).
- ☐ Explain why even a no-current process can leave bare spots (trapped air/gas, nesting).
- ☐ State what the phosphorus class tells you and why you confirm it.
- ☐ State what the high-strength/heat-treat flag triggers downstream (mandatory bake, Station 08).
- ☐ Explain why aluminum needs a different route (non-catalytic; needs zincate).

SIGN-OFF — STATION 01

Trainee: _____ Trainer: _____ Date: _____

"I confirm I read the traveler (phosphorus class, thickness, heat-treat flag), identified the substrate and its correct route, racked for full bath access and drainage, and identified the significant surfaces."



FUN FACT

Because EN follows every contour exactly, a poorly-racked part with a trapped air bubble can come out with a perfect, mirror-even coating everywhere — except one tiny bare crater where the bubble sat. The coating is only as good as the bath's access to the surface. Racking really is part of the recipe.

STATION 02 OF 9

SOAK CLEAN / DEGREASE

“PLATE OVER DIRT AND YOU’VE JUST PLATED DIRT — OR WORSE, POISONED THE BATH.”

Purpose. Get the part **chemically clean** — no oil, grease, fingerprints, or shop soil — so the EN coating initiates and bonds, and so no soil drags forward into the bath.

The “Why”. The autocatalytic reaction needs **clean, bare, catalytic metal** to start on. Oil and soil block initiation → **skip-plating** (bare patches). Worse, dragged-in soil and surfactants can **upset or contaminate the EN bath**. Cleaning here is usually a **hot alkaline soak** (some shops add separate-line electrocleaning). The free, foolproof check is the **water-break test**.



TIP — THE WATER-BREAK TEST (FREE, FAST, NEVER LIES)

Pull a cleaned part and watch the water. A truly clean surface sheets water in **one continuous, unbroken film** (PASS). A dirty surface makes water **bead up** (FAIL — re-clean). Costs nothing; takes two seconds; use it on every part.

FAIL - water beads up	PASS - water sheets evenly
+-----+ o o o X o o +-----+ Oil remains -> RE-CLEAN	+-----+ ##### OK ##### +-----+ Surface clean -> proceed



TECHNICAL STUFF

“Water break” reflects the metal’s *surface energy*. Clean steel has high surface energy so water spreads (low contact angle); even a one-molecule-thick oil film drops the energy so water beads (high contact angle). That’s why it catches contamination far too thin to see — and on an EN line, invisible oil is exactly what causes maddening skip-plating later.

Make-Up & Key Parameters.

PARAMETER	RANGE	WHAT TO WATCH
Type	Alkaline soak (± electroclean on separate line)	Per cleaner TDS
Temperature	~60–80°C (140–175°F)	Per TDS; don’t overheat
Time	3–10 min soak	Heavy oil longer; light oil shorter
Concentration	Per TDS (often 30–75 g/L)	Titrate regularly
pH	Strongly alkaline (~11–13)	Burns on contact
Water-break test	Pass = continuous sheet	The only reliable field test



HEADS-UP — HOT ALKALINE SOLUTION

This tank is **hot AND caustic**. Splashes cause **chemical burns on contact**, and steam/mist irritates airways. Full PPE: splash goggles, face shield (when charging/dumping), chemical gloves, apron, boots. Skin contact → flush 15 min; eyes → eyewash 15 min and get help.

STEP-BY-STEP PROCEDURE

- 1. **Check the tank:** temperature in range, concentration in range (last titration log), surface free of floating oil.
- 2. **Inspect the load** — heavy rust-preventive oil needs the long end of the time range.
- 3. **Immerse fully**, start the timer, confirm agitation.
- 4. **Withdraw slowly**, draining back into the tank.
- 5. **Run the water-break test.** Continuous sheet → next station. Beading → re-clean.
- 6. **Move promptly** so the clean surface doesn't sit and flash-rust.

DO

- Run the water-break test on every part.
- Keep the tank hot enough to cut oil.
- Titrate and keep concentration in range.
- Drain back into the tank to cut drag-out.
- Move clean parts along promptly.

TOP MISTAKES

- Skipping the water-break test because the part "looks fine" (the oil that ruins plating is invisible).
- Running the tank too cold to cut oil.
- Letting concentration drift low (cleaner gets used up).
- Dragging cleaner forward and contaminating downstream chemistry.
- Letting clean parts sit and flash-rust before activation.

TEACH-BACK CHECKLIST

- ☐ State what the cleaner removes and what it does *not* (oil/soil — not oxide; that's activation's job).
- ☐ Correctly perform and read a water-break test.
- ☐ State the temperature range and the caustic-burn hazard.
- ☐ Explain why poor cleaning causes skip-plating *and* can harm the bath.
- ☐ Name three pieces of required PPE.

SIGN-OFF — STATION 02

Trainee: _____ Trainer: _____ Date: _____

"I confirm the part passed the water-break test (continuous sheet), the cleaner was in range and at temperature, and I wore required PPE."



REMEMBER

On an EN line the cleaner does double duty: it makes the part *platable* (clean metal initiates the reaction) and it protects the *bath* (no dragged-in oil or surfactant to upset the chemistry). A failed water-break test isn't just a cosmetic risk — it's a bath-health risk.

STATION 03 OF 9

RINSE (THE FIREWALL)

“A RINSE ISN’T A REST STOP. IT’S A CHECKPOINT.”

Purpose. Wash the **alkaline cleaner film** off the part before it reaches the acidic activation.

The “Why”. The cleaner is alkaline; the activator is acidic. Carry alkaline drag-out forward and it neutralizes and weakens the acid, wastes it, and degrades activation — showing up later as **poor initiation / skip-plating**. The rinse knocks that drag-out down by dilution. We measure rinse cleanliness with **conductivity (µS/cm)** — *lower = cleaner*.



TIP — COUNTER-FLOW RINSING

The professional approach is a **counter-current** rinse: parts move forward, water flows backward. Fresh water enters the *last* (cleanest) tank and overflows into the dirtier one, so the cleanest water touches the part last. It saves enormous water.

Make-Up & Key Parameters.

PARAMETER	RANGE	NOTES
Temperature	Ambient	No heating needed
Time	30–60 s with agitation	Longer for bores/blind holes
Water source	Municipal or DI	DI preferred
Conductivity	< 500 µS/cm (target < 300)	Monitor at shift start
Flow	Continuous overflow / counter-current	Prevents stagnation



HEADS-UP

The rinse carries dragged-in caustic and starts mildly alkaline. Wear goggles, gloves, non-slip footwear. **Wet floors and slips are the #1 everyday injury at rinses.**

STEP-BY-STEP PROCEDURE

1. Check conductivity at shift start; if near/above limit, tell your lead.
2. Confirm water is flowing.
3. Transfer the rack promptly from the cleaner (dried cleaner is harder to rinse).
4. Immerse fully with agitation, 30–60 s; longer for bores.
5. Lift and drain over the rinse tank.
6. Move promptly to activation so the part doesn’t flash-rust.

TOP MISTAKES

- Treating the rinse as a “quick dunk.”
- Ignoring the conductivity reading.
- Letting parts drip-dry between cleaner and rinse.
- Not flushing bores/blind holes.
- Skipping the drain step.

TEACH-BACK — CAN YOU ANSWER?

- Why carrying cleaner into the acid stage causes problems?
- Define drag-out / drag-in.
- What conductivity tells you and which way is “clean”?
- State the conductivity limit and target.

SIGN-OFF — STATION 03

Trainee: _____ Trainer: _____ Conductivity: _____ µS/cm

“I confirm the rinse conductivity was within limit, water flow was running, and parts were rinsed the full time with PPE worn.”

STATION 04 OF 9

ACID ACTIVATION / ETCH

“NO ACTIVATION, NO INITIATION.” — WAKE THE SURFACE UP SO THE BATH CAN START ON IT

Purpose. Remove the invisible oxide film and present a **fresh, catalytic surface** so autocatalytic deposition initiates evenly the instant the part hits the EN bath.

The “Why”. Even spotlessly clean steel grows an oxide film in minutes, and the EN reaction won’t initiate on oxide. For **steel**, activation is usually a **sulfuric (or hydrochloric) acid dip** — a short immersion that strips the oxide and “wakes up” the catalytic steel surface. This is *not* an electro-etch (there’s no current on this line); it’s a **chemical acid activation**.



REMEMBER

No activation, no initiation — and on an electroless line a poorly activated part gives skip-plating (bare patches) or no deposit at all. Activation has to come immediately before the bath, and the part must move from activation → guard rinse → bath without sitting.

A WORD ON ALUMINUM AND OTHER NON-CATALYTIC SUBSTRATES

Steel is naturally catalytic, so an acid dip is enough. But **aluminum is not catalytic** and it instantly grows a tough oxide that nothing plates onto. Aluminum is given a **zincate** treatment first — an immersion that lays down a thin, uniform layer of zinc that *is* platable — sometimes double-zincated for best adhesion, and sometimes followed by a thin nickel **strike** to give the EN bath a catalytic surface to start on. Other non-catalytic substrates (some plastics, certain alloys) may need a **palladium (Pd) activation/strike** to seed catalytic sites. You don’t run these from memory — you follow the routing the traveler and your supervisor set.



TECHNICAL STUFF — WHY ALUMINUM NEEDS ZINCATE

Aluminum’s surface oxide reforms in seconds and isn’t catalytic, so EN simply won’t start on bare aluminum. The **zincate** swaps that oxide for a thin, even zinc film that *is* catalytic/platable; the EN deposit then initiates on the zinc and the autocatalytic process takes over. It’s a clever workaround: you can’t plate the aluminum directly, so you give the bath a platable surface to grab onto. (Palladium activation does a similar job by seeding catalytic Pd sites on non-metallic or stubborn substrates.)



HEADS-UP

The activator is a **strong acid** — burns on contact and gives off fumes. Goggles, face shield, gloves, apron; ventilation. **Acid-to-water** when making up. If running an **aluminum zincate**, that chemistry is strongly **caustic** — different PPE emphasis, same care.

Make-Up & Key Parameters (steel).

PARAMETER	RANGE / PRACTICE	NOTES
Type	Acid dip (e.g., sulfuric or HCl)	Per process spec; no current
Concentration	Per TDS (dilute mineral acid)	Don't over-concentrate
Temperature	Ambient-warm	Per spec
Time	Short – seconds to a couple minutes	Over-etch roughens; under-etch leaves oxide
Aluminum route	Zincate (± nickel strike)	Different chemistry; follow routing
Other non-catalytic	Pd activation/strike	Seeds catalytic sites

STEP-BY-STEP PROCEDURE (STEEL)

1. Confirm the part's route (steel acid dip vs. aluminum zincate).
2. Verify acid concentration/temperature in range and ventilation on.
3. Immerse the part for the **short** specified time — *don't over-etch*.
4. Withdraw and drain over the tank.
5. Move **straight to the guard rinse and then the bath** — don't let the activated surface sit and re-oxidize.

TOP MISTAKES

- Over-etching (roughens/pits the surface).
- Under-etching (oxide remains → skip-plate / no initiation).
- Letting an activated part sit and re-oxidize before plating.
- Sending **aluminum** down the steel acid route (won't plate — needs zincate).
- Skipping ventilation/PPE around acid fumes (or caustic zincate).

TEACH-BACK CHECKLIST

- Explain what activation removes and why (oxide → fresh catalytic surface for initiation).
- Explain why there's **no current** here (chemical acid dip).
- Explain what skip-plating is and how poor activation causes it.
- State why aluminum needs zincate (non-catalytic; oxide reforms instantly).
- State the acid hazard and PPE.

SIGN-OFF — STATION 04

Trainee: _____ Trainer: _____ Time: _____ s · Route: Steel / Al-zincate

"I confirm I activated the part by the correct route for its substrate, for the specified short time, with proper PPE, and moved it straight toward the bath without letting it re-oxidize."

STATION 05 OF 9

RINSE (THE GUARD RINSE)

“THE LAST THING STANDING BETWEEN DRAGGED-IN ACID AND A DELICATE, EXPENSIVE BATH.”

Purpose. Wash the **activation acid** (or zincate) off the part before it enters the EN bath.

The “Why”. This rinse is the **bath’s bodyguard**. A part carrying activator acid drags that acid straight into the EN bath, **dropping its pH** and introducing contamination — both of which destabilize a finely balanced bath and can seed **decomposition**. Because the EN bath is expensive and temperamental, this guard rinse matters more than an ordinary rinse.

★

REMEMBER

The guard rinse protects the bath, not just the part. Dragged-in acid lowers bath pH and can destabilize it; dragged-in foreign metals or contamination can poison it. A few seconds of thorough rinsing here protects hours of bath life and a tank of costly chemistry.

Make-Up & Key Parameters.

PARAMETER	RANGE	NOTES
Temperature	Ambient (some shops warm)	A warm final rinse can ease entry into the hot bath
Time	30-60 s with agitation	Longer for bores/blind holes
Water	DI preferred	Keeps foreign ions out of the bath
Conductivity	Low / per spec	Lower = cleaner = safer for the bath
Flow	Counter-current / overflow	Prevents acid build-up

⚠

HEADS-UP

Don’t let an activated, rinsed part sit before the bath — it re-oxidizes and skip-plates. And remember the next tank is **near boiling**: as you move from this rinse to the EN bath, slow down and control the load over the hot tank.

STEP-BY-STEP PROCEDURE

1. Confirm water flow and (if used) warm-rinse temperature.
2. Immerse fully with agitation, flushing bores/recesses.
3. Drain over the rinse tank.
4. Move **immediately and deliberately** into the EN bath.

TOP MISTAKES

- Rushing the rinse and dragging acid into the bath.
- Using hard/contaminated water that adds foreign ions.
- Letting the part sit and re-oxidize.
- Skipping bore flushing.
- Splashing the hot bath on entry.

TEACH-BACK

- Why this rinse protects the *bath*.
- What dragged-in acid does to bath pH.
- Why DI water is preferred here.
- Why the part must go straight into the bath.

SIGN-OFF — STATION 05

Trainee: _____ Trainer: _____ Date: _____

“I confirm I thoroughly rinsed the activated part with clean water, protected the bath from dragged-in acid, and entered the hot bath deliberately and safely.”

— STATION 06 OF 9 • THE MAIN EVENT

ELECTROLESS NICKEL PLATE (LOW-P)

WHERE CHEMISTRY ALONE GROWS A HARD, UNIFORM NI-P ALLOY — AND WHERE THE BATH CAN RUN AWAY IF YOU LET IT

Take a breath. Up to now, every station has had one job: get the part clean, activated, and protected. **Station 06 is where the low-phosphorus electroless nickel is actually created** — and it's the tank that defines this whole line, for performance *and* for its peculiar dangers.

The big idea in one sentence: **we use heat and chemistry — no electricity at all — to grow a hard, uniform nickel-phosphorus alloy, atom by atom, on every surface of the part at once.** The cast:

- **The part** — the catalytic surface the reaction grows on. No wiring, no polarity — it just sits in the bath.
- **The reducing agent** — **sodium hypophosphite**, the chemical “engine” that supplies electrons and the phosphorus.
- **The bath** — nickel salt + hypophosphite + complexants + trace stabilizer, held **near boiling (~85–95 °C)** at a controlled **pH (~4.4–5.2)**.

★

REMEMBER

Unlike an electroplating tank, **there is no rectifier, no anode, and no current here.** The bath plates on its own, autocatalytically, as long as you keep the **temperature, chemistry, and stabilizer** in range. Forget that and the whole tank behaves like a mystery.

⚠

HEADS-UP — THIS IS THE MOST DEMANDING TANK ON THE LINE, IN TWO WAYS

(1) **It's near boiling (~85–95 °C)** — splashes and steam cause **scald burns**; move slowly and wear face shield + apron. (2) **The chemistry can decompose** — if it overheats, gets contaminated, or the stabilizer is off, the bath can start **plating itself and the tank**, gas hard, and pose a **phosphine** hazard. If the bath darkens, fizzes/gasses unusually, or you see a metallic film forming on the tank, **treat it as decomposition** — **get to fresh air, alert others, and follow your shop's emergency procedure.**

WHY LOW-P EN (AND WHY IT'S DEMANDING)

ADVANTAGE	WHAT IT MEANS ON THE FLOOR
High hardness (~700 HV as-plated; ~900–1000+ HV after bake)	Survives heavy wear and abrasion
Superb thickness uniformity	Coats bores, blind holes, complex shapes evenly — no current map
Good alkaline/caustic resistance	Holds up in alkaline service
Solderability / precision	Useful in electronics and tight-tolerance work

...but the same chemistry brings demands: **near-boiling temperature control, constant replenishment** (nickel + hypophosphite + pH), **trace stabilizer on a knife-edge, filtration/agitation** to prevent particle-seeded plate-out, **loading discipline, MTO tracking**, and the ever-present risk of decomposition.

THE BATH MAKE-UP — KNOW THE RANGES

COMPONENT / PARAMETER	TYPICAL RANGE (LOW-P)	WHAT IT DOES
Nickel (as metal)	~6 g/L (NiSO ₄ ~5–7 g/L as Ni)	The metal being deposited
Nickel sulfate (salt)	~25–35 g/L	Source of the nickel ions
Sodium hypophosphite	~20–35 g/L	Reducing agent (engine) + phosphorus source
Complexants / organic acids	Per formulation	Hold nickel in solution; buffer pH
Stabilizers	Trace (ppm)	Keep the reaction <i>on the part only</i>
pH	~4.4–5.2 (acidic)	Up with ammonia/caustic; down with acid
Temperature	~85–95°C (185–203°F)	Drives the reaction; too cool = no plate, too hot = run-away
Deposition rate	~12–25 µm/hr	How fast the coating builds
Phosphorus in deposit	~2–5% P	Defines it as Low-P
As-deposited hardness	~700 HV	The functional payoff
Bath life	~6–10 MTO	When to dump and remake
Filtration / agitation	Continuous, per spec	Removes particles that seed plate-out
Loading	Per supplier (ft ² /gal or dm ² /L)	Keeps chemistry stable



TECHNICAL STUFF — TEMPERATURE AND PH WORK AS A PAIR

In an EN bath, **temperature** is the throttle (more heat = faster plating, up to a point) and **pH** strongly affects both **rate and phosphorus content**. Run too cool and the bath barely plates; too hot and you risk run-away decomposition and phosphine. Drift pH out of the ~4.4–5.2 window and you change the deposit's phosphorus (and thus its hardness/corrosion behavior) and the plating rate. Your process spec defines the window — stay in it, and let the lab confirm with titration.



REMEMBER — THE NUMBERS TO CARRY

Ni ~6 g/L, hypophosphite ~20–35 g/L, pH ~4.4–5.2, temp ~85–95 °C, rate ~12–25 µm/hr, ~2–5% P, ~700 HV as-plated, bath life ~6–10 MTO, trace stabilizer (ppm), no current. These let you sanity-check almost anything about this tank.

REPLENISHMENT — FEEDING THE BATH AS IT WORKS

Because there are no anodes feeding metal, **you** feed the bath as it plates. As the reaction consumes nickel and hypophosphite and drives pH down, you (or an automatic feeder) replenish:

- **Nickel** — back to the target metal concentration.
- **Hypophosphite** — to keep the engine running.
- **pH** — raised with **ammonia or caustic** as it drifts down (and lowered with acid if it climbs).

Replenishment is dosed to **tested values from the lab**, often as matched “Part A / Part B” replenisher additions per the supplier, and tracked against **MTO**.



HEADS-UP — NEVER GUESS A STABILIZER OR REPLENISHER ADDITION

Replenishment and especially **stabilizer** dosing are made to **tested targets**, not by eye. A stabilizer overdose can stop the bath plating; an underdose can let it decompose. If you're unsure how much to add, **stop and ask the lab**. Guessing at the EN bath is how good baths die.



TIP

Make **small, frequent** replenishments to keep the chemistry steady, rather than big swings. A bath held tightly in range plates a consistent, uniform deposit; a bath that lurches between depleted and over-fed gives variable thickness and phosphorus.


FILTRATION, AGITATION & AVOIDING PLATE-OUT

Continuous **filtration** removes tiny particles (dust, debris) that would otherwise become catalytic seeds for **plate-out** (nickel depositing where it shouldn't — on the tank, the heaters, particles). **Agitation** (and part movement) keeps fresh bath at the surface and helps gas bubbles escape so the coating stays even and bores plate fully. Heaters and tank walls are watched and periodically passivated/cleaned because a roughened or nickel-coated surface can seed decomposition.



TECHNICAL STUFF — WHY THE BATH CAN “PLATE ITSELF”

Remember from Chapter 2: the reaction proceeds on *any* catalytic surface. A particle in suspension, a roughened heater coil, or a bit of stray nickel on the tank wall can all become catalytic seeds. Once nickel starts depositing *there*, that nickel is itself catalytic, so it spreads — and the reaction can cascade until the whole bath “lights off,” gassing violently and plating the tank. Filtration (remove the seeds), stabilizer (suppress stray reaction), and temperature control (don't overheat) are the three things keeping that from happening.

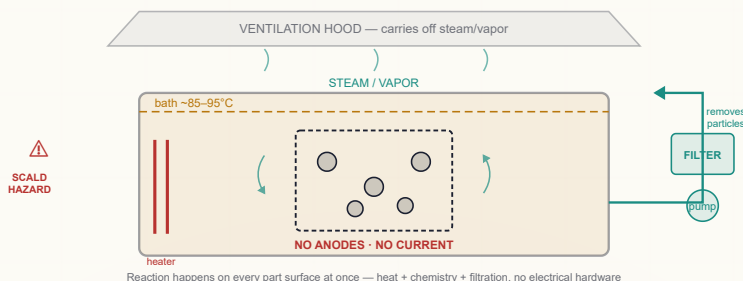

STEP-BY-STEP PROCEDURE

1. **Confirm the bath is in range** before loading: temperature (~85–95 °C), pH (~4.4–5.2), last titration values for nickel and hypophosphite, MTO status, filtration/agitation running, ventilation on.
2. **Check loading** — confirm the surface area you're about to add fits the recommended ft²/gal (dm²/L) window.
3. **Enter the part deliberately** (it's hot — slow movement, face shield, apron). Confirm bath reaches all surfaces; no trapped air in blind holes.
4. **Plate for the calculated time** based on the deposition rate (~12–25 µm/hr) and the required thickness. (Thickness here = rate × time, since there's no current to vary.)
5. **Maintain the bath during the run** — temperature steady, replenish nickel/hypophosphite/pH per schedule, watch for any sign of instability.
6. **Watch for decomposition warning signs** the whole run (see Heads-Up below).
7. **Withdraw the part slowly**, draining over the tank, and move to the rinse.
8. **Log** the run against MTO.



HEADS-UP — DECOMPOSITION WARNING SIGNS (MEMORIZE THESE)

Stop and get help / follow emergency procedure if you see: **unusual or violent gassing**, the bath **darkening or going cloudy**, **fine particles forming**, a **metallic film growing on the tank/heaters**, a sudden **rise in temperature**, or an **acid/garlic-fishy odor** (possible phosphine — but never rely on smell). A decomposing EN bath is both a **bath-loss** event and a **gas/heat safety** event. Do not lean over it.

TOP MISTAKES

- Letting temperature drift high — risks run-away decomposition and phosphine.
- Guessing at stabilizer/replenisher — kills or destabilizes the bath.
- Letting pH drift out of ~4.4–5.2 — changes phosphorus, rate, and stability.
- Overloading the bath — fast depletion, thin/uneven deposit.
- Skipping filtration — particles seed plate-out.
- Rushing over the hot tank — the #1 cause of scald burns.
- Ignoring early decomposition signs — a small instability becomes a lost tank.

TEACH-BACK CHECKLIST

- Explain how the deposit forms with **no current** (autocatalytic; hypophosphite).
- State the bath's key numbers (Ni, hypophosphite, pH, temp, rate, %P, HV, MTO).
- Explain how you control **thickness** here (rate × time).
- Explain what **MTO** measures and roughly when a bath is spent.
- Explain why **stabilizer** is a knife-edge and why you never guess.
- Name the **decomposition warning signs** and the correct response.
- State the two main hazards (near-boiling scald + decomposition/phosphine).

SIGN-OFF — STATION 06

Trainee: _____ Trainer: _____ Bath temp: _____ °C · pH: _____ · MTO: _____

"I confirm I verified the bath was in range (temp, pH, chemistry, loading, filtration, ventilation), plated for the correct time for target thickness, maintained the bath safely, knew and watched for decomposition signs, and handled the near-boiling bath deliberately with full PPE."

STATION 07 OF 9

POST-PLATE RINSE

“STOP THE CHEMISTRY FROM LEAVING THE TANK — RECOVER THE NICKEL, PROTECT THE DRAIN.”

Purpose. Wash the EN bath chemistry off the freshly plated part.

The “Why”. A part leaving the hot bath carries **nickel- and phosphite-bearing drag-out**. Rinsing stops that chemistry from spreading, **recovers nickel** (often via a still/recovery rinse that can go back toward the bath or to treatment), and **protects the drain** — EN chemistry must never go down a floor drain untreated. The part is also still hot, so this rinse begins cooling it.

★

REMEMBER

After the EN bath, the first rinse is **nickel recovery + environmental containment** before it's anything else. Every drop of dragged-out bath you capture here is nickel you don't pay to treat as waste — and chemistry that doesn't reach the sewer.

Make-Up & Key Parameters.

PARAMETER	RANGE	NOTES
Temperature	Ambient (part arrives hot)	Begins cooling the part
Time	30-60 s with agitation	Longer for bores
Type	Recovery/still rinse + flowing rinse	Recovery rinse captures nickel
Flow	Counter-current	Saves water; concentrates recovery
Drain protection	Always	EN water → treatment, never to drain

⚠

HEADS-UP

The part is **hot** coming out of the bath — handle deliberately to avoid burns and splashing hot, nickel-bearing water. Wear gloves/face shield. **Never let nickel/phosphite rinse water reach a floor drain** — route it to treatment.

STEP-BY-STEP, TOP MISTAKES & TEACH-BACK

Step-by-Step: Drain the part over the bath first (recover drag-out) · Immerse in recovery/still rinse · Then flowing rinse, agitating · Drain · Move to bake (if required) or dry.

TOP MISTAKES

- Skipping the recovery rinse (wastes nickel, loads the waste system).
- Letting hot drag-out splash.
- Sending EN water to a drain.
- Not flushing bores.

TEACH-BACK

- Why this rinse is recovery + containment.
- Where EN rinse water must (and must not) go.
- Why drag-out recovery saves money.

SIGN-OFF — STATION 07

Trainee: _____ Trainer: _____ Date: _____

"I confirm I recovered drag-out, rinsed the part thoroughly, routed all EN-bearing water to treatment (never a drain), and handled the hot part safely."

STATION 08 OF 9

POST-BAKE (OPTIONAL BUT OFTEN CRITICAL)

“ONE OVEN, TWO COMPLETELY DIFFERENT JOBS — KNOW WHICH ONE YOU’RE DOING.”

Purpose. Heat-treat the plated part for **one (or both)** of two distinct reasons: to **develop maximum hardness**, and/or to **relieve hydrogen embrittlement** in high-strength steel. **These are different bakes at different temperatures — don’t confuse them.**

THE “WHY” — TWO DIFFERENT BAKES

1. Hardness-development bake (high temperature). As-plated Low-P EN is already hard (~700 HV). Baking at **~400 °C (~750 °F)** for about **1 hour** transforms the Ni-P structure (precipitation of nickel phosphides) and drives hardness up to **~900–1000+ HV** — into hard-chrome territory. This is done when the customer wants maximum wear performance.

2. Hydrogen-embrittlement relief bake (lower temperature). During acid activation and (to a lesser degree) plating, some atomic hydrogen can enter the steel. On **high-strength/hardened steel** this causes **hydrogen embrittlement** — the part becomes brittle and can **crack and fail suddenly under load, hours or days later**. The fix is a **lower-temperature relief bake, typically ~190–220 °C (~375–425 °F) for several hours (often ≥ 4–8 hr)**, started **promptly after plating**, per the customer spec / ASTM guidance.



REMEMBER

Two bakes, two purposes, two temperatures: **~400 °C / ~1 hr** to *develop hardness*; **~190–220 °C / several hours** to *relieve hydrogen embrittlement* on high-strength steel. Read the traveler to know which (or both) the part needs. Confusing them is a real quality/safety error.



HEADS-UP — EMBRITTLEMENT IS A HIDDEN, DELAYED FAILURE

A hydrogen-embrittled high-strength part looks perfect, passes inspection, then **fails in service**. That’s exactly why the relief bake is **mandatory and not skippable** on flagged high-strength steel (Station 01 hardness flag), and why it must start **promptly** after plating — wait too long and the part can crack *before* baking. Never skip it on a flagged part.



TECHNICAL STUFF — WHY HEAT HARDENS EN

As-deposited Low-P Ni-P is a supersaturated solid solution. Heating to ~400 °C lets nickel phosphide (Ni₃P) precipitate out as fine, hard particles dispersed through the nickel — classic **precipitation hardening** — which is what pushes hardness from ~700 HV toward ~1000+ HV. The *relief* bake at ~190–220 °C is too cool to do much of this; its only job is to give absorbed hydrogen energy to **diffuse back out** of the steel before it can do harm. Same oven, two very different metallurgical purposes.



TIP

When a part needs **both** maximum hardness **and** embrittlement relief, your shop's spec/traveler dictates the schedule (the higher-temperature hardness bake will also relieve hydrogen, but timing and temperature must follow the spec — don't improvise). Follow the routing; don't average two recipes into one.

Make-Up & Key Parameters.

BAKE PURPOSE	TYPICAL TEMPERATURE	TYPICAL TIME	WHEN
Hardness development	~400°C (~750°F)	~1 hr	Max wear/hardness required
H ₂ -embrittlement relief	~190–220°C (~375–425°F)	Several hr (often ≥ 4–8)	High-strength steel; promptly after plating



HEADS-UP — HOT OVEN

The bake oven runs **very hot (up to ~400 °C)** — severe thermal-burn hazard. Use proper gloves/tools, watch for hot surfaces and hot air, and follow oven safety procedures. Don't reach into a hot oven barehanded for "just a second."

STEP-BY-STEP PROCEDURE

1. **Read the traveler** — confirm which bake(s) the part needs and the exact temperature/time.
2. **Confirm timing** — if it's a relief bake on flagged high-strength steel, it must start **promptly** after plating.
3. **Set the oven** to the specified temperature; verify it's stable.
4. **Load** parts so air circulates evenly.
5. **Bake** for the full specified time — don't short it.
6. **Cool, unload, log** the heat-treat record (traceability matters for spec parts).

TOP MISTAKES

- Confusing the two bakes (relief temp vs. hardness temp).
- Skipping the relief bake on flagged high-strength steel.
- Delaying the relief bake too long after plating.
- Shorting the time or running the wrong temperature.
- No heat-treat record (loss of traceability on spec parts).

TEACH-BACK CHECKLIST

- State the two purposes of baking and their **different temperatures/times**.
- Explain why hardness rises with the ~400 °C bake (precipitation hardening).
- Explain hydrogen embrittlement and why the relief bake is mandatory and prompt.
- State the hot-oven burn hazard and controls.

SIGN-OFF — STATION 08

Trainee: _____ Trainer: _____ Bake: ☐ Hardness (~400°C/1 hr) ☐ H₂ relief (~190–220°C/_____ hr)

"I confirm I identified the required bake(s) from the traveler, used the correct temperature and time, started any relief bake promptly, logged the heat-treat record, and handled the hot oven safely."

STATION 09 OF 9

DRY / FINAL INSPECTION

“SEND IT OUT RIGHT — DRIED, MEASURED, AND PROVEN TO SPEC.”

Purpose. Dry the finished part and **verify** it meets spec — thickness, adhesion, appearance, and (per spec) corrosion/porosity — before it ships.

The “Why”. An EN-plated part is often a precision, high-value item; the customer is paying for the right **thickness everywhere**, good adhesion, and the right phosphorus class. Final inspection is where you *prove* that, and catch anything needing rework before it leaves.

Make-Up & Key Quality Checks.

CHECK	METHOD (TYPICAL)	LOOKING FOR
Thickness	XRF or coulometric; cross-section for arbitration	Meets print on significant surfaces; even all over
Backside / bore thickness	XRF on hidden/internal surfaces where accessible	Confirms the uniformity claim
Adhesion	Bend / thermal-shock test on a sample	No flaking/blistering/peeling
Hardness (if specified)	Microhardness (Vickers) on coupon/cross-section	~700 HV as-plated; ~900–1000+ HV after bake
Appearance	Visual	Uniform semi-bright; no roughness/pitting/skip
Corrosion / porosity (per spec)	Salt spray / ferroxyl or other per spec	Meets the corrosion/porosity requirement

★

REMEMBER

A signature EN check is **thickness on hidden/internal surfaces (bores, backsides)**. The whole point of electroless nickel is that those surfaces are coated as evenly as the outside — so confirming it (XRF where accessible) is how you *prove* the uniformity advantage you sold the customer.

⚙️

TECHNICAL STUFF — XRF VS. COULOMETRIC

XRF measures coating thickness non-destructively by reading X-ray signals — fast, no damage, great for production and for checking many spots. **Coulometric** measures thickness by anodically stripping a tiny defined area and measuring the charge — accurate but it removes a small spot. Many shops use XRF for routine checks and coulometric or cross-section for arbitration/audit.

⚠️

HEADS-UP

Even at “the end,” parts may carry residual chemistry and the dryer is hot — wear PPE, watch for hot-air/surface burns, and keep handling clean (a finished EN part shouldn’t be re-contaminated or fingerprinted).

Step-by-Step & Teach-Back: Dry the part gently and completely (especially bores/recesses) · Verify thickness on significant surfaces, including hidden/internal where required · Check adhesion/appearance (and hardness/corrosion per spec) · Accept & ship or route to rework · Log results. *Top Mistakes:* shipping without verifying thickness on the significant (or internal) surface; missing roughness/pitting/skip-plate; re-contaminating a finished part; not logging results; confusing the phosphorus class on the cert.

SIGN-OFF — STATION 09

Trainee: _____ Trainer: _____ Date: _____

“I confirm I dried the part, verified thickness (including internal/significant surfaces) and the required quality checks per the inspection plan, logged results, and routed any out-of-spec parts to rework.”

PART THREE — ACROSS THE LINE
THE CORE OPERATOR SKILL

BATH CHEMISTRY CONTROL

“THERE’S NO RECTIFIER KNOB — THE BATH CHEMISTRY IS THE CONTROL PANEL.”

On an electroplating line, the operator’s core skill is current control. On an electroless line, it’s **bath chemistry control**. Five things, tracked over the bath’s life in **MTO**.

1. TEMPERATURE (~85–95 °C)

The throttle. Hold it steady — too cool and plating crawls; too hot and you risk **decomposition** and **phosphine**. Verify the heater and controller; never let a stuck heater cook the bath.

2. NICKEL & HYPOPHOSPHITE (REPLENISHMENT)

Both are consumed as you plate. Replenish to **tested lab values** (often matched A/B replenishers), in **small frequent doses** for stability. There are no anodes to feed metal — *you* are the metal supply.

3. PH (~4.4–5.2)

Drifts **down** as the bath works (the reaction produces acid). Raise it with **ammonia or caustic**; lower it with **acid** if it climbs. pH affects **plating rate AND phosphorus content** — let it drift and you change the deposit itself.

4. STABILIZER (TRACE, PPM)

The knife-edge. **Too little** → **plate-out/decomposition**; **too much** → **slow/skip/no plating**. Dosed by the lab to a tested target. **Never guess**.

5. LOADING (FT²/GAL OR DM²/L)

Keep the surface area per volume in the supplier’s window so depletion and stability stay predictable.



REMEMBER — MTO IS THE BATH’S ODOMETER

1 MTO = one full turnover of the bath’s original nickel content (plated out and replenished). Low-P bath life ≈ **6–10 MTO**. Past that, accumulated **phosphite** byproduct degrades the deposit no matter how well you feed it — the bath is dumped (to treatment) and remade. Track MTO every run.



TECHNICAL STUFF — WHY YOU CAN’T REPLENISH FOREVER

Each nickel reduction produces **orthophosphite**, which steadily accumulates. High phosphite raises bath density, can cause **roughness** and rate loss, and eventually makes a quality deposit impossible. Replenishment restores nickel/hypophosphite/pH but **cannot remove phosphite** — that’s why every EN bath has a finite life measured in MTO, not in time alone.

• THE CONTROL PANEL AT A GLANCE

WHAT YOU CONTROL	TYPICAL TARGET	DRIFTS / FAILS BY...	YOU CORRECT IT WITH...
Temperature	~85–95°C	Stuck/failed heater; lost control	Heater/controller check; hold steady
Nickel	~6 g/L (as Ni)	Consumed by plating	Replenish to lab value
Hypophosphite	~20–35 g/L	Consumed by plating	Replenish to lab value
pH	~4.4–5.2	Drifts down in use	Ammonia/caustic up; acid down
Stabilizer	Trace (ppm)	Knife-edge both ways	Lab dosing only — never guess
Loading	Supplier window	Under/over-loaded	Plan loads to fit ft ² /gal



TIP

Keep a tight log: temperature, pH, nickel & hypophosphite titrations, stabilizer additions, loading, and MTO each run. A bath held tightly in range gives consistent thickness and phosphorus; a bath managed by guesswork drifts, decomposes, or dies early. The log is how you “see” a process you can’t watch happen.



HEADS-UP

Every chemistry adjustment is also a **chemical-handling** task: ammonia (fumes/caustic), caustic, acids, and concentrated nickel/hypophosphite solutions — all near a **hot tank**. PPE, ventilation, acid-to-water, and slow movement apply to every addition.



REMEMBER

An electroplater watches *amp-hours* to know part thickness. An electroless operator watches *chemistry titrations and MTO* to know bath health. Different instruments, same goal: keep the process inside its window so the deposit comes out right every time.



FUN FACT

Modern EN lines often run automatic dosing pumps tied to live analyzers — the system titrates the bath and feeds nickel, hypophosphite, and pH adjuster on its own. But the operator still owns the result: the pumps only do what they’re set to do, and a clogged feed line or a bad sensor will quietly walk a bath out of range. The control panel got smarter; it didn’t get unattended.

THE FAILURE MODE THAT DEFINES THIS LINE

BATH DECOMPOSITION

WHEN THE BATH STARTS PLATING ITSELF — RECOGNIZE IT EARLY, RESPOND SAFELY

What it is. Decomposition is when the autocatalytic reaction starts happening **where it shouldn't** — on particles, tank walls, heaters — and **cascades** until the bath “lights off,” plating the tank, gassing hard, and degrading. It's the EN line's signature failure: a **bath-loss** event *and* a **safety** event (heat + possible phosphine).

COMMON CAUSES

- Overheating (stuck heater, lost temperature control).
- Stabilizer too low (reaction not suppressed off-part).
- Contamination dragged in (foreign metals, particles, organics).
- Local hot spots / roughened catalytic surfaces (uncleaned heater, scale).
- Particulate not removed by filtration (each particle a catalytic seed).

PREVENT IT WITH

- Steady temperature (good heater/controller).
- Correct stabilizer (lab-dosed).
- Clean, filtered, uncontaminated bath.
- Sensible loading.
- Disciplined replenishment.

WARNING SIGNS (CATCH IT EARLY)

SIGN	WHAT IT SUGGESTS
Unusual / violent gassing	Reaction accelerating off-part
Bath darkening or cloudiness	Fine nickel particles forming
Metallic film on tank/heaters	Plate-out underway
Sudden temperature rise	Run-away reaction (exothermic)
Acrid / garlic-fishy odor	Possible phosphine (never rely on smell)



HEADS-UP — A DECOMPOSING BATH IS A SAFETY EMERGENCY, NOT JUST A QUALITY PROBLEM

If you see decomposition signs: **do not lean over the tank**. Treat it as a **heat + toxic/flammable gas (phosphine)** hazard — get to fresh air, alert others, increase ventilation, and follow your shop's emergency procedure. Saving the bath is *secondary* to keeping people safe.

Recovery (only per your shop's written procedure and lab direction). Once safe, recovery may involve **cooling the bath**, **transferring (decanting) it off the plated-out tank** into a clean tank, **cleaning/passivating** the contaminated tank (often with dilute nitric acid to strip the plate-out — *kept rigorously away from hypophosphite*), **filtering**, and **lab re-balancing** of chemistry/stabilizer. Badly decomposed baths are dumped to treatment and remade.



HEADS-UP — NITRIC ACID (TANK CLEANING) + HYPOPHOSPHITE MUST NEVER MEET

Nitric acid is a strong **oxidizer**; hypophosphite is a strong **reducing agent**. Tank-cleaning nitric and EN chemistry must be kept strictly separate — mixing them risks a violent reaction. Only trained personnel do tank decontamination, following the written procedure.



REMEMBER

Prevent decomposition with the same five things that control the bath: steady temperature, correct stabilizer, clean (filtered, uncontaminated) bath, sensible loading, and disciplined replenishment. An EN bath rarely “just” decomposes — it's almost always heat, contamination, or stabilizer that let it.

DEEP DIVE

HEAT TREATMENT & EMBRITTLEMENT RELIEF

TWO BAKES, TWO PURPOSES — THE FULL PICTURE

This expands Station 08; the operator routing lives there, the “why” lives here.

HARDNESS DEVELOPMENT

As-plated Low-P EN is ~700 HV. A ~400 °C / ~1 hr bake precipitates hard **nickel phosphide (Ni₃P)** through the nickel matrix (precipitation hardening), driving hardness to ~900–1000+ HV — comparable to hard chrome, which is a major selling point for wear applications.

HYDROGEN-EMBRITTLEMENT RELIEF

Hydrogen absorbed by **high-strength steel** during acid/plating steps can cause **delayed brittle failure**. A ~190–220 °C / **several-hour** bake (per customer spec / ASTM guidance), started **promptly** after plating, lets that hydrogen diffuse back out before it cracks the part.

CONCEPT	HARDNESS BAKE	RELIEF BAKE
Goal	Maximize hardness	Prevent brittle cracking
Temp	~400°C	~190–220°C
Time	~1 hr	Several hr (often ≥ 4–8)
Metallurgy	Ni ₃ P precipitation	Hydrogen diffuses out
Trigger	Wear/hardness spec	High-strength-steel flag

★

REMEMBER
Hot bake (~400 °C) = harder. Warm bake (~190–220 °C, prompt) = safer (no embrittlement). Different jobs, different temperatures. The traveler tells you which (or both).

⚠

HEADS-UP
On flagged high-strength steel, the relief bake is **mandatory, prompt, and not skippable** — embrittlement is a hidden, delayed, potentially catastrophic failure.

💡

FUN FACT
Heat-treated Low-P EN can rival **hard chrome** for hardness — which is part of why electroless nickel is sometimes chosen as a chrome alternative: similar hardness *plus* the uniform coverage that chrome (with its terrible throwing power) can never match.

ELECTROLESS NICKEL’S SUPERPOWER

THE THICKNESS-UNIFORMITY ADVANTAGE

WHY EN COATS WHAT ELECTROPLATING CAN’T

The single biggest reason shops choose electroless nickel: **it plates the same thickness on essentially every surface at once** — outside, inside, bores, blind holes, threads, sharp corners, deep recesses. Because there’s **no current**, there’s **no current-density variation**, so there’s no thick-on-edges / thin-in-holes problem.

	ELECTROPLATING	ELECTROLESS NICKEL
Driving force	Electric current	Chemistry + heat (no current)
Coverage	Thick on edges, thin/bare in recesses & bores	Even everywhere
Complex shapes / bores	Poor (needs internal anodes, robbers)	Excellent — no special tooling
“Throwing power”	A constant battle	A non-issue

★

REMEMBER
No current → no current-density map → uniform thickness everywhere. This is *the* answer to “why electroless?” It’s why EN wins jobs with bores, internal passages, and intricate geometry that electroplating struggles with.

💡

TIP
Sell (and inspect) the strength: if a part has a deep bore or blind hole, the EN advantage is that it plates *in there too*. Verify it at inspection (XRF on internal surfaces where you can) — proving the uniformity is proving the value.

⚙️

TECHNICAL STUFF
The technical term electroplaters use for even coverage is **throwing power** — the bath’s ability to plate into recesses as well as it plates on prominences. For a current-driven bath it’s always a compromise, because current physically crowds onto the nearest, sharpest geometry. Electroless nickel sidesteps the whole concept: there’s no current to crowd, so “throwing power” stops being a parameter you fight and becomes a non-issue you simply enjoy.

☀️

FUN FACT
This is why EN is the go-to for plating the inside of long tubes, injection-mold cavities, and complex valve bodies — geometries where an electroplater would have to thread custom anodes through every passage and still get uneven results. The chemistry just flows in and coats it all.

ACROSS THE LINE

RINSING & WATER MANAGEMENT

PROTECT THE NEXT CHEMISTRY, RECOVER NICKEL, CONTAIN THE WASTE

On an EN line, rinsing does triple duty: it **protects the next chemistry** (especially the delicate bath, via the guard rinse), **recovers dragged-out nickel** (saving money and reducing waste load), and **contains EN chemistry** so it doesn't reach the wastewater untreated.

- **Counter-current (cascade) rinsing** saves water — fresh water enters the cleanest stage and flows backward toward the dirtiest.
- **The guard rinse (Station 05)** is the bath's bodyguard — it keeps dragged-in acid and contamination out of the EN tank.
- **Recovery/still rinses after the bath (Station 07)** capture concentrated nickel for recovery or controlled treatment.
- **Conductivity** is the cleanliness gauge — *lower = cleaner*.
- **All EN-bearing rinse water** goes to **waste treatment**, never to a drain.

EACH RINSE, BY MISSION

RINSE	SITS BETWEEN	ITS MISSION
Station 03 (firewall)	Cleaner → activator	Stop alkaline drag-out from neutralizing the acid
Station 05 (guard)	Activator → EN bath	Protect the delicate, expensive bath from acid/contamination
Station 07 (post-plate)	EN bath → bake/dry	Recover nickel; contain EN chemistry from the drain

★

REMEMBER

Every rinse is a **checkpoint**, not a rest stop. Before the bath, the rinse protects the *bath*; after the bath, the rinse recovers *nickel* and contains the *waste*. Same tank type, different mission depending on where it sits.

⚠

HEADS-UP

Never let nickel/phosphite rinse water reach a floor drain — it's a regulated discharge. Keep drains protected and route all EN-bearing water to treatment.

💡

TIP

A “still” (non-flowing) recovery rinse right after the EN bath builds up a concentrated nickel solution over time — which can be fed back toward the bath or sent to recovery. It quietly saves nickel *and* cuts your waste-treatment load. Don't treat it as an afterthought tank.

— WHY EN WASTE IS HARDER THAN MOST

WASTE & ENVIRONMENTAL

NICKEL, PHOSPHITE, AND THE CHELATOR PROBLEM

EN waste can't just be neutralized and poured out. It has three challenges:

1. NICKEL

Nickel is a regulated metal — discharge limits are strict, and nickel is a **sensitizer/health concern**. It must be removed from wastewater before discharge.

2. PHOSPHITE

Phosphite (the plating byproduct that builds up over MTO) ends up in spent baths and rinses and is regulated for discharge — and it complicates the chemistry of removing the nickel.

3. THE CHELATOR PROBLEM (THE HARD ONE)

The same **complexants/chelators** that keep nickel dissolved in the bath also keep it dissolved in the **wastewater** — so ordinary hydroxide precipitation **doesn't drop the nickel out** the way it would for un-chelated metal. Treating **chelated nickel** requires special steps (chelate-breaking chemistry, specific precipitants, or other treatment) — which is why EN waste treatment is genuinely harder than for many plating processes.



REMEMBER

EN waste is hard because the chelator that helps you plate fights you at the drain. Chelated nickel won't precipitate with simple pH adjustment — it needs specialized treatment. Spent baths (high phosphite, end-of-MTO) and rinses both go to that treatment, never to a drain.



TECHNICAL STUFF

Standard metal-waste treatment is "raise pH, precipitate the metal hydroxide, settle/filter." That works for **free** metal ions. But a **chelated** nickel ion is wrapped in its complexant "claw" and stays dissolved even at high pH. So EN treatment must first **break the chelate** (or use a precipitant that out-competes it) before the nickel can be dropped out and the water tested to permit limits. Phosphite chemistry adds further treatment requirements.



HEADS-UP

Spent EN baths, recovery solutions, and rinses are **hazardous/regulated waste**. Handle, store (away from oxidizers — hypophosphite!), and manifest them per your shop's program and regulations. Never mix EN waste with oxidizing waste streams.



FUN FACT

The very "claw" chemistry that makes EN such a smooth, reliable bath is the same reason its wastewater needs special treatment — one of those neat cases where a process's greatest strength and its biggest headache are literally the same molecule.

— PROVING THE DEPOSIT IS RIGHT

QUALITY CHECKS & TROUBLESHOOTING

THICKNESS, ADHESION, CORROSION — AND A DEFECT→CAUSE→FIX TABLE

• QUALITY CHECKS

CHECK	WHAT “GOOD” LOOKS LIKE	HOW IT’S CHECKED
Thickness	Meets print on all significant surfaces, including internal	XRF (routine), coulometric / cross-section (arbitration)
Uniformity	Even thickness outside <i>and</i> in bores/recesses	XRF on internal surfaces where accessible
Adhesion	No blistering/flaking/peeling	Bend / thermal-shock on a sample
Hardness (if specified)	~700 HV as-plated; ~900–1000+ HV after hardness bake	Microhardness (Vickers) on coupon/cross-section
Corrosion / porosity (per spec)	Meets spec (note: Low-P weaker in acid/chloride)	Salt spray / porosity test per spec
Appearance	Uniform semi-bright; no roughness/pitting/skip	Visual

**REMEMBER**

For Low-P, verify hardness/wear-related properties and **internal thickness** especially. And remember the deposit’s limit: **Low-P corrosion performance is weaker in acid/chloride** — if a corrosion test is failing, first ask whether Low-P was even the right class for that environment.

**TIP**

Most EN defects trace to one of four roots: **prep** (clean/activate), **bath chemistry** (temp/pH/Ni/hypophosphite/stabilizer), **bath age** (high MTO/phosphite → roughness), or **wrong class/heat-treat** (Low-P vs High-P, bake vs no bake). Name the root, not just the symptom.

**HEADS-UP**

Among all these, **decomposition is the only one that’s a safety emergency**. Every other defect is a quality problem you can troubleshoot calmly; a decomposing bath gets the **people-first** response (heat + phosphine) before any troubleshooting.

• TROUBLESHOOTING QUICK-INDEX (DEFECT → CAUSE → FIX)

DEFECT / SYMPTOM	LIKELY CAUSE	FIX
Roughness / grainy deposit	Particulate; high phosphite (old/high MTO); poor filtration	Improve filtration; check MTO/phosphite; lab review
Skip-plate / bare patches	Poor cleaning/activation; oil; trapped gas; stabilizer too high	Re-clean/re-activate; water-break; orient for gas escape; lab check stabilizer
Dull / off-color deposit	pH out of range; chemistry imbalance; contamination	Correct pH; lab titrate/balance; check contamination
Pitting	Gas bubbles clinging; surface defect; contamination	Improve agitation/wetting; verify prep; lab check
Slow plating / low rate	Temp too low; Ni/hypophosphite depleted; stabilizer high; pH off	Verify temp; replenish; lab check stabilizer; correct pH
No plating / no initiation	Surface not activated/oxidized; non-catalytic substrate; stabilizer way too high	Re-activate (acid dip; zincate for Al); lab check stabilizer
Plate-out on tank / particles forming	Stabilizer too low; contamination; local hot spots	Lab adjust stabilizer; filter; clean/passivate tank; verify heaters
Bath decomposition (run-away gassing, darkening, film on tank)	Overheating; stabilizer too low; contamination	Safety first (heat/phosphine) → emergency procedure; then decant/clean/rebalance or dump
Wrong hardness	Wrong/missing heat treatment; wrong phosphorus class	Verify bake schedule; confirm Low-P vs other class
Poor adhesion / blistering	Bad cleaning/activation; (Al) bad zincate; contamination	Re-prep; verify activation/zincate
Poor corrosion in salt/acid	Low-P used where High-P was needed	Confirm correct phosphorus class for the service environment
High nickel in discharge	Treatment incomplete (chelated nickel)	Verify chelate-breaking/treatment; do not discharge



REMEMBER

Notice how many EN problems point back to the same few roots: **prep, chemistry, bath age, or wrong class/heat-treat**. A roughness problem on an old bath isn't "bad luck" — it's phosphite buildup telling you the MTO clock has run out. Read the deposit and it tells you where to look.



TIP

Before reaching for chemistry adjustments, sanity-check the basics first: is the **temperature** actually in range, is **filtration** running, and was the part **truly clean and activated**? A surprising share of "mystery" EN defects are a cold heater, a clogged filter, or a failed water-break test — not the bath chemistry at all.

— EVERY TERM, PLAIN AND SIMPLE

GLOSSARY

THE VOCABULARY OF AN ELECTROLESS NICKEL LINE, DEFINED THE WAY YOU'D EXPLAIN IT TO A FRIEND

Autocatalytic deposition: plating driven by a chemical reaction that catalyzes its own growth — the deposit speeds up its own formation, with **no electric current**.

Electroless plating: plating with **no current, no anodes, no rectifier** — driven by a chemical reducing agent.

Reducing agent: the chemical that supplies electrons to turn metal ions into metal; here, **sodium hypophosphite**.

Sodium hypophosphite: the EN reducing agent; also the source of the phosphorus in the alloy. **Oxidizer-incompatible**; phosphine risk if mishandled/overheated.

Ni-P alloy: the deposit — **nickel plus phosphorus**, not pure nickel.

Phosphorus content: the % P in the deposit — defines Low-P (~2–5%), Mid-P (~6–9%), High-P (~10–13%).

Low-P EN: ~2–5% P; **microcrystalline, hard (~700 HV, ~900–1000+ HV after bake), wear-resistant, good in alkaline service, weaker in acid/chloride**.

High-P EN: ~10–13% P; **near-amorphous, non-magnetic, best acid/chloride corrosion resistance** (for contrast).

Complexant / chelator: molecule that holds nickel in solution and controls its release; makes plating smooth but makes **waste treatment harder**.

Stabilizer: **trace (ppm)** additive that keeps the reaction **on the part only**. Too little = decomposition; too much = no plating.

MTO (Metal Turnover): one full turnover of the bath's original nickel content; the bath's "odometer." Low-P life ≈ **6–10 MTO**.

Loading: part surface area per bath volume (**ft²/gal** or **dm²/L**); kept in the supplier's window for stability.

Phosphite (orthophosphite): the plating byproduct that **accumulates** over MTO and eventually ends bath life; also a waste-treatment concern.

Replenishment: adding nickel, hypophosphite, and pH adjuster as the bath consumes them (no anodes to feed metal).

pH: acidity; Low-P EN runs **~4.4–5.2**; drifts down in use; raised with ammonia/caustic, lowered with acid.

Bath decomposition: the reaction running away — plating the tank, gassing, possible phosphine; a **safety emergency**.

Plate-out: unwanted nickel depositing on tank/heaters/particles (the seed of decomposition).

Zincate: immersion treatment that puts a thin, platable zinc layer on **aluminum** (non-catalytic) so EN can start.

Palladium (Pd) activation/strike: seeds catalytic sites on non-catalytic substrates so EN initiates.

• GLOSSARY (CONTINUED)

Deposition rate: how fast the coating builds; Low-P ~12–25 $\mu\text{m/hr}$. Thickness = rate $\times$ time (no current to vary).

XRF (X-ray fluorescence): non-destructive way to measure coating thickness by reading X-ray signals — fast, no damage, great for production.

Coulometric: small-spot-destructive thickness measurement — anodically strips a defined area and measures the charge; accurate, used for arbitration.

Hydrogen embrittlement: hydrogen absorbed into high-strength steel causing delayed brittle cracking; relieved by a ~190–220 °C bake started promptly after plating.

Hardness-development bake: a ~400 °C / ~1 hr bake that precipitates Ni_3P and drives Low-P hardness to ~900–1000+ HV.

HV (Vickers Hardness): a hardness scale. Low-P EN: ~700 HV as-plated, ~900–1000+ HV after the hardness bake.

Precipitation hardening: the metallurgy behind the hardness bake — fine nickel-phosphide particles form and harden the deposit.

Skip-plating: bare/un-plated patches from poor cleaning/activation or over-stabilization.

Throwing power (here, a non-issue): the even-coverage problem electroplaters fight — EN sidesteps it entirely because there's no current.

Drag-out / drag-in: chemistry that rides along on the parts from one tank to the next. *Drag-out* leaves a tank; *drag-in* arrives in the next. Rinses control it.

Water-break test: free field test for cleanliness — clean metal sheets water evenly; dirty metal beads it.

Conductivity ($\mu\text{S/cm}$): a measure of dissolved salts in rinse water — how “dirty” the rinse is. **Lower is cleaner.**

Counter-current rinse: water-saving setup where fresh water flows opposite to the parts, so the cleanest water meets the cleanest parts.

Filtration: continuously pumping the bath through a filter to remove particles that would seed plate-out/decomposition.

Phosphine (PH_3): a toxic, flammable gas that can be released by an overheated/decomposing EN bath; garlic/fishy odor (never rely on smell).

Sensitizer: a substance (like nickel) that can cause an allergic reaction (dermatitis, respiratory) after exposure — sometimes for life.

ASTM B733: the standard spec for autocatalytic (electroless) nickel-phosphorus coatings; classifies by phosphorus content, thickness, heat treatment.

AMS 2404 / MIL-C-26074: aerospace and military specifications for electroless nickel plating.

RoHS: “Restriction of Hazardous Substances” — EN deposits are generally RoHS-friendly (no hex chrome or cadmium in the coating itself).

Significant surface: a surface where the coating must meet the print's thickness/quality — what you verify at inspection.



REMEMBER

Of all these terms, five matter most on this line: **electroless/autocatalytic** (no current), **hypophosphite** (the reducing agent — and the phosphine/oxidizer hazard), **stabilizer** (the knife-edge), **MTO** (bath life), and **phosphorus class** (Low-P vs High-P). Master those five and you understand electroless nickel.



FUN FACT

“Nickel” comes from the German *Kupfernickel* — “Old Nick’s copper” / “the devil’s copper” — a curse miners gave an ore that looked like copper but yielded none. The “devilish” metal that fooled miners is now prized for one of the most controllable, uniform coatings in all of metal finishing.

— TEMPLATE — PRINT ONE PER OPERATOR

OPERATOR TRAINING MATRIX

HOW A SUPERVISOR PROVES — ON PAPER — THAT EACH OPERATOR IS TRAINED BEFORE RUNNING SOLO



REMEMBER

An operator is “line-qualified” only when every station they run is signed. **Nobody works any station — especially the hot EN bath — until the Safety / PPE / SDS / hygiene row and the hot-bath & decomposition/phosphine awareness rows are signed.** Safety qualification comes first, always.

Sign-off levels: **O** = Observed only · **A** = Assisted under supervision · **Q** = Qualified to run solo · **T** = Qualified to Train others.

#	STATION / SKILL	O/A/Q/T	TRAINER INIT & DATE	OPERATOR INIT & DATE	RE-CERT DUE
1	Safety / PPE / SDS / hygiene (all stations)	_____	_____	_____	_____
2	Hot-bath (~90°C) safety + decomposition/phosphine response	_____	_____	_____	_____
3	Electroless concept (no current / autocatalytic)	_____	_____	_____	_____
4	Station 01 — Inspect / Rack / substrate & class ID	_____	_____	_____	_____
5	Station 02 — Soak Clean + water-break	_____	_____	_____	_____
6	Station 03 — Rinse + conductivity	_____	_____	_____	_____
7	Station 04 — Acid Activation (and Al/zincate awareness)	_____	_____	_____	_____
8	Station 05 — Guard Rinse	_____	_____	_____	_____
9	Station 06 — EN Bath (Low-P) operation	_____	_____	_____	_____
10	Bath chemistry control (Ni / hypophosphite / pH / stabilizer)	_____	_____	_____	_____
11	MTO tracking & replenishment	_____	_____	_____	_____
12	Loading, filtration & agitation	_____	_____	_____	_____
13	Decomposition recognition & recovery procedure	_____	_____	_____	_____
14	Station 07 — Post-plate rinse + nickel recovery	_____	_____	_____	_____
15	Station 08 — Post-Bake (hardness vs H ₂ relief)	_____	_____	_____	_____
16	Station 09 — Dry / Final Inspection (XRF/coulometric)	_____	_____	_____	_____
17	EN waste handling (nickel/phosphite/chelated) & oxidizer separation	_____	_____	_____	_____
18	Emergency response — eyewash, shower, burn, spill, gas	_____	_____	_____	_____
19	Troubleshooting — symptom recognition	_____	_____	_____	_____

Operator name: _____ Hire/start date: _____

Supervisor name: _____ Review cycle: ☐ Annual ☐ Other: _____



HEADS-UP

Safety rows (1, 2, 13, 17, 18) are not optional and not “fill in later.” An operator may not work any station until Safety/PPE/SDS/hygiene, hot-bath & decomposition/phosphine response, and waste/oxidizer-separation awareness are signed. On a near-boiling, gas-capable line, safety competency absolutely precedes production competency.

PART FOUR — COMPLETION TEST, ANSWER KEY & CERTIFICATE

20 QUESTIONS • PASSING SCORE 80% (16/20)

ELECTROLESS NICKEL COMPLETION TEST

COVERS FUNDAMENTALS, THE ELECTROLESS CONCEPT, EVERY STATION, AND SAFETY
— ANSWER IN YOUR OWN WORDS WHERE ASKED

**REMEMBER**

Passing score: 80% (16 of 20 correct). Any **safety** question answered wrong (Q3, Q9, Q14, Q18, Q19) is an automatic fail of the safety gate — re-teach and re-test before sign-off, regardless of total score. The Answer Key follows — no peeking until you're done!

Name: _____ Date: _____ Score: _____ / 20 **Safety-gate Qs (all must be correct): 3, 9, 14, 18, 19**

Q1. Electroless nickel plating is different from electroplating mainly because it:

- A. Uses more current B. **Uses no electric current at all — it's a chemical (autocatalytic) reaction** C. Uses gold anodes D. Only works on plastic

Q2. The reducing agent that drives a low-phosphorus EN bath is:

- A. Chromic acid B. Sodium cyanide C. **Sodium hypophosphite** D. Zinc metal

Q3. (Short answer) [SAFETY GATE] Name the **two** biggest hazards of the EN bath itself (think temperature and reactive chemistry), and state what toxic gas can be released if the bath is overheated, contaminated, or decomposing.

Q4. Low-phosphorus electroless nickel contains approximately:

- A. 0% P B. **2–5% P** C. 10–13% P D. 50% P

Q5. A typical Low-P EN bath operates at about:

- A. Room temperature B. Below freezing C. **~85–95 °C (near boiling)** D. 200 °C

Q6. (Short answer) Explain electroless nickel's **headline advantage** over electroplating, and *why* the process produces it (hint: no current).

Q7. Typical Low-P EN bath pH and deposition rate are about:

- A. pH 10–11; 1 µm/hr B. **pH ~4.4–5.2; ~12–25 µm/hr** C. pH 1; 200 µm/hr D. pH 7; 0.1 µm/hr

Q8. "One MTO" (metal turnover) means:

- A. **The bath has plated out and replenished an amount of nickel equal to its original nickel content** B. The bath has been heated once C. One hour of plating D. One part has been plated

Q9. (Short answer) [SAFETY GATE] Explain why **stabilizer** is dosed only in trace (ppm) amounts and only to a tested target — what happens if there's **too little**, and what happens if there's **too much**?

Q10. As-deposited Low-P EN hardness is about **~700 HV**. After a ~400 °C / ~1 hr bake it rises to about:

- A. 100–200 HV B. 300 HV C. It gets softer D. **900–1000+ HV**

Q11. (Short answer) A Low-P EN bath has no anodes feeding metal. Explain how the operator keeps the bath plating — what gets **replenished**, and how bath life is tracked.

Q12. A customer's part lives in **salt spray / acidic** service and needs maximum corrosion resistance. The better choice is:

A. Low-P (it's hardest) B. Either, identical C. No coating D. **High-P (better acid/chloride corrosion resistance)**

Q13. **Aluminum** can't be plated directly by EN because it's non-catalytic and instantly oxidizes. The standard pre-treatment is:

A. **A zincate (± nickel strike) before EN** B. A hotter bath C. More stabilizer D. Higher pH

Q14. (Short answer) [SAFETY GATE] List **four** signs that an EN bath is **decomposing**, and state the correct **first response** when you see them.

Q15. The byproduct that builds up over a bath's life and eventually ends it (around 6–10 MTO) is:

A. **Phosphite** B. Chromium C. Hydrogen D. Oxygen

Q16. EN coating thickness on a finished part is typically verified by:

A. Weighing the whole part only B. Color matching C. Counting amp-hours D. **XRF or coulometric measurement**

Q17. (Short answer) There are **two different post-plate bakes**. Name each one's **purpose** and **approximate temperature/time**.

Q18. [SAFETY GATE] Sodium hypophosphite (a reducing agent) must be kept far away from:

A. Water B. Nickel C. **Strong oxidizers (nitrates, peroxides, nitric acid, chlorine chemistry)** D. Plastic tanks



SAFETY SECTION — MUST BE CORRECT TO CERTIFY

Questions 3, 9, 14, 18, and 19 cover hazards that can permanently harm you or others. A miss on any safety item means re-teach and re-test before sign-off.

Q19. (Short answer / Safety) [SAFETY GATE] List **four** pieces of PPE required at the near-boiling EN tank, and state the single most important *behavior* that prevents scald burns there.

Q20. (Short answer) Name **two** ways electroless nickel is fundamentally different from an electroplating process like acid zinc or hard chrome.

End of test. Hand to your trainer for grading.

FOR TRAINERS & SELF-CHECKERS

ANSWER KEY

SHORT-ANSWER RESPONSES DON'T NEED TO MATCH WORD-FOR-WORD — LOOK FOR THE KEY CONCEPTS IN BOLD

**HEADS-UP**

Keep this page out of the trainee's copy. Questions **3, 9, 14, 18, and 19** are safety-critical — any wrong answer there requires re-training on that topic before sign-off, regardless of total score.

Q1. B — Uses **no electric current**; it's a chemical (autocatalytic) reaction.

Q2. C — **Sodium hypophosphite**.

Q3. Two hazards: **(1) near-boiling temperature (~85–95 °C)** → **scald/steam burns**, and **(2) reactive chemistry that can decompose / run away** (plus nickel as a sensitizer, hypophosphite + oxidizer incompatibility). Gas that can be released: **phosphine (PH₃)** — toxic and flammable.

Q4. B — **2–5% P**.

Q5. C — **~85–95 °C (near boiling)**.

Q6. Headline advantage: **superb thickness uniformity** — it coats **every surface evenly**, including bores, blind holes, and complex shapes. *Why:* with **no current**, there's **no current-density variation**, so the chemical reaction proceeds at the same rate on every catalytic surface (no thick-edges/thin-recesses problem).

Q7. B — **pH ~4.4–5.2; ~12–25 µm/hr**.

Q8. A — The bath has **turned over (plated out and replenished)** an amount of nickel equal to its original nickel content. (Low-P life ≈ 6–10 MTO.)

Q9. Stabilizer keeps the reaction **on the parts only**, and is so powerful it's used in **trace (ppm)** amounts to a **tested target**. **Too little** → the reaction starts off-part → **plate-out / bath decomposition**. **Too much** → the reaction is over-suppressed even on the parts → **slow plating, skip-plating, or no plating**. Never guess additions.

Q10. D — **900–1000+ HV** (precipitation hardening from the bake).

Q11. No anodes feed metal, so the **operator replenishes: nickel, hypophosphite (reducing agent), and pH** (with ammonia/caustic), dosed to **tested lab values** in small frequent additions. Bath life is tracked in **MTO (metal turnovers)** — Low-P ≈ **6–10 MTO** before it's dumped and remade.

Q12. D — **High-P** (better acid/chloride corrosion resistance; Low-P is weaker there).

Q13. A — A **zincate** (± nickel strike) before EN, because bare aluminum is non-catalytic and re-oxidizes instantly.

Q14. Signs (any four): **unusual/violent gassing, bath darkening/cloudiness, fine particles forming, metallic film on tank/heaters, sudden temperature rise, acrid/garlic-fishy odor (possible phosphine)**. First response: **treat it as a heat + toxic/flammable-gas safety emergency — don't lean over the tank; get to fresh air, alert others, increase ventilation, and follow the shop's emergency procedure** (people first, bath second).

Q15. A — **Phosphite** (orthophosphite byproduct).

Q16. D — **XRF or coulometric** (cross-section for arbitration).

Q17. (1) Hardness-development bake: ~400 °C for ~1 hr → drives hardness to ~900–1000+ HV. **(2) Hydrogen-embrittlement relief bake: ~190–220 °C for several hours (often ≥ 4–8)**, started promptly after plating → drives absorbed hydrogen out of high-strength steel.

Q18. C — **Strong oxidizers** (reducing agent + oxidizer = violent reaction / fire-explosion risk).

Q19. PPE (any four): sealed chemical splash goggles, face shield, chemical-resistant (heat-aware) gloves, chemical apron/suit, chemical-resistant boots, respirator per program. **Behavior: move slowly and deliberately over the hot tank — never rush a load over near-boiling bath** (most scalds come from haste/splashing).

Q20. Any two of: **no electric current / autocatalytic** (vs. current-driven); **no anodes/rectifier; deposits uniformly on all surfaces** (no throwing-power problem); **controlled by chemistry + temperature, not a current knob; bath life tracked in MTO** (vs. amp-hours); **runs near boiling (~85–95 °C); deposit is a Ni-P alloy** whose properties depend on phosphorus content.

Answer distribution (MC): A=3 · B=3 · C=3 · D=3 — correct answers are spread evenly across all four options (self-check).

**REMEMBER**

A score of 16/20 passes — but every safety question (3, 9, 14, 18, 19) must be correct to certify. Miss a safety item → re-teach and re-test before sign-off. On a near-boiling, gas-capable line, we don't gamble with people.

PRINT, FILL IN, SIGN



PLATING POSTERS

PLATING POSTERS INC • METAL FINISHING REFERENCE SERIES

CERTIFICATE OF
COMPLETION

ELECTROLESS NICKEL (LOW PHOSPHORUS) PLATING
TRAINING PROGRAM

This certifies that

OPERATOR NAME

has successfully completed the **Electroless Nickel (Low Phosphorus) Plating** training course — covering the full Low-P electroless nickel workflow (Inspect/Rack, Soak Clean, Rinse, Acid Activation, Guard Rinse, Electroless Nickel Plate, Post-plate Rinse, Post-Bake, and Final Inspection), the **autocatalytic (no-current) deposition concept**, Ni-P alloy chemistry and the Low/Mid/High-P family, bath chemistry control (nickel, hypophosphite, pH, stabilizer, loading, and MTO), replenishment and bath-life management, the thickness-uniformity advantage, heat treatment for hardness and hydrogen-embrittlement relief, EN waste/environmental handling, and — above all — the **safety practices** required of every operator on a near-boiling EN line (hot-bath burn prevention, nickel-sensitizer hygiene, hypophosphite/oxidizer separation, **decomposition and phosphine response**, spill response, and PPE) — and has passed the Completion Test with a score of _____ / 20, including all required safety competencies.

This operator is hereby cleared for **independent work** at the certified stations listed on the Operator Training Matrix.

Date of completion: _____ Re-certification due: _____

TRAINEE SIGNATURE

CERTIFYING TRAINER

SUPERVISOR

Training reference only. Verify all parameters against your chemistry supplier's TDS, customer specifications, and applicable regulatory requirements before production use. The electroless nickel bath runs near boiling and uses a sensitizing metal salt and an oxidizer-incompatible reducing agent — always consult current SDS and comply with OSHA, EPA, REACH, and local regulations. Specs commonly referenced: ASTM B733, AMS 2404, MIL-C-26074.