

GOT



737-600/700/800/900 TASK CARDS

CHAPTER 20 STANDARD PRACTICES

Subject/Page	Date	COC	Subject/Page	Date	COC	Subject/Page	Date	COC
20-EFFECTIVE PAGES			20-010-02-01	SYS (cont)		20-030-01-01	SYS (cont)	
1 thru 9	Jun 15/2025		16	Sep 15/2023		6	Feb 15/2015	
10	BLANK		17	Sep 15/2023		7	Jun 15/2021	
20-010-01-01	SYS		18	Sep 15/2023		8	Feb 15/2015	
1	Feb 15/2024		20-020-00-01	SYS		9	Feb 15/2024	
2	Jun 15/2021		1	Jun 15/2022		10	Feb 15/2024	
3	Jun 15/2021		R 2	Jun 15/2025		11	Feb 15/2024	
4	Jun 15/2021		R 3	Jun 15/2025		12	Feb 15/2015	
5	Jun 15/2021		R 4	Jun 15/2025		13	Feb 15/2015	
6	Feb 15/2015		5	Jun 15/2022		14	Feb 15/2015	
7	Feb 15/2024		6	Jun 15/2022		15	Feb 15/2015	
8	Feb 15/2024		R 7	Jun 15/2025		16	Feb 15/2015	
9	Feb 15/2024		8	Jun 15/2023		17	Feb 15/2015	
10	Feb 15/2024		9	Jun 15/2022		18	Feb 15/2015	
11	Feb 15/2024		10	Jun 15/2022		19	Feb 15/2015	
12	Feb 15/2024		R 11	Jun 15/2025		20-030-02-01	SYS	
13	Feb 15/2024		12	Jun 15/2022		1	Sep 15/2023	
14	Feb 15/2024		13	Jun 15/2022		2	Jun 15/2021	
15	Feb 15/2024		14	Jun 15/2022		3	Jun 15/2021	
16	Feb 15/2024		15	Jun 15/2022		4	Feb 15/2015	
17	Feb 15/2024		16	Jun 15/2022		5	Jun 15/2021	
20-010-02-01	SYS		17	Jun 15/2022		6	Feb 15/2015	
1	Sep 15/2023		18	Jun 15/2022		7	Jun 15/2021	
2	Jun 15/2021		19	Jun 15/2022		8	Feb 15/2015	
3	Jun 15/2021		20	Jun 15/2022		9	Sep 15/2023	
4	Feb 15/2015		21	Jun 15/2022		10	Sep 15/2023	
5	Jun 15/2021		22	Jun 15/2022		11	Sep 15/2023	
6	Jun 15/2021		23	Jun 15/2022		12	Feb 15/2015	
7	Feb 15/2021		24	Jun 15/2022		13	Feb 15/2015	
8	Sep 15/2023		25	Jun 15/2022		14	Feb 15/2015	
9	Sep 15/2023		26	Jun 15/2022		15	Jun 15/2015	
10	Sep 15/2023		20-030-01-01	SYS		16	Feb 15/2015	
11	Sep 15/2023		1	Feb 15/2024		17	Feb 15/2015	
12	Sep 15/2023		2	Jun 15/2021		18	Feb 15/2015	
13	Sep 15/2023		3	Jun 15/2021		19	Feb 15/2015	
14	Sep 15/2023		4	Feb 15/2015				
15	Sep 15/2023		5	Jun 15/2021				

A = Added, R = Revised, D = Deleted, O = Overflow, C = Customer Originated Change

20-EFFECTIVE PAGES

GOT



737-600/700/800/900 TASK CARDS

AIRLINE CARD NO		TITLE			BOEING CARD NO.	
		GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL			20-020-00-01	
DATE	TASK INSPECTION - GEN VISUAL				RELATED CARD	
TAIL NUMBER	WORK AREA E/E COMPARTMENT	VERSION 1.1	THRESHOLD 30000 FH	REPEAT 30000 FH	APPLICABILITY	
STATION	SKILL AVION				AIRPLANE ALL	ENGINE ALL
		ACCESS 112A 113BW 117A 121EW 121JW 121KW 122GW 122HW			ZONE 117 118	

General visual inspection of HIRF/L sensitive wire runs inside the pressure vessel. Look for obvious signs of damage and lack of security of the wire runs.

A. References

Reference	Title
AMM 21-25-01-000-801	Recirculation Air Filter - Removal (P/B 401)
AMM 21-25-01-400-801	Recirculation Air Filter - Installation (P/B 401)
AMM 25-21-45-000-801	Ceiling Panel - Removal (P/B 401)
AMM 25-21-45-000-803-001	Main Ceiling Panel - Removal (P/B 401)
AMM 25-21-45-400-801	Ceiling Panel - Installation (P/B 401)
AMM 25-21-45-400-803-001	Main Ceiling Panel - Installation (P/B 401)
AMM 25-24-31-000-801-001	Overhead Stowage Bin - Removal (P/B 401)
AMM 25-24-31-000-802-001	Overhead Stowage Bin Module - Removal (P/B 401)
AMM 25-24-31-020-801	Overhead Stowage Bin - Removal (P/B 401)
AMM 25-24-31-400-801	Overhead Stowage Bin - Installation (P/B 401)
AMM 25-24-31-400-803-001	Overhead Stowage Bin - Installation (P/B 401)
AMM 25-24-31-400-804-001	Overhead Stowage Bin Module - Installation (P/B 401)
AMM 25-24-40-000-801	Center Overhead Stowage Box Removal (P/B 401)
AMM 25-24-40-400-801	Center Overhead Stowage Box Installation (P/B 401)
AMM 32-00-01-480-801	Landing Gear Downlock Pins Installation (P/B 201)
AMM 53-14-01-020-801	Nose Wheel Well Access Panels - Removal (P/B 401)
AMM 53-14-01-420-801	Nose Wheel Well Access Panels - Installation (P/B 401)
SWPM Chapter 20	Standard Wiring Practices Manual

EFFECTIVITY GOT ALL	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL
		D633A109-GOT 20-020-00-01

Page 1 of 26
Jun 15/2022

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01							
TASK 05-55-15-200-806				MECH	INSP						
1. General Visual Inspection - Wiring at Connectors Inside the Pressure Vessel (Figure 1, Figure 2, Figure 3, Figure 4, Figure 5, Figure 6, Figure 7)											
A. General											
(1) A General Visual Inspection is a visual check for obvious damage associated with assemblies or installations. (a) You will search for evidence of wiring irregularities near connectors, using normally available lighting. (b) Do not remove sealant when you do this task. (c) Do not disassemble connectors when you do this task. (d) Do not remove system Line Replaceable Unit (LRU)s when you do this task.											
B. Prepare for the Inspection											
SUBTASK 05-55-15-010-006 (1) Do this task: Landing Gear Downlock Pins Installation, AMM TASK 32-00-01-480-801.											
SUBTASK 05-55-15-010-029 (2) Open these access panels: <table border="0" style="width: 100%;"> <thead> <tr> <th style="text-align: left;"><u>Number</u></th> <th style="text-align: left;"><u>Name/Location</u></th> </tr> </thead> <tbody> <tr> <td>121EW</td> <td>Panel Assy - Fwd Cargo Compartment Aft Bulkhead</td> </tr> <tr> <td>122GW</td> <td>Panel Assy - FWD Cargo Compartment Aft Bulkhead</td> </tr> </tbody> </table>				<u>Number</u>	<u>Name/Location</u>	121EW	Panel Assy - Fwd Cargo Compartment Aft Bulkhead	122GW	Panel Assy - FWD Cargo Compartment Aft Bulkhead		
<u>Number</u>	<u>Name/Location</u>										
121EW	Panel Assy - Fwd Cargo Compartment Aft Bulkhead										
122GW	Panel Assy - FWD Cargo Compartment Aft Bulkhead										
GOT 101-199, 201-215, 217, 219-244, 247-250, 303-305, 307, 308, 312, 313, 321-323, 327, 330-338, 340-343, 346-348, 350-353, 355, 356, 358-365, 367-399, 401, 403-410, 415-419, 430, 431, 434, 438, 439, 441, 442, 444											
SUBTASK 05-55-15-010-025 (3) Do this task: Recirculation Air Filter - Removal, AMM TASK 21-25-01-000-801.											
SUBTASK 05-55-15-020-003 (4) Remove recirculation air filter supports as necessary to access the connector/wire bundle.											
GOT ALL											
SUBTASK 05-55-15-010-007 (5) Open these access panels: <table border="0" style="width: 100%;"> <thead> <tr> <th style="text-align: left;"><u>Number</u></th> <th style="text-align: left;"><u>Name/Location</u></th> </tr> </thead> <tbody> <tr> <td>112A</td> <td>Forward Access Door</td> </tr> <tr> <td>117A</td> <td>Electronic Equipment Access Door</td> </tr> </tbody> </table>				<u>Number</u>	<u>Name/Location</u>	112A	Forward Access Door	117A	Electronic Equipment Access Door		
<u>Number</u>	<u>Name/Location</u>										
112A	Forward Access Door										
117A	Electronic Equipment Access Door										
SUBTASK 05-55-15-010-022 (6) Open this access panel: <table border="0" style="width: 100%;"> <thead> <tr> <th style="text-align: left;"><u>Number</u></th> <th style="text-align: left;"><u>Name/Location</u></th> </tr> </thead> <tbody> <tr> <td>113BW</td> <td>Forward Nose Wheel Well Panel</td> </tr> </tbody> </table>				<u>Number</u>	<u>Name/Location</u>	113BW	Forward Nose Wheel Well Panel				
<u>Number</u>	<u>Name/Location</u>										
113BW	Forward Nose Wheel Well Panel										
(a) Do this task: Nose Wheel Well Access Panels - Removal, AMM TASK 53-14-01-020-801.											
EFFECTIVITY GOT ALL		SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL D633A109-GOT 20-020-00-01								

GOT



737-600/700/800/900 TASK CARDS

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01									
SUBTASK 05-55-15-010-026 (7) Open these access panels: <table border="1"><thead><tr><th>Number</th><th>Name/Location</th></tr></thead><tbody><tr><td>121JW</td><td>PANEL ASSY - FORWARD CARGO COMPARTMENT FWD BULKHEAD</td></tr><tr><td>121KW</td><td>PANEL ASSY - FORWARD CARGO COMPARTMENT FWD BULKHEAD FILTER COVER</td></tr><tr><td>122HW</td><td>PANEL ASSY - FORWARD CARGO COMPARTMENT FWD BULKHEAD FAN COVER</td></tr></tbody></table> SUBTASK 05-55-15-010-009 (8) Gain access to the connectors behind the Mode Control Panel (MCP). (a) Loosen the fasteners on MCP and slide it out to access the connectors. SUBTASK 05-55-15-010-010 (9) Gain access to the connectors behind the AutoBrake/AntiSkid/Engine Control Panel: (a) Loosen the four quarter turn fasteners and lift the AutoBrake/AntiSkid/Engine Control Panel assembly out of the center main panel. (b) Carefully hang the panel assembly by the connecting wire bundles. GOT 306, 309, 311, 315-317, 328, 329, 851-999 SUBTASK 05-55-15-010-011 (10) Gain access to the disconnect panels above the passenger compartment ceiling. Remove the ceiling panels at Station 410 and 424. GOT 101-199, 201-215, 217, 219-244, 247-250, 303-305, 307, 308, 312, 313, 321-323, 327, 330-338, 340-343, 346-348, 350-353, 355, 356, 358-365, 367-399, 401, 403-410, 415-419, 430, 431, 434, 438, 439, 441, 442, 444 SUBTASK 05-55-15-010-027 (11) Gain access to the disconnect panels above the passenger compartment ceiling. (a) Remove the ceiling panels at Station 410 and 424 (AMM TASK 25-21-45-000-801 or AMM TASK 25-21-45-000-803-001). (b) If necessary, remove the overhead stowage bin (AMM TASK 25-24-31-020-801 or AMM TASK 25-24-31-000-801-001 or AMM TASK 25-24-31-000-802-001) GOT 211, 212, 227, 228, 239, 243, 244, 312, 313, 321, 358-361, 365, 367, 369, 399, 408, 410, 415, 417-419, 430, 434, 441, 442, 444 (c) If it is necessary, remove the center overhead stowage box (AMM TASK 25-24-40-000-801). GOT ALL C. General Visual Inspection SUBTASK 05-55-15-210-018 (1) Procedure to do the General Visual Inspection of the wire bundle cables listed in Table below: <u>NOTE:</u> Do this procedure only for the exposed part of the wire bundle.				Number	Name/Location	121JW	PANEL ASSY - FORWARD CARGO COMPARTMENT FWD BULKHEAD	121KW	PANEL ASSY - FORWARD CARGO COMPARTMENT FWD BULKHEAD FILTER COVER	122HW	PANEL ASSY - FORWARD CARGO COMPARTMENT FWD BULKHEAD FAN COVER	MECH	INSP
				Number	Name/Location								
121JW	PANEL ASSY - FORWARD CARGO COMPARTMENT FWD BULKHEAD												
121KW	PANEL ASSY - FORWARD CARGO COMPARTMENT FWD BULKHEAD FILTER COVER												
122HW	PANEL ASSY - FORWARD CARGO COMPARTMENT FWD BULKHEAD FAN COVER												
EFFECTIVITY GOT ALL		SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL										
			D633A109-GOT 20-020-00-01										

GOT



737-600/700/800/900 TASK CARDS

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01																																																																																											
(a) Make sure that the wire bundle cables are not chafed, cut, or worn. (b) Replace or repair any damaged wiring found during this inspection (SWPM Chapter 20). SUBTASK 05-55-15-200-016 (2) Connectors in the Forward Access Area: Table 1 <table border="1"><thead><tr><th>WIRE BUNDLE</th><th>CONNECTOR</th><th>PNL OR MODULE</th><th>WDM</th></tr></thead><tbody><tr><td>W6570</td><td>D11306</td><td>M1827</td><td>28-41-11</td></tr></tbody></table> SUBTASK 05-55-15-200-017 (3) Connectors in the Nose Wheel Well: Table 2 <table border="1"><thead><tr><th>WIRE BUNDLE</th><th>CONNECTOR</th><th>PNL OR MODULE</th><th>WDM</th></tr></thead><tbody><tr><td>W0088</td><td>D48116J</td><td>J48A Pos 13</td><td>28-41-11</td></tr><tr><td>W5158</td><td>D48116P</td><td>J48A Pos 13</td><td>28-41-11</td></tr><tr><td colspan="4">GOT 101-199, 201-215, 217, 219-244, 247-250, 303-309, 311-313, 315-317, 321-323, 327-338, 340-343, 346-348, 350-353, 355, 356, 358-365, 367-399, 401, 403-410, 415-419, 430, 438, 439, 441, 442, 444, 851-999</td></tr><tr><td>W0088</td><td>D48128J</td><td>J48A Pos 24</td><td>28-41-11</td></tr><tr><td colspan="4">GOT 431, 434</td></tr><tr><td>W0088</td><td>D47600J</td><td>J48A Pos 24</td><td>28-41-11</td></tr><tr><td colspan="4">GOT 101-199, 201-215, 217, 219-244, 247-250, 303-309, 311-313, 315-317, 321-323, 327-338, 340-343, 346-348, 350-353, 355, 356, 358-365, 367-399, 401, 403-410, 415-419, 430, 438, 439, 441, 442, 444, 851-999</td></tr><tr><td>W6570</td><td>D48128P</td><td>J48A Pos 24</td><td>28-41-11</td></tr><tr><td colspan="4">GOT 431, 434</td></tr><tr><td>W5558</td><td>D47600P</td><td>J48A Pos 24</td><td>28-41-11</td></tr><tr><td colspan="4">GOT ALL</td></tr><tr><td colspan="4">SUBTASK 05-55-15-200-018</td></tr><tr><td colspan="4">(4) Connectors in the E/E Bay Main Equipment Center: Table 3 <table border="1"><thead><tr><th>WIRE BUNDLE</th><th>CONNECTOR</th><th>PNL OR MODULE</th><th>WDM</th></tr></thead><tbody><tr><td>W2363</td><td>D04069P</td><td>E1-1 Pos 29</td><td>22-11-11</td></tr><tr><td>W2465</td><td>D08019J</td><td>E1-4 Pos 1</td><td>22-11-11</td></tr><tr><td>W5367</td><td>D04073P</td><td>E1-1 Pos 27</td><td>22-11-31</td></tr><tr><td>W5375</td><td>D04077J</td><td>E1-4 Pos 15</td><td>22-11-31</td></tr></tbody></table> SUBTASK 05-55-15-200-019 (5) Connectors in the Forward Cargo Compartment, Forward: </td><td>MECH</td><td>INSP</td></tr><tr><td colspan="2">EFFECTIVITY GOT ALL</td><td>SOURCE MRB</td><td colspan="3">GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL D633A109-GOT 20-020-00-01</td></tr></tbody></table>				WIRE BUNDLE	CONNECTOR	PNL OR MODULE	WDM	W6570	D11306	M1827	28-41-11	WIRE BUNDLE	CONNECTOR	PNL OR MODULE	WDM	W0088	D48116J	J48A Pos 13	28-41-11	W5158	D48116P	J48A Pos 13	28-41-11	GOT 101-199, 201-215, 217, 219-244, 247-250, 303-309, 311-313, 315-317, 321-323, 327-338, 340-343, 346-348, 350-353, 355, 356, 358-365, 367-399, 401, 403-410, 415-419, 430, 438, 439, 441, 442, 444, 851-999				W0088	D48128J	J48A Pos 24	28-41-11	GOT 431, 434				W0088	D47600J	J48A Pos 24	28-41-11	GOT 101-199, 201-215, 217, 219-244, 247-250, 303-309, 311-313, 315-317, 321-323, 327-338, 340-343, 346-348, 350-353, 355, 356, 358-365, 367-399, 401, 403-410, 415-419, 430, 438, 439, 441, 442, 444, 851-999				W6570	D48128P	J48A Pos 24	28-41-11	GOT 431, 434				W5558	D47600P	J48A Pos 24	28-41-11	GOT ALL				SUBTASK 05-55-15-200-018				(4) Connectors in the E/E Bay Main Equipment Center: Table 3 <table border="1"><thead><tr><th>WIRE BUNDLE</th><th>CONNECTOR</th><th>PNL OR MODULE</th><th>WDM</th></tr></thead><tbody><tr><td>W2363</td><td>D04069P</td><td>E1-1 Pos 29</td><td>22-11-11</td></tr><tr><td>W2465</td><td>D08019J</td><td>E1-4 Pos 1</td><td>22-11-11</td></tr><tr><td>W5367</td><td>D04073P</td><td>E1-1 Pos 27</td><td>22-11-31</td></tr><tr><td>W5375</td><td>D04077J</td><td>E1-4 Pos 15</td><td>22-11-31</td></tr></tbody></table> SUBTASK 05-55-15-200-019 (5) Connectors in the Forward Cargo Compartment, Forward:				WIRE BUNDLE	CONNECTOR	PNL OR MODULE	WDM	W2363	D04069P	E1-1 Pos 29	22-11-11	W2465	D08019J	E1-4 Pos 1	22-11-11	W5367	D04073P	E1-1 Pos 27	22-11-31	W5375	D04077J	E1-4 Pos 15	22-11-31	MECH	INSP	EFFECTIVITY GOT ALL		SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL D633A109-GOT 20-020-00-01		
				WIRE BUNDLE	CONNECTOR	PNL OR MODULE	WDM																																																																																								
W6570	D11306	M1827	28-41-11																																																																																												
WIRE BUNDLE	CONNECTOR	PNL OR MODULE	WDM																																																																																												
W0088	D48116J	J48A Pos 13	28-41-11																																																																																												
W5158	D48116P	J48A Pos 13	28-41-11																																																																																												
GOT 101-199, 201-215, 217, 219-244, 247-250, 303-309, 311-313, 315-317, 321-323, 327-338, 340-343, 346-348, 350-353, 355, 356, 358-365, 367-399, 401, 403-410, 415-419, 430, 438, 439, 441, 442, 444, 851-999																																																																																															
W0088	D48128J	J48A Pos 24	28-41-11																																																																																												
GOT 431, 434																																																																																															
W0088	D47600J	J48A Pos 24	28-41-11																																																																																												
GOT 101-199, 201-215, 217, 219-244, 247-250, 303-309, 311-313, 315-317, 321-323, 327-338, 340-343, 346-348, 350-353, 355, 356, 358-365, 367-399, 401, 403-410, 415-419, 430, 438, 439, 441, 442, 444, 851-999																																																																																															
W6570	D48128P	J48A Pos 24	28-41-11																																																																																												
GOT 431, 434																																																																																															
W5558	D47600P	J48A Pos 24	28-41-11																																																																																												
GOT ALL																																																																																															
SUBTASK 05-55-15-200-018																																																																																															
(4) Connectors in the E/E Bay Main Equipment Center: Table 3 <table border="1"><thead><tr><th>WIRE BUNDLE</th><th>CONNECTOR</th><th>PNL OR MODULE</th><th>WDM</th></tr></thead><tbody><tr><td>W2363</td><td>D04069P</td><td>E1-1 Pos 29</td><td>22-11-11</td></tr><tr><td>W2465</td><td>D08019J</td><td>E1-4 Pos 1</td><td>22-11-11</td></tr><tr><td>W5367</td><td>D04073P</td><td>E1-1 Pos 27</td><td>22-11-31</td></tr><tr><td>W5375</td><td>D04077J</td><td>E1-4 Pos 15</td><td>22-11-31</td></tr></tbody></table> SUBTASK 05-55-15-200-019 (5) Connectors in the Forward Cargo Compartment, Forward:				WIRE BUNDLE	CONNECTOR	PNL OR MODULE	WDM	W2363	D04069P	E1-1 Pos 29	22-11-11	W2465	D08019J	E1-4 Pos 1	22-11-11	W5367	D04073P	E1-1 Pos 27	22-11-31	W5375	D04077J	E1-4 Pos 15	22-11-31	MECH	INSP																																																																						
WIRE BUNDLE	CONNECTOR	PNL OR MODULE	WDM																																																																																												
W2363	D04069P	E1-1 Pos 29	22-11-11																																																																																												
W2465	D08019J	E1-4 Pos 1	22-11-11																																																																																												
W5367	D04073P	E1-1 Pos 27	22-11-31																																																																																												
W5375	D04077J	E1-4 Pos 15	22-11-31																																																																																												
EFFECTIVITY GOT ALL		SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL D633A109-GOT 20-020-00-01																																																																																												

GOT



737-600/700/800/900 TASK CARDS

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01	
Table 4				MECH	INSP
WIRE BUNDLE	CONNECTOR	PNL OR MODULE	WDM		
W0220	D40130J	E2-2 Pos 25	73-31-11		
W0220	D40136J	E2-2 Pos 7	80-11-11		
W0220	D40450J	E2-2 Pos 24	73-31-11		
W0410	D40156J	E4-1 Pos 50	73-21-21		
W0410	D40158J	E4-1 Pos 42	76-21-21		
W0410	D40390J	E4-1 Pos 52	73-21-31		
W0422	D40164J	E4-2 Pos 15	28-41-11		
W0422	D40388J	E4-2 Pos 24	27-62-11		
W0422	D40618J	E4-2 Pos 35	24-33-11		
W3170	D49994P	E3-1 Pos 14	79-33-11		
W4170	D40732P	E3-1 Pos 36	77-12-11		
W5158	D40618P	E4-2 Pos 35	24-33-11		
W5162	D40130P	E2-2 Pos 25	73-31-11		
W5310	D40448P	E3-1 Pos 11	73-24-11		
W5310	D40450P	E2-2 Pos 24	73-31-11		
W5375	D42053P	E3-2 Pos 47	27-18-11		
W5564	D40136P	E2-2 Pos 7	80-11-11		
W6162	D40156P	E4-1 Pos 50	73-21-21		
W6412	D40388P	E4-2 Pos 24	27-62-11		
W6412	D40390P	E4 -1 Pos 52	73-21-31		
W6412	D40394P	E3-1 Pos 34	36-11-11		
W6564	D40158P	E4-1 Pos 42	76-21-21		
W6586	D40164P	E4-2 Pos 15	28-41-11		
SUBTASK 05-55-15-200-020					
(6) Connectors in the Forward Cargo Compartment, Aft:					
Table 5					
WIRE BUNDLE	CONNECTOR	PNL OR MODULE	WDM		
W5162	D39921	AC0520 DM11	73-21-21		
W5170	D39925	AC0520 DM13	79-31-11		
W5172	D39917	AC0520 DM09	73-21-21		
W5564	D39909	AC0520 DM05	76-21-11		
W6162	D39922	AD0520 DM12	73-21-21		
EFFECTIVITY GOT ALL		SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL		
			D633A109-GOT 20-020-00-01		
			Page 5 of 26 Jun 15/2022		

GOT



737-600/700/800/900 TASK CARDS

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01	
Table 5 (Continued)				MECH	INSP
WIRE BUNDLE	CONNECTOR	PNL OR MODULE	WDM		
W6170	D39926	AD0520 DM14	30-21-21		
W6172	D39918	AD0520 DM10	73-21-21		
W6564	D39910	AD0520 DM06	76-21-21		
W6586	D39906	AD0520 DM04	28-41-11		
SUBTASK 05-55-15-200-021					
(7) Connectors in the Flight Compartment:					
Table 6					
WIRE BUNDLE	CONNECTOR	PNL OR MODULE	WDM		
W2363	D00299	Mode Control Panel	22-11-11		
W2363	D00301	Mode Control Panel	22-11-11		
W2363	GD977	Shield Gnd	22-11-11		
W2363	GD981	Shield Gnd	22-11-11		
W2465	D01815	Mode Control Panel	22-11-11		
W2465	GD980	Shield Gnd	22-11-11		
W2465	GD985	Shield Gnd	22-11-11		
SUBTASK 05-55-15-200-022					
(8) Connectors in the Passenger Cabin, Forward:					
Table 7					
WIRE BUNDLE	CONNECTOR	PNL OR MODULE	WDM		
W3170/W5172	D40736P to D40736J	AB0420A Pos 2	79-31-11		
W3170/W5170	D40734P to D40734J	AB0420A Pos 1	79-31-11		
W4170/W6170	D40728P to D40728J	AB0405B Pos 1	77-12-11		
D. Put the Airplane Back to Its Usual Condition					
SUBTASK 05-55-15-410-028					
(1) Close these access panels:					
Number	Name/Location				
121JW	PANEL ASSY - FORWARD CARGO COMPARTMENT FWD BULKHEAD				
121KW	PANEL ASSY - FORWARD CARGO COMPARTMENT FWD BULKHEAD FILTER COVER				
122HW	PANEL ASSY - FORWARD CARGO COMPARTMENT FWD BULKHEAD FAN COVER				
EFFECTIVITY GOT ALL		SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL		
			D633A109-GOT 20-020-00-01		

GOT



737-600/700/800/900 TASK CARDS

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01													
SUBTASK 05-55-15-410-007 (2) Reinstall the AutoBrake/AntiSkid/Engine Control Panel assembly and tighten the fasteners. SUBTASK 05-55-15-410-008 (3) Reinstall the MCP and tighten the fasteners. GOT 306, 309, 311, 315-317, 328, 329, 851-999 SUBTASK 05-55-15-410-009 (4) Install the ceiling panels at Station 410 and 424. GOT 101-199, 201-215, 217, 219-244, 247-250, 303-305, 307, 308, 312, 313, 321-323, 327, 330-338, 340-343, 346-348, 350-353, 355, 356, 358-365, 367-399, 401, 403-410, 415-419, 430, 431, 434, 438, 439, 441, 442, 444 SUBTASK 05-55-15-410-027 (5) To install the ceiling panels, do these steps: (a) Install the ceiling panels at Station 410 and 424 (AMM TASK 25-21-45-400-801 or AMM TASK 25-21-45-400-803-001) (b) If removed, install the overhead stowage bins (AMM TASK 25-24-31-400-801 or AMM TASK 25-24-31-400-803-001 or AMM TASK 25-24-31-400-804-001) GOT 211, 212, 227, 228, 239, 243, 244, 312, 313, 321, 358-361, 365, 367, 369, 399, 408, 410, 415, 417-419, 430, 434, 441, 442, 444 (c) If removed, install the center overhead stowage box (AMM TASK 25-24-40-400-801). GOT 101-199, 201-215, 217, 219-244, 247-250, 303-305, 307, 308, 312, 313, 321-323, 327, 330-338, 340-343, 346-348, 350-353, 355, 356, 358-365, 367-399, 401, 403-410, 415-419, 430, 431, 434, 438, 439, 441, 442, 444 SUBTASK 05-55-15-410-023 (6) If removed, install recirculation air filter supports to access the connector/wire bundle. SUBTASK 05-55-15-410-029 (7) Do this task: Recirculation Air Filter - Installation, AMM TASK 21-25-01-400-801. GOT ALL SUBTASK 05-55-15-410-030 (8) Close these access panels: <table><tr><th><u>Number</u></th><th><u>Name/Location</u></th></tr><tr><td>121EW</td><td>Panel Assy - Fwd Cargo Compartment Aft Bulkhead</td></tr><tr><td>122GW</td><td>Panel Assy - FWD Cargo Compartment Aft Bulkhead</td></tr></table> SUBTASK 05-55-15-410-010 (9) Close these access panels: <table><tr><th><u>Number</u></th><th><u>Name/Location</u></th></tr><tr><td>112A</td><td>Forward Access Door</td></tr><tr><td>117A</td><td>Electronic Equipment Access Door</td></tr></table>				<u>Number</u>	<u>Name/Location</u>	121EW	Panel Assy - Fwd Cargo Compartment Aft Bulkhead	122GW	Panel Assy - FWD Cargo Compartment Aft Bulkhead	<u>Number</u>	<u>Name/Location</u>	112A	Forward Access Door	117A	Electronic Equipment Access Door	MECH	INSP
				<u>Number</u>	<u>Name/Location</u>												
				121EW	Panel Assy - Fwd Cargo Compartment Aft Bulkhead												
				122GW	Panel Assy - FWD Cargo Compartment Aft Bulkhead												
				<u>Number</u>	<u>Name/Location</u>												
				112A	Forward Access Door												
				117A	Electronic Equipment Access Door												
				EFFECTIVITY GOT ALL		SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL										
							D633A109-GOT 20-020-00-01										

Page 7 of 26
Jun 15/2025

GOT



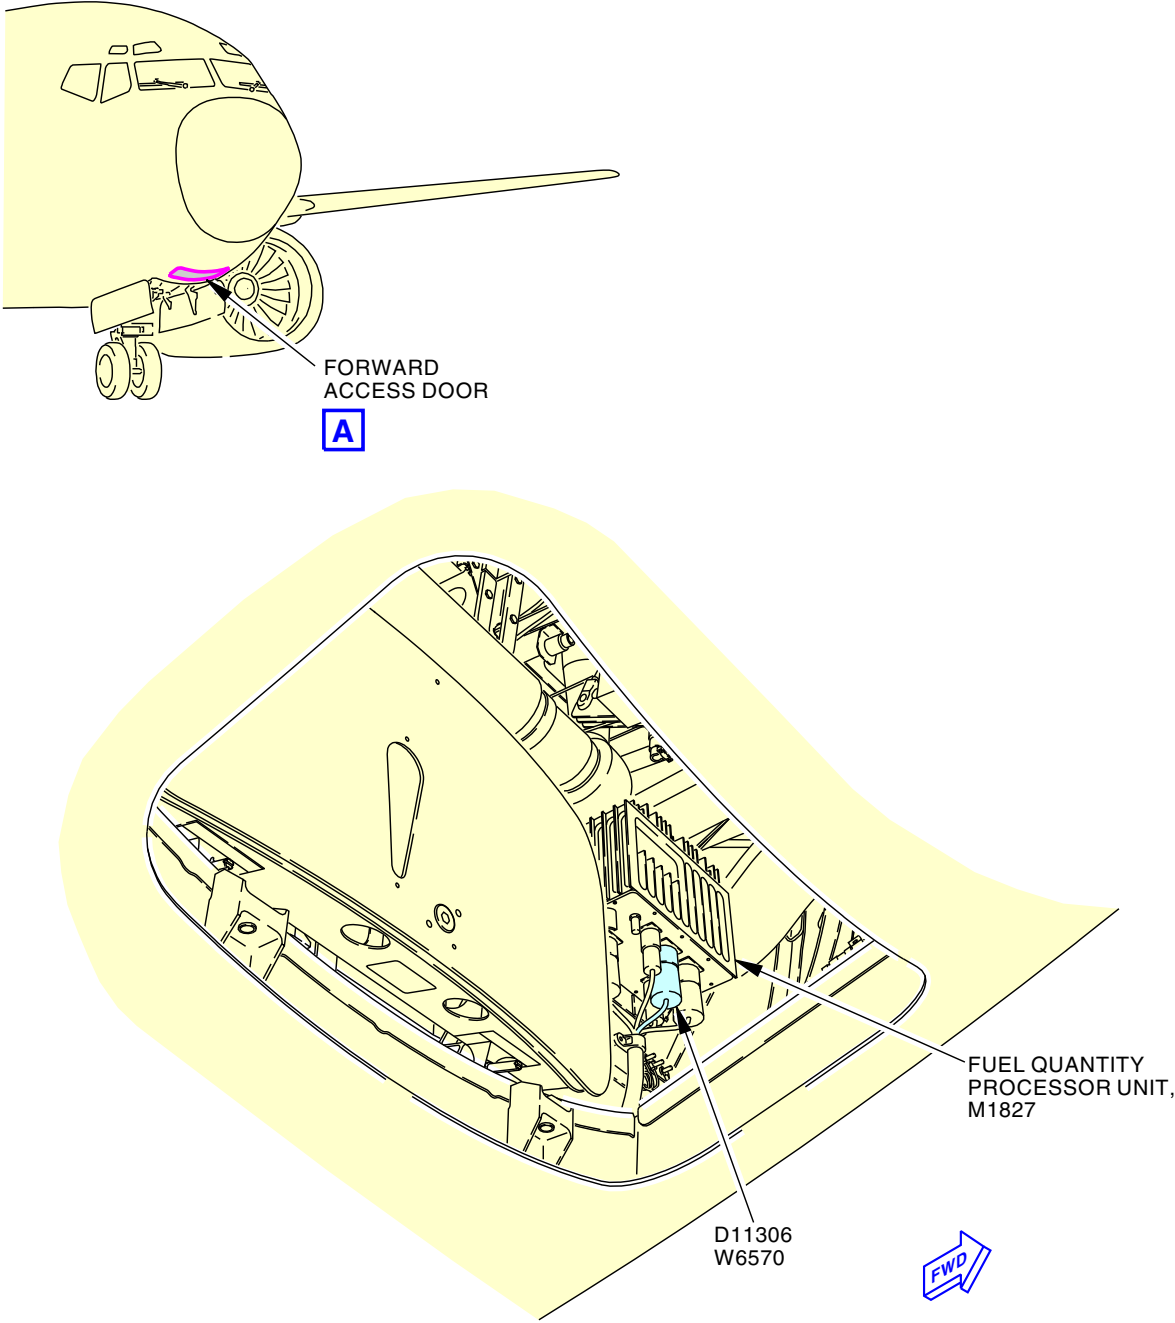
737-600/700/800/900 TASK CARDS

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01					
SUBTASK 05-55-15-410-021 (10) Close this access panel: <table border="1"><thead><tr><th><u>Number</u></th><th><u>Name/Location</u></th></tr></thead><tbody><tr><td>113BW</td><td>Forward Nose Wheel Well Panel</td></tr></tbody></table> (a) Do this task: Nose Wheel Well Access Panels - Installation, AMM TASK 53-14-01-420-801. ————— END OF TASK —————				<u>Number</u>	<u>Name/Location</u>	113BW	Forward Nose Wheel Well Panel	MECH	INSP
				<u>Number</u>	<u>Name/Location</u>				
113BW	Forward Nose Wheel Well Panel								
EFFECTIVITY GOT ALL		SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL						
			D633A109-GOT 20-020-00-01						
			Page 8 of 26 Jun 15/2023						


GOT



737-600/700/800/900 TASK CARDS

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
 FORWARD ACCESS DOOR FUEL QUANTITY PROCESSOR UNIT, M1827 D11306 W6570 FWD HIRF/LIGHTNING PROTECTION - WIRING IN THE FORWARD ACCESS AREA - INSPECTION Figure 1 428181 S0000138908_V2				
EFFECTIVITY GOT ALL	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL		
		D633A109-GOT 20-020-00-01		
		Page 9 of 26 Jun 15/2022		

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
------	-------------	---------	------------------	---------------------------------

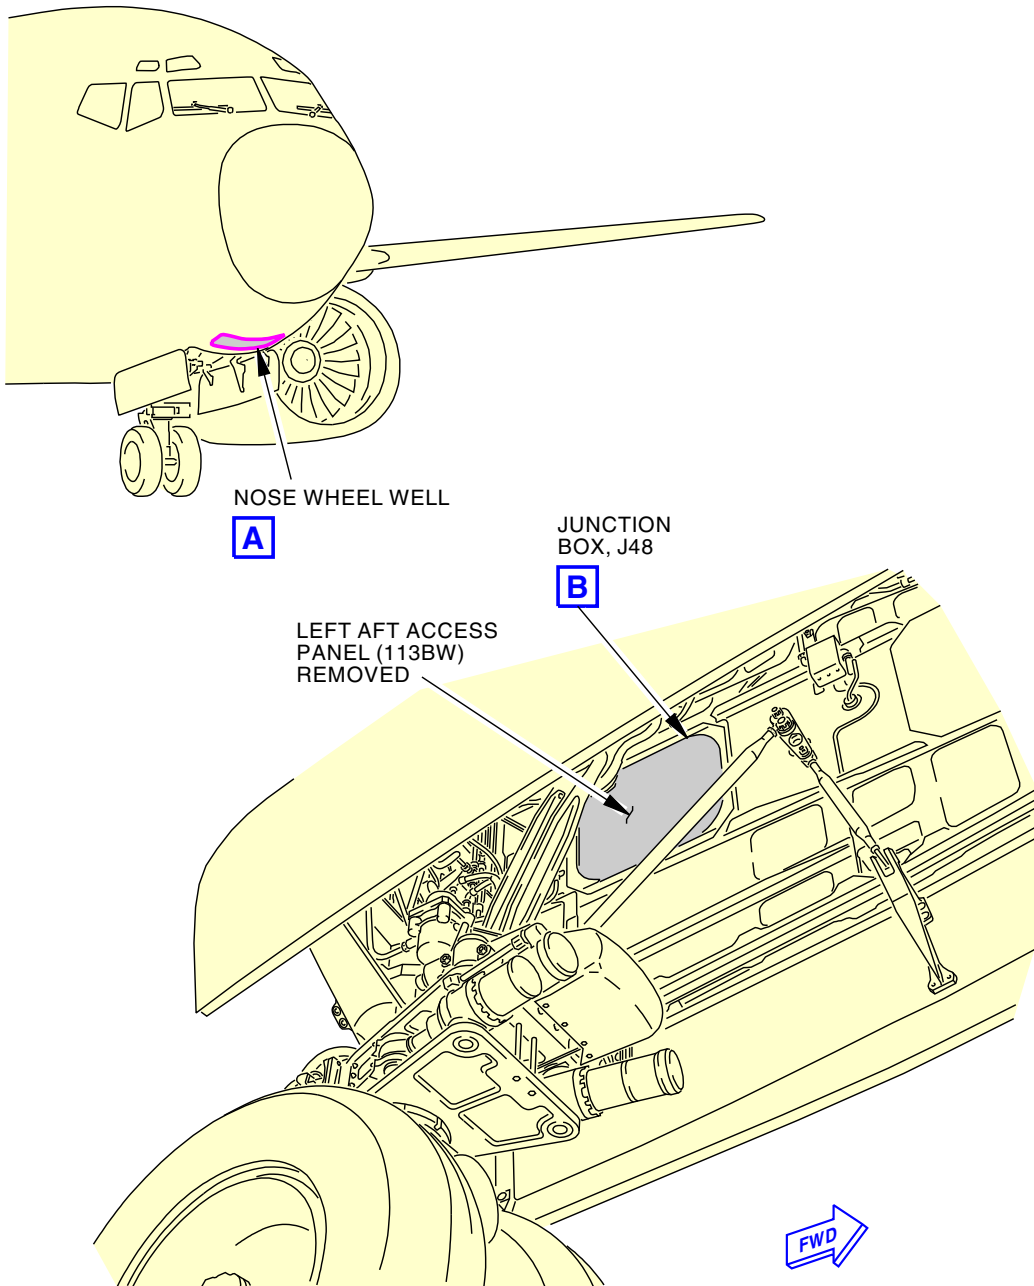

NOSE WHEEL WELL

A


400707 S0000135328_V2

HIRF/LIGHTNING PROTECTION - WIRING IN THE NOSE WHEEL WELL - INSPECTION

Figure 2 (Sheet 1 of 3)

EFFECTIVITY GOT ALL	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL
		D633A109-GOT 20-020-00-01
		Page 10 of 26 Jun 15/2022

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
------	-------------	---------	------------------	---------------------------------

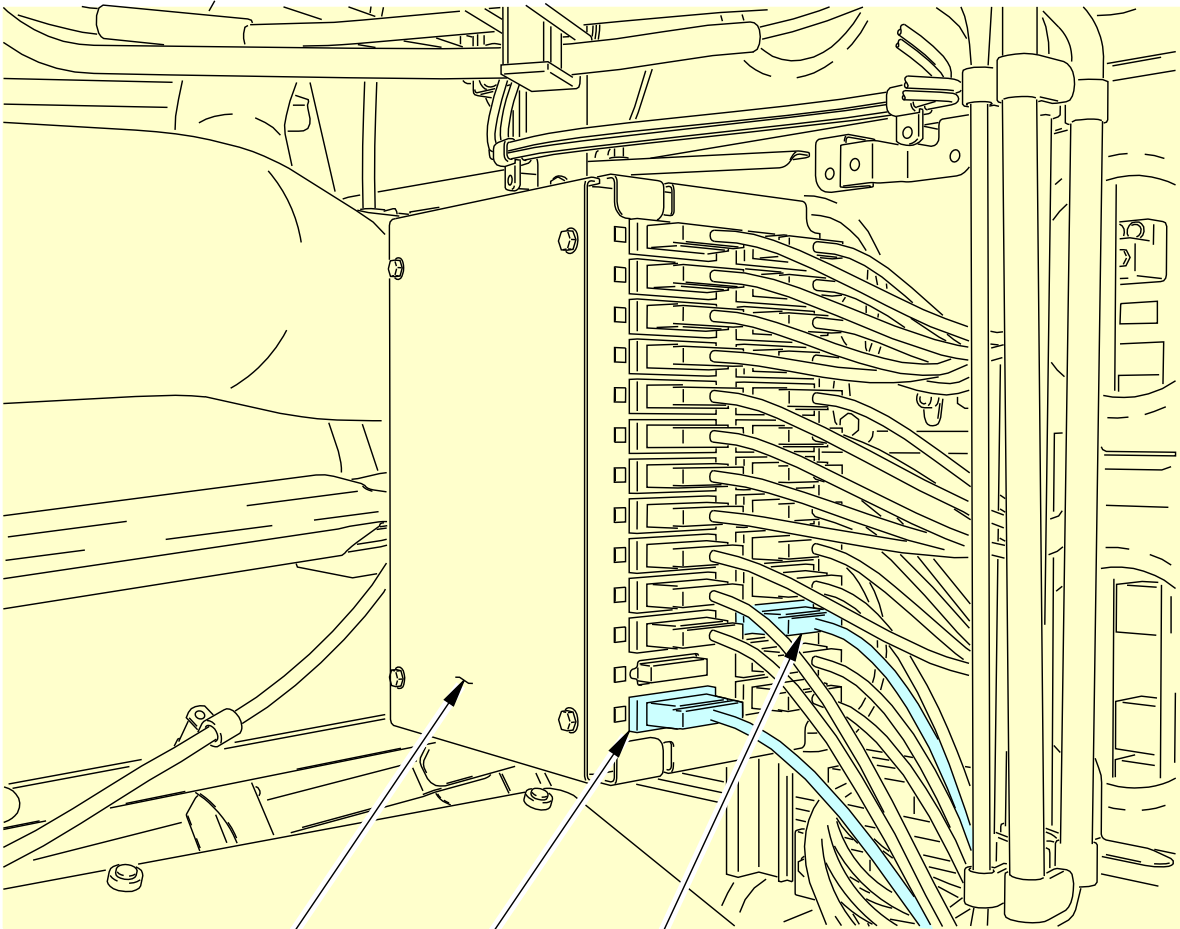

JUNCTION
BOX, J48

D48116P
W5158
(D48116J
W0088
OPPOSITE)

D48128P
W6570
(D48128J
W0088
OPPOSITE)

JUNCTION BOX, J48



400708 S0000135331_V2

HIRF/LIGHTNING PROTECTION - WIRING IN THE NOSE WHEEL WELL - INSPECTION
Figure 2 (Sheet 2 of 3)


EFFECTIVITY GOT 101-199, 201-215, 217, 219-244, 247-250, 303-309, 311-313, 315-317, 321-323, 327-338, 340-343, 346-348, 350-353, 355, 356, 358-365, 367-399, 401, 403-410, 415-419, 430, 438, 439, 441, 442, 444, 851-999	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL D633A109-GOT 20-020-00-01	Page 11 of 26 Jun 15/2025
---	---------------------------------	---	--

GOT



737-600/700/800/900
TASK CARDS

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
------	-------------	---------	------------------	---------------------------------

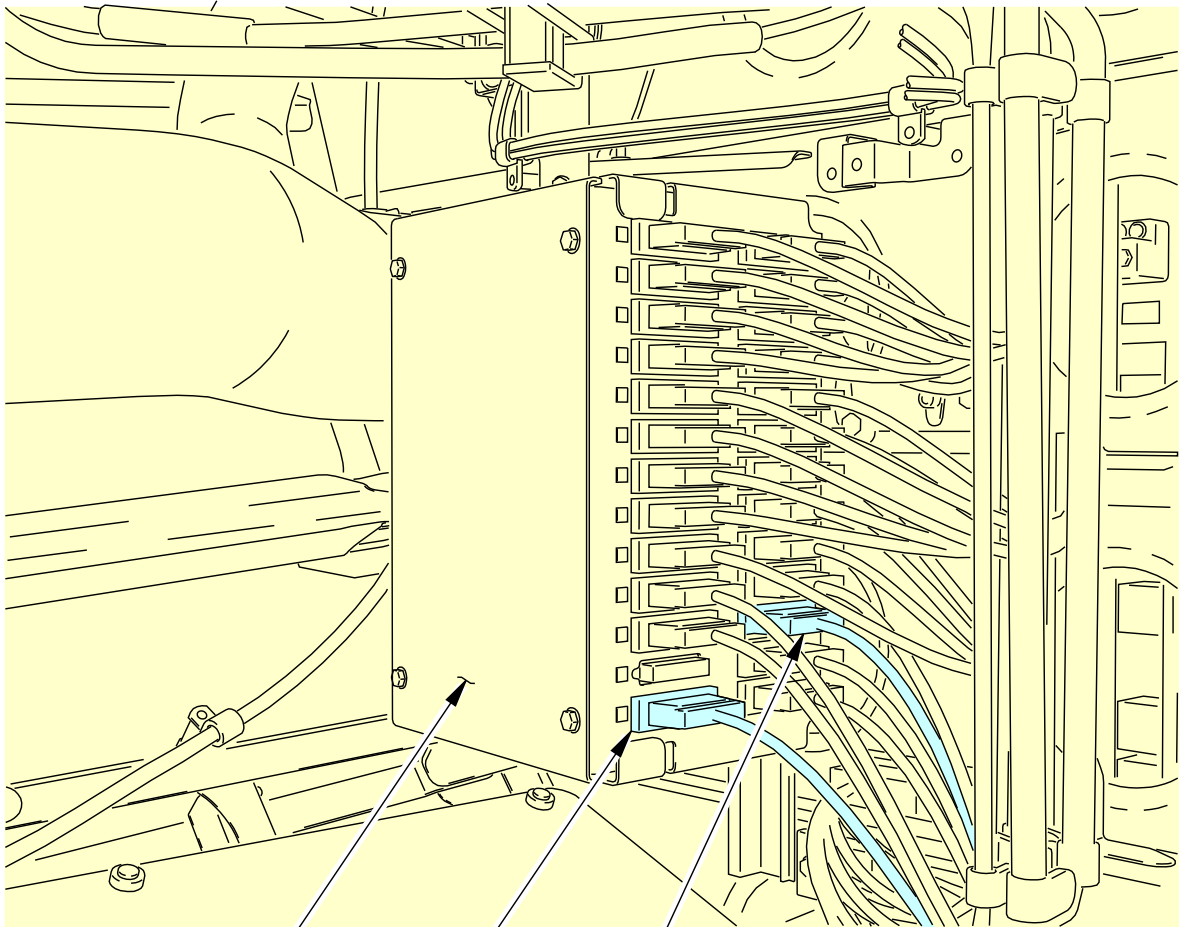

JUNCTION
BOX, J48

D48116P
W5158
(D48116J
W0088
OPPOSITE)

D47600P
W5558
(D47600J
W0088
OPPOSITE)

JUNCTION BOX, J48



2921327 S0000703577_V1

HIRF/LIGHTNING PROTECTION - WIRING IN THE NOSE WHEEL WELL - INSPECTION

Figure 2 (Sheet 3 of 3)



EFFECTIVITY GOT 431, 434	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL D633A109-GOT 20-020-00-01	Page 12 of 26 Jun 15/2022
-----------------------------	---------------	---	------------------------------

GOT



737-600/700/800/900 TASK CARDS

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
------	-------------	---------	------------------	---------------------------------

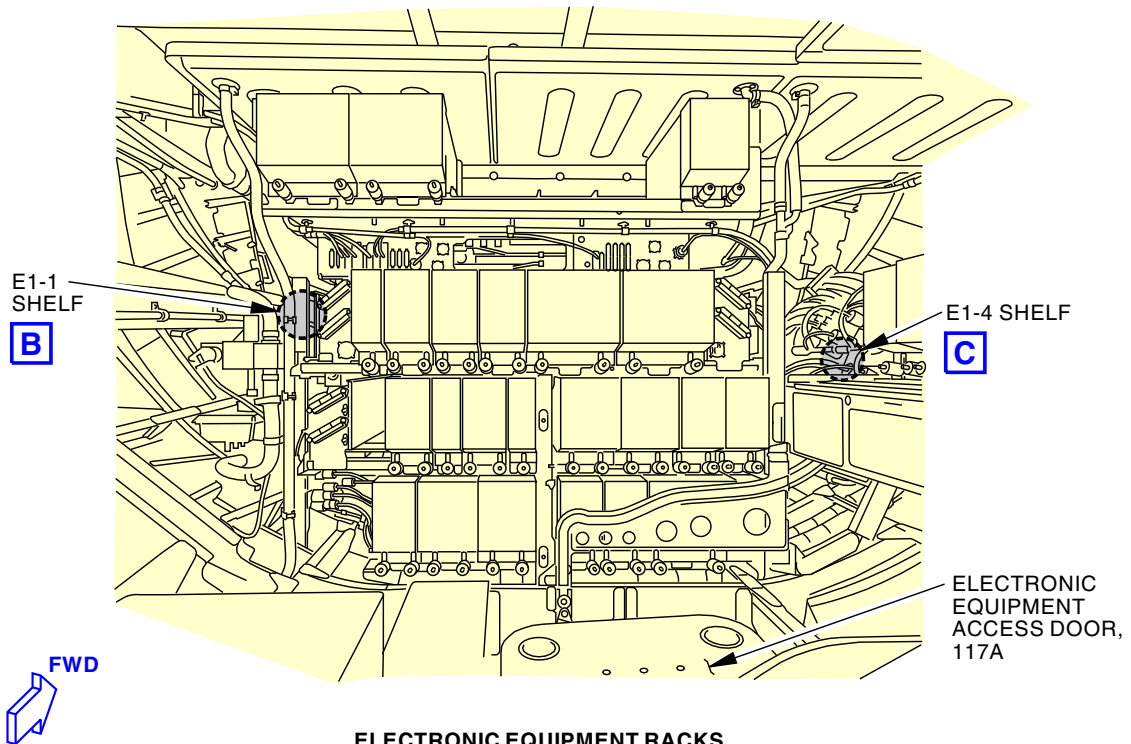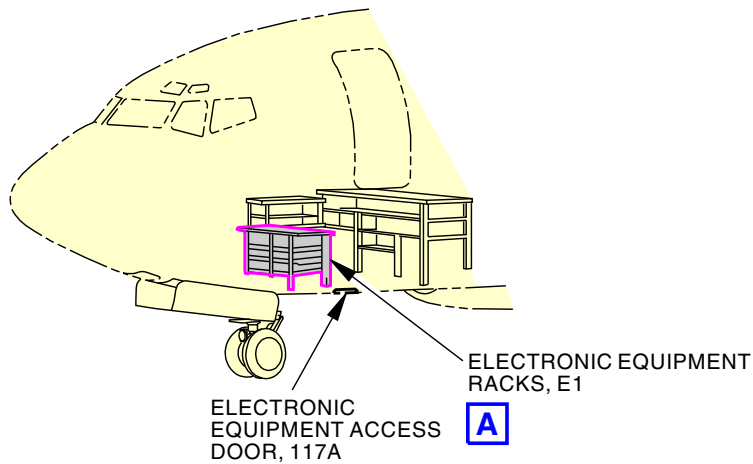

ELECTRONIC EQUIPMENT RACKS

400733 S0000135456_V3

HIRF/LIGHTNING PROTECTION - WIRING IN THE E/E BAY MAIN EQUIPMENT CENTER - INSPECTION


Figure 3 (Sheet 1 of 3)

EFFECTIVITY GOT ALL	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL
		D633A109-GOT 20-020-00-01
		Page 13 of 26 Jun 15/2022

GOT



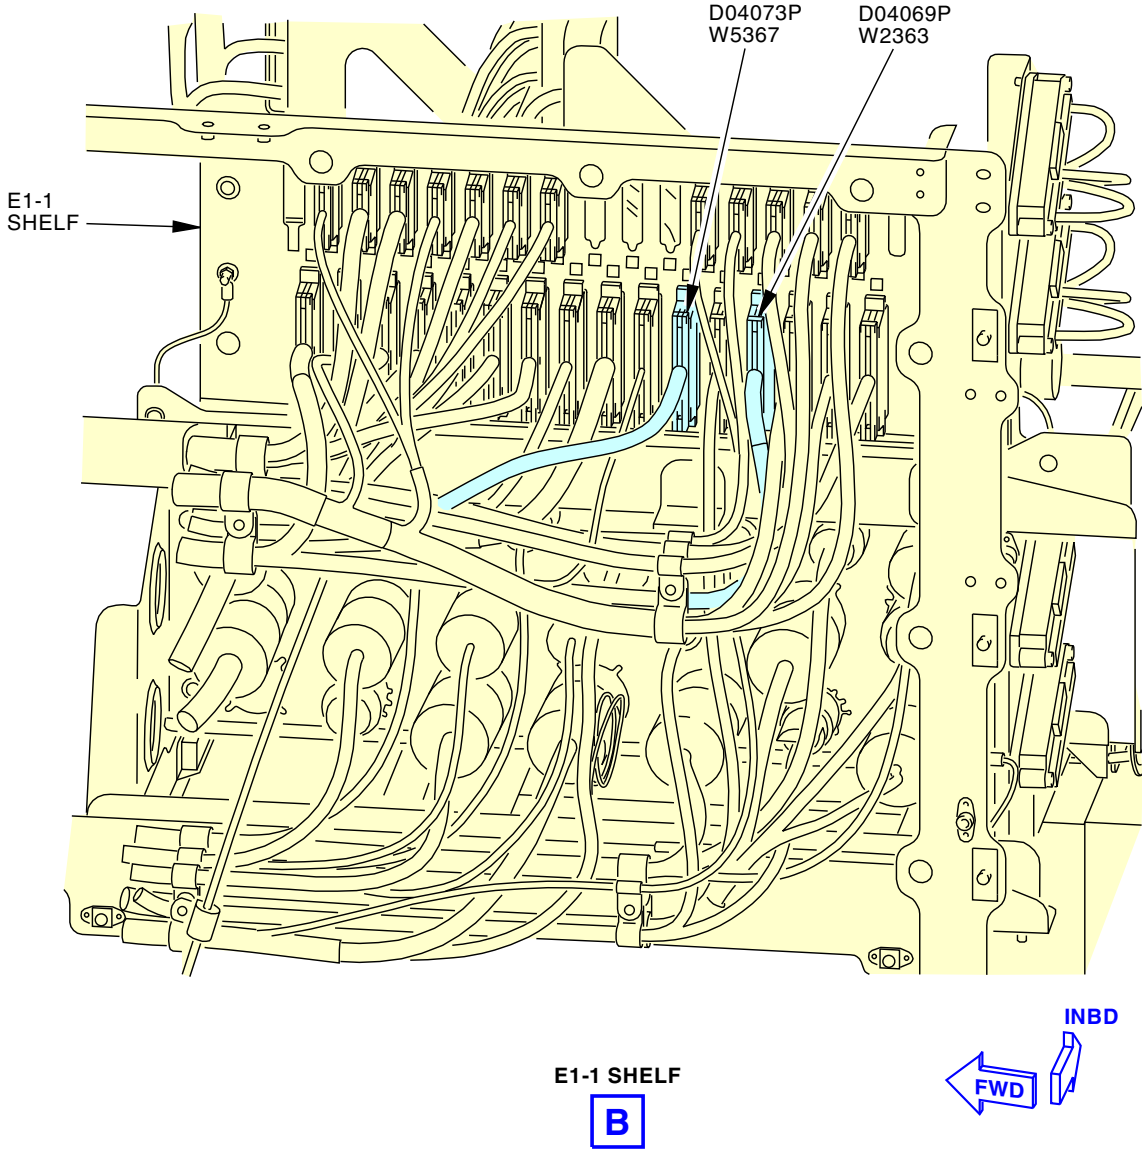737-600/700/800/900 TASK CARDS


DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
 E1-1 SHELF D04073P W5367 D04069P W2363 B FWD INBD 400736 S0000135458_V2 HIRF/LIGHTNING PROTECTION - WIRING IN THE E/E BAY MAIN EQUIPMENT CENTER - INSPECTION Figure 3 (Sheet 2 of 3)				
EFFECTIVITY GOT ALL	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL		
		D633A109-GOT 20-020-00-01		
		Page 14 of 26 Jun 15/2022		

GOT



737-600/700/800/900
TASK CARDS

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
------	-------------	---------	------------------	---------------------------------

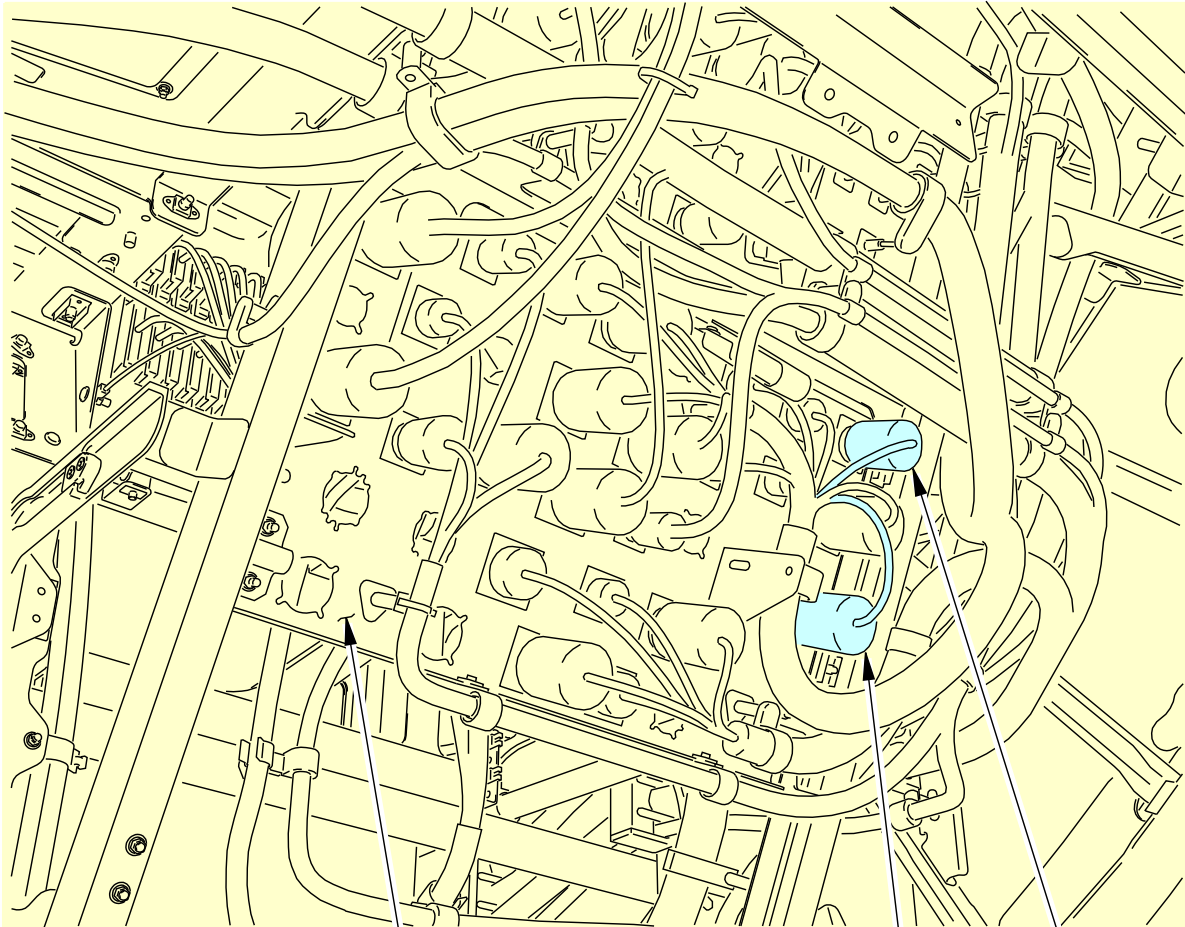

DISCONNECT
PANEL, AE104A
(E1-4 SHELF)

D04077J
W5375

D08019J
W2465



DISCONNECT PANEL, AE0104A



400740 S0000135459_V3



HIRF/LIGHTNING PROTECTION - WIRING IN THE E/E BAY MAIN EQUIPMENT CENTER - INSPECTION
Figure 3 (Sheet 3 of 3)

EFFECTIVITY GOT ALL	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL D633A109-GOT 20-020-00-01	Page 15 of 26 Jun 15/2022
------------------------	---------------	---	------------------------------

GOT



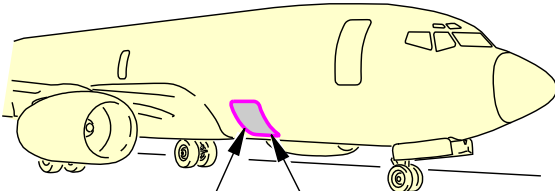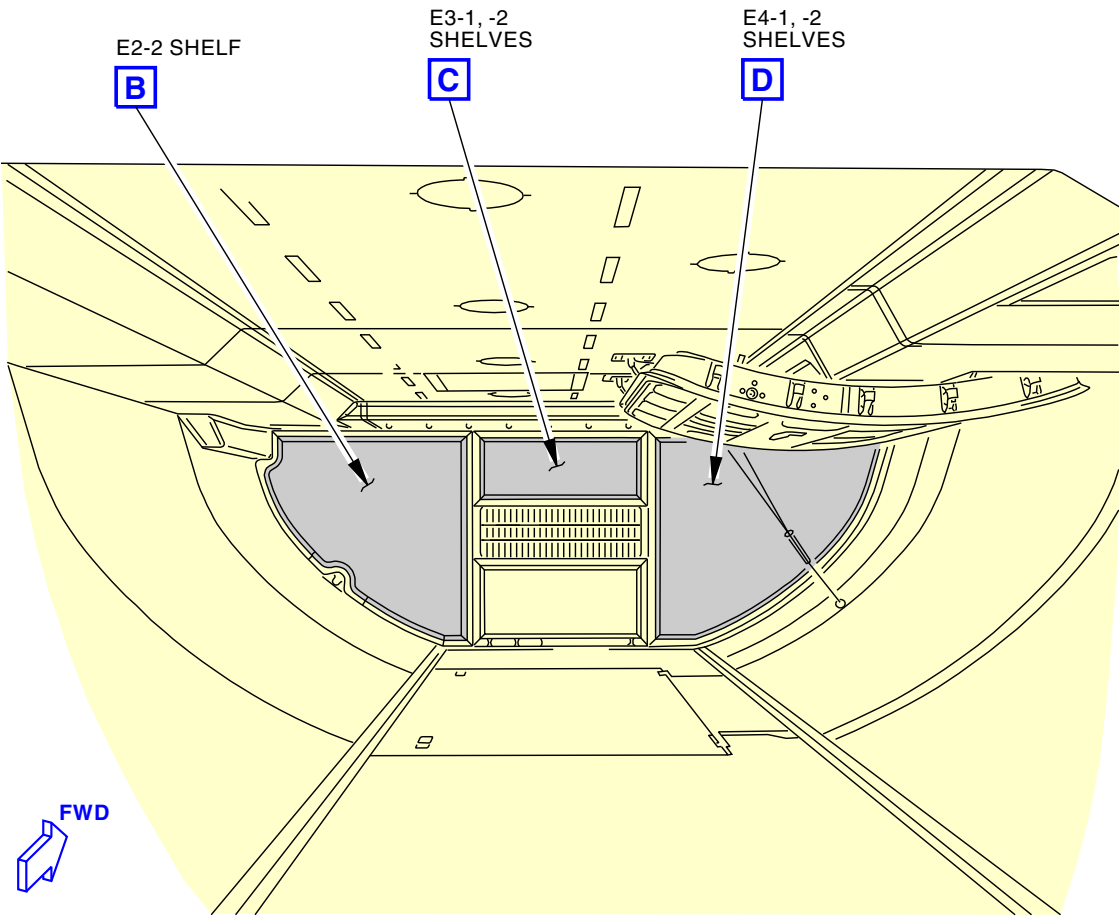
737-600/700/800/900
TASK CARDS

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
 FORWARD CARGO COMPARTMENT FORWARD CARGO DOOR A  E2-2 SHELF E3-1, -2 SHELVES E4-1, -2 SHELVES B C D FWD FORWARD CARGO COMPARTMENT A				
400751 S0000135618_V2 HIRF/LIGHTNING PROTECTION - WIRING IN THE FORWARD CARGO COMPARTMENT, FORWARD - INSPECTION Figure 4 (Sheet 1 of 4)				
EFFECTIVITY GOT ALL		SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL	
			D633A109-GOT 20-020-00-01	
			Page 16 of 26 Jun 15/2022	

GOT



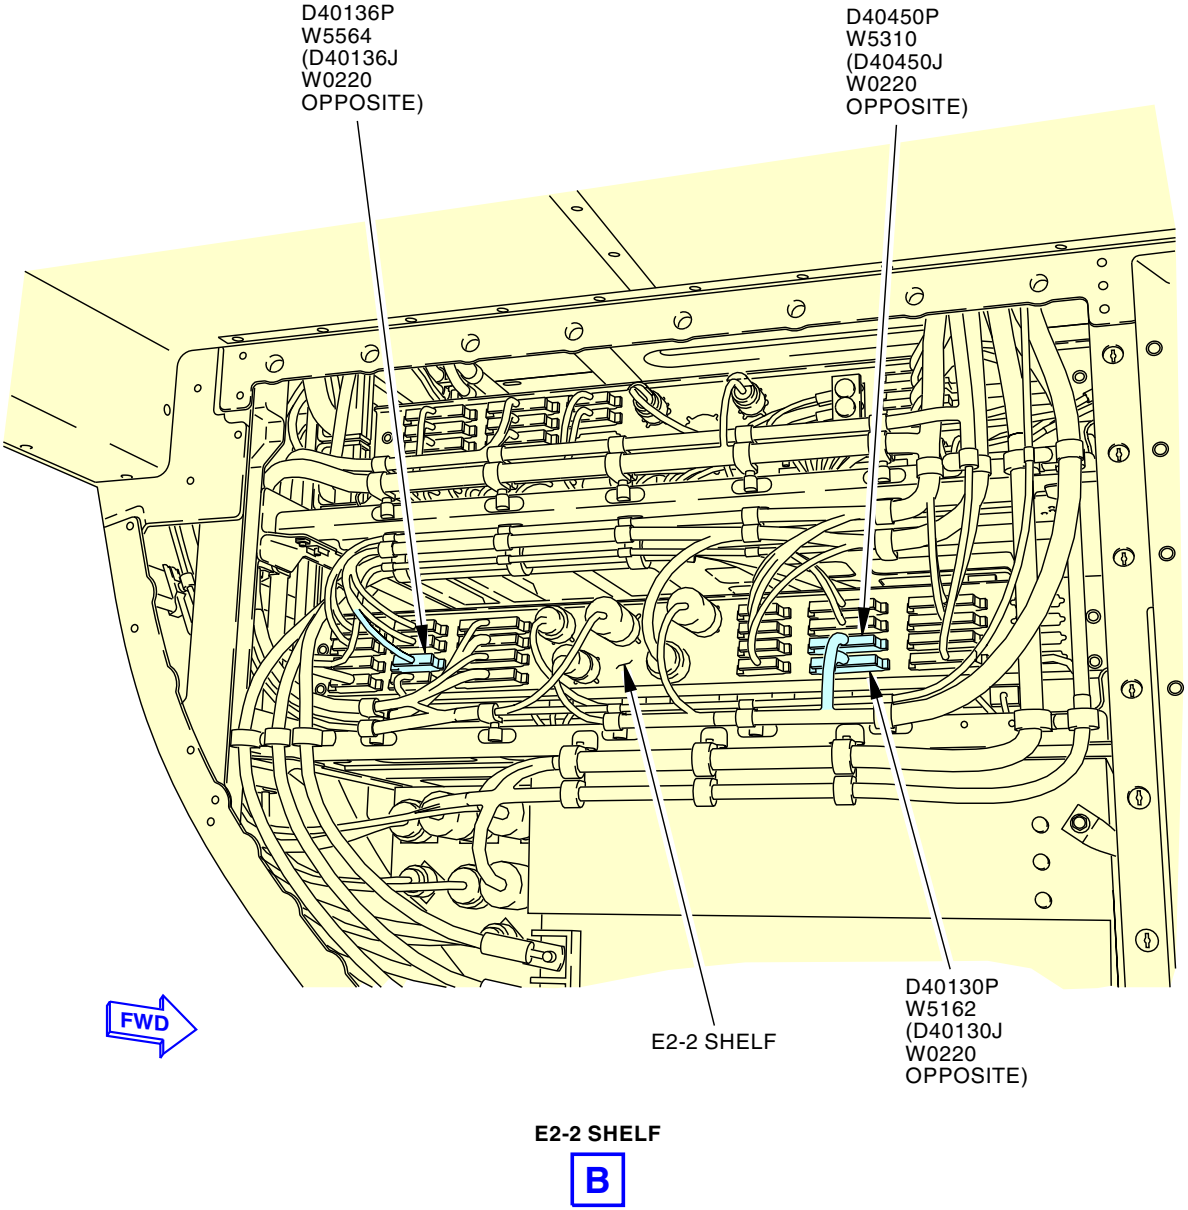737-600/700/800/900 TASK CARDS


DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
 D40136P W5564 (D40136J W0220 OPPOSITE) D40450P W5310 (D40450J W0220 OPPOSITE) FWD E2-2 SHELF D40130P W5162 (D40130J W0220 OPPOSITE) E2-2 SHELF B				
400752 S0000135716_V2 HIRF/LIGHTNING PROTECTION - WIRING IN THE FORWARD CARGO COMPARTMENT, FORWARD - INSPECTION Figure 4 (Sheet 2 of 4)				
EFFECTIVITY GOT ALL	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL		
		D633A109-GOT 20-020-00-01		
		Page 17 of 26 Jun 15/2022		

GOT



737-600/700/800/900 TASK CARDS

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
------	-------------	---------	------------------	---------------------------------

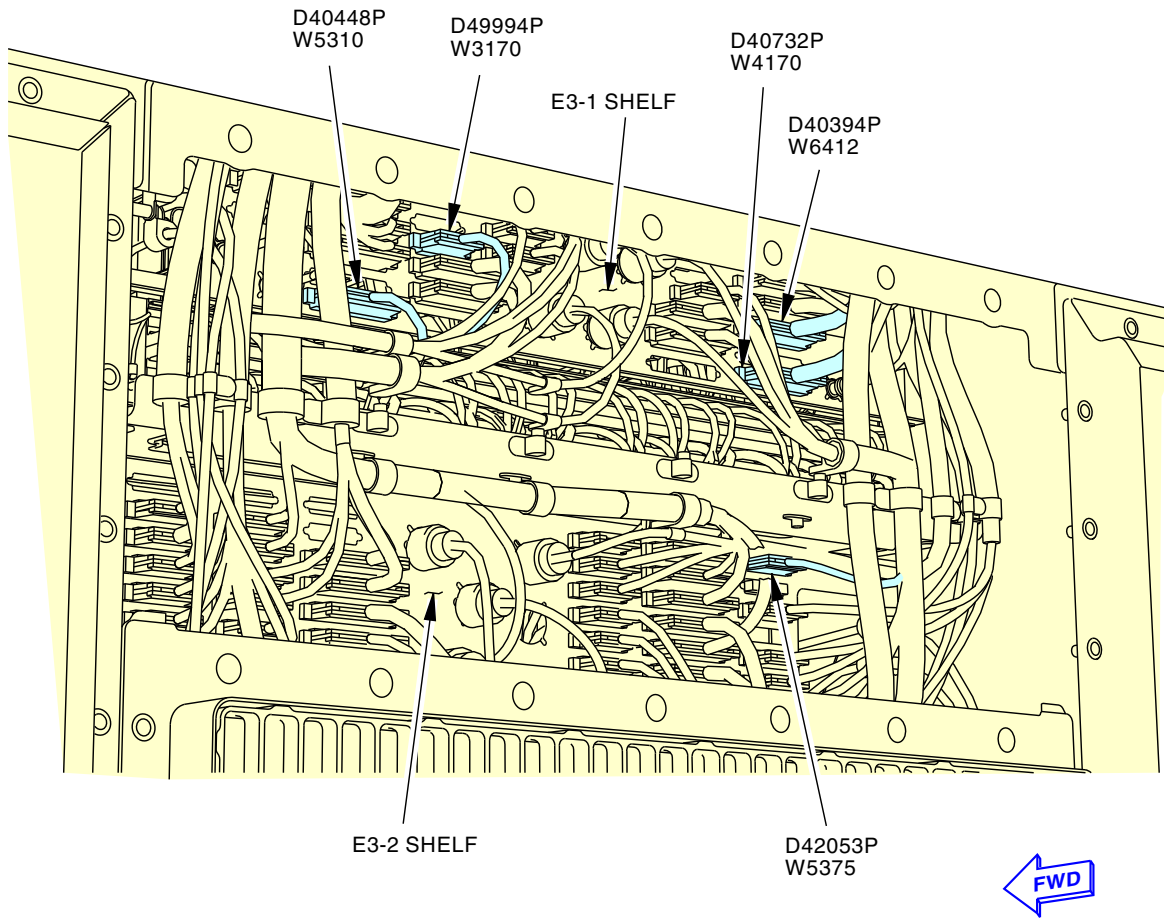

E3-1, -2 SHELVES



400753 S0000135717_V2
**HIRF/LIGHTNING PROTECTION - WIRING IN THE FORWARD CARGO COMPARTMENT, FORWARD -
INSPECTION**
Figure 4 (Sheet 3 of 4)


EFFECTIVITY GOT ALL	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL D633A109-GOT 20-020-00-01	Page 18 of 26 Jun 15/2022
------------------------	---------------	---	------------------------------

GOT



737-600/700/800/900 TASK CARDS

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
------	-------------	---------	------------------	---------------------------------

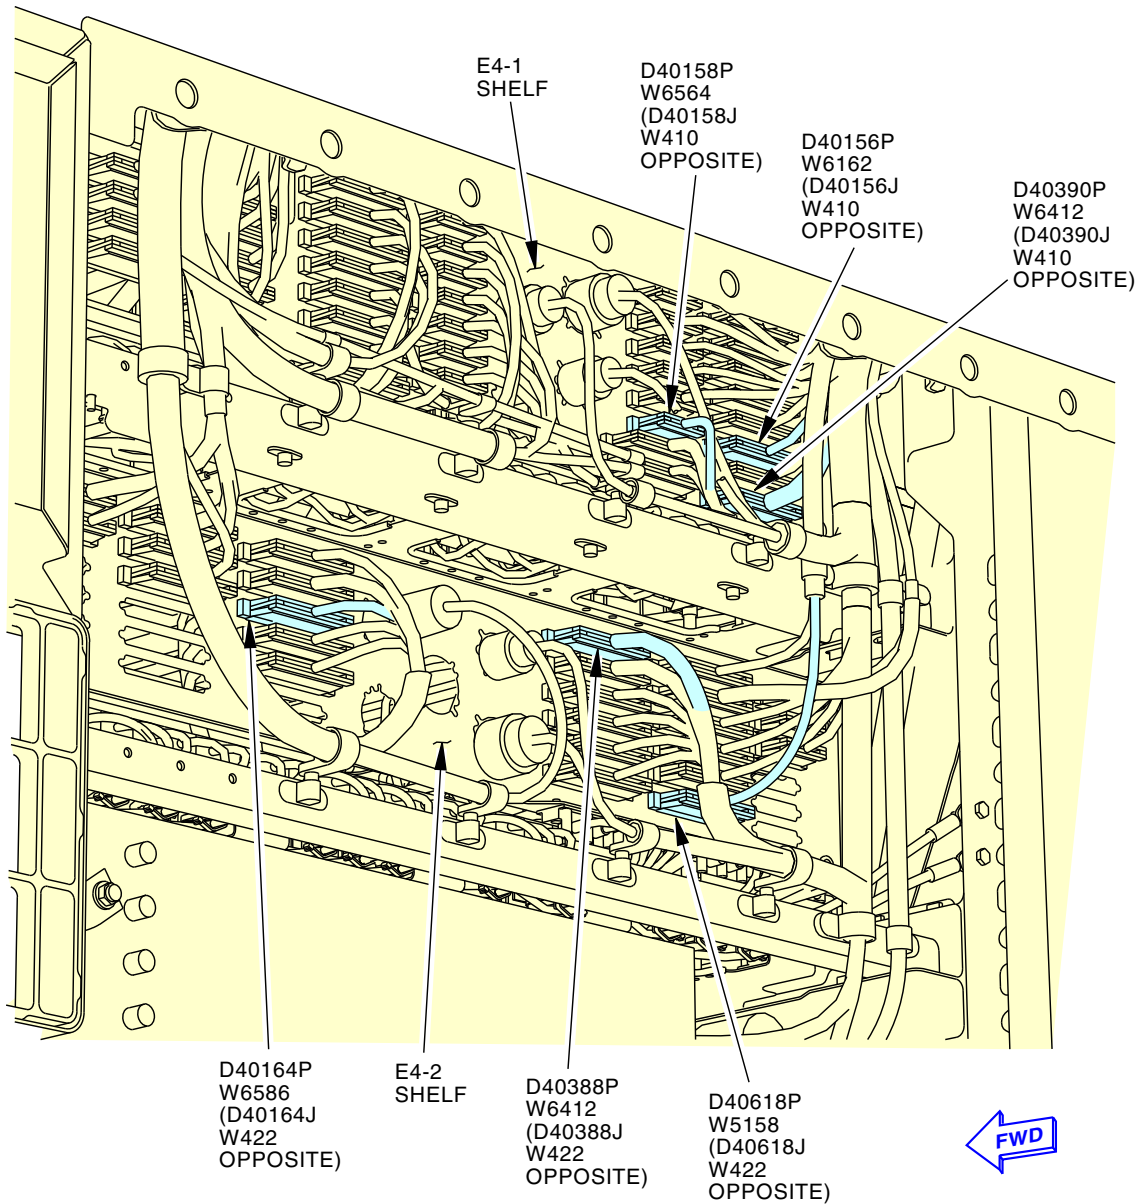

E4-1, -2 SHELVES





400754 S0000135718_V3
HIRF/LIGHTNING PROTECTION - WIRING IN THE FORWARD CARGO COMPARTMENT, FORWARD - INSPECTION
Figure 4 (Sheet 4 of 4)


EFFECTIVITY GOT ALL	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL D633A109-GOT 20-020-00-01	Page 19 of 26 Jun 15/2022
------------------------	---------------	--	------------------------------

GOT



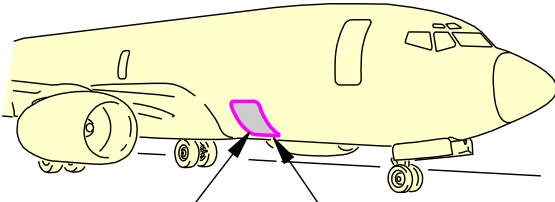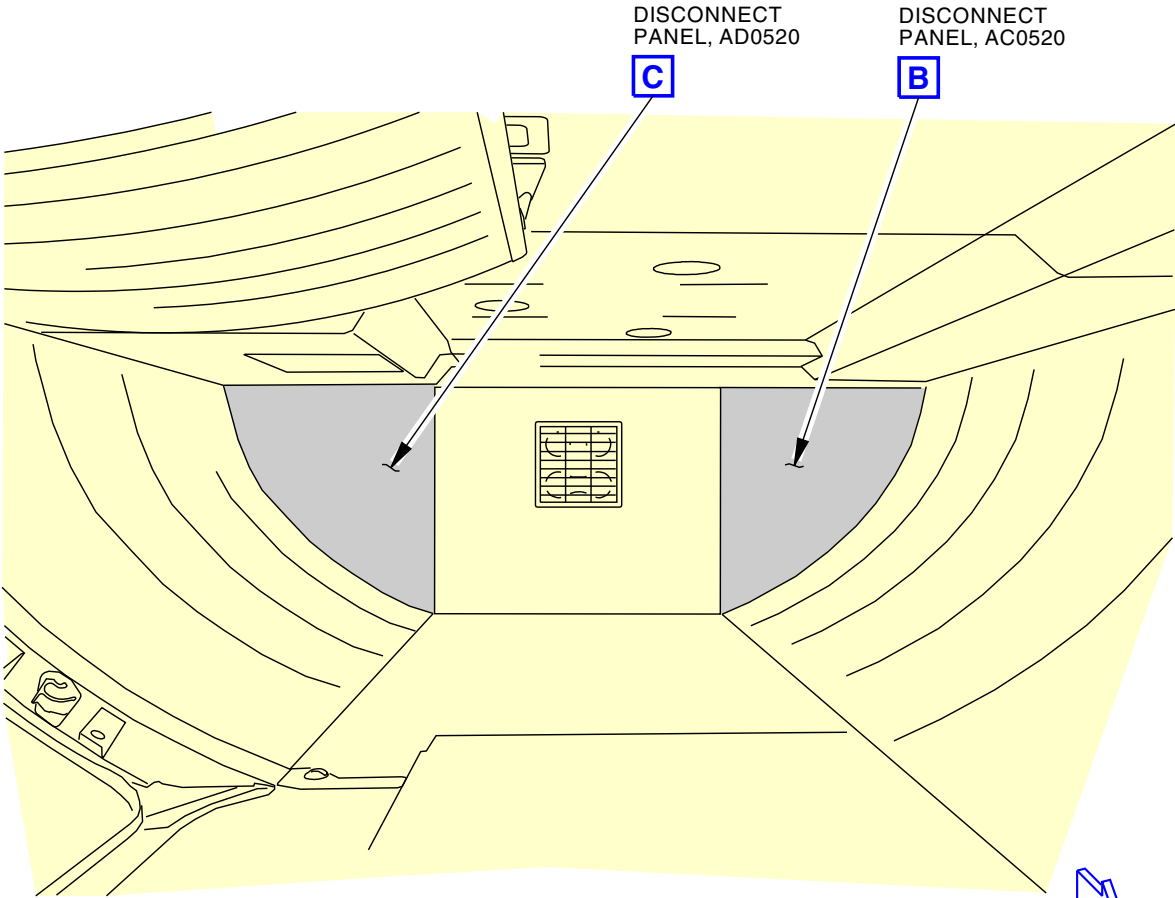737-600/700/800/900 TASK CARDS


DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
 FORWARD CARGO COMPARTMENT FORWARD CARGO DOOR A  DISCONNECT PANEL, AD0520 DISCONNECT PANEL, AC0520 C B FORWARD CARGO COMPARTMENT A FWD 400769 S0000135754_V2 HIRF/LIGHTNING PROTECTION - WIRING IN THE FORWARD CARGO COMPARTMENT, AFT - INSPECTION Figure 5 (Sheet 1 of 3)				
EFFECTIVITY GOT ALL		SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL	
			D633A109-GOT 20-020-00-01	
			Page 20 of 26 Jun 15/2022	

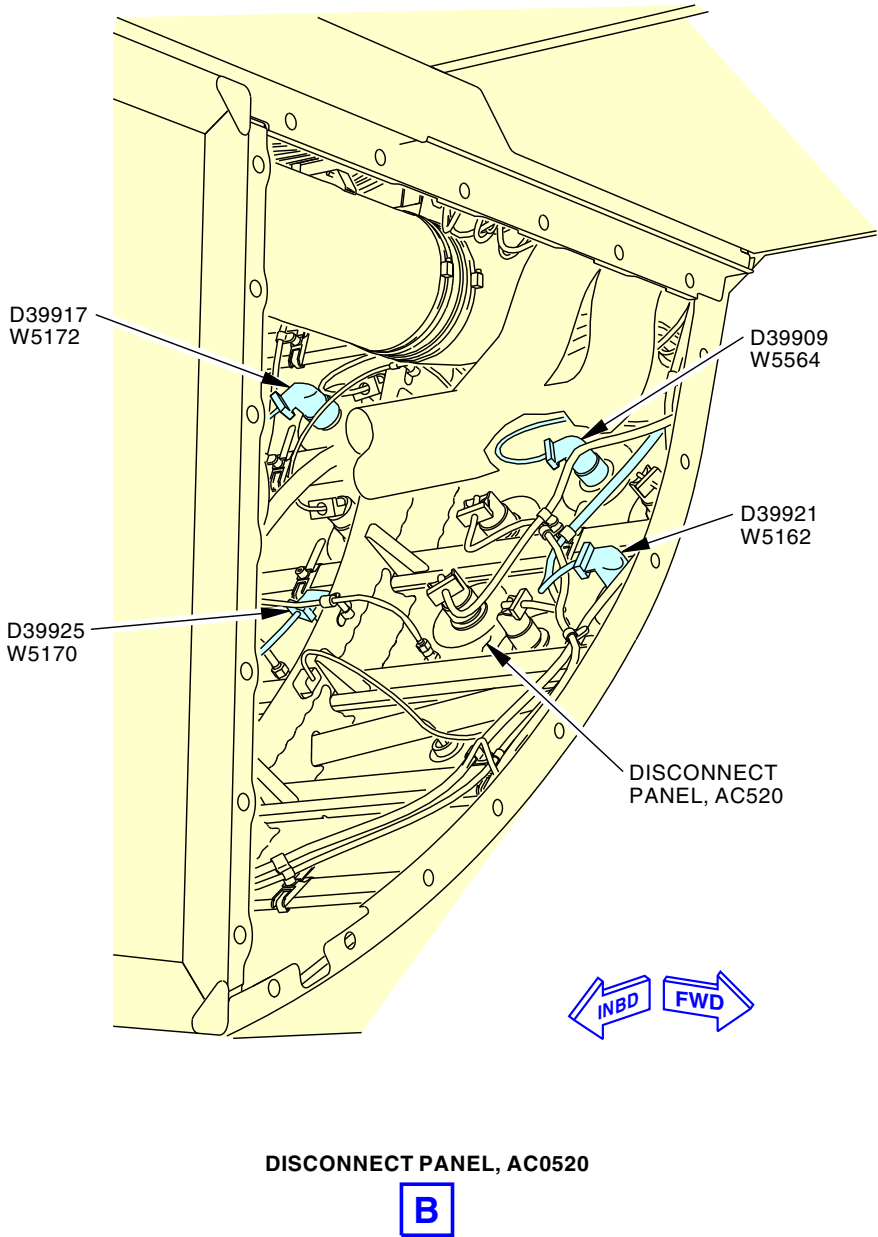DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
 D39917 W5172 D39909 W5564 D39921 W5162 D39925 W5170 DISCONNECT PANEL, AC520 INBD FWD DISCONNECT PANEL, AC0520 B				
400771 S0000135756_V2 HIRF/LIGHTNING PROTECTION - WIRING IN THE FORWARD CARGO COMPARTMENT, AFT - INSPECTION Figure 5 (Sheet 2 of 3)				
EFFECTIVITY GOT ALL	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL		
		D633A109-GOT 20-020-00-01		
				Page 21 of 26 Jun 15/2022

GOT




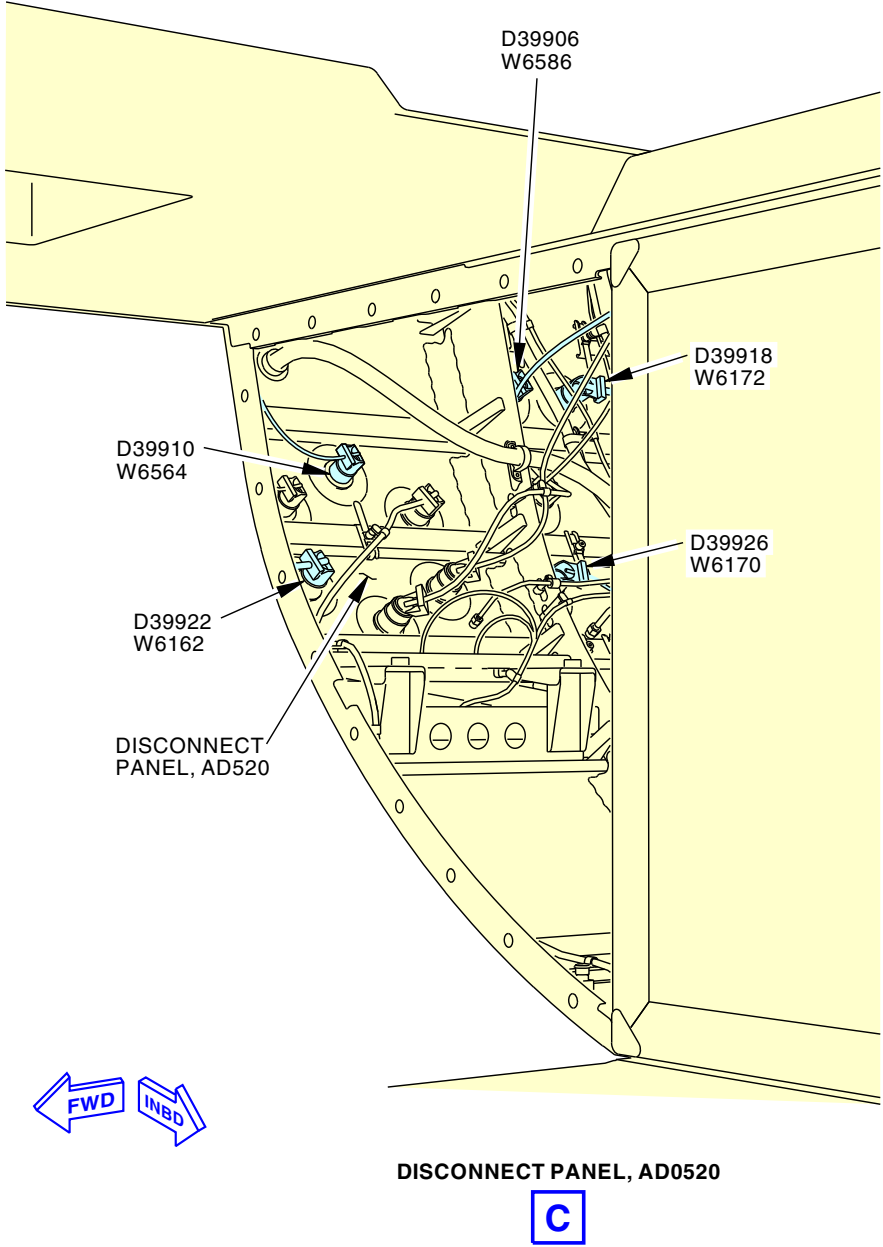
737-600/700/800/900 TASK CARDS

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
 DISCONNECT PANEL, AD0520 NOTE: MIX BAY AIR DISTRIBUTION SYSTEM NOT SHOWN FOR CLARITY. 400773 S0000135757_V2 HIRF/LIGHTNING PROTECTION - WIRING IN THE FORWARD CARGO COMPARTMENT, AFT - INSPECTION Figure 5 (Sheet 3 of 3)				
EFFECTIVITY GOT ALL	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL		
		D633A109-GOT 20-020-00-01		
		Page 22 of 26 Jun 15/2022		


GOT



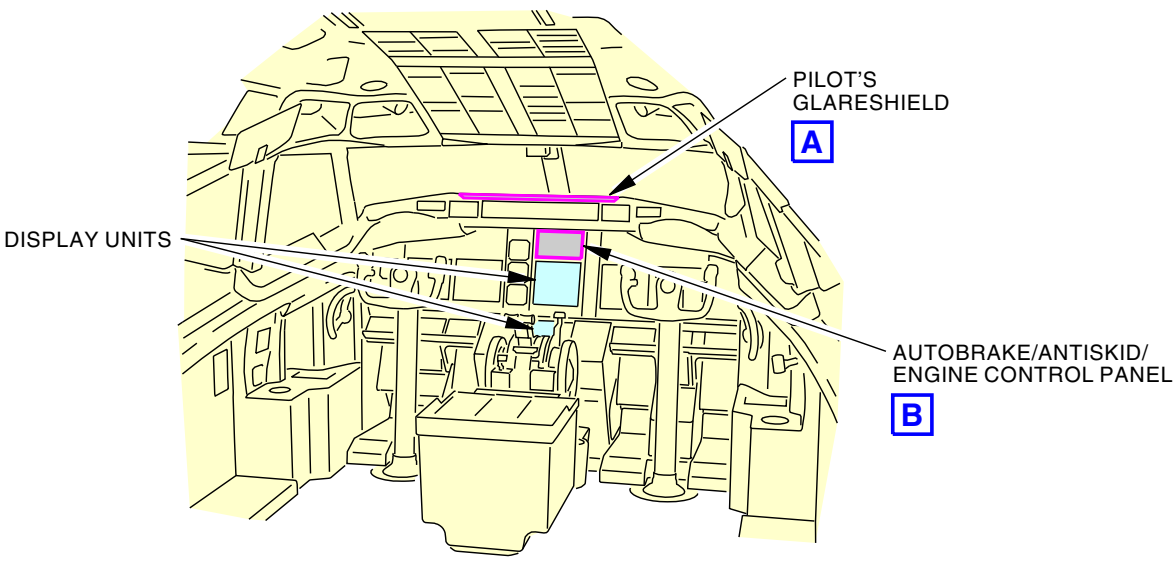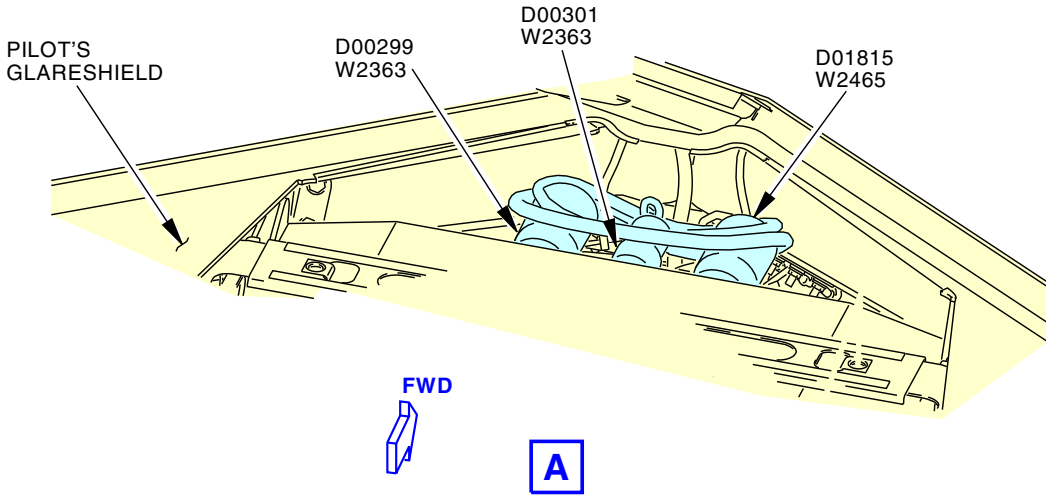737-600/700/800/900
TASK CARDS

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
 FLIGHT COMPARTMENT  HIRF/LIGHTNING PROTECTION - WIRING IN THE FLIGHT COMPARTMENT - INSPECTION Figure 6 (Sheet 1 of 2)				
EFFECTIVITY GOT ALL	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL		
		D633A109-GOT 20-020-00-01		
		Page 23 of 26 Jun 15/2022		

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
------	-------------	---------	------------------	--

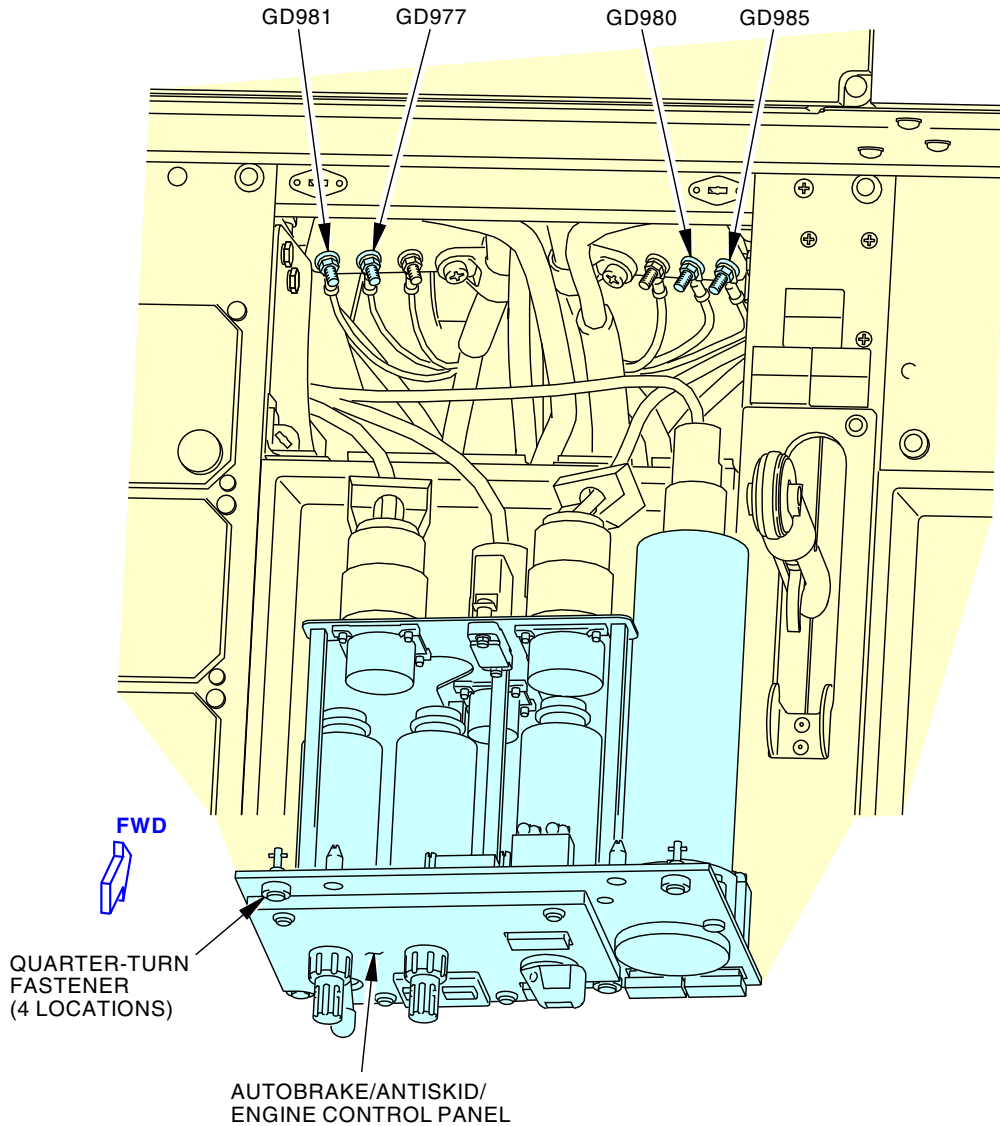



B

418363 S0000137020_V2


HIRF/LIGHTNING PROTECTION - WIRING IN THE FLIGHT COMPARTMENT - INSPECTION

Figure 6 (Sheet 2 of 2)

EFFECTIVITY GOT ALL	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL
		D633A109-GOT 20-020-00-01
		Page 24 of 26 Jun 15/2022

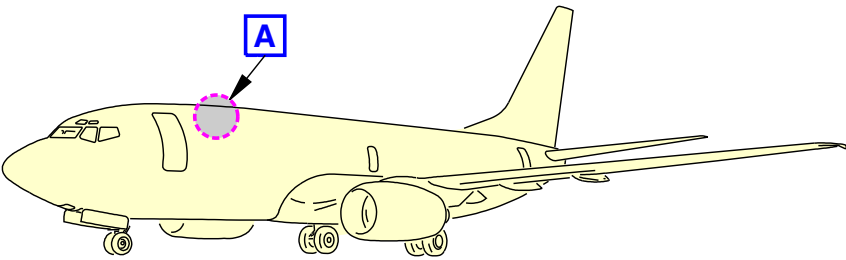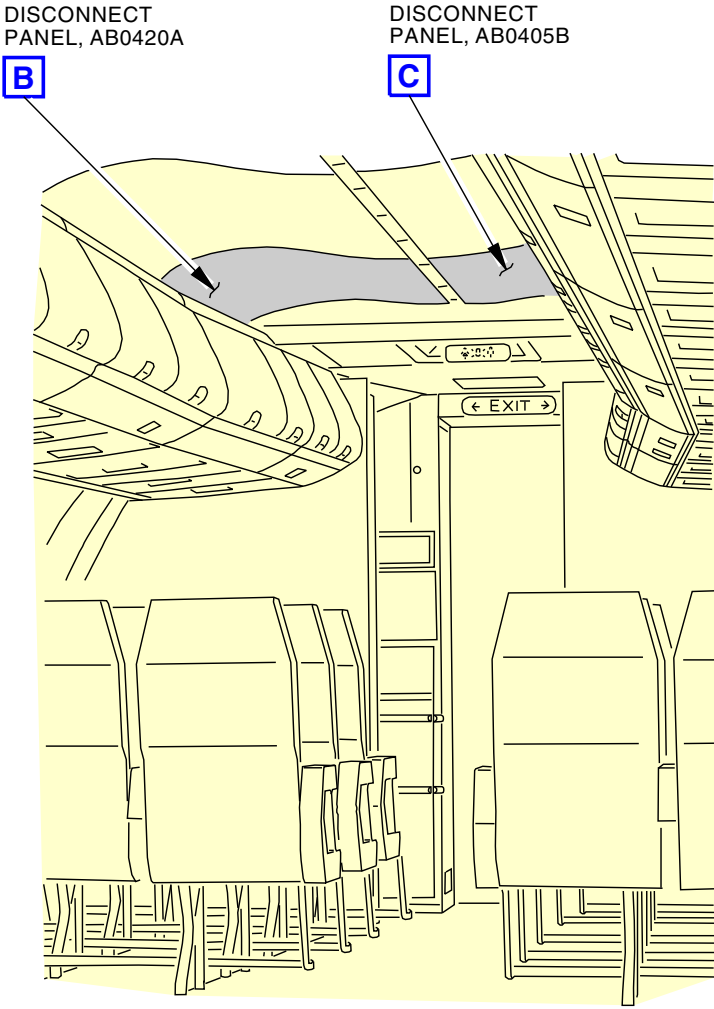
DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
  A				
HIRF/LIGHTNING PROTECTION - WIRING IN THE PASSENGER CABIN, FORWARD - INSPECTION Figure 7 (Sheet 1 of 2) 400788 S0000135856_V2				
EFFECTIVITY GOT ALL	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL D633A109-GOT 20-020-00-01		
			Page 25 of 26 Jun 15/2022	

DATE	TAIL NUMBER	STATION	AIRLINE CARD NO.	BOEING CARD NO. 20-020-00-01
------	-------------	---------	------------------	---------------------------------

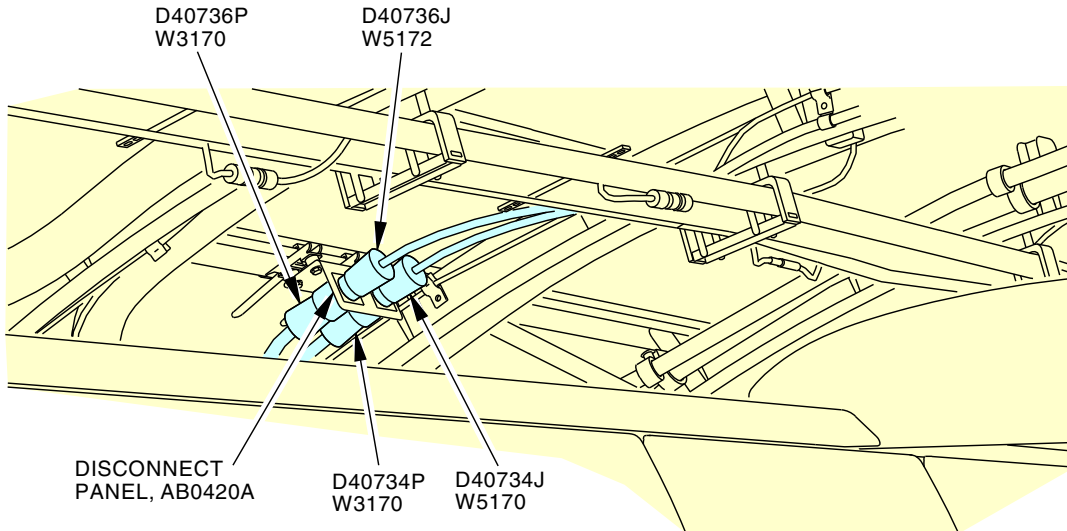

DISCONNECT PANEL, AB0420A

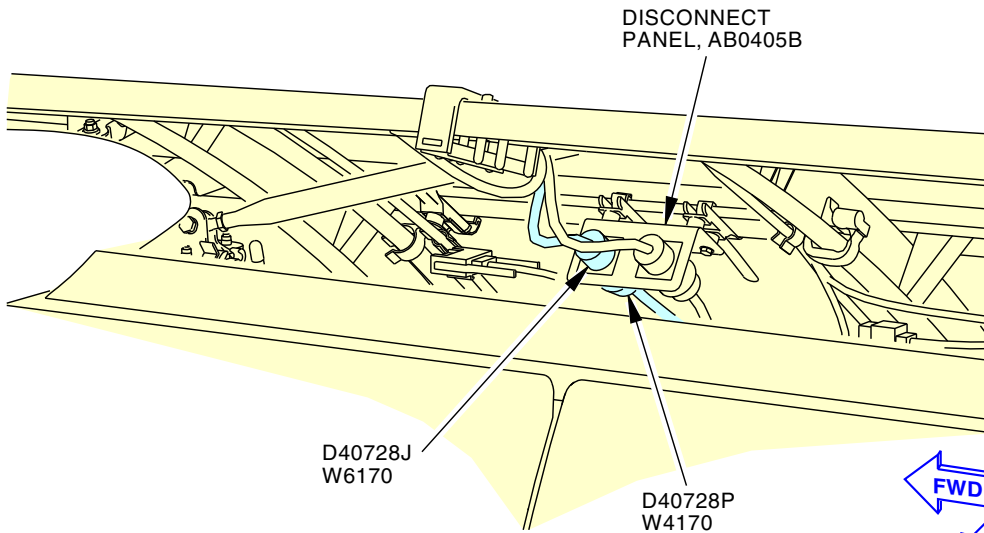B



DISCONNECT PANEL, AB0405B

C



400790 S0000135857_V2

HIRF/LIGHTNING PROTECTION - WIRING IN THE PASSENGER CABIN, FORWARD - INSPECTION

Figure 7 (Sheet 2 of 2)

EFFECTIVITY GOT ALL	SOURCE MRB	GVI OF HIRF/L SENSITIVE WIRE RUNS INSIDE THE PRESSURE VESSEL
		D633A109-GOT 20-020-00-01