
CONFIDENTIAL B



Telephony技术月刊

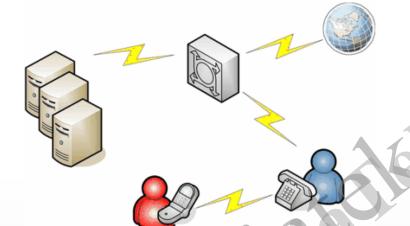

2017年08月刊

CT VOLTE配置说明

- CT VOLTE可以在OM版本上打开,也可以在CT定制版本上打开。
- 具体配置请在MTK online (DCC) 上搜索 "CT_C库_送测版本准备", 文档中有专门关于CT VOLTE配置, 请严格按照说明配置。



范例1: 6577 AND Datasheet:可以搜索到同时包含 6577 和 Datasheet 的资料喔

范例2: "6577 Datasheet" (含双引号): 可以搜索到包含 6577 Datasheet 这段话的资料喔

MOL Quick Start特别推荐 Message专区

• 专栏介绍

- ▶ 短信、彩信和小区广播协议基础知识
- > MTK Mms应用的设计
- > 短信、彩信和小区广播的常见问题分析方法
- ➤ 若学习Message知识或者分析Message问题时遇到疑问,可先查询专区。
 - MOL中输入关键字搜索"Message专区"
 - 专栏网址如下:

http://online.mediatek.inc/_layouts/15/mol/topic/ext/Topic.aspx?mappin gid=201f3865-195e-4c9b-aff3-9eb3d2130344

SMS	
SMS基础知识	•
SMS发送问题如何分析	•
SMS发送问题案例分享	•
SMS接收问题如何分析	•
SMS接收问题案例分享	+
MMS	
MMS基础知识	•
MMS发送问题如何分析	•
MMS发送问题案例分享	+
MMS接收问题如何分析	+
MMS接收问题案例分享	+
CellBroadcast	
CellBroadcast基础知识	+
CellBroadcast接收不到问题如何分析	+
CB接收不到问题案例分享	+
FAQ	
相关FAQ	+

Case share

【wlan】先开启移动网络共享,然后开启USB共享时pc端无法上网

			-		
风险高低	平台	SW版本	软硬件	涉及领域	
古同	MT6750	alps-mp-n0.mp7	SW	TELEPHONY	
现象描述	▶连接ap热点的配合机可以上网,但使用USB网络共享的pc不能上网				
复现路径	▶1.测试机进入设置便携式热点,开启移动网络共享,并使用配合机连接成功该热点 ▶ 2.使用USB将测试机与pc连接,然后在便携式热点中打开USB网络共享				
分析过程	07-13 20:46:30.415446 1076 1200 D Tethering: TetherModeAliveState got CMD_TETHER_MODE_REQUESTED 07-13 20:46:30.415560 1076 1200 D Tethering: [MSM_TetherModeAlive][TetherMaster] processMessage what=327681 07-13 20:46:30.415914 1076 1200 I Tethering: CMD_TETHER_MODE_REQUESTED with change iface =empty,TetherMaster 07-13 20:46:30.416601 1076 1200 D Tethering: TetherModeAliveState got CMD_TETHER_MODE_REQUESTED 07-13 20:46:30.416842 1076 1200 D Tethering: [MSM_TetherModeAlive][Ipv6TetherMaster] processMessage what=327681 07-13 20:46:30.423308 1076 1200 I Tethering: CMD_TETHER_MODE_REQUESTED with change iface =empty,Ipv6TetherMaster 07-13 20:46:30.423465 1076 1200 D Tethering: TetheredState got CMD_TETHER_CONNECTION_CHANGED 07-13 20:46:30.423593 1076 1200 I Tethering: [ISM_Tethered] CMD_TETHER_CONNECTION_CHANGED s:empty,TetherMaster 07-13 20:46:30.423728 1076 1200 I Tethering: [ISM_Tethered] IfaceNameSmNames[0]:empty IfaceNameSmNames[1]:TetherMaster 07-13 20:46:30.423728 1076 1200 I Tethering: [ISM_Tethered:TetherMaster] CMD_TETHER_CONNECTION_CHANGED				
解决方案	Patch ALP	S03407299			

WEDIATEK

Case share

【PSW】【Data service】				
风险高低	平台	SW版本	软硬件 涉及领域	
高	MT6757C	alps-mp-n0.mp5-V1.53	SW TELEPHONY	
现象描述	▶正常上网,断网			
复现路径	▶1、插中国联通卡▶2、手机在正常使用数据网络▶3、7-7 16: 52, 发生断网			
分析过程	 07-27 19:05:26.972436 1348 1348 D DCT : [0]doRecovery() get data call list 07-27 19:06:27.064119 1348 1348 D DCT : [0]doRecovery() cleanup all connections 07-27 19:18:47.520937 1348 1348 D DCT : [0]doRecovery() get data call list 07-27 19:19:47.532681 1348 1348 D DCT : [0]doRecovery() cleanup all connections 			
1.替换统计API public void updateTxRxSum() { this.txPkts = TrafficStats.getMobileTxPackets(); this.rxPkts = TrafficStats.getMobileRxPackets(); this.rxPkts = TrafficStats.getMobileRxPackets(); } 2.增大监听事件间隔 // Default for the data stall alarm for aggressive stall detection private static final int DATA_STALL_ALARM_AGGRESSIVE_DELAY_IN_MS_DEFAULT = 1000 * 60; 3.增大统计包 // Default sent packets without ack which triggers initial recovery steps private Static final int NUMBER_SENT_PACKETS_OF_HANG = 10;				



ID	FAQ Title	平台
FAQ17447	关闭指定网络类型/RAF	Common
FAQ09024	Android N user load工模没有ATCI入口	Common

MEDIATEK

CONFIDENTIAL B

MEDIATEK

everyday genius