

Id.-No. 21 01 18 73 ED



**Instructions for the use of the
Neck Ring Holder Fixture
210118730M**



Heye International GmbH
Lohplatz 1
D-31683 Obernkirchen
Germany
Telephone +49 (0) 5724 26 452
Telefax +49 (0) 5724 1288

>> Keep available for future use <<


© Heye International GmbH, Obernkirchen, 2004

Table of Contents

Page

Parts contained in the fixture's box	2
Required measuring tools, however, not part of the delivery	2
Instructions to check neck ring holders	3 - 10
Maintenance of the fixture	11

The Neck Ring Holder Fixture is supplied in a box:

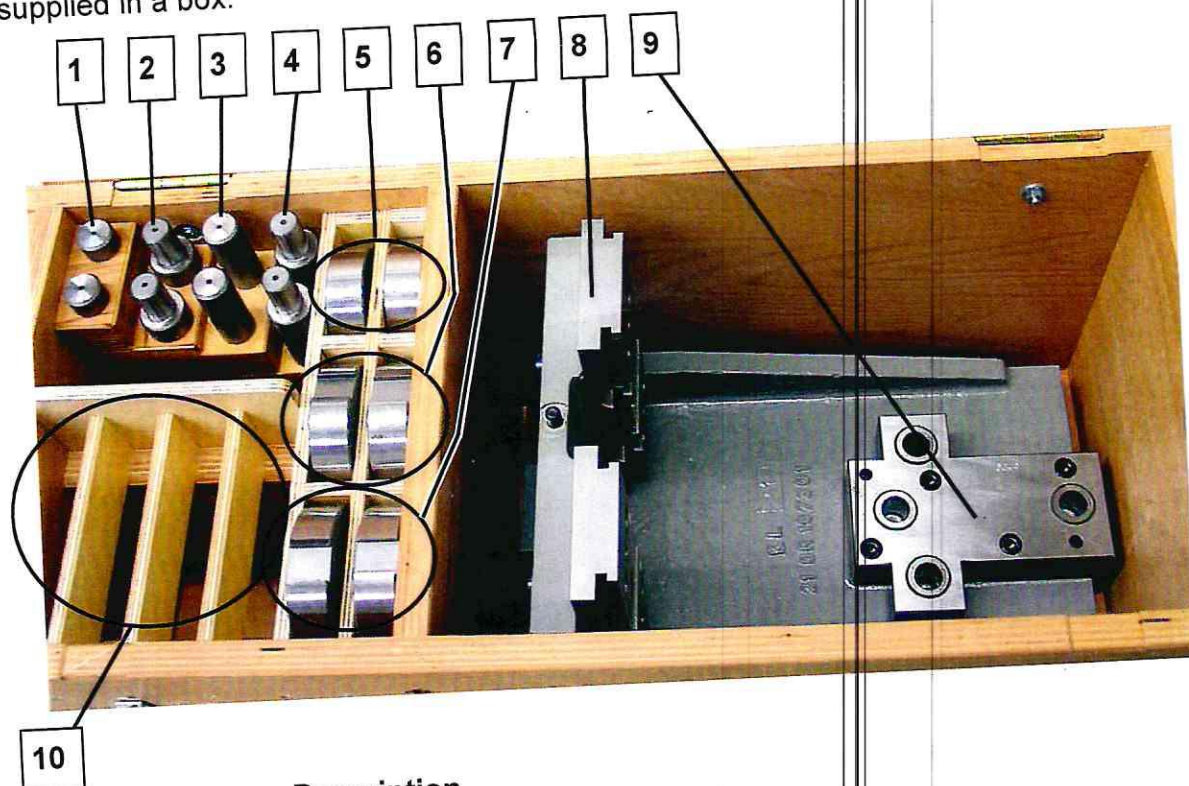


Pos.	Description
1	Supporting bolt 2101187309
2	Mounting bolt 2101187310
3	Supporting bolt 2101187308
4	Mounting bolt 2101187315
5	Caliper 70
6	Caliper 83
5	Caliper 90
8	Work holding attachment
9	Inspection plate according to centre distance
10	Space for additional inspection plates

Additionally, the following tools are required for the measurement (not part of the delivery!):


1. A surface plate
2. A comparator stand
3. A dial indicator
4. A feeler gauge (0.05 – 1 mm)
5. A slide gauge 0 – 150 mm
6. A bevelled edge square 90° (approx. 300 x 200 mm)

Instructions how to check neck ring holders

1. Pay attention that the numbers of the arms to be checked are the same.


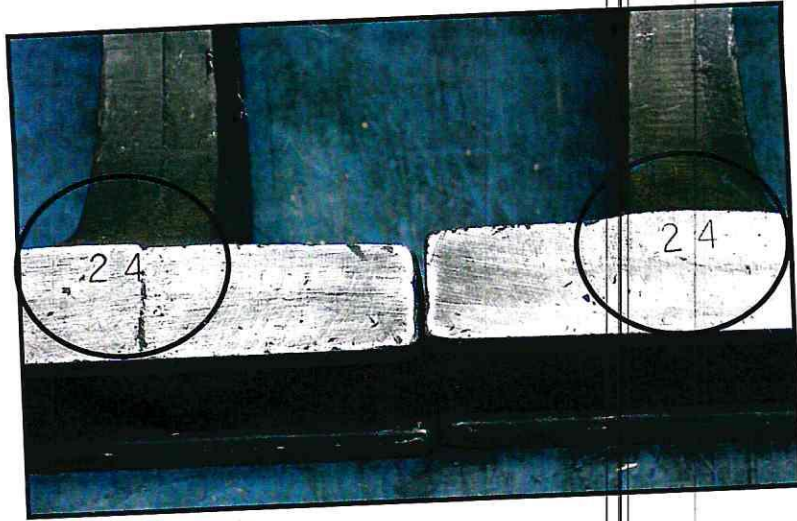


2. Clean the surfaces [A] and the T-grooves [B]

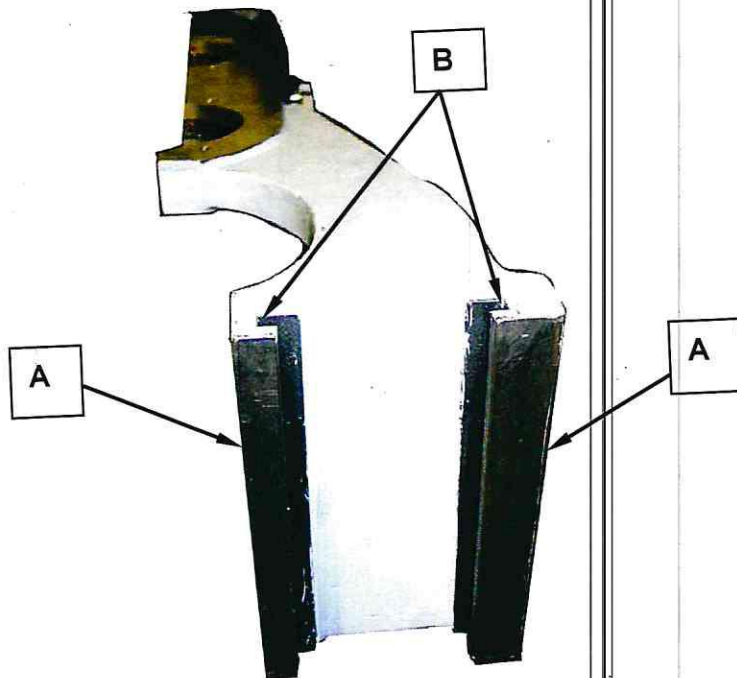


Check Neck Ring Holder

3. Remove the leaf springs [C] and clean the groove [D]. Check the retaining plates [E].

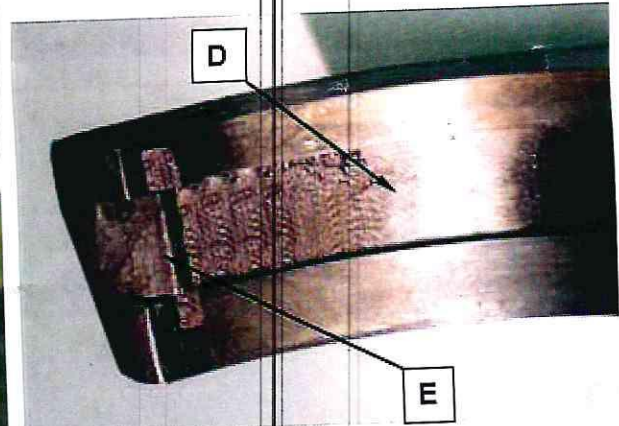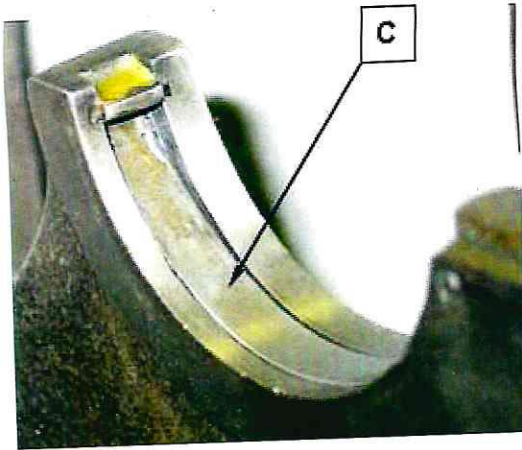

4. *Ширина пазов не > 46,6 мм*
The width of the T-grooves may not exceed 76.6 mm. The measurement has to be made at the upper and lower side by means of a slide gauge.

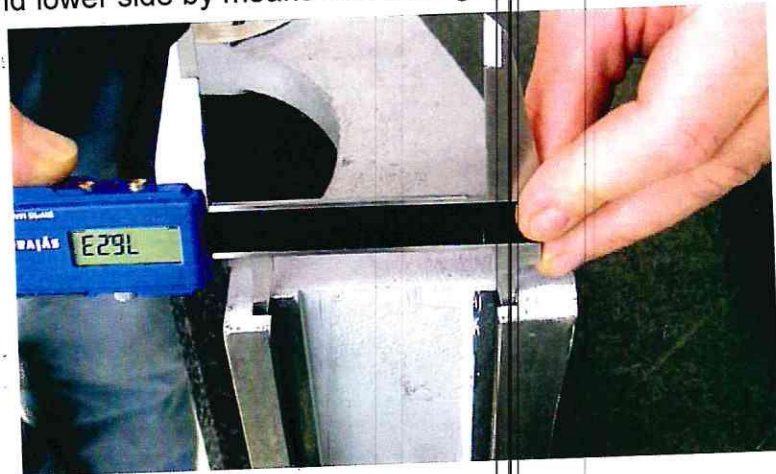


5. The width of the groove may nowhere exceed the nominal dimension (11.0 mm) by more than 0.55 mm. *Номин. размер не более 11,55 мм*



Check Neck Ring Holder

6. Check the knob for correct seating by means of a latch bolt.
7. Check the spring of the latch bolt for tensioning (if need be exchange it).
8. Check the latch bolt for wear and sufficient play (clean it, if need be exchange it).

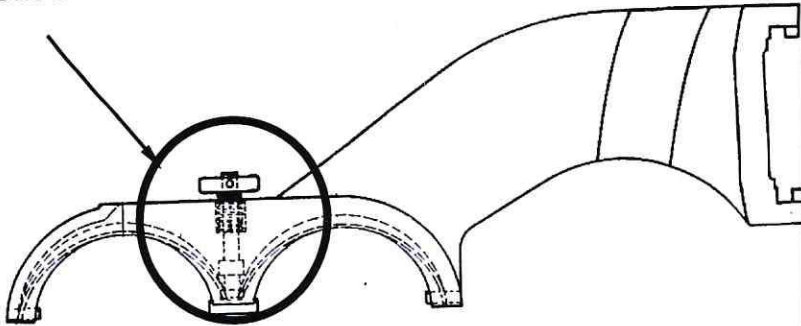


9. To check **straight** neck ring holders

Insert
 supporting bolt 2101187309 at [A] and
 mounting bolt 2101187310 at [B]


- 9a. To check **universal** and „**offset**“ neck ring holders

Insert
 supporting bolt 2101187308 at [A] and
 mounting bolt 2101187315 at [B]

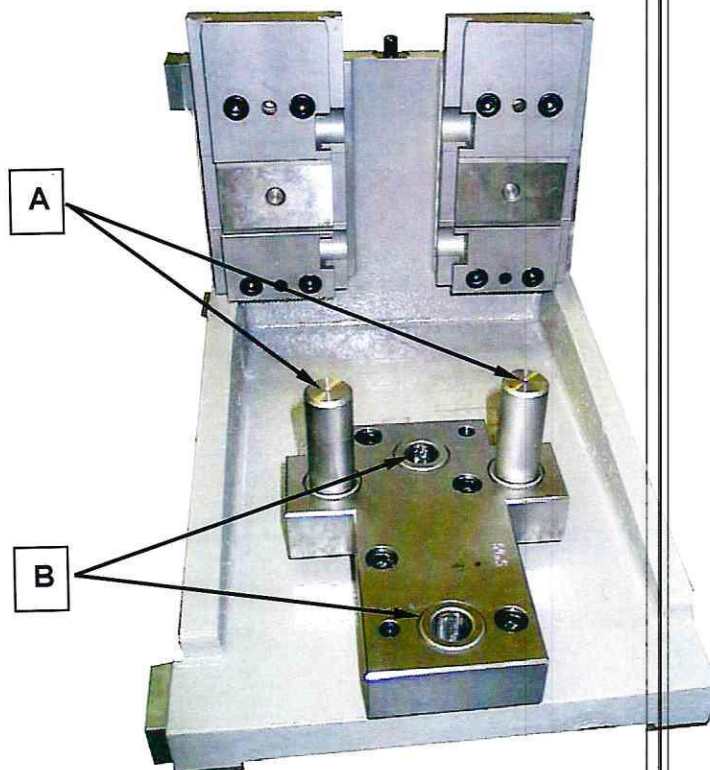


Check Neck Ring Holder

10. Put the neck ring holder on and tighten the clamping screw [C]. Subsequently check if the arm rests correctly [D].

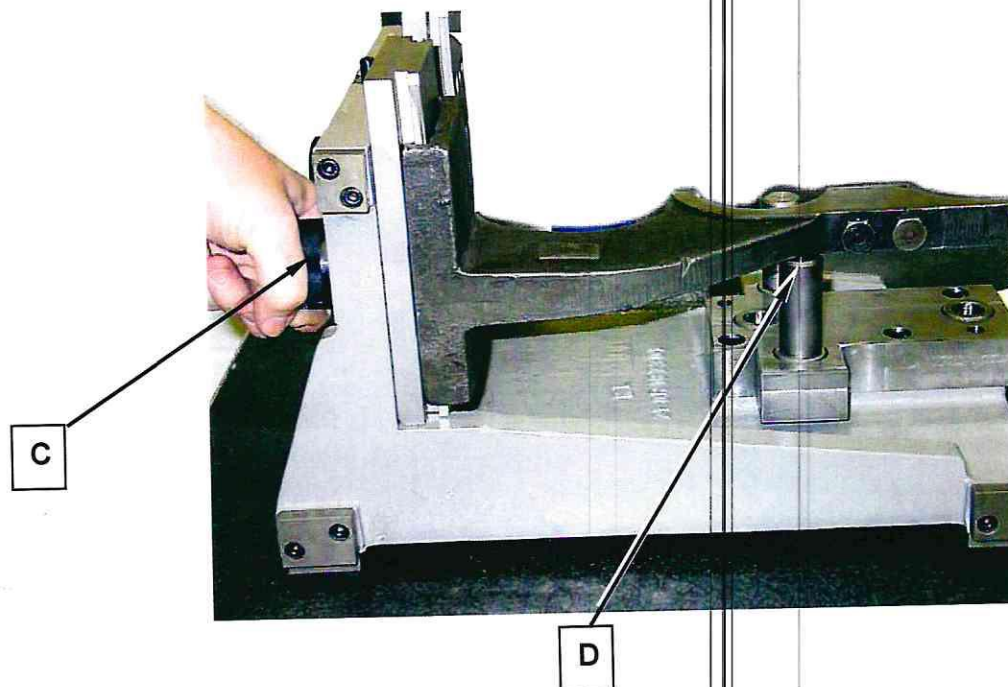


11. The height offset of the arms among themselves and the deviation from the parallelism of the surfaces may not exceed 0.2 mm. *отклонение параллельности не 70,2 мм!*

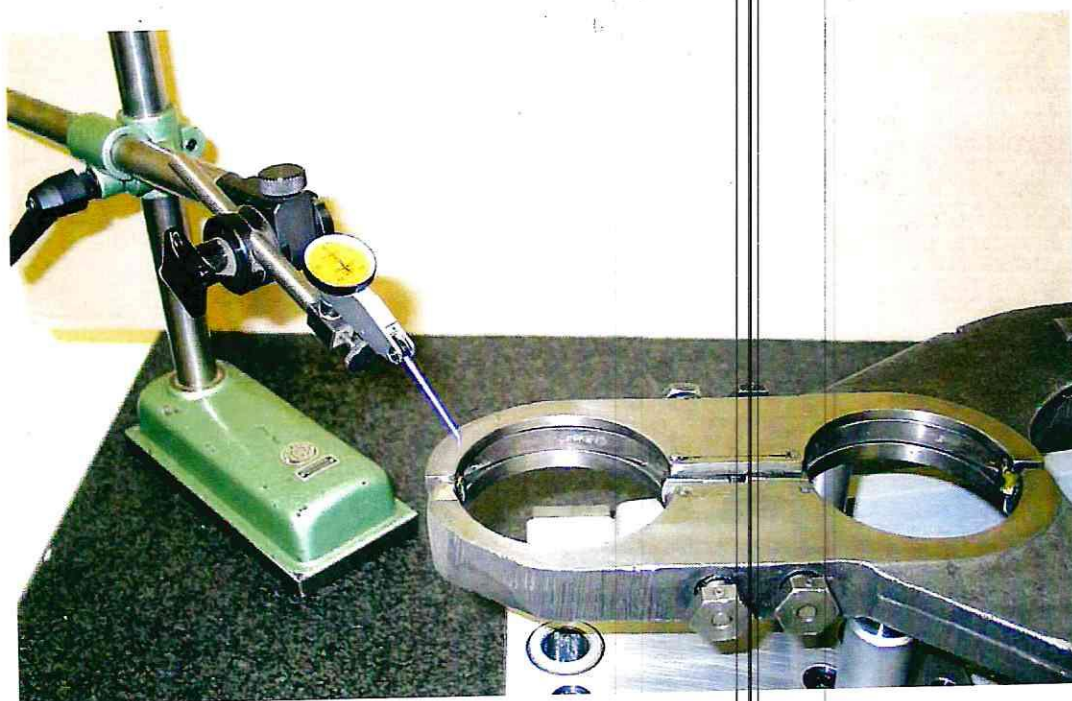


Check Neck Ring Holder

63% точность не > 0,2 мм

12. Angularity (parallelism) of the arms in longitudinal direction, deviation not more than 0.2mm (min. 3 measuring points per half). Measure at the points [A], [B] and [C].

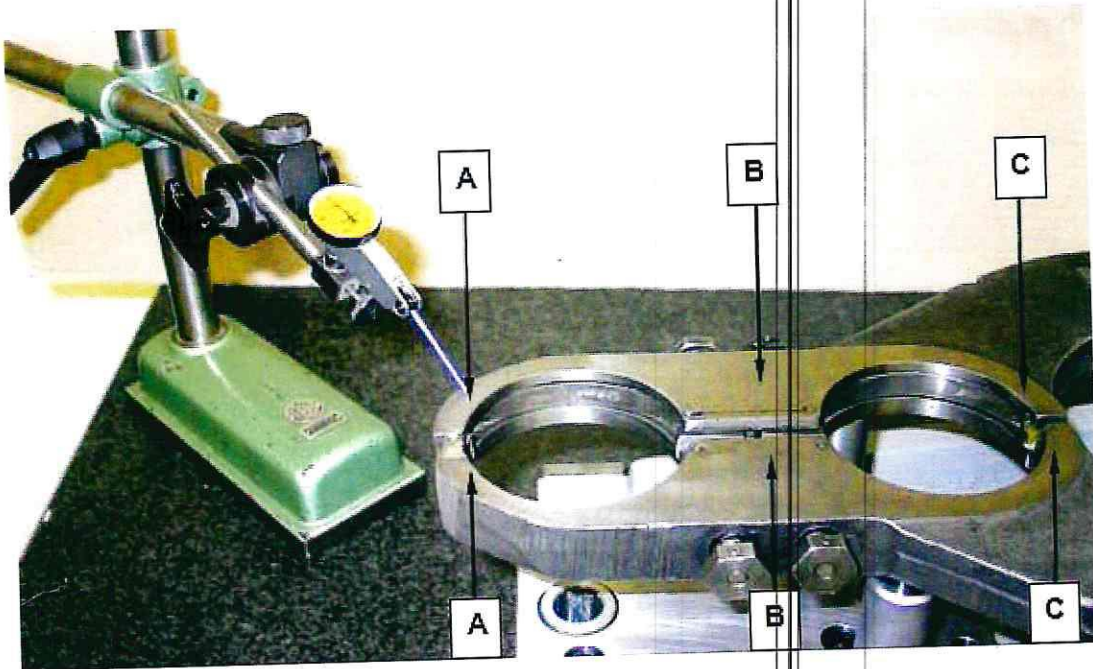

13. **In any case** exchange the leaf springs (insert with copper grease). The leaf spring in the neck ring holder must be on the same level as the inner edge of the drilling [A] and must be curved in such a way that the neck ring centres by itself.

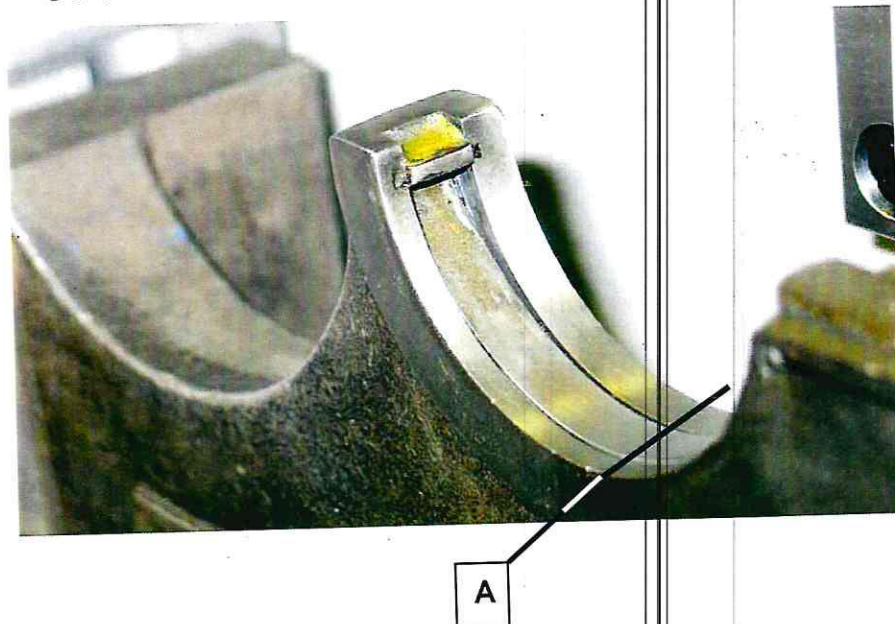


Check Neck Ring Holder

14. The diameter may max. be 79.0 mm for nominal size 70, 90.2 mm for nominal size 83 and 95.5 mm for nominal size 90. The ovality may not exceed 0.2 mm and the centre offset of the drilling may max. be ± 0.2 mm.

*овальность не > 0.2 мм.
смещение не > 0,2 мм*




Insert the corresponding mounting bolts [A] and calipers [B] for measurement. Measure at several points of the caliper circumference [C] with a feeler gauge.

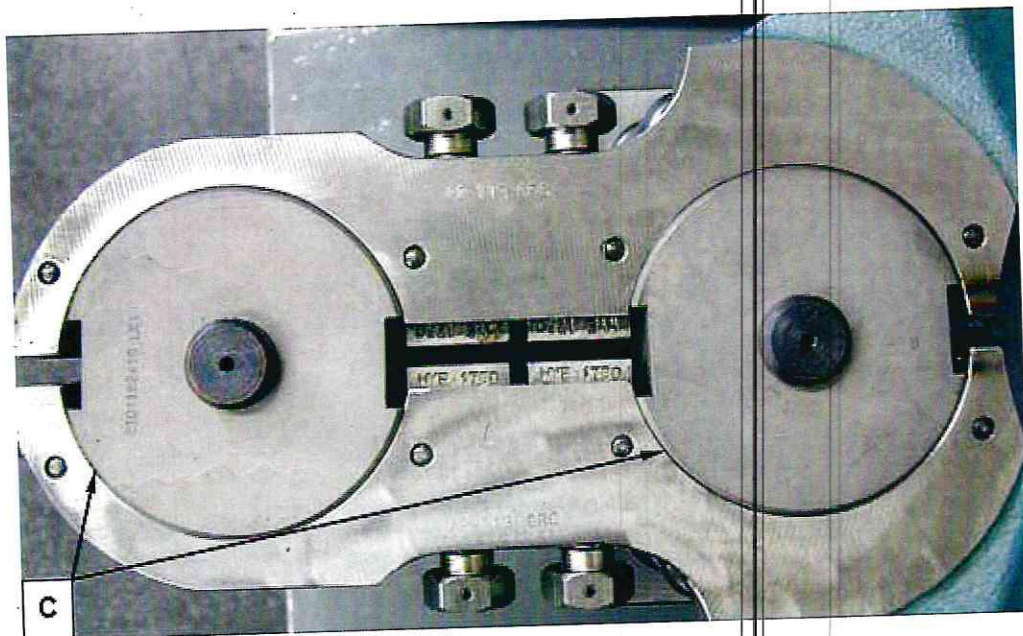


Check Neck Ring Holder

15. According to the design of the neck ring holder fixture, checking can also be made with a dial indicator:

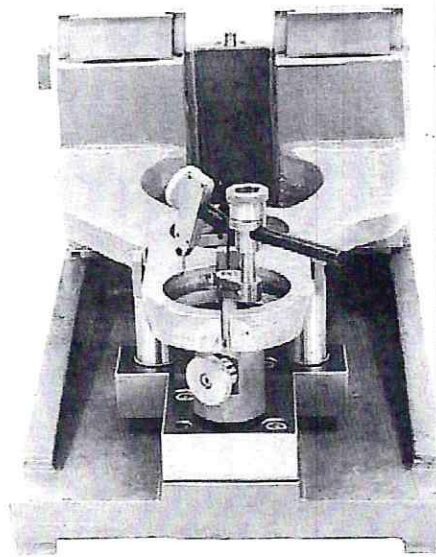

16. The parallelism at [C] may deviate by 0.5 mm (measured with comparator stand)

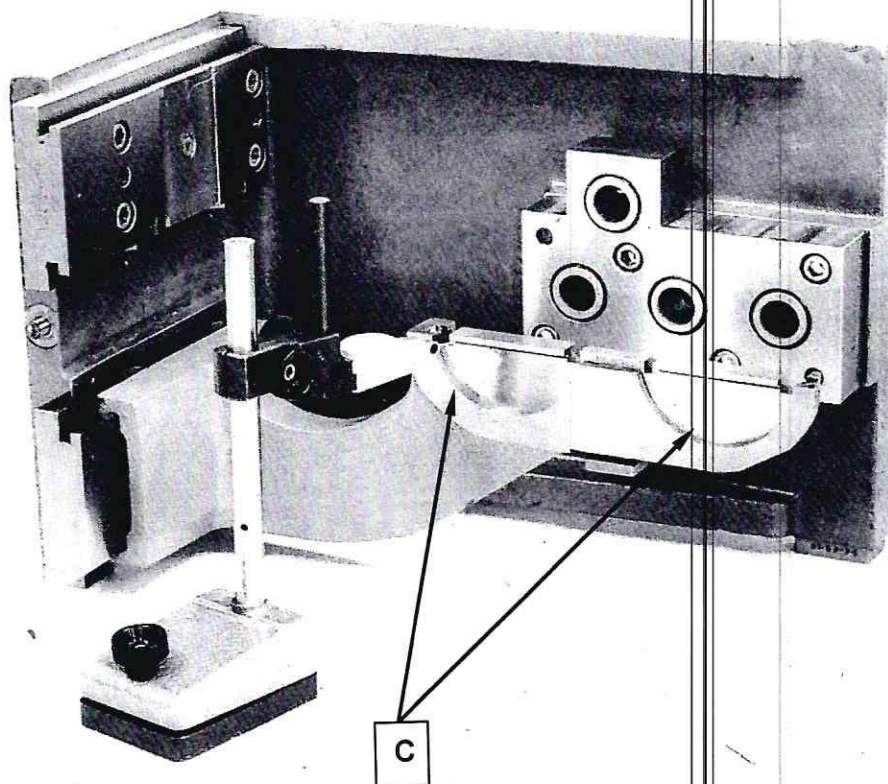

17. The angle may deviate by max. 0.2 mm.



Maintenance of the fixture:

1. After the check-ups have been made remove all bolts, calipers and the inspection plate from the work holding attachment.
2. Clean all parts (**Never use abrading means!**).
3. Grease all parts a little with spray oil.
4. Pack the parts as shown in the photo on page 2.