SHOP FINDINGS REPORT

AIRFRANCE INDUSTRIES / KLM Engineering & Maintenance


Exclusion Category :	Contamination

COMPONENT REPAIR ORDER REFERENCES

Customer :	ETHIOPIAN AIRLINES
Customer repair order :	63870812
Aircraft registration :	ETAPS
AFI Request Number :	50809895
Incoming part number :	822-0990-004
Designation :	TRANSCEIVER HF / HFS 900D
Serial number :	1864VP

REASON FOR REMOVAL (REPORTED BY CUSTOMER)

REMOVAL TEXT: R/H RADIO TUNING PANEL INOPERATIVE WHEN SELECTING HF RIGHT.
Removal date : 19FEB25
From : ETAPS

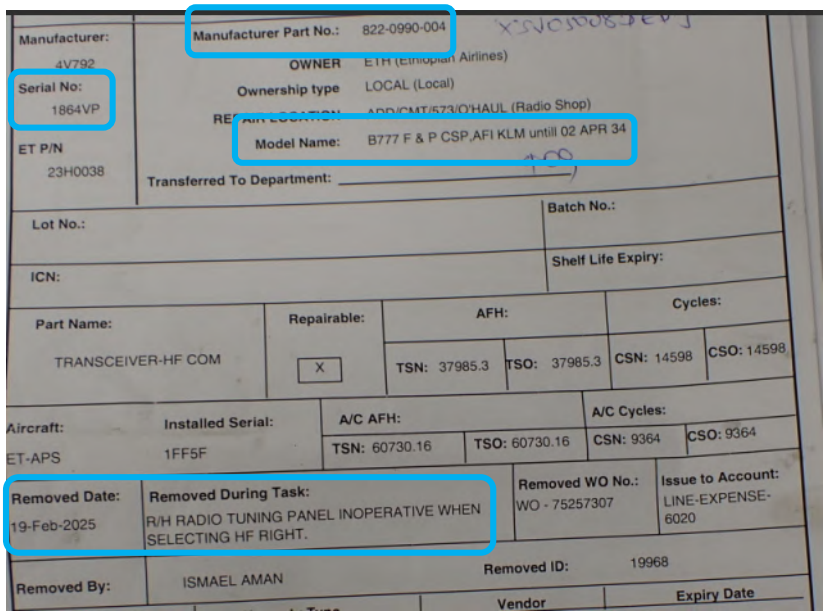

VISUAL INSPECTION

FIRST SHOP VISIT, TRANSCEIVER HF received in our shop with contaminated parts

ID PLATE




SHOP FINDINGS


We found that the Unit was very dirty, with Pollution traces by liquid on the cover (CID).
The Voltage regulator card was corroded due to liquid's pollution (CID).Presence of corrosion and Verdigris.


GLOBAL SIGHT




DAMAGES

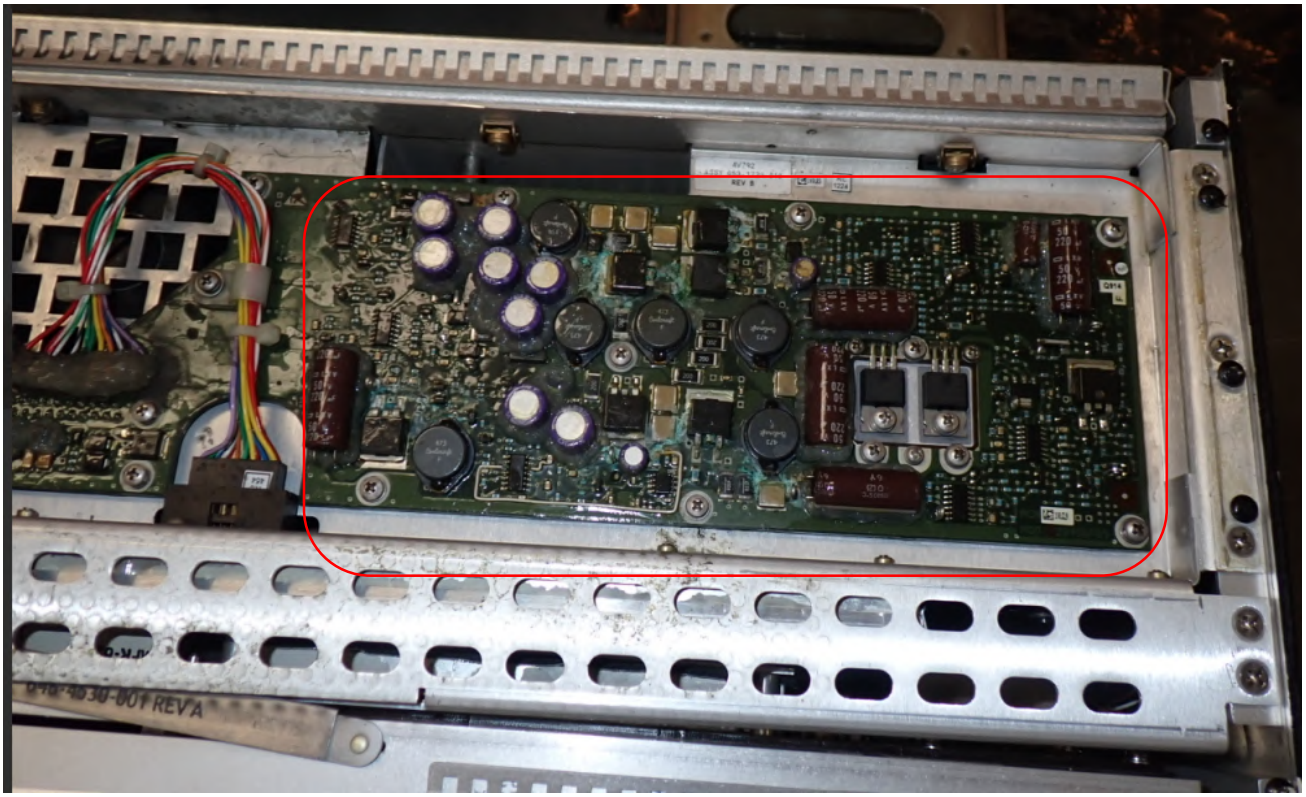

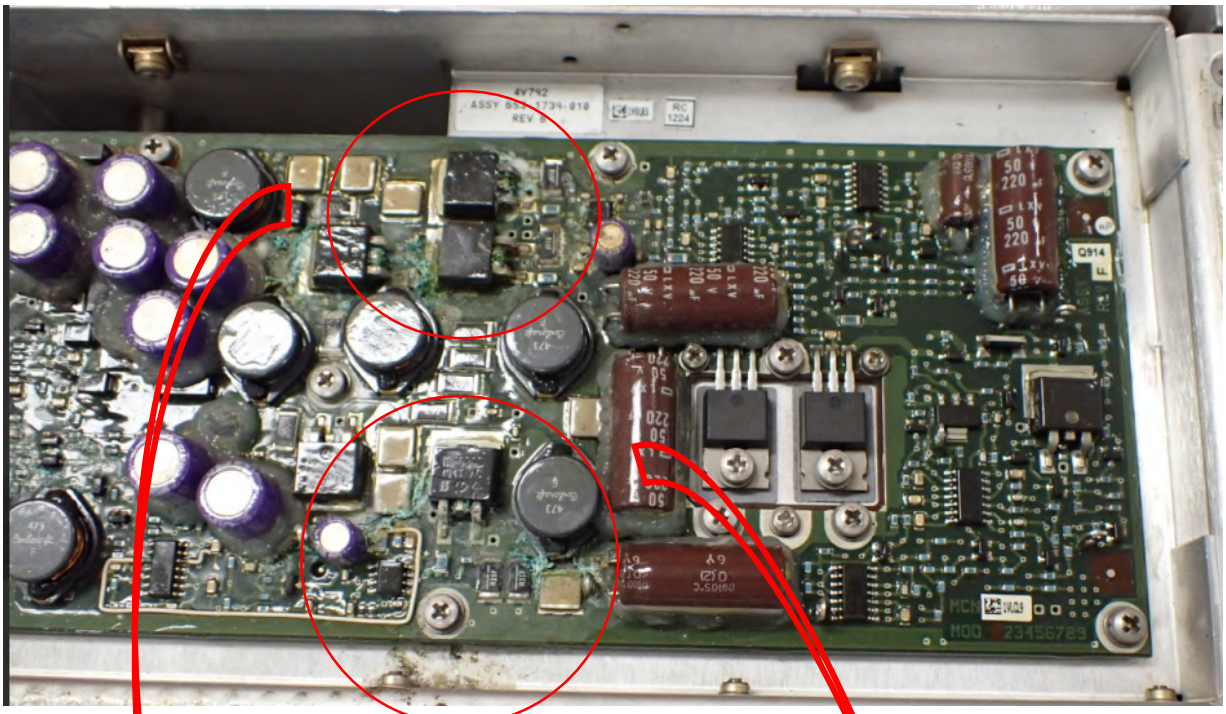

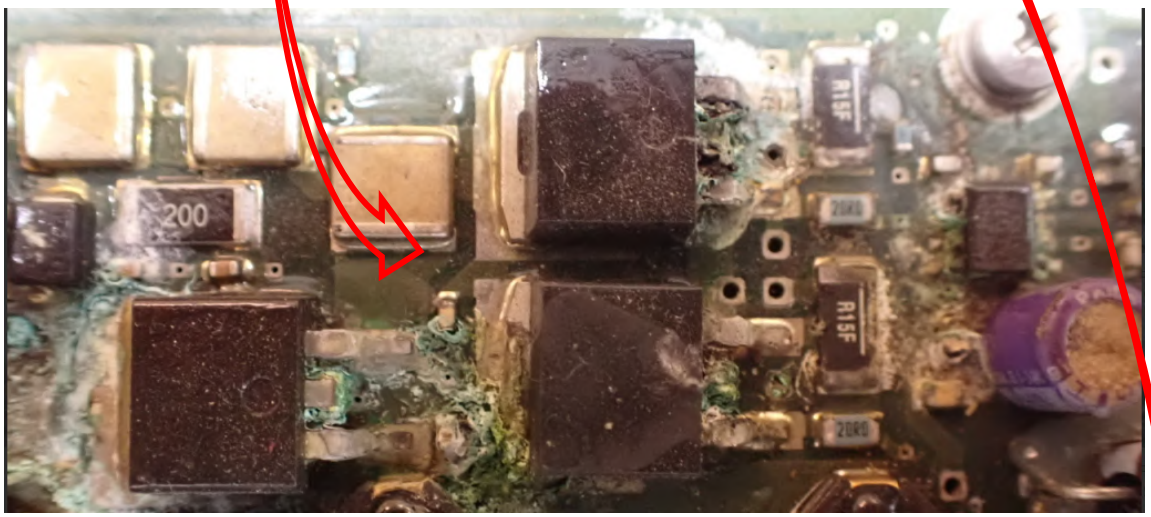


Presence Verdigris & Corrosion

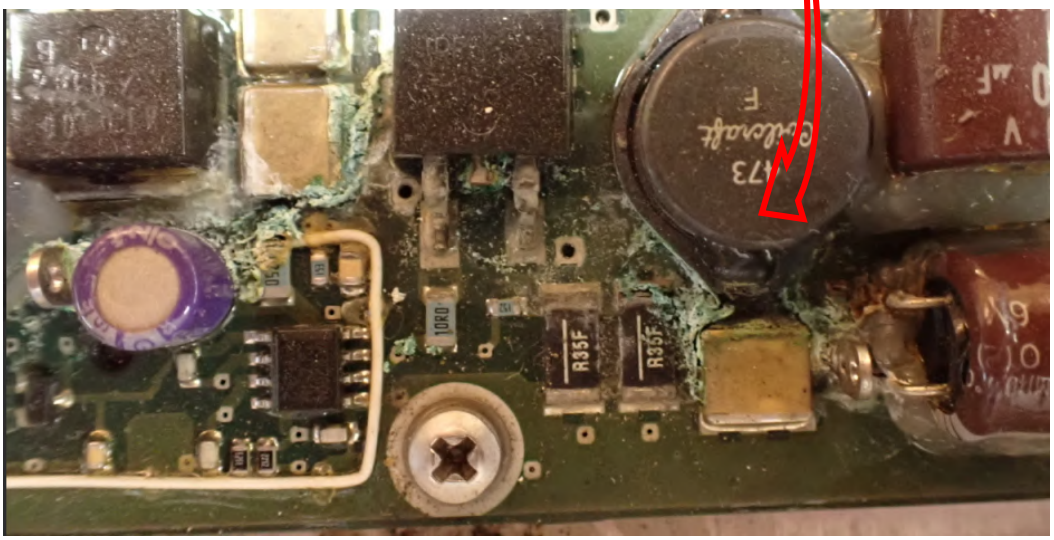



Traces of pollution causing damages

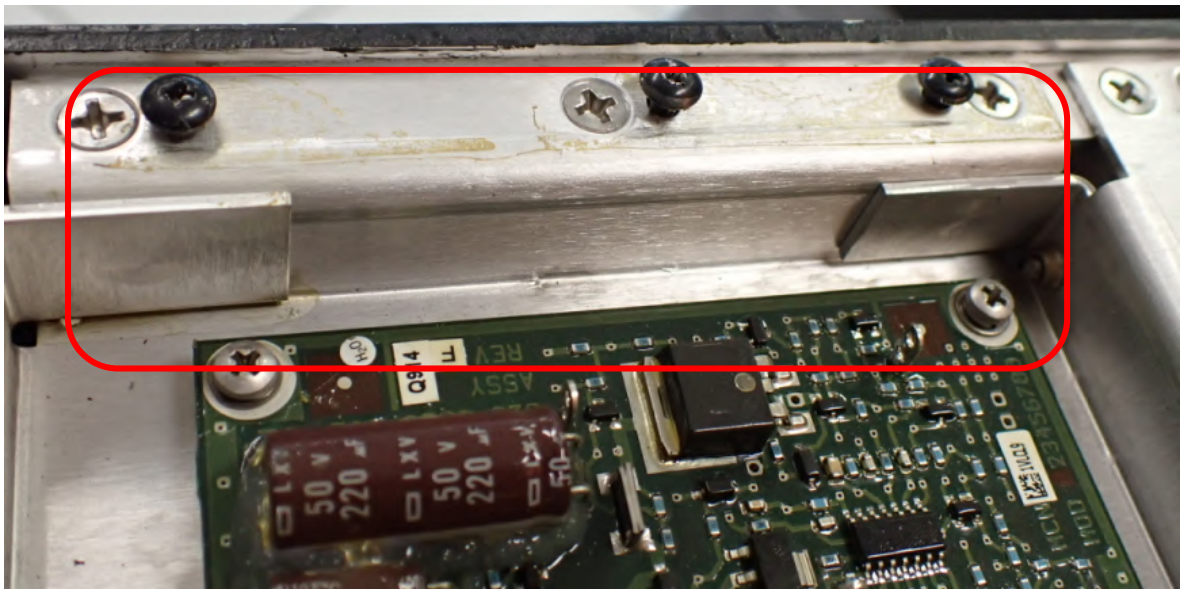

WORK_PERFORMED

Due to the damages, Voltage regulator circuit card A6A3A1 had to be replaced. PN: 828-0560-001

REDACTOR

Name :	Charnet, Didier (MS CS IN) - AF	**Date :**	03/02/2026	**Ref Nr :**	R260522