Simplified Breakfast – Combi Oven Best Practices/Troubleshooting

Although not required for Simplified Breakfast, Combi Ovens can be helpful tools to support the Simplified Breakfast platform in restaurants. Ensure that your COMBI Ovens are operating properly.

Combi Oven Resources

Combi Oven Playbook





QR code that you can use for the Ecolab Cleaning and Sanitation Resource Portal.
This portal is available to the restaurants to access.
ALL the cleaning procedures not only for Combi Ovens but all Kay Cards.

See next few slides for best practices associated with the Blodgett and Convotherm models.

© McDonald's

Simplified Breakfast – Combi Oven Best Practices/Troubleshooting

Blodgett Combi Oven: BLCT-6E-H-MCD

Utility Connections

- ❑ Power to Hoodini Ventless Hood – Each Hoodini hood must be powered on a dedicated 120-volt, 20-amp circuit
  - Both blue indicator lights should be illuminated when powered on
- ❑ RO Water Pressure – Regulator to be set at 50 PSI and remain above 40 PSI during the entire cook cycle
  - This can be monitored by checking the water gauge that should be installed within 10 ft. of the combi oven
- ❑ External Drain Box – Must be installed vertically - if installed on an angle, the oven will not cook correctly






RO Water Pressure Gauge

BLODGETT

Service: 802-860-3700

Scan QR Code for Operational Procedures

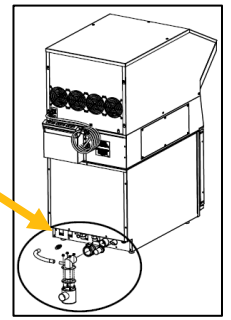



External Drain Box Installed

Operating Practices

- ❑ Menu Settings – Confirm the correct settings are uploaded into the oven
  - Click or scan to watch video on How to Edit a Cook Setting
- ❑ Egg Settings
  - Single & 2-tray Cook – Use the "Round Egg" icon (4:00min for waterfall trays/4:15min for old style round egg cups)
  - 3 Tray Cook – Use the "3 Tray Round Batch" Icon
    - 3 tray batch is primarily used when initially loading the Moffat humidified holding cabinet
  - Egg Procedure
    - Ensure the tray(s) being loaded into the oven are not too hot – should be warm to the touch – if trays are too hot, the eggs will cook prematurely, resulting in overcooked eggs
    - Eggs must be pulled from a refrigerated state – eggs being stored either too cold or being left in ambient temperature (beyond 30 min) can negatively impact the cooking results






Waterfall (top) vs. Old Style (bottom) Egg Trays

© McDonald's

Classified - Confidential

Simplified Breakfast – Combi Oven Best Practices/Troubleshooting

Blodgett Combi Oven: BLCT-6E-H-MCD

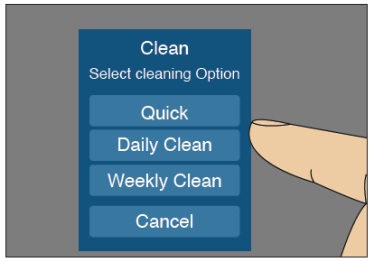

BLODGETT
Service: 802-860-3700

Scan QR Code for Operational Procedures


Cleaning PM Procedures

❑ Daily:

- **Quick Clean Cycle** as needed during the day – Most effective following a 5-tray batch cycle of bacon to wash away excess grease
- **Daily Clean Cycle** at end of each day
- Wipe down oven door gasket with a damp sanitized towel for added longevity



- Check Heavy Duty Degreaser and Oven Rinse Aid products, ensuring pickup probe is inserted into container and containers contain product

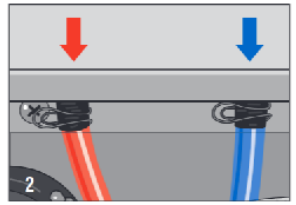

- Ensure Oven Rinse Aid (blue tube) is installed on the RIGHT and Heavy Duty Degreaser (red tube) on the LEFT

❑ Bi-Annual:

- Remove Hoodini grill and wipe down the air intake fans





❑ Scale Buildup:

- If scale buildup is ever seen inside the oven cavity, check the RO filter system.
- For additional assistance, please contact your beverage company or RO filter supplier.



Oven Cavity with Scale Buildup

© McDonald's

Classified - Confidential

Simplified Breakfast – Combi Oven Best Practices/Troubleshooting

Blodgett Combi Oven BLCT-6E-H-MCD – Troubleshooting Tips

❑ Oven Will Not Heat Up

- Check that each Hoodini hood is on its own dedicated 120-volt, 20-amp circuit
- Inspect Hoodini blue indicator lights – both must be illuminated to call for heat
- Locate the circuit breaker, reset if needed



Blue Indicator Lights

BLODGETT

Service: 802-860-3700

Scan QR Code for Operational Procedures

❑ Steam Escaping Out of Oven Door

- Inspect door gaskets for cleanliness – if there are any tears then the door gasket will need to be replaced

❑ Scale Buildup Inside Oven Cavity

- This indicates there could be a potential issue with the RO system – For additional assistance, please contact your beverage or filter company



RO Water Pressure Gauge

❑ Eggs Not Cooking Correctly

- Confirm that the oven cavity is recovering to the set menu temperature
  - Click link or scan QR code to watch video on Viewing Actual vs. Set Temperature
- Monitor RO pressure gauge – water pressure cannot go below 40 PSI at any point during the cook cycle
  - A water pressure regulator and gauge should be installed on the RO water line within 10 feet of the oven
- Ensure the interior baffle with J-tube is installed in the correct position (see picture to the right)
- Other variables to consider: Eggs not being stored at the proper temperature, trays are too hot prior to loading, the wrong menu settings are loaded in the oven

Scan QR Code for Video Showing How to Adjust J-Tube



Correct J-Tube Position

© McDonald's

Classified - Confidential


Simplified Breakfast – Combi Oven Best Practices/Troubleshooting

Convotherm

Convotherm Generation1: Gray screen overlay



Convotherm Generation2: Black screen overlay

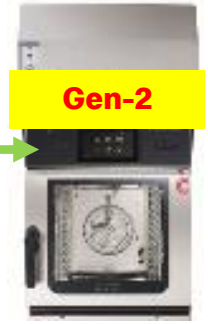

CONVOTHERM

ConvothermSVC@Convotherm.com

Call: 844.724.2273, 4, 3
for service and technical support

Scan QR Code for Operational Procedures

❑ Hands Free Cleaning:

- Ensure your unit is cleaned as outlined: 2 min Quick Rinse after cooking bacon. Ensure daily handsfree cleaning completed at the end of the day or when designated by the restaurant.

❑ Capture Hood:

- Replace charcoal hood filters quarterly
- Clean mesh front mesh filter weekly
- Hood service indicator, ensure the red hood service light indicator is not illuminated. Contact service provider if illuminated, the Convotherm will remain operational .







❑ Cleaning Chemicals:

- Ensure oven cleaner chemicals [rinse aid and heavy-duty degreaser] are promptly replaced when the oven prompts replacement.

❑ Door Gaskets:

- Clean with sanitized towel during daily cleaning, replace if torn or oven leaks steam

Not changing charcoal filter can cause grease drip.

© McDonald's

Classified - Confidential


Simplified Breakfast – Combi Oven Best Practices/Troubleshooting


Convotherm Troubleshooting



❑ **Cleaning Chemicals:**

- Ensure oven cleaner chemicals [rinse aid and heavy duty degreaser] are promptly replaced when the oven prompts replacement.
- Ensure there is not a kink in the chemical lines, should appear as *below illustration.*
- Multiple attempts to run cleaning cycle when error is displayed, will damage pump, becomes in operatable due to dry pumping, not covered under warranty.

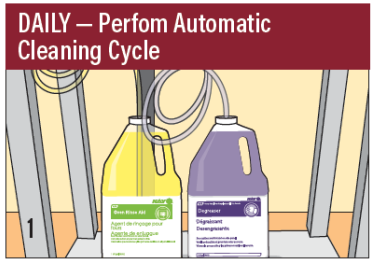

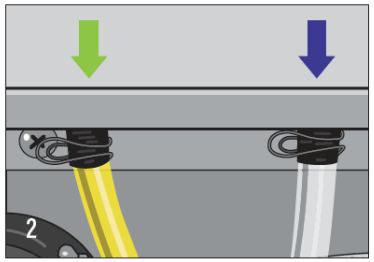



❑ **Cooking:**

- For any concerns for items not cooking correctly, confirm the Combi Station guide cooking procedures are being followed.
- If Oven is not heating, contact the service provider.
- Round eggs undercooking; check for torn door gaskets, ensure water being injected in water tube while cooking [see photo].

❑ **Error Codes:**

- Follow on screen prompts. Contact service provider if the capture hood service light is on.

CONVOTHERM

ConvothermSVC@Convotherm.com

Call: 844.724.2273, 4, 3
for service and technical support

Scan QR Code for Operational Procedures

Simplified Breakfast – Combi Oven Best Practices/Troubleshooting

Water Infrastructure Checklist

The Moffat Cabinet and COMBI Ovens use blended RO or filtered boosted water. Any existing issues with water systems will be exacerbated by the additional capacity requirements of using this equipment. It is imperative to ensure water systems are fully operational, to avoid issues.

- ❑ **Ensure no existing water pressure issues and/or system issues or outages with:**
  - **Water Treatment System (WTS)**
  - **Pre-Filter & Fine Filtration**
  - **Water Booster System (WBS)**
  - **Reverse Osmosis System (ROS)**
  - **Water Surge System (WSS)**
- ❑ **Review the restaurant's most recent QMC summary letter and address all outstanding issues that have already been identified.**

Important note:
Issues left unaddressed will most often first present symptoms in existing COMBI Ovens, as restaurants try to go-live on Simplified Breakfast. Restaurants experiencing COMBI issues should prioritize these actions.

If experiencing issues, Coca-Cola service can be contacted via call or text at 800-241-COKE (2653), or email beverageservices@coca-cola.com

© McDonald's