

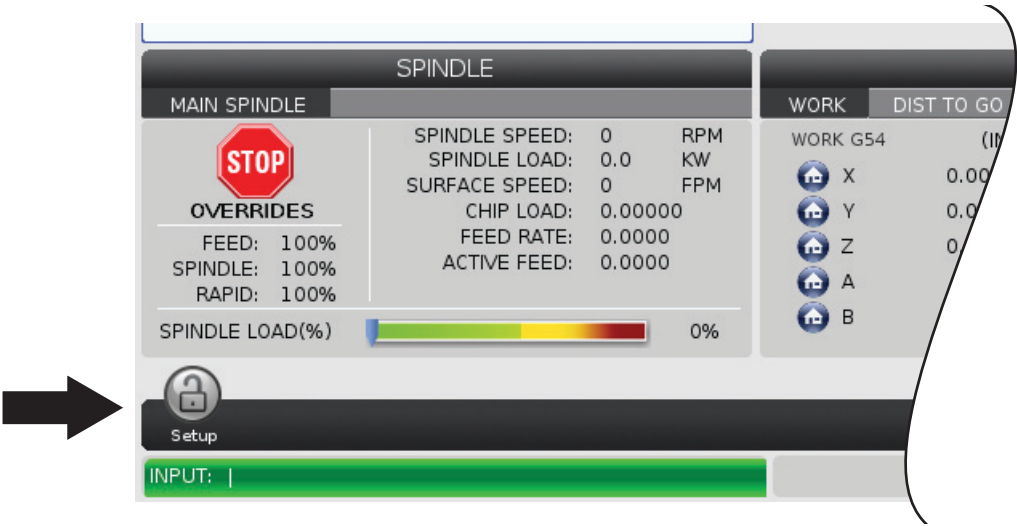
Chapter 3: Control Icons

3.1 Next Generation Control Icon Guide

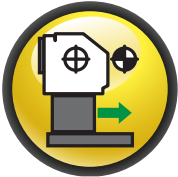
The control screen shows icons to quickly give you information about machine status. Icons tell you about current machine modes, your program as it runs, and machine maintenance status.

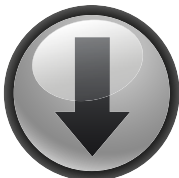
The icon bar is near the bottom of the control pendant display, above the input and status bars.

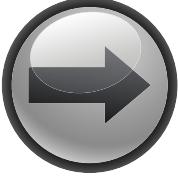
F3.1: Icon Bar Location



T3.1: Lathe Control Icons

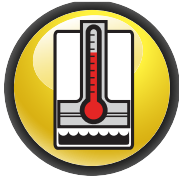
Name	Icon	Meaning
Setup		Setup mode is locked; the control is in Run mode. Most machine functions are disabled or limited while the machine doors are open.
Setup		Setup mode is unlocked; the control is in Setup mode. Most machine functions are available, but may be limited while the machine doors are open.
Bar Feeder is Not Aligned		This icon appears when the bar feeder is enabled and out of position. Make sure the bar feeder is aligned with the feeding hole.
Bar Feeder Cover is Open		This icon appears when the bar feeder is enabled and the bar feeder cover is open
Bar Feeder is Out of Bars		This icon appears when the bar feeder has run out of the bars.

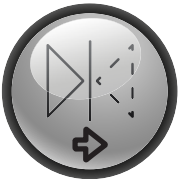
Name	Icon	Meaning
Cycle Door		The door must be cycled at least once to ensure that the door sensor is working. This icon appears after [POWER UP] if the user has not yet cycled the door.
Door Open		Warning, door is open.
Running		The machine is running a program.
Jog		An axis is jogging at the current jog rate.
Power Saving		The power-saving servos-off feature is active. Setting 216, SERVO AND HYDRAULIC SHUTOFF, designates the time period allowed before this feature activates. Press a key to activate the servos.
Jog		This icon appears while the control returns to the workpiece during a run-stop-jog-continue operation.

Name	Icon	Meaning
Jog		You have pressed [FEED HOLD] during the return portion of a run-stop-jog-continue operation.
Jog		This icon prompts you to jog away during a run-stop-jog-continue operation.
Feed Hold		The machine is in feed hold. Axis motion has stopped, but the spindle continues to turn.
Feed		The machine is executing a cutting move.
Rapid		The machine is executing a non-cutting axis move (G00) at the fastest possible rate. Overrides can affect the actual rate.
Dwell		The machine is executing a dwell (G04) command.

Name	Icon	Meaning
Singbk Stop		SINGLE BLOCK mode is active, and the control needs a command to continue.
Door Hold		Machine motion has stopped because of door rules.
Restricted Zone		A current axis position is in the restricted zone.
Remote Jog		The optional remote jog handle is active.
Low Gearbox Oil Flow		This icon appears when low gearbox oil flow persists for 1 minute.

Name	Icon	Meaning
Low Gearbox Oil		The control detected a low gearbox oil level.  NOTE: <i>The control only monitors the gearbox oil level condition at power-on. Once the gearbox low oil condition is detected, the icon will clear on the next power on when a normal level condition is detected.</i>
Dirty HPC Filter		Clean the High-Pressure Coolant filter.
Low Coolant Concentrate		Fill the concentrate reservoir for the coolant refill system.
Low Lube		The spindle lubrication oil system detected a low oil condition, or the axis ball screw lubrication system detected a low grease or low pressure condition.
Low Oil		The rotary brake oil level is low.

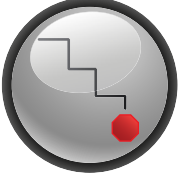
Name	Icon	Meaning
HPU Oil Low		The HPU oil level is low. The HPU oil level is low. Check the oil level and add the recommended oil for the machine.
HPU Oil Temperature (Warning)		The oil temperature is too high to reliably operate the HPU.
Mist Filter		Clean the mist extractor filter.
Low Coolant (Warning)		Coolant level is low.
Low Air Flow		Inch Mode - Air flow is not sufficient for correct machine operation.
Low Air Flow		Metric Mode - Air flow is not sufficient for correct machine operation.

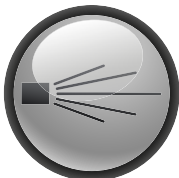
Name	Icon	Meaning
Spindle		When you press [HANDLE SPINDLE] , the jog handle varies the spindle override percentage.
Feed		When you press [HANDLE FEED] , the jog handle varies the feed rate override percentage.
Handle Scroll		When you press [HANDLE SCROLL] , the jog handle scrolls through the text.
Mirroring		Secondary spindle swap with Z-Axis mirroring active.
Mirroring		Mirroring mode is active. Either G101 is programmed or Setting 45, 46, 47, 48, 80, or 250 (mirror image of axis X, Y, Z, A, B, or C) is set to ON.
Chuck		The chuck is unclamped.

Name	Icon	Meaning
Spindle Fan Failed		This icon appears when the spindle fan stops operating.
Electronics Overheat (Warning)		This icon appears when the control has detected cabinet temperatures are approaching levels that are potentially dangerous to the electronics. If the temperature reaches or exceeds this recommended level alarm 253 ELECTRONICS OVERHEAT will be generated. Inspect the cabinet for clogged air filters and correctly operating fans.
Electronics Overheat (Alarm)		This icon appears when the electronics remains in the overheat state for too long. The machine will not operate until the condition is corrected. Inspect the cabinet for clogged air filters and correctly operating fans.
Transformer Overheat (Warning)		This icon appears when the transformer is detected to be overheated for more than 1 second.
Transformer Overheat (Alarm)		This icon appears when the transformer remains in the overheat state for too long. The machine will not operate until the condition is corrected.

Name	Icon	Meaning
Low Voltage (Warning)		The PFDM detects low incoming voltage. If the condition continues, the machine cannot continue operation.
Low Voltage (Alarm)		The Power Fault Detect Module (PDFM) detects incoming voltage that is too low to operate. The machine will not operate until the condition is corrected.
High Voltage (Warning)		The PFDM detects incoming voltage above a set limit, but still within operating parameters. Correct the condition to prevent damage to machine components.
High Voltage (Alarm)		The PFDM detects incoming voltage that is too high to operate and could cause damage to the machine. The machine will not operate until the condition is corrected.
High Air (Warning)		The air pressure to the machine is too high to reliably operate pneumatic systems. Correct this condition to prevent damage to or incorrect operation of pneumatic systems. You may need to install a regulator at the machine's air input.
Low Air (Alarm)		The air pressure to the machine is too low to operate pneumatic systems. The machine will not operate until the condition is corrected. You may need a higher-capacity air compressor.

Name	Icon	Meaning
Low Air (Warning)		The air pressure to the machine is too low to reliably operate pneumatic systems. Correct this condition to prevent damage to or incorrect operation of pneumatic systems.
High Air (Alarm)		The air pressure to the machine is too high to operate pneumatic systems. The machine will not operate until the condition is corrected. You may need to install a regulator at the machine's air input.
E-Stop		[EMERGENCY STOP] on the pendant has been pressed. This icon disappears when [EMERGENCY STOP] is released.
E-Stop		[EMERGENCY STOP] on an auxiliary device has been pressed. This icon disappears when [EMERGENCY STOP] is released.
Chamfer Mode		This icon appears when the e-wheel is in chamfer mode.
Single Blk		SINGLE BLOCK mode is active. The control executes programs (1) block at a time. Press [CYCLE START] to execute the next block.

Name	Icon	Meaning
Tool Life (Warning)		The tool life remaining is below Setting 240, or the current tool is the last one in its tool group.
Tool Life (Alarm)		The tool or tool group has expired, and no replacement tools are available.
Opt Stop		OPTIONAL STOP is active. The control stops the program at each M01 command.
Blk Delete		BLOCK DELETE is active. The control skips program blocks that begin with a slash (/).
Tool Change		A tool change is in progress.
Probe		The probe system is active.

Name	Icon	Meaning
Parts Catcher		The parts catcher is activated.
Tailstock Hold		The tailstock is engaged with the part.
Conveyor Fwd		The conveyor is active and moving forward.
Conveyor Rev		The conveyor is active and moving in reverse.
HPC		The High-Pressure Coolant system is active.
Air Blast		The Air Blast is active.

Name	Icon	Meaning
HIL Light		Indicates the optional High Intensity Lights (HIL) are turned ON and the doors are open. Duration is determined by Setting 238.
Coolant		The main coolant system is active.

3.2 More Information Online

For updated and supplemental information, including tips, tricks, maintenance procedures, and more, visit the Haas Service page at www.HaasCNC.com. You can also scan the code below with your mobile device to go directly to the Haas Service page:

