


Chapter 4: Operation

4.1 Machine Power-On

Before you do this procedure, make sure that possible crash areas, such as the tool probe, parts catcher, tailstock, tool turret, and secondary spindle, are clear.

F4.1: Possible Crash Areas During Power-Up

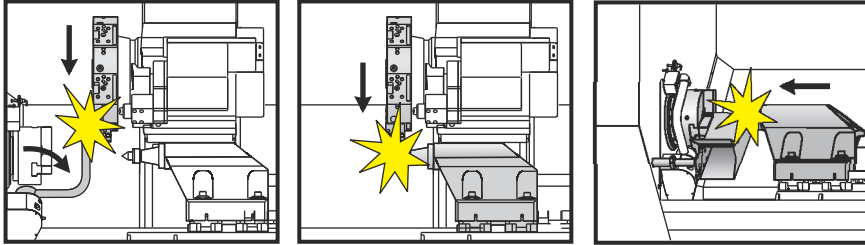

1. Press **[POWER ON]** until you see the Haas logo on the screen. After a boot sequence, the display shows the startup screen.

The startup screen gives basic instructions to start the machine. Press **[CANCEL]** to dismiss the screen.

2. Turn **[EMERGENCY STOP]** to the right to reset it.
3. Press **[RESET]** to clear the startup alarms. If you cannot clear an alarm, the machine may need service. Contact your Haas Factory Outlet (HFO) for assistance.
4. If your machine is enclosed, close the doors.
5. Press **[POWER UP]**.



The **Zero All Axes** display shows. Select the axis zero return order.

The control is now in **OPERATION:MEM** mode. You can now press **[CYCLE START]** to run the active program, or you can use other control functions.