

When you press this pedal, the hydraulic steady rest clamps or unclamps, equivalent to the M-code commands that control the steady rest (M146 to clamp, M147 to unclamp). This allows you to operate the steady rest hands-free while you handle the workpiece. The user interface for the steady rest can be found under Commands-> Devices -> Mechanisms tab. Press the **[F2]** button to clamp/unclamp the steady rest.

To unclamp the steady rest while the spindle is turning, the rpm must be below setting 283. Refer to page **400** for more information.

When clamp/unclamp via M-code, there is an inherent delay for the action to complete. Use Setting 358 to adjust the clamp/unclamp delay. Refer to page **408** for more information.

Use Setting 360 to enable or disable the steady rest foot pedal. Refer to page **408** for more information.


4.8 Drawtube Operation

The hydraulic unit provides the pressure necessary to clamp a part.

4.8.1 Clamping Force Adjustment Procedure

To adjust the clamping force on the drawtube:

F4.15: Draw tube Clamping Force Adjustment: [1] Locking knob, [2] Adjustment knob.

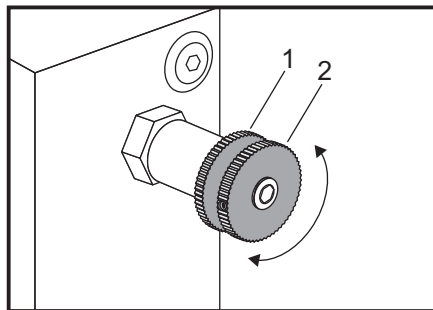

1. Go to Setting 282 on the **Settings** page and choose either **I.D.** clamping or **O.D.** clamping. Do not do this with a program running.
2. Turn the locking knob [1] counterclockwise to loosen.
3. Turn the adjustment knob [2] until the gauge reads the desired pressure. Turn clockwise to increase pressure. Turn counterclockwise to decrease the pressure.
4. Turn the locking knob [1] clockwise to tighten.