2D CAM FOR CNC · IN THE BROWSER

COPO


COPO draws your parts as vectors, calculates toolpaths (profile, pocket, V-carving, drilling) and writes the G-code for your machine. Everything runs in the browser, with no installation and no account.

`Version 1.331` `GPL v3` `Windows · macOS · Linux`

`Chrome · Edge · Firefox` `Français · English`

Open the app
`https://gbulleryahen-hash.github.io/copo/`

GitHub repository (code, download)
`https://github.com/gbulleryahen-hash/copo`

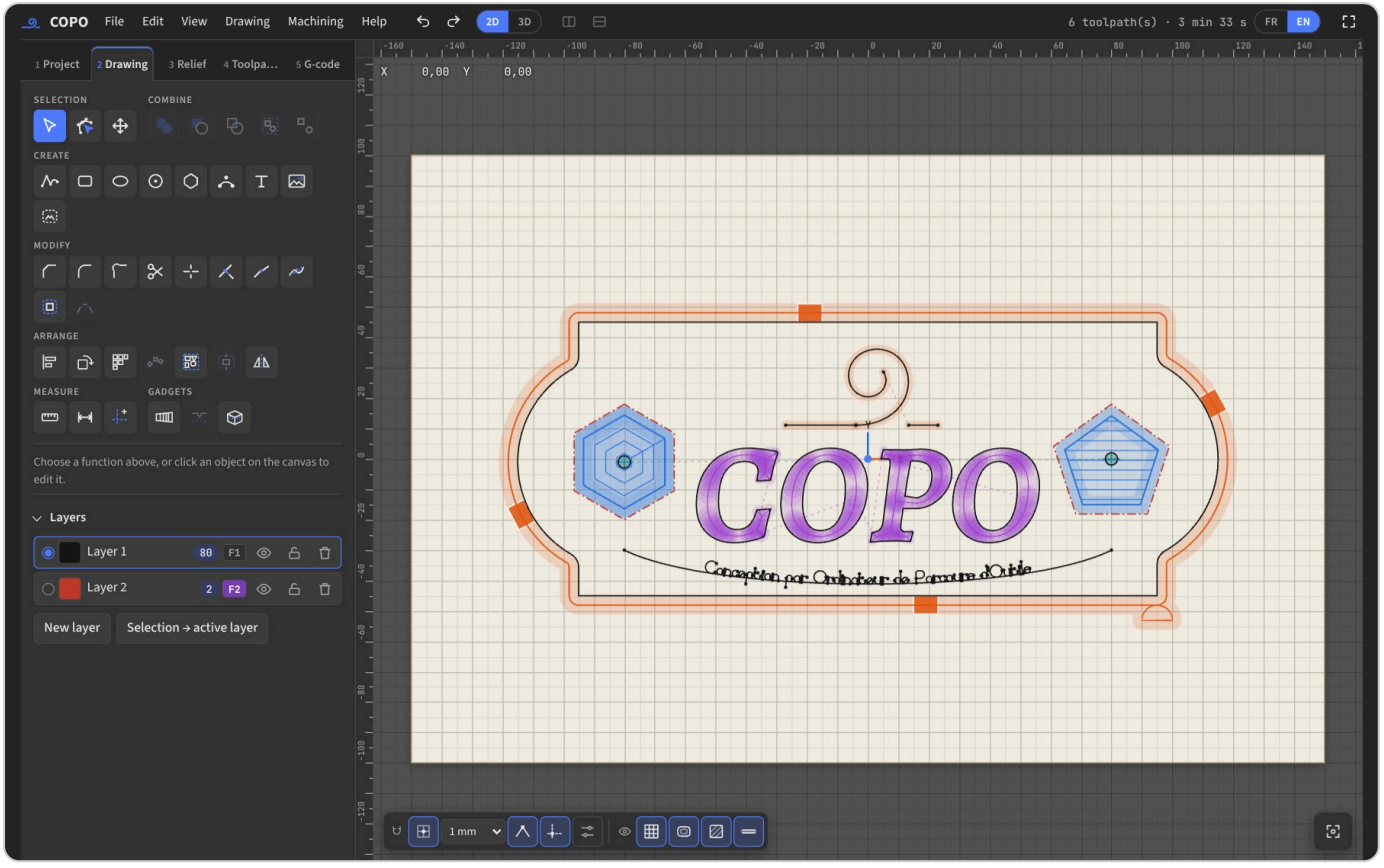

The sample project: COPO text V-carved, a line of single-line text on a curve, a decorative flourish with a ball nose tool, two drilled holes, a cut-out with tabs and two pockets on side 2. Toolpaths are shown in color on the stock.

At a glance

Vector drawing
Rectangle, ellipse, polygon, star, arc, Bézier pen, text, nodes, chamfers, fillets, booleans, layers, dimensions.

2D machining
Outside, inside or on-the-line profile, spiral or zigzag pocket, rest machining, drilling.

V-carving
Along the medial axis, like Aspire: the tool rises up to the tip of every corner.

Tool entries
Back-and-forth ramp, continuous ramp, arc, ramped arc, helix. Allowance and finishing pass.

Tabs
Spaced automatically or placed by hand, flat or triangular.

Nesting
Places several parts on the sheet following their true shape, with rotations.

Single-line fonts
About sixty included (Hershey, EMS, Relief…) for fast one-pass engraving.

Double-sided
Layers per side, flip around X or Y, pause to turn the part over.

3D preview
Material removal simulation, side 1 and side 2, with animated playback.

G-code
GRBL, grblHAL, manual GRBL (G53), Carbide Motion, Onefinity, LinuxCNC, Mach3/4, UCCNC, MASSO, a custom post-processor, about sixty .pp-format machines (Haas, Tormach PathPilot, Axyz, Isel, Kuka, laser, HPGL…) and import of your own .pp files. G2/G3 arcs.

Setup sheet
Printable workshop sheet: 2D and 3D views, origin, tools, toolpaths, speeds, checks.

Millimeters or inches
Drawing, tools and feeds in mm or inches (fractions available), G-code in G21 or G20.

French and English
Interface and user guide in both languages, chosen with the FR / EN buttons at the top right.

Free software
GNU GPL v3 licence: use, modify and share COPO freely.

Your first job in six steps

1

Set up the project

Project tab: stock size and material, X0 Y0 origin point, Z zero (top of stock or table), units and machine.

2

Draw or import

Draw with the icons of the Drawing tab, import an SVG, DXF, PDF or AI file or an image (the **Import** icon in the Create group, or the File menu) or type some text.

3

Check your tools

Choose the material in the Project tab, then check in the **Tool library** (Toolpaths tab) the speed, feed, pass depth and stepover of each tool.

4

Create the toolpaths

Select vectors in the 2D view, open the **Toolpaths** tab, choose Profile, Pocket, V-carve or Drilling, adjust, then click **Calculate**.

5

Check in 3D

The **Machining simulation** button (Toolpaths tab) or **Machining › 3D machining preview** shows the machined stock. Play the job back to spot a wrong depth or tool.

6

Save the G-code

G-code tab: choose the post-processor, then **Save G-code**. Always do a dry run before cutting.

The interface

The window reads from left to right, in the order you work.

First launch: a welcome screen offers a **quick tour** (six bubbles on the main areas), the sample project or an empty project. Then, the first time you open each tab, one or more **tips** show the essentials. Skipping the tour also turns tips off. Use **Help › Quick tour** to see it again and **Help › Show tips again** to bring the tips back; the “Don’t show at startup” box hides the welcome screen.

- **Save button** (floppy disk, left of 2D/3D): the first time it asks where to save the project; after that it simply overwrites the same file (like `Ctrl` + `S`). A blue dot shows unsaved changes.
- **Menu bar**: File, Edit, Drawing, Machining, Extensions and Help. The Drawing menu sorts its commands into five framed categories: Groups, Combine, Vectors, Corners and Arrange. The **Extensions** menu gathers the modules that create drawings and toolpaths in one go: guitar fretboard, V inlay, pocket inlay, finger-joint box and rotary graduations. The Help menu opens this guide, lets you report a bug and shows the licence. The **FR / EN** buttons, at the far right of the bar, switch the interface language; the button next to them puts COPO in **full screen** (Esc to leave).
- **Drawing tab**: at the top, a grid of icons gathers every drawing function in two columns: on the left Selection and Library, Create, Arrange; on the right Measure, Modify, Combine; each with a tooltip and a shortcut letter. Just below appears what you need: the settings of the chosen tool (with a hint and a small diagram), the form of the clicked function (Align, Array copy, Nesting, Images…), or the Selection block when a vector is selected. Greyed icons need a selection first. Layers stay at the bottom. Esc closes the open function.
- **Workspace**: the stock in beige, rulers in millimeters, the grid and the origin (X and Y arrows).
- **Left panel** with five tabs: **Project**, **Drawing**, **Relief**, **Toolpaths** and **G-code**. They are numbered 1 to 5 in the usual order of work. In the Project and Toolpaths tabs and in the tool library, small diagrams show what each setting does (depth, allowance, cut direction, tool entry, tabs, tool shape, Z zero…) and update with your choices.
- **Workspace bar**, floating at the bottom left of the 2D view (cursor coordinates relative to the origin show at the top left of the 2D view, on a transparent background, like the 3D view information): two groups of on/off icons (their name shows on hover). *Snap* (magnet): grid and its spacing, vectors, guides, and the settings button that opens Snap settings just above it. *Show* (eye): grid, toolpaths, removed material, overlapping lines. An active button has a


blue outline. At the bottom right, the **Fit all** button fits the view to the stock and drawing; the 3D view has the same bars in the same places.

- **Tooltips**: rest the mouse a quarter of a second on a button or setting to see what it does. The tooltip disappears as soon as the mouse leaves, and shows straight away on the next button while you explore. The ▲ ▼ arrows in the toolpath list change the machining order. In the toolpath list only the name is shown: the operation, tool, time and any warnings (*!* badge) appear on hover.
- **Math in fields**: in any number field, type an operation with `+` `-` `*` (or `x`) `/` and parentheses, for example `595-140`, `73.694/2` or `(10+5)*3`: the result replaces it on `Enter` or when leaving the field.
- **Toolpath names**: a new toolpath is named *layer_function_tool*, for example `female_clearance_6mm`, `female_vcarve_90deg` or `F2_bottom_pocket_6mm` on side 2. As long as you have not changed it, the name follows the settings (another tool, another function). To rename a toolpath, double-click its name in the list (or `F2`): nothing is recomputed. In the form, if only the name changes, the toolpath is not recomputed either.
- **Three levels of help** (1.283): under each setting, a short line says what to do. The ⓘ icon opens a bubble with the details (why, when, shortcuts): hover over it, or tap it on a tablet; its “Learn more” link opens the matching section of this guide. **Technical words** (ramp, tabs, stepover, peck, allowance…) show their definition when you hover over them, with no icon or underline; on a tablet, tap the word. Warnings state the consequence and the fix, for example “Risk of breaking the tool: reduce the pass depth”.

A vector is selected by clicking **on its line** (not inside it), so stacked vectors stay reachable. An already selected vector can be moved by dragging from inside.

Right click (Select tool): on a vector, in the 2D view as in the 3D view, it selects it and opens a menu next to the pointer. On a vector: **Machine** (Profile, Pocket, V-carve, Drilling), **Duplicate**, **Group**, **Weld**, **Offset…**, **Mirror…**, **Rotation…**, **Center on the stock**, **Create a relief** (Dome, Extrusion), **Move to layer**, **Copy to layer** and **Delete**. On an image: vectorize, turn into a relief, fit, center, stacking order, lock, delete. On a relief: roughing, finishing or profile toolpath, outline, duplicate, fit, center, hide, delete, and in 3D move, rotate, resize, drop to the bottom or align to the top. On empty space in the 2D view, right click closes the current tool or settings and deselects, without a menu; on empty space in the 3D view: fit all, top view, front view. With the pen or another drawing tool, right click still ends the path; in 3D, right-dragging still pans the view. **Duplicate** (`Ctrl` + `D`) creates the copy *in place*, selected: drag it or move it with the arrow keys. **Overlapping lines** (duplicates, copies not moved, shared edges, doubled DXF imports) are highlighted in pink so you spot them at a glance: the tool would pass twice over those portions. The *Overlapping lines* button in the Show group (or **Settings** › **Display**) turns this highlight on or off.

Drawing

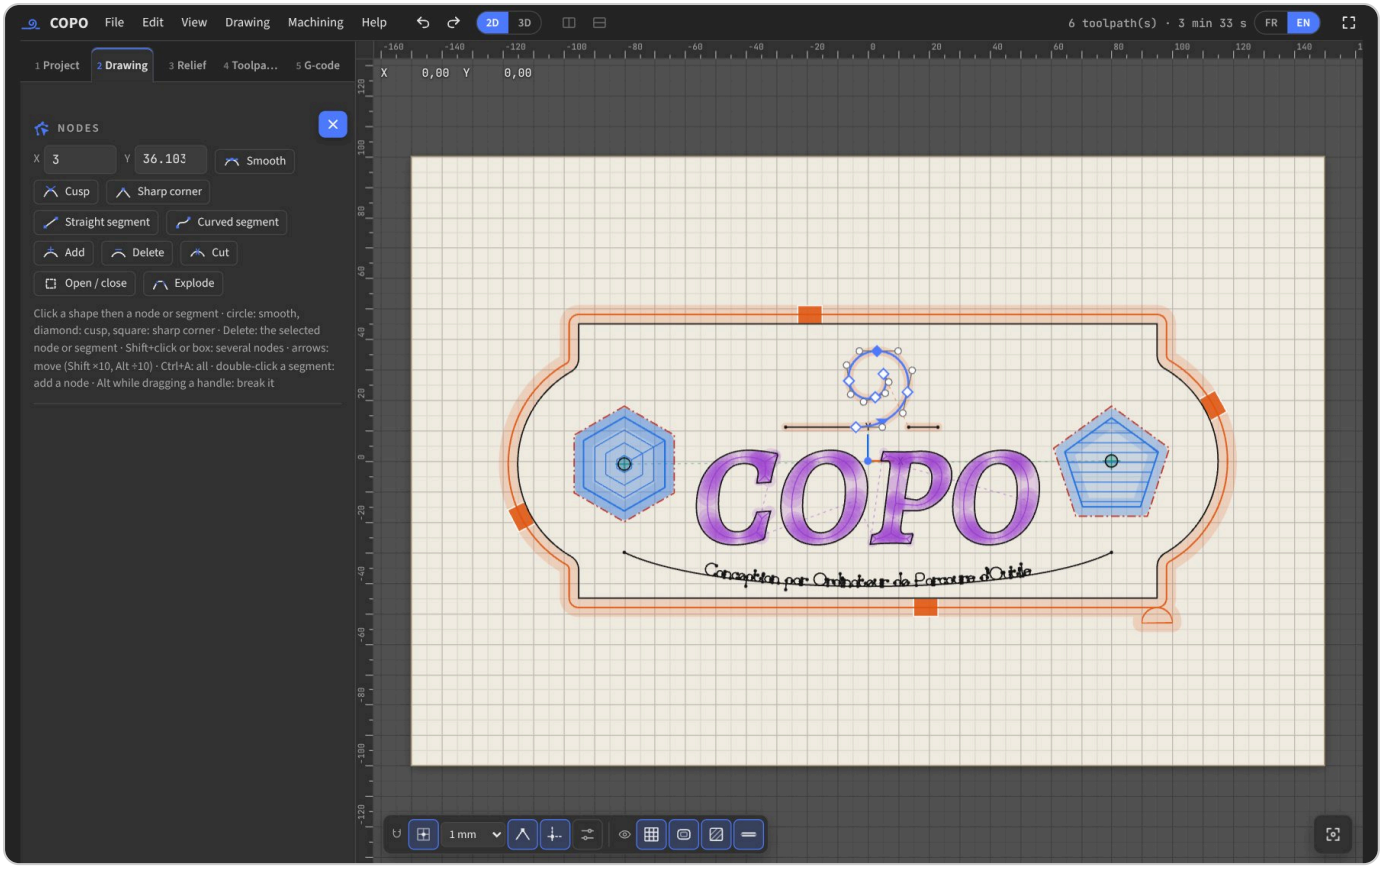

The Nodes tool: X/Y position in absolute or relative mode, then the buttons sorted by use (node types, segments, add, delete, cut, explode, open / close).

The Drawing panel, as in Aspire: when you pick a tool or a function from the grid, its settings replace the icons. The **blue cross** at the top right, or a right click on empty space in the drawing, closes them and brings the grid back. When you click a vector, the grid stays and its settings (Selection, image…) appear below it; help texts open with the ⓘ icon.

Shapes and paths

- **Rectangle** `R`, with square, external radius, internal radius (hollow arcs) or chamfered corners. **Ellipse** `E` (Shift: circle) and **Circle from center** `C`.
- **Typed values** (circle, ellipse, rectangle, polygon and star, arc): the tool panel shows fields as in Aspire. Circle: center X/Y, radius or diameter. Ellipse and rectangle: reference point (9-point grid), X/Y, width and height. Polygon and star: center, radius, angle. Arc: start point, end point, radius and height (sagitta), linked together. Draw with the mouse: the vector stays selected and the values change it directly (corners and number of sides included); **Confirm** finishes it, and you can draw the next one. With no vector in progress, type the values then **Create**. To come back later to a vector drawn this way (even

moved or resized), select it and click the pencil icon **Edit dimensions** in the Selection section.

- **Polygon and star** `O`: number of sides or points, inner radius. Click the center then drag: the 2nd point snaps horizontally and vertically to the center (`Ctrl`: 15° steps).
- **Pen** `P` (first tool of the Create row): click for a corner point, click-drag for a curve point, click the first point to close, double-click to finish. Near the horizontal or vertical of the previous point, the line aligns to it by itself ("Horizontal" / "Vertical" marker and dashes); with `Ctrl`, the angle moves in 15° steps (0°, 45°, 90°…). **Extending a line**: start the Pen on the end of an open line ("End" marker); the path continues that line instead of making a new one, and the curve to the next point leaves exactly along its axis (tangent). Drag from that first point, along the axis, to set the curve's tension. The `space bar` ends the current line and starts a new one; a *right click* ends the line and leaves the pen. The **Next point** block in the panel creates points from the keyboard: type *X* and *Y* (absolute position), or an *angle* and a length *L*, or *dx* and *dy* from the last point. The six fields stay linked (typing the angle and length fills in X, Y, dx and dy) and a dashed preview shows the point. `Enter` or **Add** places it, **Undo** removes the last point, **Close** and **Finish** end the path.
- **Arc** `A`: through 3 points (start, end, then the bulge) or, in *Center, start, end* mode, click the center, the start then the end: the arc goes the way you turn the mouse around the center.
- **Nodes** `N`: move nodes and handles, double-click a segment to add a node, `Alt` while dragging a handle to break it, `Shift` to keep it horizontal or vertical to its node. Clicking a handle **selects** it (orange dot): its X/Y coordinates show in the panel, absolute or relative, and can be changed like a node's. The *L* (handle length, its distance to the node) and *Angle* (0° to the right, 90° up) fields can be set too: changing L keeps the direction, changing the angle keeps the length. While dragging, nodes and handles snap to lines and to the **extension** of straight segments (dashed "Extension" marker): put a curve's handle on the extension of the line before it and the curve is tangent to it. Four node types: **Smooth** (circle, aligned handles), **Symmetric** (dotted circle, aligned handles of the same length: dragging one mirrors the other), **Cusp** (diamond, two independent handles for a corner between two curves) and **Sharp corner** (square, no handles). Several nodes: `Shift` +click to add or remove one, drag a box in empty space to take them all at once (`Shift` to add), `Ctrl+A` for all. Selected nodes move together with the mouse or the **arrow keys** (1 mm, `Shift` 10 mm, `Ctrl` fine step depending on zoom, `Alt` ÷ 10). The X and Y fields give the node position in *Absolute* mode; in *Relative* mode, type an offset then Enter: it applies to all selected nodes. The buttons are sorted by use: node types (Cusp, Sharp corner, Smooth,

Symmetric), segments (curve, straight), add, delete, cut, then Explode and Open / close; Smooth, Sharp corner and Delete apply to all of them. A selected **segment** (click it, it turns red) is deleted with **Delete** or the `Del` key: a closed outline becomes an open line, an open line is split in two. To switch to another vector, click its outline. **Explode** (also in the Modify row) cuts the profile at every node: each segment becomes a separate vector.

Editing

- **Chamfer** `K` and **Fillet** `F` on one corner, or on every sharp corner from the **Corners** block. The corner can also be made by two separate vectors that touch (a line and an arc, for example): COPO joins them into one vector, then makes the fillet or chamfer.
- **Copy, cut, paste**: `Ctrl+C`, `Ctrl+X`, `Ctrl+V` (also in the **Edit** menu). Each paste is offset by 10 mm and stays selected; groups and layers are kept. The clipboard also works from one project to another. With a relief selected, Ctrl+C then Ctrl+V pastes a copy.
- **Trim** `X` deletes the part of a vector between two intersections; **Cut** `U` splits a vector where you click.
- **Extend vectors** (Modify group): click the open line to extend, then move the mouse near one of its ends. Its extension shows as a dashed line, in the direction of the path, with a circle at each crossing with another vector. Click a crossing: the line is extended up to it. You can go on to the next crossing; `Esc` lets you pick another line.
- **Weld, Subtract, Intersect** for boolean operations; **Join** and **Close** for open vectors, gaps being bridged by a straight line or by a smooth curve that continues both vectors; **Offset contour**: on a closed vector outside, inside or both sides; on an open vector to the right or left of the path, or all around ("Both" creates a closed outline). A negative distance goes to the other side (−1 with Outside = 1 mm inside). Sharp or rounded corners, and an option to delete the original.
- **Smooth (fit curves)** (Modify): replaces vectors made of many small segments (tracing, DXF, import) with *arcs*, *Bézier curves* or *straight lines* that stay within the tolerance of the original. "Keep sharp corners" keeps as sharp corners those whose change of direction exceeds the max angle (60° by default). A dashed orange preview and the node count before/after are shown before applying; uncheck "Replace" to keep the originals. *Arcs* or *Bézier*? In COPO every curve (circles, arcs, ellipses, letters) is stored as Bézier curves, as in an SVG file. The *Arcs* mode finds the portions that follow a true circle (constant center and radius) and draws them with Béziers fitted to that arc, at most one per quarter circle: the gap from a perfect arc is about 0.03% of the radius (under a hundredth of a millimetre for a 30 mm radius). Use it for mechanical

shapes (templates, fillets, holes): the radii are truly constant and give clean G2/G3 arcs. The *Bézier curves* mode gives free-form curves, often with fewer nodes on organic shapes (traced drawings, scrolls), but a “round” part is not necessarily an exact circle.

- **Align and distribute** (vectors or reliefs; for reliefs, `Shift` + click in the 2D view picks several, and the same buttons are in the Relief tab): choose the reference in “Align to”. *The selection*: a single vector aligns to the stock, several align to each other. *The first selected vector*: it stays put and the others align to it; Distribute places them after it, in the order you selected them, with the given spacing. *The stock*: aligns to the stock edges and distributes across its full width or height.
- **Rotation** (Arrange): an orange pivot appears at the center of the selection; drag it in the 2D view (it snaps to vectors, guides and the grid), pick one of the nine points, or type its coordinates. *Relative* rotation (the selection turns by the given angle, positive counterclockwise) or *absolute* (the selection takes the given angle; COPO remembers earlier rotations). ↺ 90° and ↻ 90° buttons for quarter turns.
- **Handles**: click an already selected vector a second time. Squares resize (corners keep proportions when “Keep proportions” is checked, Shift for the opposite, Ctrl for whole millimeters; middles resize one axis), circles rotate around the pivot (Ctrl: angle rounded to 15°, 0, 15, 30…; Ctrl + Shift: to the degree), and the pivot can be moved. Click again to hide them. The **Rotating frame** box (Selection block, unticked by default, under “Keep proportions”) makes the frame follow the angle of a rotated vector, so you stretch it along its own axes, as in Aspire (for a single vector, or vectors rotated by the same angle; a straight line takes its own direction, so its width is its length). The width and height of the Selection block are then those of the vector along its own axes, and changing them stretches it along those axes.
- **Moving with the keyboard**: the arrow keys move the selection by 1 mm (`Shift`: 10 mm). With `Ctrl`, the step follows the zoom: about one screen pixel, rounded to 1, 2 or 5 (0.05 mm close up, 1 mm from afar), to place a vector precisely; `Ctrl` + `Shift`: ten times more. The step used is shown. Same for nodes and images.
- **Right-click and double-click**: a single right-click in the 2D view finishes the current line (polyline), cancels a vector in progress, goes back to the selection tool and deselects; with the selection tool, it hides the handles and then deselects. Double-clicking a vector, from the selection tool or a shape tool (rectangle, ellipse, circle, polygon, arc, dimension, measure), selects it with its handles; another double-click opens node editing (Esc or right-click to leave).
- **Mirror** (Arrange group): flips the selection about the top, left, right or bottom edge of its frame, horizontally or vertically (about its center, or the stock

center when the box is checked), or about a straight line selected with the vectors (**Flip about the line**). Small icons (the letter P and its reflection) show the effect of each button. The *Create a mirror copy* box keeps the original in place.

- **Outline** (last icon of the Create group): with an image selected, opens its vectorization; with a relief selected, creates the vector that follows its edge.
- **Array copy** in a grid, a circle or *along a curve* (also the **Repeat along a curve** icon in Arrange): select the vectors to repeat then, last, the guide curve (`Shift`+click); set the number of copies, spread over the whole curve or with a spacing, a start offset, and check *Align to the curve* so they rotate with it. **Mirrors**, **rotation**, **stacking order**.
- **Exact position and size**: **Selection** block, with a reference point chosen among nine (corners, middles, center).

Snapping, guides and dimensions


Edit › **Settings** › **Snapping** gathers the **snap settings**: snap to grid and its spacing, **guides**, stock corners, midpoints and center, snap radius (small to large), and vector snapping with its six kinds of points (ends and nodes, midpoints, intersections, centers, tangents, and *on path*: any point of a line or curve, the closest to the cursor). Precise points (end, midpoint…) take priority over "on path". **Center of a circle or arc**: move the mouse near its outline and a small orange cross shows the center; go to it to snap there (also for circles made of straight segments, imported or vectorized). The **origin** (X0 Y0) is always a snap point. When you move a vector by grabbing one of its points (node, corner, midpoint, center), that point is the one that snaps: drag a rectangle's corner onto the origin and it lands exactly there. These settings are remembered. Drag from a ruler to create a guide: drawn points snap to it, and when you move a selection its edges and center line up with the guides (and with the stock if that box is checked). **Double-click a guide** to open the **Guides** block (Measure group) on its position, to change it with the keyboard; the **padlock** on each row locks the guide, which no longer moves with the mouse. An orange symbol at the cursor shows the snap found. The grid icon below the 2D view shows or hides the grid. The **Measure** tool `M` gives a distance and the **Dimension** tool `D` places a dimension that stays in the 2D view. An end snapped to a node, a segment midpoint or the center of an arc or circle (solid dot at the end of the extension line) stays attached to the vector: move it, resize it or edit its nodes and the dimension follows, with its value updated. An end placed elsewhere (grid, intersection, free point) stays fixed.

Layers, images and files

- **Layers**: stroke color, visibility, lock and machined side (F1 top, F2 bottom). Deleting a layer that holds vectors asks whether to move them to another layer or delete them too. Below the list, **Selection → active layer** moves the selection to the active layer and **Copy → active layer** copies it there (the copies are selected, the originals stay in place); the right-click menu also offers **Move to layer** and **Copy to layer**.
- **Reference images** (**Import** icon › Image, **File** › **Insert an image…** or drag and drop): move, resize and rotate them with the handles to trace over them. They are never machined.
- **Drawing and image library** (**Library** icon of the Drawing panel, or **File** › **Drawing and image library…**): folders on the left, previews on the right. **Add to drawing** (or a double-click) places the chosen drawing (SVG, DXF, PDF, AI) or image (PNG, JPG…). **New folder**, **Add files…** and **Add a folder…** (a whole folder of the computer, with its sub-folders) fill it; **Import the current drawing** (also **File** › **Add the current drawing to the library…**) saves it as SVG, or just the selection. **Export my library…** and **Import my library…** back it up or move it to another computer (.copolib file). The gear at the top opens **Settings** › **Library**: the library can stay in the browser, or be a **folder on the computer** (Chrome and Edge) made of real files, which you can also organize with the file explorer; preview size and double-click are set there too.
- **COPO library**: under “My library”, the **COPO library** folder holds 2D drawings (closed outlines, in mm) and grayscale reliefs supplied with COPO, sorted by category (2D drawings: corners, shapes, Christmas, panels and shields; Reliefs: animals, decorative, objects, plants, ribbons, textures…). They are free to use, even for parts you sell, and come from the website: you need to be online the first time, then they stay available offline. This folder is read-only: **Add to drawing** places the item, **Copy to my library** copies it into your own folders so you can rename or change it. A grayscale image is placed on the drawing; turn it into a relief in the Relief tab. The full list, with sources and licences, is also on the website’s Library page.
- **Adjusting an image** (Drawing panel, image selected): center, angle, width, height and opacity fit on two rows; the row of icons below fits the image to the stock, centers it, resets the angle to 0°, changes the stacking order, locks and removes it (each button's name shows on hover). The details of the help show in the ⓘ icon’s bubble.
- **Vectorize an image** (collapsible **Vectorize** section below the image settings; when collapsed it shows the threshold and smoothing): COPO traces the outlines of the image. Set the *threshold* (anything darker becomes the shape; “Auto threshold” works it out for you) and the *smoothing* (softer outlines, small details removed), check *Invert* to outline light areas. The preview

updates live; **Create outlines** adds closed, grouped vectors where the image is, ready for a pocket, a profile or V-carving. A sharp, high-contrast image (logo, line drawing, silhouette) gives the best result.


- **Import**: the **Import** icon in the Create group opens a panel with two choices, *Vector* (SVG, DXF, PDF, AI) and *Image* (reference image to trace over or vectorize).
- **SVG**: import in millimeters with curves kept; export the whole drawing or the selection.
- **PDF and AI**: the vectors of the first page are imported to scale (in mm), curves kept; clipping areas, images and text that is not outlined are ignored. Illustrator files must have been saved with “Create PDF Compatible File” (the default); a very old AI (PostScript) is refused with a message. Convert text to outlines before exporting (Type › Create Outlines).
- **DXF** (text/ASCII, any version): lines, polylines with arcs, circles, arcs, ellipses, splines and blocks. The file's unit is respected (mm, cm, inches…); a file without a unit is read as millimeters. Touching segments are joined into outlines, closed when possible, and each DXF layer becomes a COPO layer. Text, dimensions, hatches and 3D objects are skipped (the message says which).

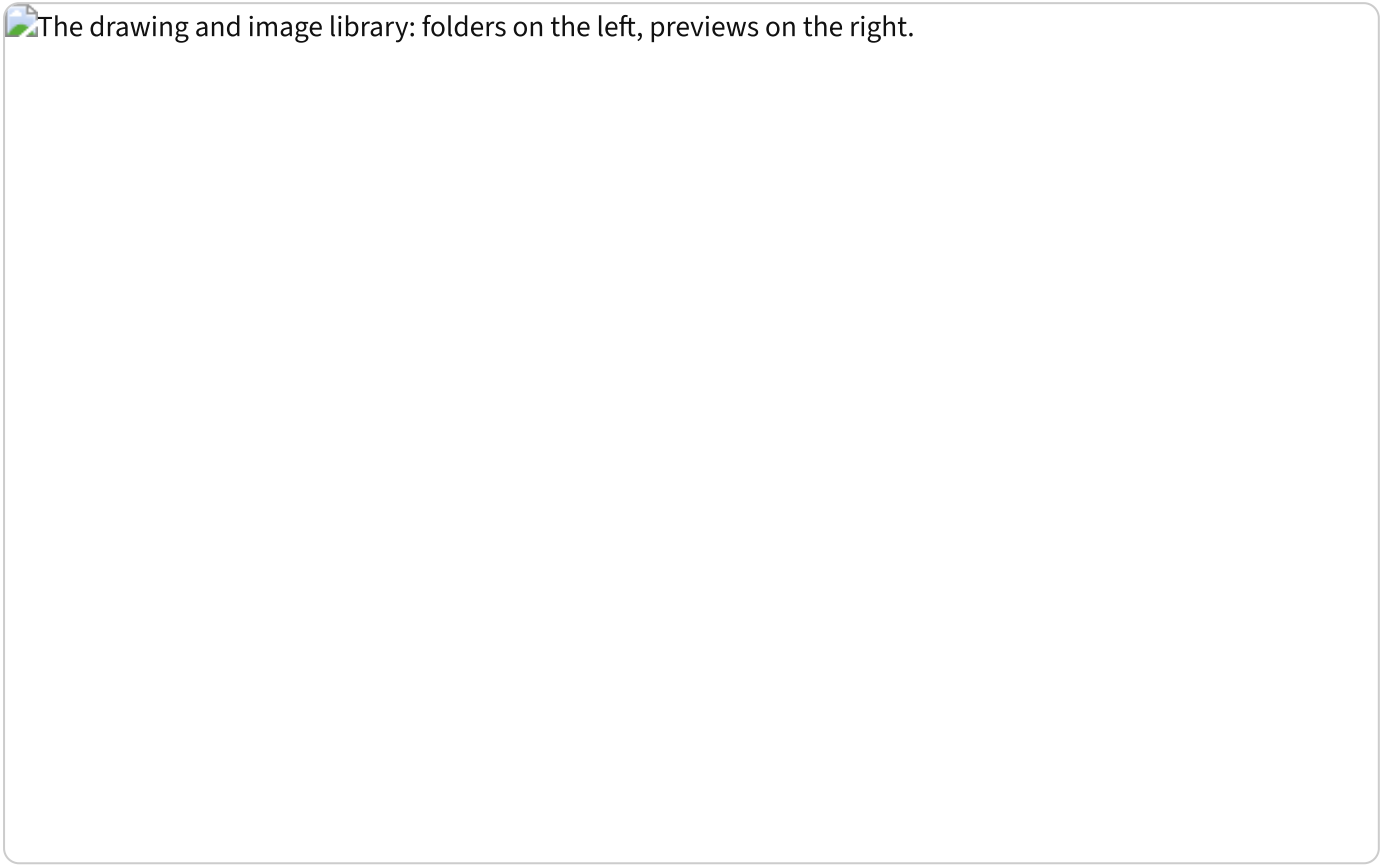


The drawing and image library: folders on the left, previews on the right, import and export buttons at the bottom.

Corners for tenons and mortises: dogbone and T-bone

A round tool leaves a fillet of its radius in corners, so a square tenon will not fit its mortise. The relief is drawn on the shape, corner by corner, so it only goes where it is needed. Take the **Relief** tool `B` (Modify group), choose *Dogbone* (the tool moves diagonally to touch the sharp corner) or *T-bone* (the relief extends the longer side, less visible) and the **tool diameter**, then click near the corners to relieve. The same settings are in the **Corners** block of the Drawing panel. Corners are picked one by one, as for chamfers and fillets. Relief only works between two straight segments; its diameter is 0.1 mm larger than the tool so it fits without forcing. Then machine the vector as usual (pocket, inside or outside profile) with that tool.

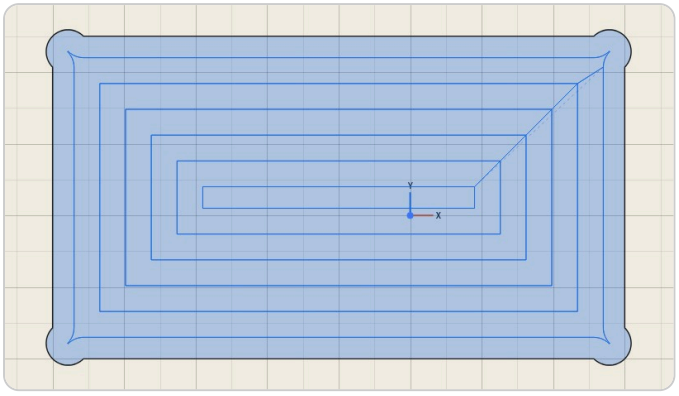


Dogbone: an arc the size of the tool, diagonally in each corner.

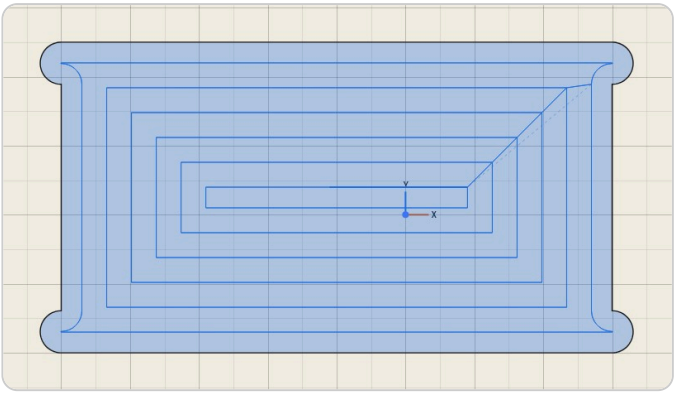

T-bone: the arc extends the longer side.

Project tab

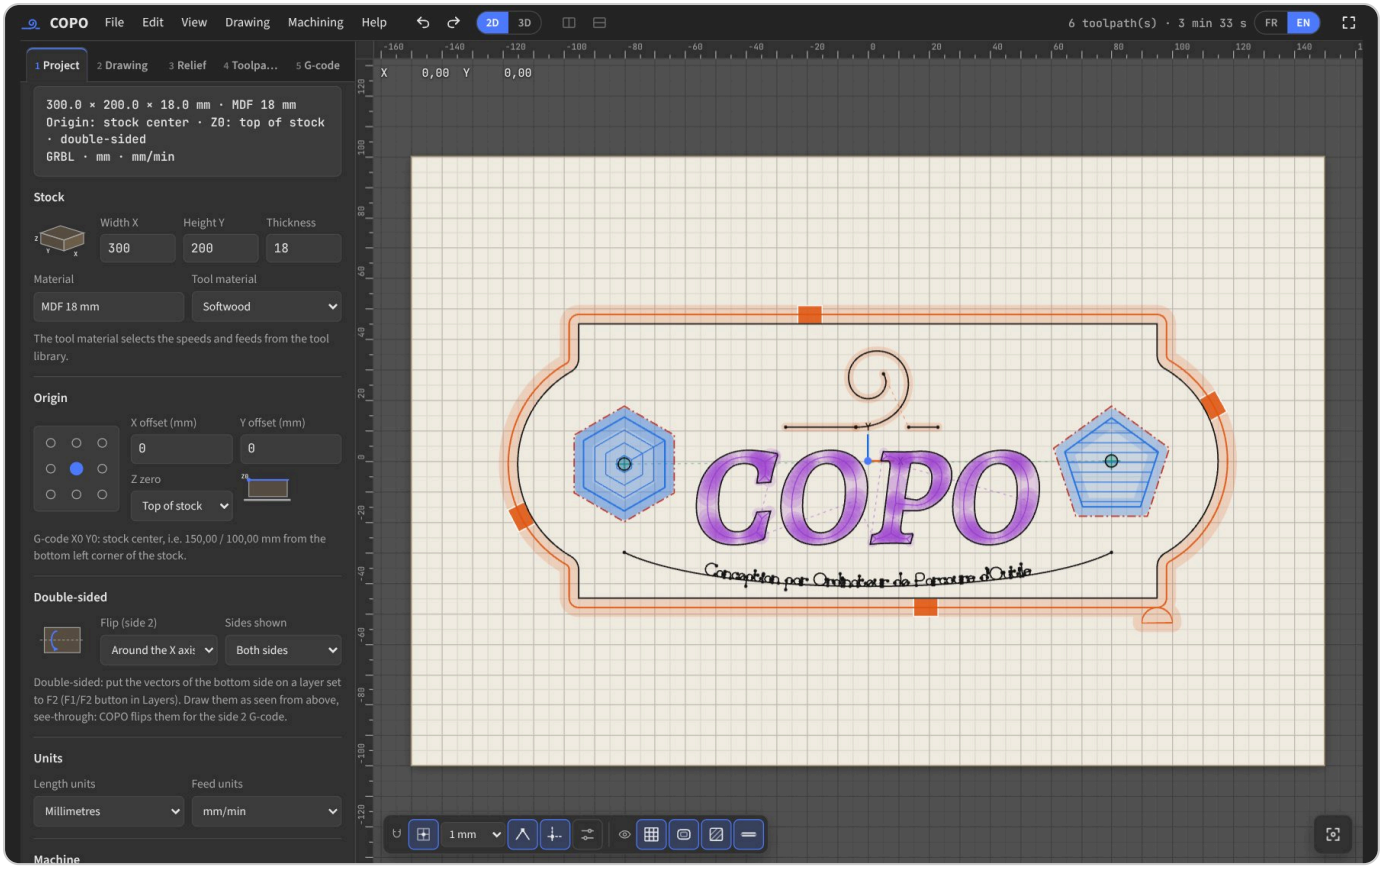

The Project tab gathers everything you set at the start of a job. The summary at the top lets you check it all at a glance.

The **Project** tab, first in the left panel, opens by itself when you create a new project. It contains:

- **Project type**: *Single-sided*, *Double-sided* (the Double-sided block appears) or *Rotary* (4th axis). The settings below change with the choice. If the selected machine has no rotary axis declared, a warning appears under the Rotary choice, without blocking anything.
- **Rotary**: the part is a cylinder turning between a chuck and a tailstock. *Job size*: length (L) and diameter (D). You draw on the **unrolled** surface of the cylinder, like a label laid flat: the sheet is L by π × D (the circumference, computed for you). The middle of the sheet is the top of the cylinder; dashed lines mark 90°, 180° and 270°, and the sheet edges are the seam (0° = 360°): a design crossing it must match up. *Z zero*: cylinder surface or axis. *Orientation*: rotation axis along X (Y wraps) or along Y (X wraps). The 3D view and the simulation show the part wrapped on the cylinder (uncheck to go back to flat, for example to place a relief with the handles). In the G-code, the wrapped coordinate is output as an **A** angle (or B, depending on the machine; degrees) with any post-processor, and arcs are replaced with short segments; a “Wrap”

or “Rotary” post-processor (.pp) can also be used. Depths are measured towards the center: the deeper you cut, the more the design tightens.


- **Stock**: X width, Y height, thickness and material (used by the setup sheet);
- **Origin**: the X0 Y0 point on the nine-point grid, an X/Y offset to place it outside the stock, and Z zero on the top of the stock or on the table;
- **Double-sided**: the flip axis and the sides shown;
- **Units**: millimeters or inches, feed unit;
- **Machine** (top of the tab): the name of the machine in use and its post-processor; **Change…** opens the **machine library**. On the left, the list of machines (the checked one is used for the G-code; click another to switch), with **+ New machine**, **Duplicate** and **Delete** (two clicks to confirm). On the right, its settings, saved automatically: name, X/Y/Z travel (optional: the Project tab warns if the stock is larger), spindle speed range (tool speeds are clamped to it in the G-code), rotary axis fitted and its letter (A or B), notes. With the “GRBL manual” or custom post-processor, the *Rise to a machine Z (G53) at tool changes* box is **off by default**: a wrong machine Z can drive the spindle into its limit; when off, the spindle rises to the safe Z and G53 lines are removed, and: post-processor, rapid speed, **maximum cutting feed** (2000 mm/min by default: tool feeds are capped at this value), safe and clearance Z, G2/G3 arcs and comments. The **G81/G82/G83 drilling cycles** box writes holes as canned cycles: G81 plain, G82 with a dwell at the bottom, G83 with pecking, G98 retract to clearance Z. G83 has no dwell: a hole with both pecking *and* dwell is written as G0/G1. It is checked by default for grblHAL, LinuxCNC, Mach3/4, UCCNC and MASSO, and unticked for GRBL, Carbide Motion, Onefinity and the custom post-processor (holes are then written as G0/G1); you can always change it. If the controller does not know these cycles, it simply stops with an error.

The origin point must match the point where you set X0 Y0 on the machine. Stock, origin and material are saved with the project. Units and machine settings are remembered in the browser.

> Example: with the origin at the bottom left corner, a square whose corner sits at X0 Y0 in the 2D view is cut from the bottom left corner of your sheet. The line under the grid tells you where the G-code X0 Y0 falls.

Rotary project (4th axis), with the sample

File › Open the rotary sample (4th axis) loads a beech cylinder, 90 mm in diameter and 150 mm long, with the word COPO V-carved and a flourish engraved all around. Follow it to see how it works:

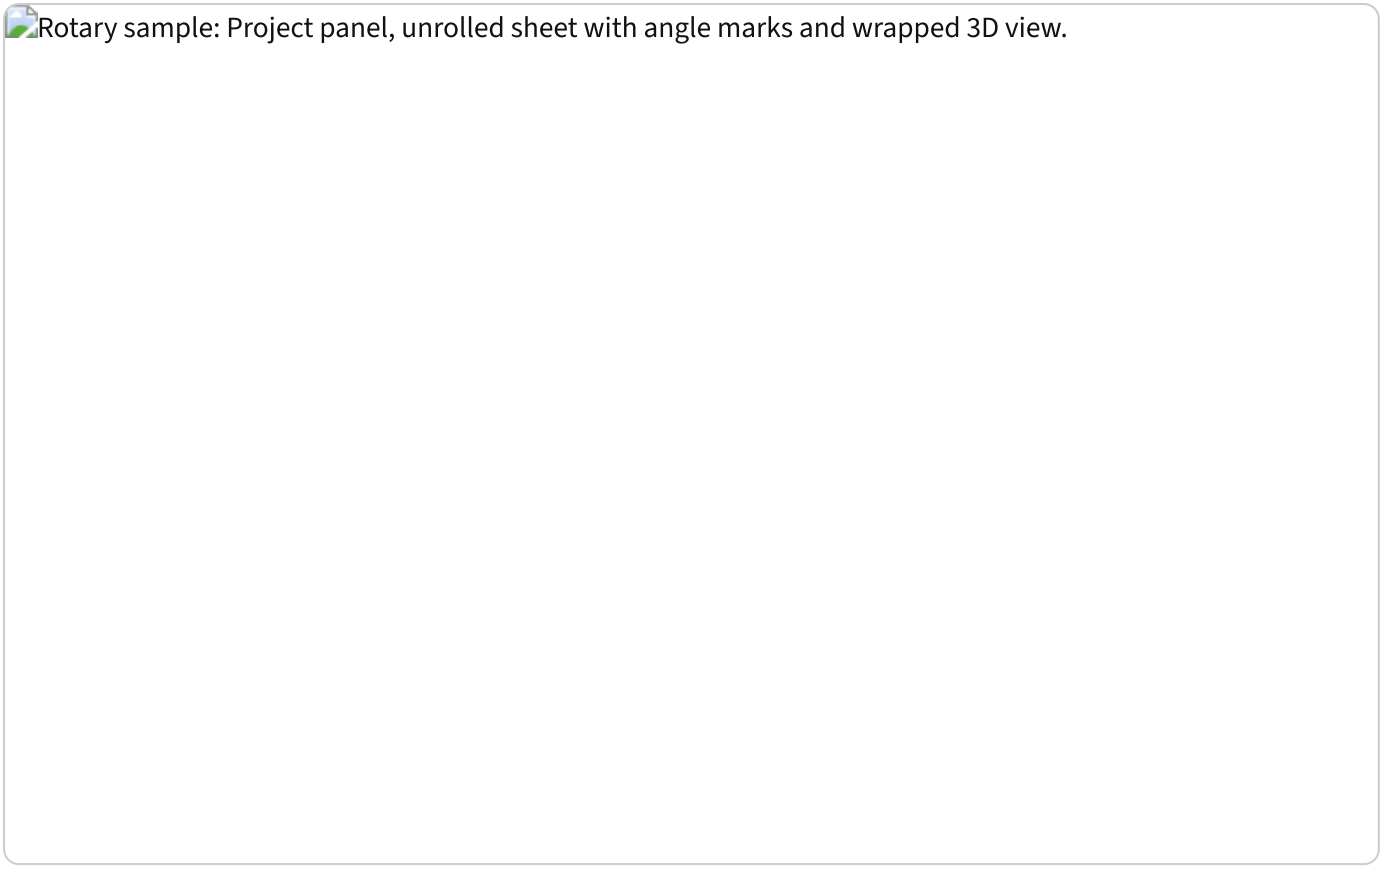

Left, the *Rotary* type and the job size; center, the unrolled sheet (150 × 282.74 mm) with the 0°, 90° and 270° marks; right, the 3D view wrapped on the cylinder.

1

Project type: Rotary

The stock becomes a cylinder. If the machine has no rotary axis declared, an orange warning appears, without blocking anything.

2

Job size

Length 150 mm, diameter 90 mm: COPO computes the circumference (π × 90 = 282.74 mm), which becomes the width of the unrolled sheet.

3

Z zero, XY origin, orientation

Z zero on the cylinder surface; origin middle left (X0 at the left end of the part, A0 on top); rotation axis along X, so Y wraps.

4


Drawing and toolpaths

Draw and create toolpaths flat, as usual. The middle of the sheet is the top of the cylinder; its two edges meet (0° = 360°).

5

Simulation and G-code


The 3D preview shows the material removed on the cylinder. In the G-code, Y becomes the A angle, in degrees, and arcs are replaced with short segments.

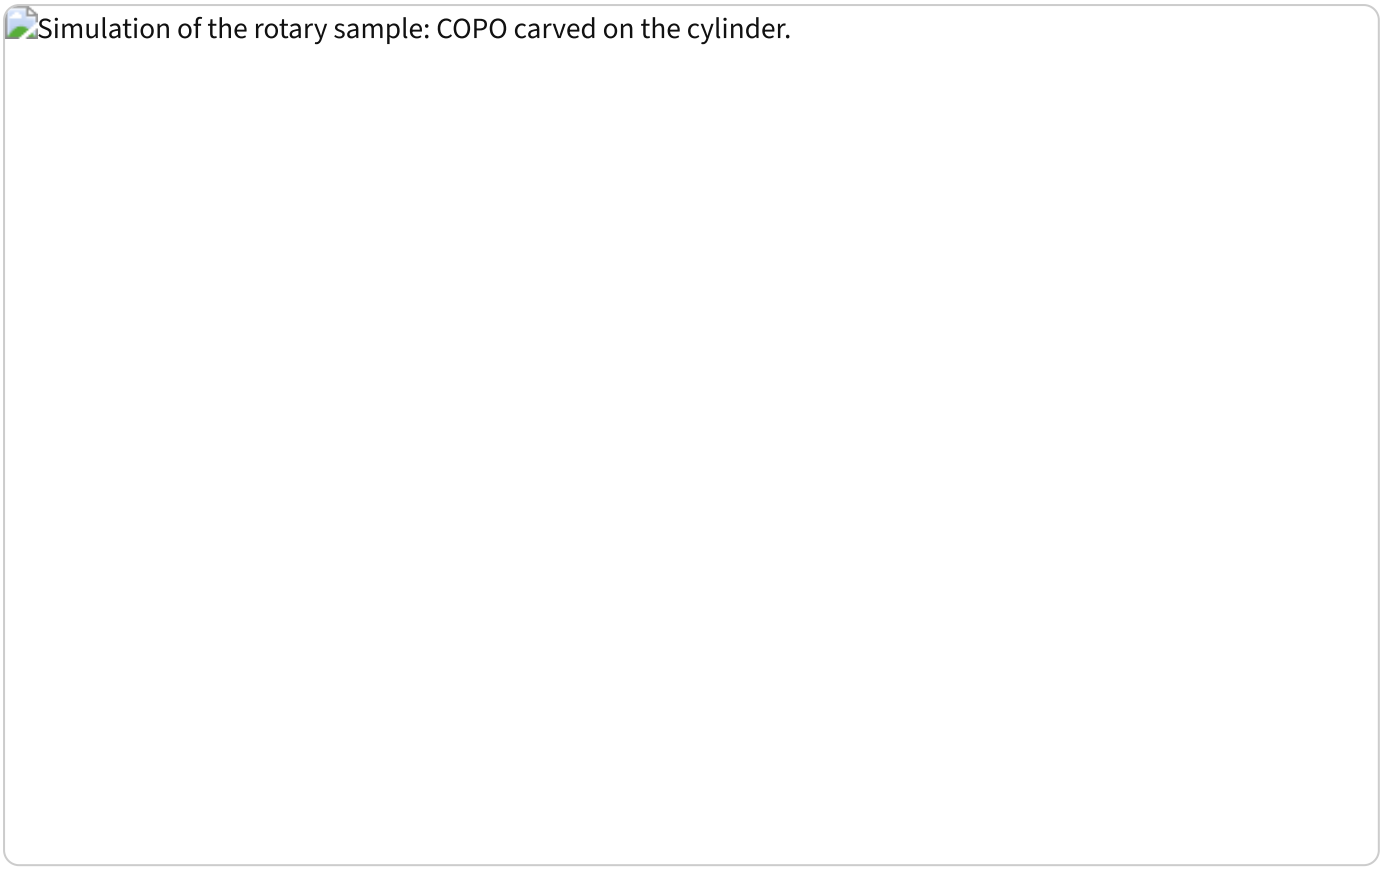

Simulation at High resolution: the V-carved text is cut into the cylinder.

```
(COPO 2D CAM)
(Cylinder L 150 x D 90 mm unrolled sheet 150 x 282.743)
(XY origin: middle left - Z0: cylinder surface)
G21 G90 G17 G94
(Rotary axis: Y wraps to A - diameter 90 mm - Z0 at the surface)
G0 Z10
(Tool: Ball nose 3 mm)
…
(Rotary axis: Y wraps to A - diameter 90 mm - Z0 at the surface)
G0 X50 A14.137
X73.401 A14.14 F1000
X73.722 A14.148
X74.042 A14.162
X74.36 A14.181
```

Machine library

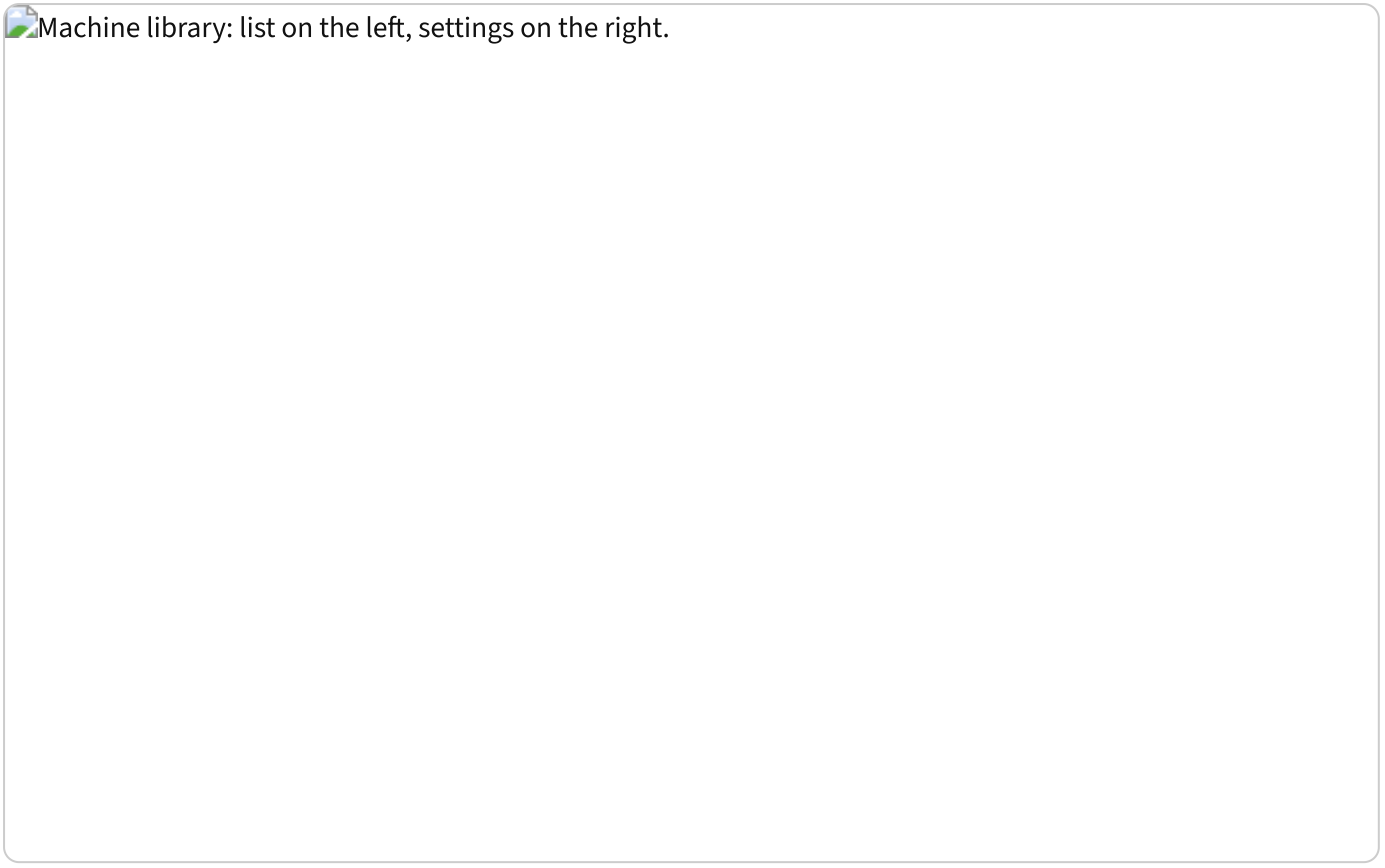

Left, the machines (the checked one is used for the G-code); right, the settings of the selected machine, saved automatically.

In the Project tab, **Machine** › **Change…** opens the library. Each machine keeps its post-processor, speeds, safe heights, X/Y/Z travel, spindle range and rotary axis (letter A or B). The default machine uses the *GRBL (M0 pause at tool change)* post-processor, and rising to a machine Z (G53) at tool changes is off by default. The **tool change** can also be set in the machine: *As set by the post-processor* (default), *No command* (the tool only appears in a comment), *Pause command* (M0 or another command, at each change) or *Tool change command* (start command, tool number, end command: “T6 M6”, “M6 T6”…), with an example under the fields. The tool number (T…) is the tool’s number in the tool library; if two tools of the program share a number, a warning shows under the G-code. It does not apply to .pp post-processors, which define the tool change themselves. **Export…** saves all machines to a `machines-copo.json` file (another computer, backup); **Import…** adds the machines from such a file without replacing anything.


Settings

Edit › **Settings…** (`Ctrl` + `,`) opens a window with sections: titles on the left, content scrolling on the right (click a title to jump to it; the title of the part shown lights up). Everything is saved in the browser.

- **General**: interface language, welcome screen at startup, tab tips (and *Show all tips again*), quick tour, *toolpath recomputation* after a drawing change (Automatic or Manual, see Toolpaths).
- **Snapping**: snap to grid and its spacing, guides, stock, snap radius and vector snapping (see Drawing). The snap button of the 2D view bar opens this section directly.
- **Display**: *Theme* Dark (default) or Light “Établi clean” (cream background, frameless tools, steel-blue accent), applied at once and remembered by the browser; the screenshots in this guide stay in the dark theme. *Relief resolution*, as in Aspire: Standard (fastest), High (about 3 × slower, recommended) or Very high (about 7 × slower); whatever the resolution, a relief being moved follows the mouse immediately, shown slightly coarser, and the fine display returns on release; vertical walls (STL parts, relief edges) are smoothed, with no streaks or stair-stepped edges; toolpaths are not affected, grid, toolpaths, *name and time of each toolpath in the simulation* (under the time in the 3D view; ▸ marks the current toolpath, ✓ the finished ones; off by default), removed material, overlapping lines, ends of open lines, reliefs in the 2D view.
- **3D views**: mouse buttons (by default like Fusion, FreeCAD, Tinkercad: hold right button = orbit, hold middle button = pan; or Classic: left button = orbit, right button = pan; Shift + right button pans on a touchpad) and orbit center: Origin, View center or Under cursor (default).
- **3D views** (continued): wheel zoom towards the cursor (default) or towards the view center. **Relief color**: bronze (default), aluminium, light wood, dark wood or plastic, the same in the 3D view and in the simulation.
- **Library**: location of the drawing and image library (in the browser or in a folder on the computer), preview size, double-click action.
- **Simulation**: default resolution of the 3D preview (Standard, High or Very high).

Units and machine stay in the Project tab, close at hand. The G-code tab shows the selected post-processor; **Change…** opens the machine library.

Tool library

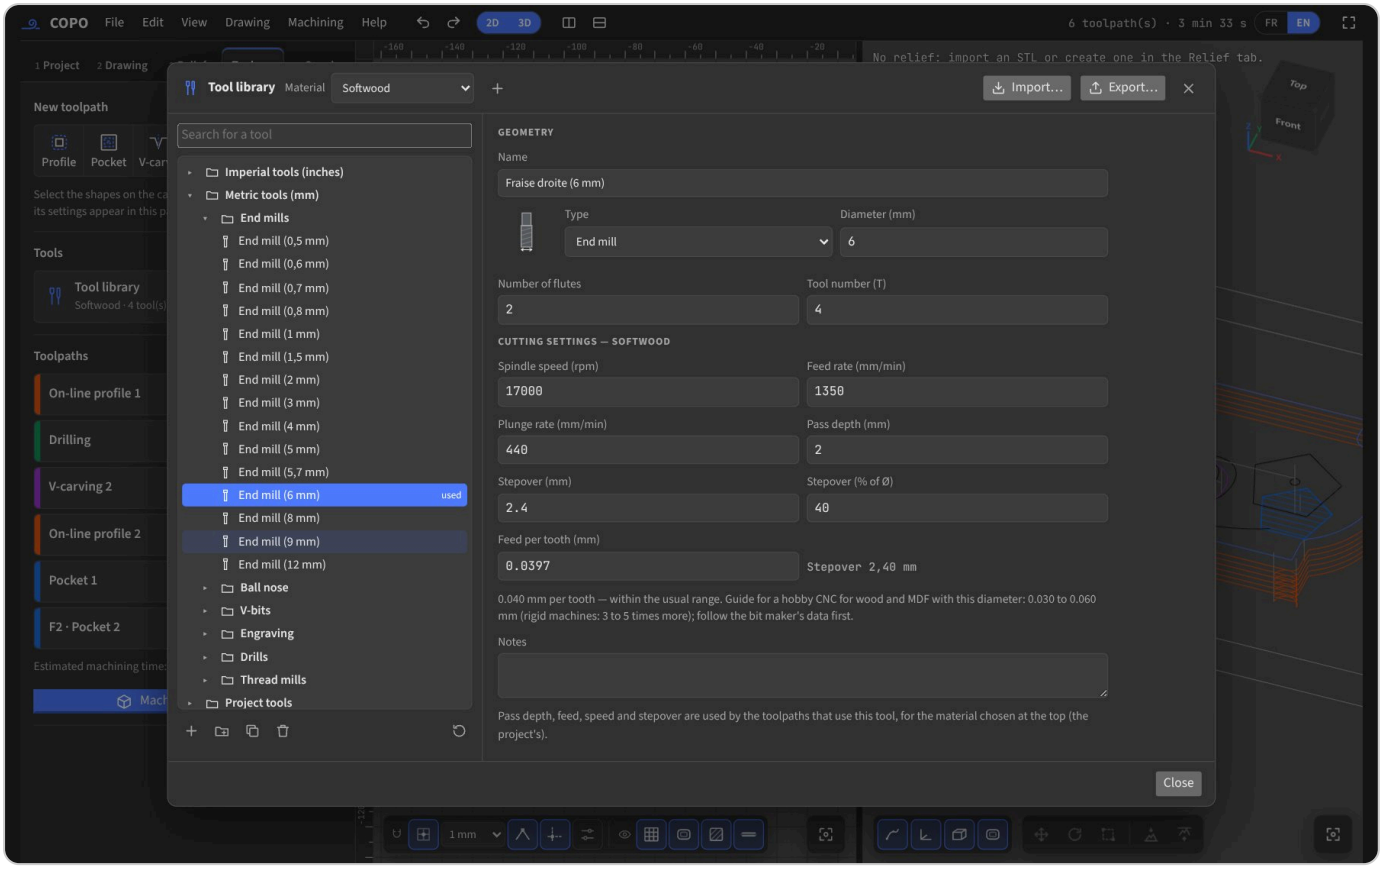

The tool library: the material at the top, tools sorted by unit system and type on the left, the tool's settings for that material on the right.

The library opens from the **Tool library** card in the Tools block of the Toolpaths tab (it shows the project material), from **Machining** › **Tool library…**, and from the **Tool** button of a toolpath window. Inspired by Aspire's, it comes filled: metric (mm) and imperial (inch) tools, sorted into end mills, ball nose, **V-bits** (including 30° bits for fine engraving and the carbide *carving* bits Ø 10 and Ø 32 with a 6 mm shank), **engraving bits (flat tip)** (carbide, 15° to 90°, 0.1 or 0.2 mm flat, 1 or 2 flutes), **tapered ball nose bits** and drills, named as in the catalogs, with settings for eight materials: **softwood, hardwood, MDF, acrylic, PVC, HDPE, aluminium and brass**. The first four come from an Aspire library tuned for a WorkBee-type machine; settings missing there are **estimated** for a hobby CNC from the CncFraises charts (“hobby”, very cautious) and the Sorotec charts (small diameters): feed per tooth by material and diameter, spindle speed from the cutting speed (between 8,000 and 18,000 rpm, feed capped at 2,000 mm/min), pass depth k × Ø (0.5 to 1 × Ø in soft materials, 0.1 to 0.35 × Ø in aluminium and brass), reduced because the tool often cuts its full width. PVC takes the acrylic settings. Estimated values are flagged by an orange banner: do a test cut and correct them. Below the settings, a **tip** recalls the rules of the material (chips, not dust; lubricate aluminium; plastics that melt…) and of the tool; a banner warns

when the tool is not recommended for the material (two-flute javelot or carving bit in aluminium).

Your changes are saved in the library: they are used by every toolpath and every project that uses this tool with this material (a bubble says so at the first change). A *You changed these settings* banner flags them, with a **Restore the original values** button that brings back the settings shipped with COPO, or the estimate, for this material. The comment under the feed per tooth turns orange when the feed per tooth leaves the reference range or when the pass depth exceeds k × Ø.

- **Material** (top): this is the project material, also set in the Project tab (*Tool material*). Changing it makes every project tool take that material's settings and recomputes the toolpaths. The **+** button adds a material.
- **Tree** (left): click a folder to open it, double-click to rename it; the search box filters by name; “used” marks the tools of the project's toolpaths. At the bottom: new tool, new folder, duplicate, delete and back to the default library (two clicks). The **Import…** and **Export…** buttons are at the top right.
- **Settings** (right): geometry (name, type, diameter, angle, engraving tip, number of flutes, T number, notes), then cutting settings for the chosen material. The name updates itself as long as you have not edited it.

SETTING	PURPOSE
Type	End mill, ball nose, three tapered bits — **V-bit** (perfect point: Ø and included angle), **engraving bit (flat tip)** (Ø, angle and flat diameter) and **tapered ball nose** — or drill (point angle, usually 118°).
Tapered ball nose tool	Defined as on its box: **shank diameter D**, **tip radius R** and **cutting length L**. COPO derives the side angle, that of the cone tangent to the ball that reaches diameter D at height L: for D 6, R 1, L 20, about 5.99° (11.99° included). The three tapered bits are used for V-carving and inlays with their real shape: the flat or rounded tip counts in the depth, the cut width, the clearance and the simulation.
Diameter	Used to calculate offsets and pockets. When you change it (end mill or ball nose), each material's speeds, feeds, pass depths and stepovers are recalculated in the ratio of the estimates between the old and new diameter: check them.
Tool number (T)	Written in the G-code of tool-change post-processors (`T2 M6` , `M6 T2`).
Spindle speed	In rpm, written with `M3` .
Feed, plunge rate	In mm/min, for cutting and for plunging or ramping.
Pass depth	Maximum depth per pass; it fills the toolpath's pass depth when you choose the tool.
Stepover	Distance between two pocket passes, in mm or % of the diameter (as in Aspire). Not shown for drills.
Number of flutes	Number of cutting edges of the tool.
Not center-cutting	For end mills or ball nose bits whose end does not cut: toolpaths never plunge straight down with them (back-and-forth ramp instead) and the toolpath form says so.
Feed per tooth	Calculated: feed ÷ (spindle speed × number of flutes). Type a value to recalculate the feed. The comment below, on an orange background when conditions are not optimal, says whether it is low (the tool rubs and heats up) or high (risk of breakage), against the hobby-CNC reference range of the material by diameter, flags a pass depth that is too deep, and warns when the feed exceeds the machine's maximum feed; the tool maker's data come first. For a drill, COPO gives the feed per revolution.

Choosing a toolpath's tool


In a toolpath window, the **Tool** button shows the chosen tool; click it to open the library, select the tool then **Use this tool** (or double-click). Tools that do not suit the toolpath type are greyed out. The toolpath takes the tool's settings for the project material, and its pass depth. Editing a tool in the library updates the toolpaths that use it. A new toolpath takes the project's 6 mm end mill when it suits.

Importing an Aspire library

The import button reads Aspire, VCarve and Cut2D libraries directly (`.vtdb` file, for example `C:\ProgramData\Vectric\Aspire\V12.0\ToolDatabase\tools.vtdb` , or an export from Aspire's library). Tools, their folders and their per-material settings are added in an “Aspire import” folder, inches converted to millimeters; if the file holds several machines, COPO asks which one to use. Missing materials (PVC, HDPE, aluminium, brass) are estimated. Form tools and diamond drag tools, which COPO cannot machine yet, are skipped. Import also accepts a COPO library exported as `.json` .

Relief (modelling)

The **Relief** tab prepares sculpted machining, like Aspire's modelling: each relief item is a height map placed in the stock. The tab opens the 3D view next to the drawing (**2D** / **3D** buttons); the creation buttons show how to use them on hover.

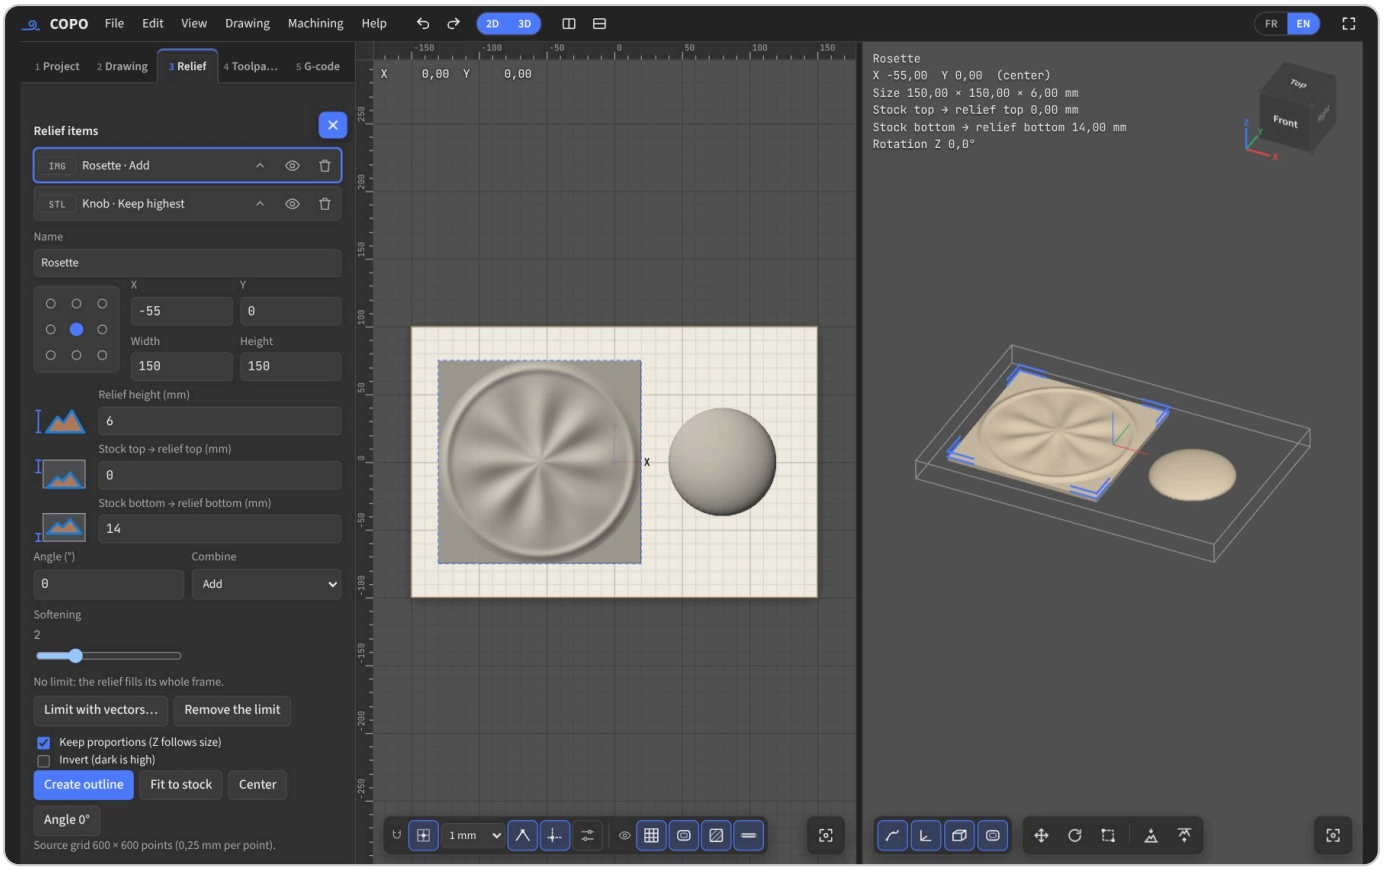

A grayscale image (rosette) and an STL model (knob, "keep highest") with the item settings.

- **Grayscale**: insert the image (PNG, JPG) in the Drawing tab (**Import** › **Image**), place and size it, select it, then click **Grayscale**: the image is *turned into a relief* at the same place, size and angle, and leaves the 2D view. The relief is shown shaded in the 2D view and handled like a vector. Light is high, dark is low (check *Invert* for the opposite). A transparent background counts as black for heights but is not machined: with no boundary selected, machining stays within the opaque part of the image. For an image on a black background (a JPG, for instance), check *Black background → transparent, no relief (threshold)*: anything darker than the *threshold* (8 % by default) becomes transparent, with no relief and no machining, and the rest of the relief starts from zero at the edge, with no step.
- **3D model** (binary or text STL): the model is seen from above and projected into heights, at its real size: it is never scaled down, even if it is larger than the

stock. In that case, a message and the panel summary (in red) say so: enlarge the stock in the Project tab, or shrink the model yourself. If the model comes in lying down or upside down, *X angle* and *Y angle* tilt it (180° on X to flip it, ±90° to stand it up), *Z angle* turns it flat (other reliefs only have the Z angle). Undercuts are machined as seen from above. Also from **File** › **Import an STL (relief)…**.


- **Settings of each item**: position and size as for a vector (one of nine reference points, X, Y, width, height), *relief height*, *stock top → relief top* and *stock bottom → relief bottom* (editing one recalculates the other: their sum plus the height is the stock thickness), angle, *softening* and how it *combines* with the items before it: add, subtract, keep highest or keep lowest, or *blend*: where reliefs overlap, their heights are averaged, faded towards the item's edges, without adding or subtracting. "Keep proportions" makes the height follow size changes. To delete an item, click the bin on its row in the list. When a relief is selected, its settings take the place of the creation buttons; the blue cross, or a right click on empty space in the drawing, closes them.
- **Limit with vectors**: click **Limit with vectors…**, pick one or more closed vectors in the 2D view and click **Apply the limit**. The relief only exists inside those vectors (a vector inside another makes a hole); outside there is no relief. The limit follows the vectors if you edit them; **Remove the limit** gives the whole frame back to the relief.
- **Create outline**: with a relief selected, this button creates a closed vector that follows its outline seen from above (STL, image, dome, sweep…), taking its rotation and limit into account. Then apply an outside *Profile* toolpath to cut the part out, or offset it with *Offset*.
- **Cutting out a relief without drawing its outline**: in a *Profile* toolpath, click the relief itself, in the 2D view or in the 3D view. Its outline shows as a dashed blue line and the button becomes **Compute around the relief**. The depth is set automatically to the bottom of the relief (stock top → relief top + relief thickness, never more than the stock thickness); you can change it. The toolpath follows the relief's outline and is recomputed when you move or change it (update it). Click the relief again to remove it; you can also add vectors to the same toolpath.
- **In the 2D view**, a relief (STL, grayscale, dome, extrusion or sweep) is handled like a vector with the Select tool: a first click selects it and opens its position settings in the Relief tab, and you can drag it to move it; a second click shows the handles: squares to resize (corners: proportions kept, Shift to distort; sides: one dimension only), circles to rotate (Ctrl: 15° steps); Ctrl resizes in whole millimeters. Delete removes it. Right-clicking a relief, in the 2D view or in the 3D view, opens its menu (toolpaths, outline, duplicate, delete…).

- **Display**: in 2D, all reliefs (STL, grayscale, domes, extrusions and sweeps) are shown shaded under the drawing; the whole relief is visible in the 3D view. The summary gives the depth of the lowest point and warns if it exceeds the stock thickness. A relief that extends beyond the stock (after shrinking the stock, for example) stays fully shown, in 2D and 3D, but only the part inside the stock will be machined.

Relief data is kept in the browser and saved in the `.copo` file: each relief's heights, images, and the full mesh of STL models. A project sent to someone therefore opens as is on another computer, without the original STL file, and the model's orientation can still be changed.

Shapes built from the drawing

Select vectors in the 2D view, then click one of the three buttons under **Create from the drawing**. The shape is copied into the relief: editing the drawing afterwards does not change it.

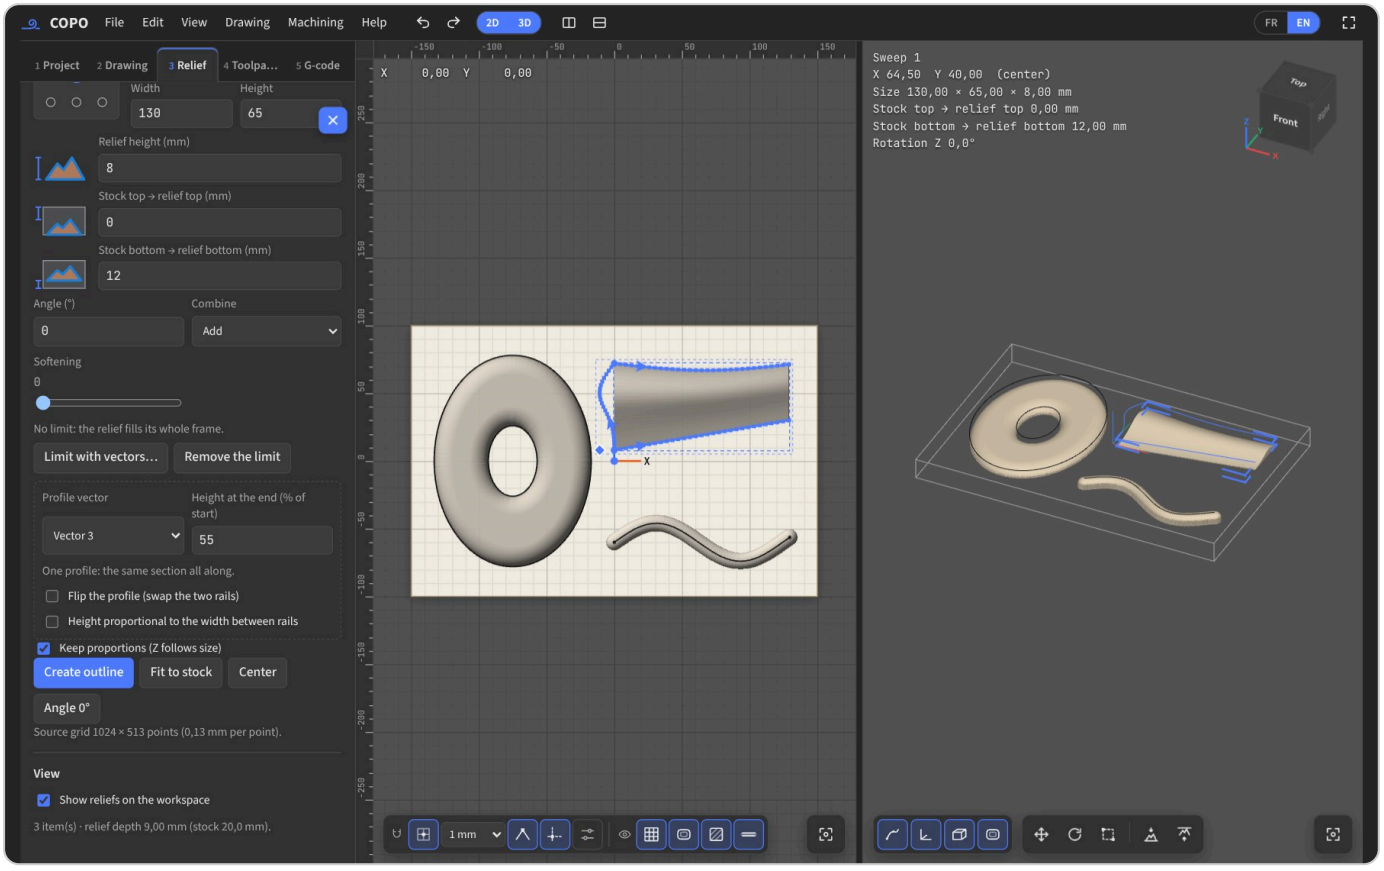


A dome with a 14 mm edge on an ellipse with a hole, an extrusion along a curve and a two-rail sweep with an ogee profile (end height 55%).

- **Dome** (one or more closed vectors; inner vectors make holes): height rises from the edge. *Edge width* = 0 domes up to the center (a ridge along


elongated shapes, as in Aspire); a value gives a rounded edge of that width, then a plateau.

- **Extrusion** (one or more vectors, open or closed): a molding of the chosen *width* follows the path, with rounded ends.
- **Sweep** (two rails + one profile vector, all open): the drawn section spans from one rail to the other, scaled to the gap between them. The profile is the vector joining the two rails, otherwise the last one selected (changeable with *Profile vector*); its chord runs from rail to rail and its real height gives the Z height; *Flip the profile* reverses it if needed. Without a third vector, the section is round; *Height at the end* varies the height from start to end (scroll, neck, domed edge) and *Height proportional to the width* adapts it to the gap between the rails.
- **Sweep with several profiles**: to make the section change along the rails, draw several profiles *across*, each from one rail to the other, where it should apply (both ends on the rails). Select both rails and all the profiles, then **Sweep**: COPO recognises the rails (the vectors the profiles touch), places each profile where it crosses the rails and blends the section gradually from one to the next, shape and height included. Before the first profile and after the last, the section stays that of the nearest profile. The *Smooth transition between profiles* box (checked by default) rounds the change from one section to the next: no kink at a profile, and the shape arrives flat at the first and last ones; uncheck it for a straight-line transition. The panel shows the number of profiles and their position as a % of the rails' length. To move a profile, move its vector in the 2D view and create the sweep again.

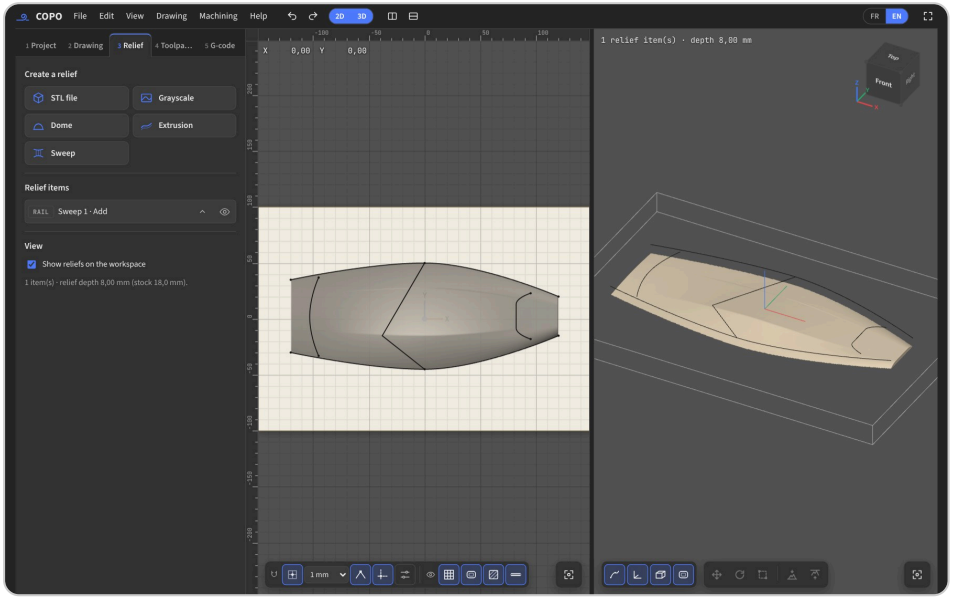

Two rails and three profiles drawn across: the section goes from a low round bump (left) to a high peak (middle) then to a flat section (right), with a smooth transition.

- **Profile** of domes and extrusions: round, angular (pointed), flat or ogee (S-shaped). Z height, base offset, combine mode and softening work as for other items.

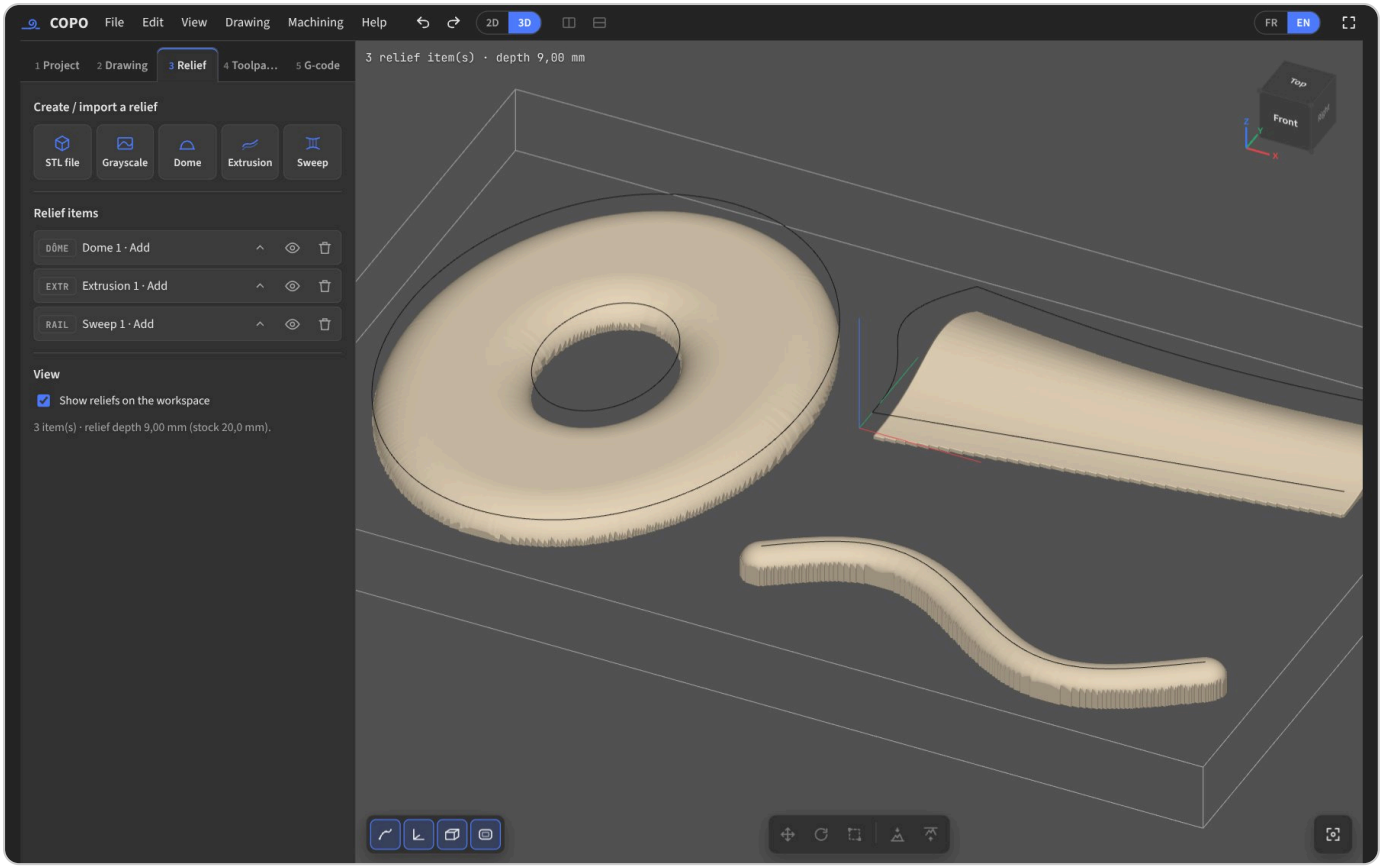

View the relief in 3D: the relief carved into the stock, its highest point at the surface.

Machining the relief


In the **Toolpaths** tab, the **Relief** type offers two operations, each shown by a small cross-section: roughing as steps around the relief, finishing following the surface. The strategies have their picture too: *Z levels* (flat steps) and *3D raster* for roughing, *Raster* (back and forth) and *Offset* (passes following the outline) for finishing. Below the list of reliefs to machine, the **Advanced options** section (open by default) gathers the machining limit, with a picture showing the chosen limit in blue (model outline, stock outline or selected vectors), the offset, the tool position, the strategy and the steps.

- **Roughing**: raster by Z levels with a flat end mill (the largest is suggested), each level stepping down by the pass depth, leaving an *allowance* (0.5 mm by default) for finishing. Default stepover: 40% of the diameter. **Tool entry**: *Back-and-forth ramp* by default (the tool goes down following the start of the pass, over the ramp length computed as for a profile, then returns to its start at full depth), *Helix* (the tool bores a 1.5 × Ø hole, going down by the chosen *step-down per turn*, at the first place along the pass where the circle fits entirely


within the machining boundary and the material to remove, then joins the start of the pass; otherwise it ramps in) or *Straight plunge*.

- **Finishing**: parallel raster following the surface with the real tool shape, never gouging the relief. Use a ball nose, a tapered ball nose (defined by D, R and L) or, for fine details, a flat-tip engraving bit (angle and tip diameter). A round-tip engraving bit is described as a tapered ball nose, using the box dimensions: shank diameter D, tip radius R, cutting length L; COPO derives the angle (D 6, R 1, L 20: 5.99°). Default stepover: 10% of the diameter; adjustable raster angle and an optional *second cross pass* at 90°.
- **Reliefs to machine**: check the items whose outline limits machining (all by default). Heights stay those of the full relief.
- **Machining boundary**: *Model boundary* (the checked reliefs, without the transparent background of images), *Stock boundary* (the whole stock) or *Selected vectors* (closed vectors selected in the 2D view). *Tool relative to boundary*: *tool edge inside* (default, the tool does not cross the vector) or *tool center on boundary* (the tool overhangs by one radius) or *tool edge outside* (the tool goes all the way around the relief and fully past it: the usual choice to finish a relief edge cleanly, with no offset to add). *Boundary offset* enlarges (positive) or shrinks (negative) the boundary, for example to leave room for a clearance.
- **Strategy**: for roughing, *Z levels* (machines only below each level, in runs) or *3D raster* (each line follows the surface without going below the level, fewer retracts); for finishing, *Raster* (parallel lines at the chosen angle, optional cross pass) or *Offset* (contours parallel to the boundary edge, from outside in, climb or conventional).

Passes are chained in zigzags region by region and short links stay on the surface, to limit retracts and air moves. If the relief changes after calculation, the toolpath says so in orange: open it and click **Update**. Finishing files are long (tens of thousands of lines), as in any carving software; the 3D preview replays roughing then finishing.

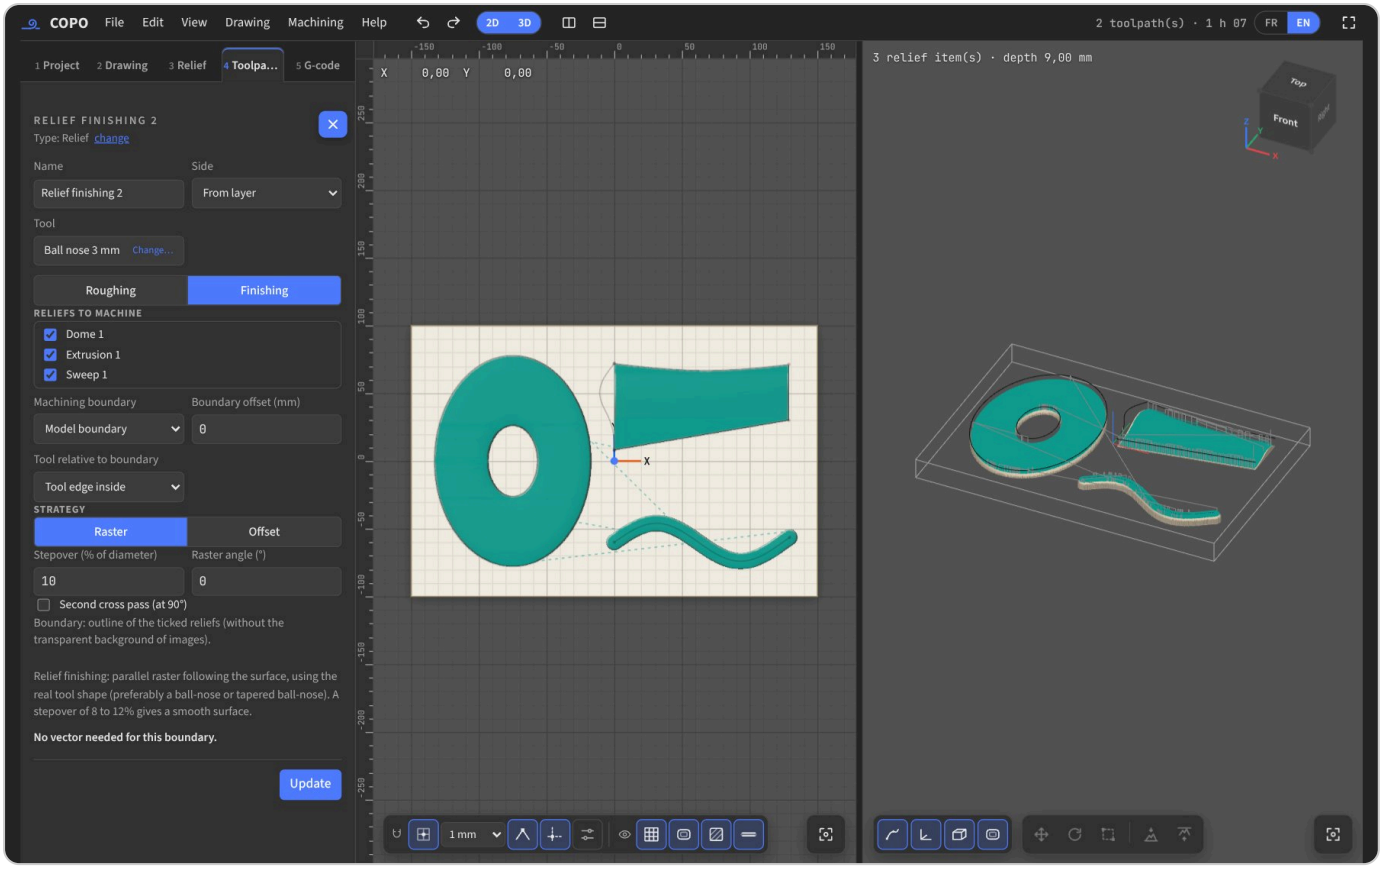


Roughing with a 6 mm flat end mill then finishing with a 3 mm ball nose, with no boundary selected.

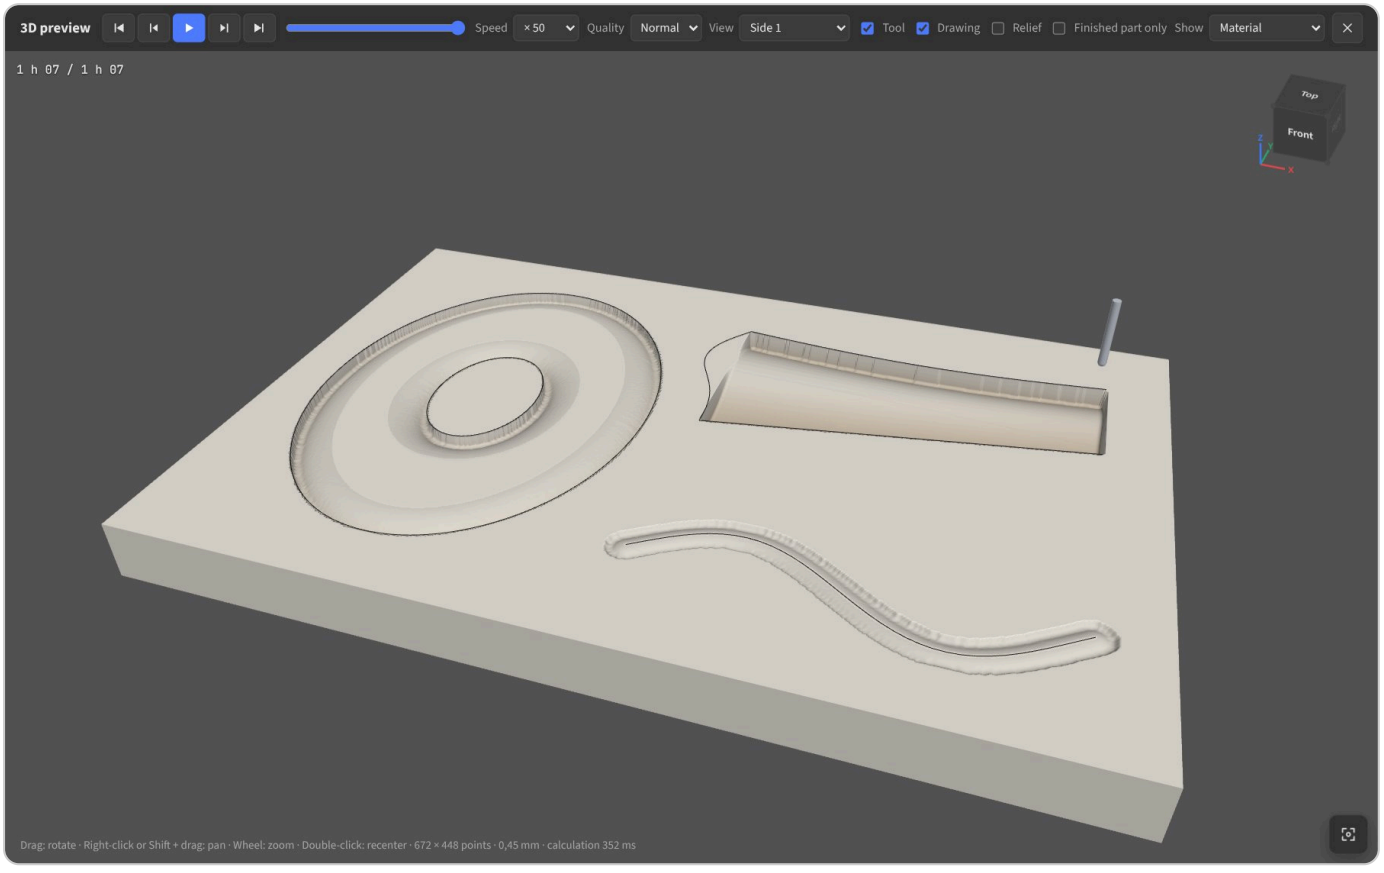

The result in the 3D preview.

Toolpaths

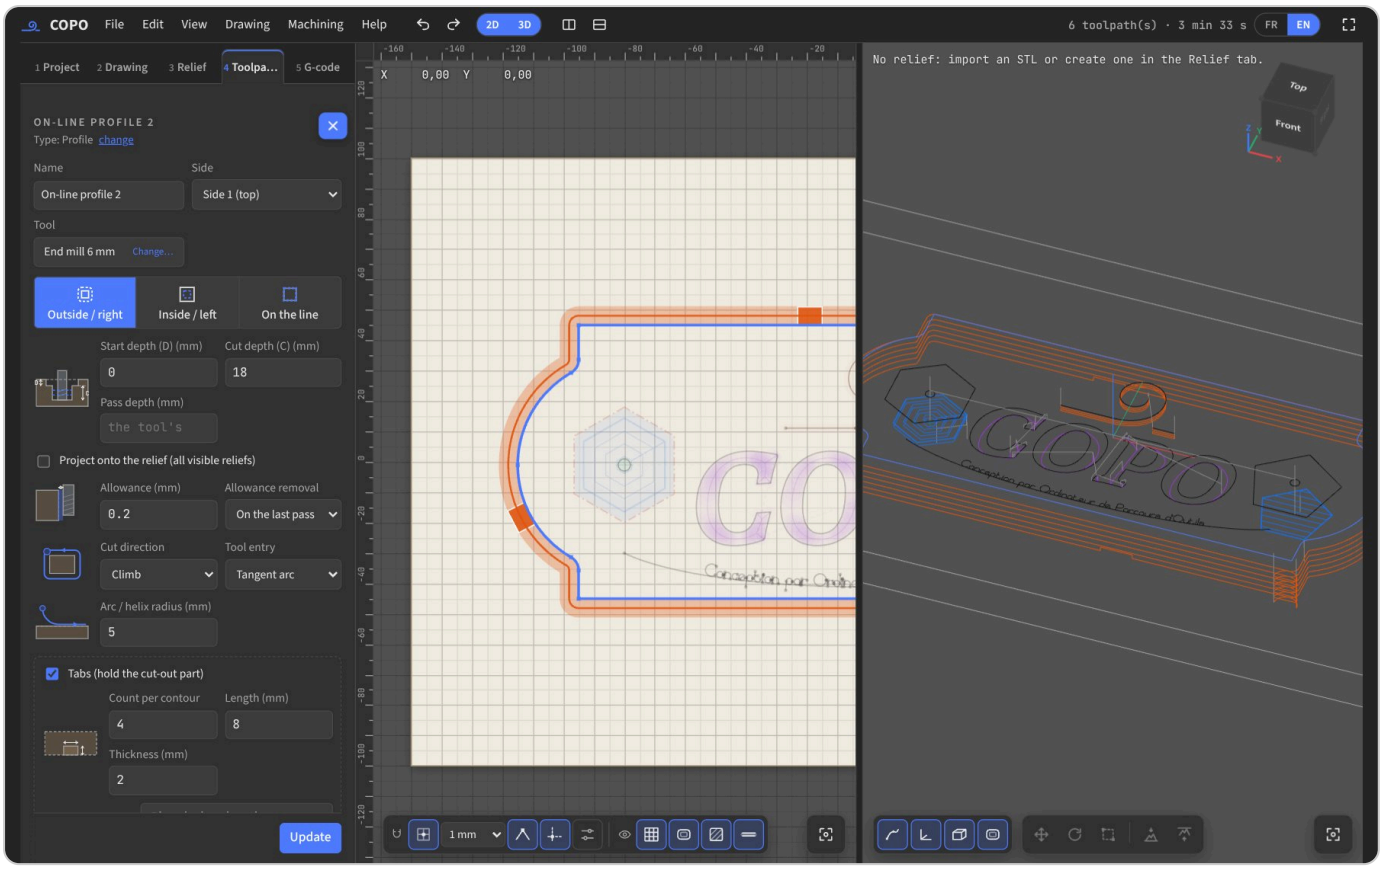

Click a toolpath in the list to edit it: its path is highlighted in the 2D view. The text under the form sums up what the machine will do.

At the top of the tab, the four buttons **Profile**, **Pocket**, **V-carve** and **Drilling** create a toolpath: select the vectors in the 2D view (even with the settings open), then click the operation. Its settings replace the buttons and the list in the panel, hiding nothing of the 2D view or the 3D view; the line *Type: Profile · change* lets you switch operation. Clicking a toolpath in the list opens its settings to edit it. The **blue cross** at the top right, or a right click on empty space in the drawing, closes them and brings the list back.

While the toolpath settings are open, the rest of the drawing and the other toolpaths are **dimmed**: only the selected vectors and the current toolpath stand out. Everything returns to normal when they close. At the bottom of the settings, a **status line** says what will be machined, for example “3 vectors selected (2 closed, 1 open)”; it turns red when nothing is selected, and warns when a pocket, V-carving or drilling will ignore open vectors.

The four types

- **Profile**: *Outside / right* (the part is kept), *Inside / left* (the hole is cleared) or *On the line*. On an open line, Outside runs the tool to the right of the path and Inside to the left, in its drawing direction (Drawing › Reverse direction to change it); “On the line” follows the stroke or runs left or right according to the “Open lines” setting. On an open line offset to the right or left, ramp, tangent arc and ramped arc entries apply too: the arc enters and leaves on the waste side.
- **Pocket**: four strategies, on one row of icons: *Spiral in → out* (starts in the middle and widens to the edge), *Spiral out → in* (follows the edge first, then tightens), *Zigzag* (parallel lines at the chosen angle, never a pass around the edge: edges slightly scalloped; the allowance does not apply) and *Zigzag + contour* (the same lines, then one pass around the edge to clean it). With a spiral, if a strip too wide for a single pass is left in the middle (depending on the pocket width and stepover), a clean-up pass is added automatically. *Rest machining* (Advanced options) uses the toolpath’s tool, the small one, for the corners a larger one could not reach. In **After the toolpath**, choose the pocket made before on the same vectors, for example “Pocket 1 (End mill 6 mm)”: its tool, depth and allowance are used. Or choose **Create a toolpath…**: COPO opens the library for the larger tool and creates a linked roughing toolpath before the rest machining, as in Aspire. With an allowance, the larger tool leaves it; the small one finishes the walls, except with “Do not remove the allowance”, where both leave it.
- **V-carving**: the V-bit follows the medial axis of the path; it goes deeper where the stroke is wide and rises up to the tip of every corner. Branches are chained in the shortest order; between two branches the tool moves straight while staying inside the carving (at a safe depth, or just above the surface) and only rises to the clearance Z when the move would leave the design. Links are drawn dashed like moves, and the V-bit does not run along the bottom where the rings or the clearance tool have already removed the material. On later levels it rapids down to 0.2 mm above what is already carved, then plunges. With a clearance tool, each level first cleans the corners, then cuts the contour (the wall); the pass depth is kept everywhere. A maximum depth gives a flat bottom. With an engraving bit (flat tip) or a tapered ball nose, the depth follows the real tip shape: corners are rounded to the tip radius, areas narrower than the tip are not machined (in red in the 2D view, with a warning), and the tip clears flat bottoms itself when there is no clearance tool. A fine pointed V-bit (under about 60°) does not clear a flat bottom: add a clearance tool. The *pass depth* (the tool’s when left empty) splits the carving into steps, as in Aspire: deep areas are cut in several goes, with the same final result. The *calculation precision* (0.1 mm by default) is the spacing of the points used to compute the medial axis: 0.05 mm for small lettering.


Clearance tools (flat end mills), chosen after the V-bit with **+ Add a tool…**, can clear the flat areas: COPO sorts them from largest to smallest and adds, just before the V-carve, one linked "clearance" toolpath per tool; each one only removes what the previous one could not, and the V-bit only cleans up the edge. These toolpaths are set up from the V-carve. If you delete the V-carve, COPO asks whether to keep them as independent toolpaths. Renaming the V-carve does not touch its clearance toolpaths.

- **Drilling**: one hole at the center of each closed vector, with optional pecking and dwell at the bottom (0 = none). **Pecking** is filled in automatically from the tool, set in the tool library according to the material: aluminium, copper, brass (long chips) 0.5 × D; steels, cast iron and plastics 1 × D; wood and MDF 2 × D. With a flat end mill, circles larger than the tool can be milled helically to the drawn diameter (box unticked by default); the option is hidden for a drill tool, a ball nose or a V-bit. When it is unticked, an orange warning points out circles larger than the tool, which will be drilled at the tool diameter (handy when you draw large circles just to see and select the holes more easily). With a drill tool, each hole is drilled at the tool diameter; COPO shows the tip length to add for a through hole.
- **Threading**: tapped holes and screws milled with a *thread mill* (single-form, 60°), centered on each selected circle. Set internal (tapped hole) or external (screw), pitch, nominal diameter (0 = the circle's: draw an 8 mm circle for M8), thread hand and number of radial passes; the thread length is the cut depth. COPO shows the pre-drill diameter (nominal Ø − pitch, e.g. Ø6.75 for M8 × 1.25). The tool always climb-mills, one helix turn per pitch, with tangent half-circle lead-in and lead-out; the feed entered is the cutting-edge feed and COPO corrects it at the tool center. For a screw, clear the material around the cylinder first. Two thread mills (Ø4 and Ø8 mm) were added to the library with estimated settings.

Toolpath recomputation: when the drawing changes, COPO only recomputes the toolpaths concerned (those whose vectors or settings changed); undo and redo reuse calculations already made. A long calculation runs **in the background**, with a progress bar: you can keep drawing meanwhile (if the drawing changes in the meantime, the toolpath is recomputed afterwards).

- **Automatic** (default, **Settings › General**): a toolpath that is slow to compute (over half a second) waits for a pause of about 1.5 s without changes; you can make edit after edit without waiting, and the toolpath shows the ⟳ badge meanwhile. Opening the G-code tab recomputes it at once. If recomputing is often slow, COPO offers once to switch to manual.
- **Manual**: affected toolpaths are marked ⟳ and keep their old path until you click **Recompute toolpaths** (below the toolpath list).

- In both modes, an **orange dot** on the Toolpaths and G-code tabs flags out-of-date toolpaths; the banner in the G-code tab has a **Recompute now** button. G-code export, the setup sheet and the simulation first recompute what is out of date (in manual mode, COPO asks: **Recompute and continue**). The **Recompute all toolpaths** button stays available.

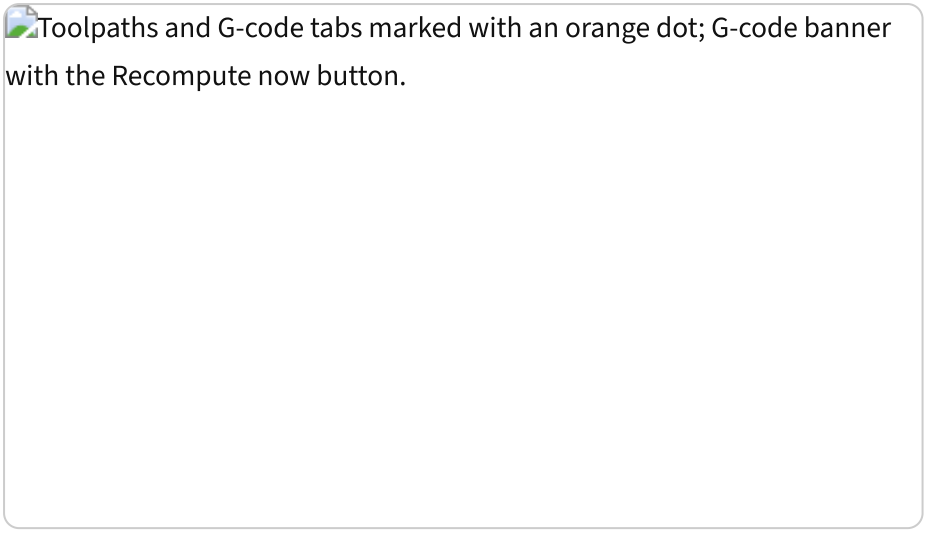

Out-of-date toolpaths: orange dot on the tabs, *Recompute now* button in the G-code tab.

Advanced options: below the cut direction, this folding section (closed by default, COPO remembers your choice) gathers the allowance and its removal, projection onto the relief, the tool entry and ramp length, rest machining (pocket), and for drilling the helix, pecking and dwell. The allowance is 0 by default.

Passes, allowance and cut direction

Start depth (D) and **Cut depth (C)**, as in Aspire: machining starts at depth D below the surface (for example at the bottom of a pocket already cut) and goes down by C from there, so the bottom is at D + C. For a profile or a pocket, C can be 0: a single pass at depth D (surfacing, or the tool resting on the relief with projection). Leave D at 0 to start from the surface. In V-carving, the pattern is computed as if the surface were at D, which is what inlays use. The small diagram next to the fields shows what D and C are. A *negative* value starts above the surface: the first passes cut air, useful when the stock is thicker than planned or its surface uneven (D = −2 and C = 5: start 2 mm above, bottom 3 mm deep).

Project onto the relief (profile, pocket, V-carving): the toolpath follows the surface of all visible reliefs of the Relief tab instead of the flat stock top (no need to select the relief: only select the toolpath's vectors); depths D and C are then measured from the relief. The contact height takes the tool shape into account (V, ball nose, flat), to carve a pattern or lettering on a domed surface. Outside the

relief, the toolpath stays measured from the stock top. Side 1 only; if the relief changes, the list flags that the toolpath must be recalculated.



Single-line text engraved *on* a sweep: the toolpath (orange) follows the relief surface.

The cut depth is split into passes of the chosen depth. An **allowance** leaves a little material on the walls while roughing; it is removed on the last pass or by a full-depth finishing pass, or left in place (*Do not remove the allowance*) to remove it with another finishing toolpath, for example with another tool. The cut direction is *climb* or *conventional*.

Tool entry

ENTRY	BEHAVIOUR
Back-and-forth ramp	The tool goes down while moving, returns to the start at full depth, then goes around. Each pass starts and ends at the same point. Default setting. Left empty, the ramp length is computed to take the pass down at the angle recommended for the project's tool material: 10° for softwood, MDF and plastics, 5° for hardwood, 4° for aluminium and brass (length = pass ÷ tan(angle), never less than 1.5 × Ø); the field shows the value and the angle. For plywood (3 to 5°), enter a longer ramp.
Continuous ramp	The tool goes down while moving and continues around; the ramp portion is recut at the end.
Tangent arc, ramped arc	Arc lead-in and lead-out on the contour, to avoid a mark on the finished wall.
Helix	The tool spirals down, ideal for pockets and holes. Left empty, the helix diameter is 1.5 × Ø (the tool bores a hole one and a half times its own width) and the step-down per turn follows the material's ramp angle; both fields show the computed values.
Straight plunge	Vertical plunge, for center-cutting tools or V-carving.


The ⓘ bubble next to **Tool entry** sums up the guidelines: helix diameter 1.5 to 2 × Ø in wood (1.2 to 1.8 × Ø in metal), ramp angle 5 to 15° in softwood and MDF, 3 to 8° in hardwood, 3 to 5° in plywood and aluminium, 1 to 3° in steel; ramp feed at 50 to 70% of the cutting feed. Ramp length = depth ÷ tan(angle): 5 mm at 10° gives about 28 mm. Under 1.2 × Ø, the helix almost plunges; beyond 2 × Ø, a bit that does not cut at the center leaves a post. The maker's values come first, and a bit that does not cut at the center must never plunge straight down.

Ramps and helixes go down at 60% of the cutting feed. In the 2D and 3D views, these descents are drawn in orange over the toolpath, to show where the tool enters the material.


Tabs

Tabs hold a cut-out part until the end. Set their count per contour, length and thickness, flat or triangular (easier to break). **Place by hand in the 2D view…** lets you add a tab with a click on the toolpath, drag it or remove it.

Text and V-carving

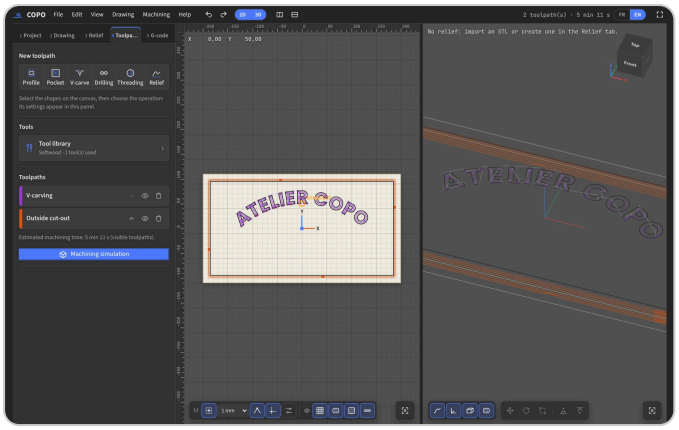


Text placed above an arc: every setting of the panel (placement, alignment, letters, spacing…) changes it live.

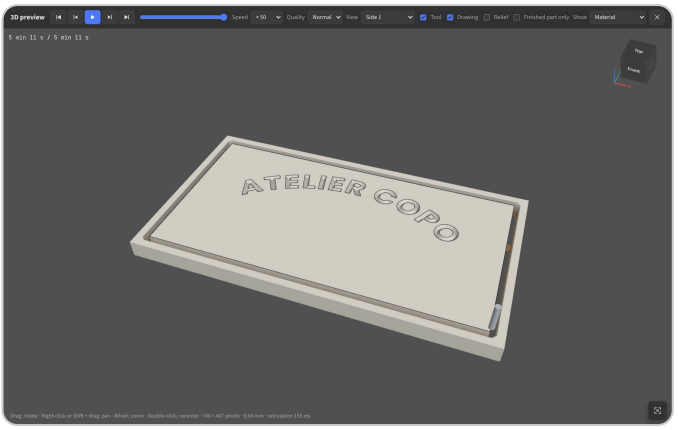

The same job in the 3D preview.

Choose a font in the **Text** block list: installed fonts (Chrome and Edge) or your fonts folder (**Open a fonts folder…** button of the block; the ⓘ icon explains where to keep them), with a preview. Two boxes at the top of the list, *COPO fonts* and *Computer fonts*, shorten the list; the choice is remembered. Take the **Text** tool `T`: a dashed outline follows the cursor and shows where the text will go. The **placement** is chosen on five pictures: *Straight* (click in the 2D view), *Above the curve*, *On the curve* or *Below the curve* (click a line, an arc, a circle, an outline…) and *Between two curves*; a blue box says what to click. While the placed text (or one reopened with **Edit the text**) stays selected, clicking another curve (or, with *Straight* placement, another point) *moves* it there; `Shift` + click places a second one. On a curve, set the **alignment** (left, center or right of the curve; for a closed outline, relative to the clicked point), the **letters** (aligned to the curve or kept upright), *Text on the other side of the curve* (to write inside an arc, for example) and the **spacing** between letters (also for straight text). **While the Text tool stays active, every setting changes the text you have just placed, live**: text, font, height, placement, alignment… no more deleting and starting again. To edit a text later, select it: the **T** icon of the Selection block reopens its settings. The text becomes grouped vectors, ready for V-carving, pocketing or profiling. In **Between two curves** placement, click the bottom curve (the baseline) then the top one: the letters stretch to fill the space between them, like an envelope (two arcs for an arched sign, for example). The *offset* moves the text away from the curve (on a curve) or keeps a margin with each of the two curves (between two curves).

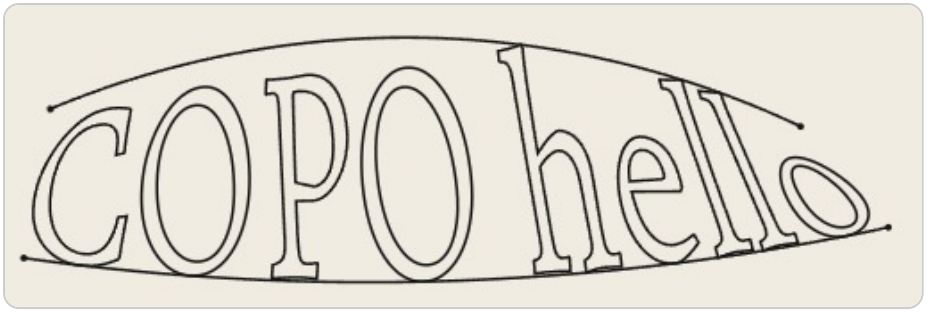

Between two curves text: the letters stretch to follow the bottom and top curves.

Single-line fonts

COPO comes with about sixty **single-line fonts** (Hershey, EMS, Cutlings, Relief SingleLine, Routed Gothic…), stored in the `fonts/trait-unique` folder and listed first in the font list, with a preview. Each letter is a single stroke: the text is engraved in one pass with a **Profile On the line** toolpath, with a V-bit or a small end mill. It is the fastest way to mark part numbers, plates and assembly marks. When the selection holds only open strokes, **Machine…** offers this profile directly. The `fonts/apercu-polices.html` catalogue (link “See the single-line font catalogue” in the Text block) shows them all with a preview of your text. You can also add your own SVG fonts with **Add fonts…**.

Decorative fonts


Nine **decorative font** families are also bundled, in the `fonts/decoratives` folder, and listed under *Decorative fonts (bundled with COPO)*: **URW Chancery** (chancery italic), **Alegreya** (roman and italic), **Cinzel Decorative** (ornate capitals, 3 weights), **Pirata One** (blackletter), **Chicle**, **Comic Neue** (6 styles), **Protest Riot**, **Great Vibes** (script) and **Smokum** (western). These are outline fonts: machine them with V-carving, a pocket or a profile. For thin scripts such as Great Vibes, use a large enough text height (20 mm or more) so the tool fits in the hairlines. The *COPO fonts* box hides them together with the single-line fonts. Licences: SIL Open Font License for most, Apache 2.0 for Smokum, AGPL 3 with font exception for URW Chancery (see `fonts/decoratives/LICENCES.txt`).

Lutherie: fretboard and inlay

Guitar fretboard

Extensions › **Guitar fretboard…** draws the fretboard, nut on the left, centered on the stock. Set the **scale length**, the **number of frets**, the **width at the nut** and the second width, *at the 12th fret* or *at the end of the scale*, the overhang after the

last fret, the **frets with a marker** and **a double marker** (lists of numbers) and the marker diameter. The **scale line** (checked by default) draws the center line from the nut to the bridge, with a mark at each end, to place the bridge. With the **Zero fret** box, a fret 0 is drawn at the start of the scale (with the same edge distance as the others) and the board starts before it, at the distance set in *Board start → zero fret*; the "nut" width is then the zero-fret width. The **fret-to-edge distance** stops the fret lines short of the board edge (0 = through frets). The preview updates live. The window opens next to the left panel, like the toolpath settings, and moves by its title.

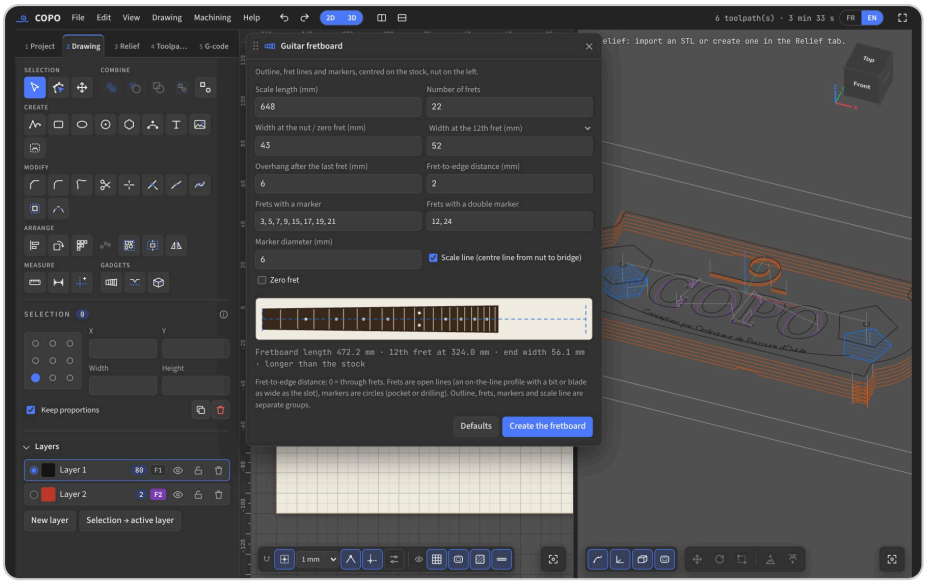

The **Guitar fretboard** window with its preview: board, frets, markers and the dashed scale line.

Fret positions

COPO uses the exact equal-temperament formula, the one used by reference fret calculators:

$$d_n = L - L / 2^{n/12} \quad \text{i.e.} \quad d_n = L \times (1 - 2^{-n/12})$$

where L is the scale length, n the fret number and d_n the distance from the nut to the fret. Each fret shortens the string by a semitone, a factor of $2^{1/12} \approx 1.05946$; the 12th fret falls exactly at half the scale. The "rule of 17.817" gives the same result; the old, less accurate rule of 18 is not used. No compensation is applied to the frets: intonation is set at the bridge, moved back a few millimeters from the scale line.

FRET	1	5	7	12	
Distance from the nut (648 mm scale)	36.37 mm	163.51 mm	215.64 mm	324.00 mm	466.1(

The result is separate groups: the scale line (not to be machined), the outline, the fret lines (open lines, to cut with an **On the line** profile and a bit or blade as wide as the slot) and the markers (circles, pocketed or drilled).

V-carve inlay

Select the design (closed vectors), then **Drawing** › **V-carve inlay…**. The settings open in the left panel, with a dimensioned diagram as in Aspire: **a** pocket depth, **g** glue gap at the bottom, **b** male height below the backing (it must exceed a − g: the rest is planed off), **c** backing overhang, and an optional **prefix** for the toolpath names, built as *layer_function_tool*: `female_clearance_6mm`, `female_vcarve_90deg`, `male_clearance_6mm`… Choose the V-bit (**Library…** button for the whole library) and, if you like, flat **clearance tools** that first clear the flat areas (faster on large designs). As in Aspire, you can add several (**+ Add a tool…**): COPO sorts them from largest to smallest; the largest clears the flat areas, each next one is a rest machining toolpath linked to the previous one and only removes what it could not. The overhang *c* is automatic when left empty; the *Create the toolpaths* box can be unticked to draw only the male piece. COPO creates:

- a *female* V-carving of the design in your part;
- the *male* plug: the mirrored design inside a frame, on the “male” layer, with a V-carving that starts at the pocket depth minus the gap and goes down by the surface gap. All layers (“male”, “clearance”, “inlay (computed)”) and all toolpaths are created *visible*: to cut a single part, hide the other part's toolpaths (eye icon in the list) before saving the G-code.
- with a clearance tool, a “clearance” pocket before each V-carving, where the V would reach its full depth. With an engraving bit (flat tip) or a tapered ball nose, the female and the male are machined on the same working shape, whose points and inner corners are rounded to the tip radius: the two parts fit down to the bottom (your drawing is not changed). The V-bit does not go over the bottoms already cleared: it cuts the wall, then only what the clearance tool could not reach because of its diameter (points, narrow passages). For the male, the clearance empties everything up to the frame (straight wall), at the depth where the V-bit works, and the V-bit only cuts the sloped wall of the design, in levels, plus the corners the clearance tool cannot reach: it touches neither the frame nor the flat bottoms. The automatic overhang widens so that the bit's cone stays inside the frame.

Flip the plug, glue it into the female pocket, then plane or sand off the excess. The V-carving **Start depth** setting is also available by hand in the toolpath form.

Pocket inlay (flat end mill)

Select the design (closed vectors), then **Extensions** › **Pocket inlay…** or, with a right click, **Inlay** › **Pocket**. The settings open in the left panel. Choose the **flat end mill** (the **Library…** button gives access to the whole tool library), the **glue gap** (0.1 mm by default) and how to make the male piece (*Male piece on a backing board* box). A small dimensioned diagram, as in Aspire, shows the values to fill in: **a** pocket depth, **b** male height (below the backing, or piece thickness without backing) and **c** backing overhang (automatic when left empty). The *Create the toolpaths* box (checked by default) can be unticked to create only the outlines. For large pockets, check *Rough with a bigger tool*: COPO recommends roughing or not depending on the pocket width and the main tool, and suggests a tool (from the project, otherwise from the library). The big tool then clears the pocket and the plug background, and the main tool only cleans the corners and narrow passages (rest machining): on a 60 × 40 mm pocket, the time drops by almost three.

A flat end mill cannot cut a corner sharper than its radius. COPO therefore computes a **common outline** whose corners, inside and outside, are all rounded to at least the tool radius: the pocket and the insert are machined exactly on this outline and fit without touch-up. The preview shows this outline in blue, the original drawing in dashed red, and the share of area changed; a warning flags parts thinner than the tool, which disappear.

- **Male piece on a backing board** (box checked, default): the design is machined mirrored, raised, in a thick board, to a height *b* greater than the pocket *a*: once glued, the board stays b − a above the part, leaving room for the saw cut. Glue the board upside down into the pocket, then saw or plane off the excess. All parts of the design stay joined and go in at once.
- **Male piece without backing** (box unticked): the design is cut out of a thin board of thickness *b*, with holding tabs. The *cut-out depth* is b when left empty; use a little more (b + 0.2 mm, say) to cut cleanly through if your spoilboard allows it. Make b equal to a for a flush piece, a little more if you want to sand after gluing; COPO warns when b is smaller than a. Break the tabs, sand, then glue the piece into the pocket.


Deleting an inlay toolpath also deletes the outlines it created (your original drawing is kept). COPO creates the pocket on the “Pocket inlay · female” layer and the insert to the right of the design, on the “Pocket inlay · male” layer. Both toolpaths are visible and go into the G-code; hide one (eye) if you machine the pieces separately.

Finger-joint box

The **Extensions** › **Finger-joint box…** menu opens this module, which draws a box assembled with straight finger joints, like Vectric's “Box Creator”. Set the **outer dimensions** (width X, depth Y, height Z), the **material thickness** (the stock's by default), the **finger width** (their number, always odd, follows), the **joint allowance** (0.1 to 0.2 mm in wood), the **cutting tool**, the **top joint** (*finger-jointed* for a closed box, the default, or *laid flat* for a removable lid) and the **faces to machine** (Top, Bottom, Sides, Ends). Fingers are spread evenly between the corners: the corner zone, as thick as the material, only exists where another panel joins, so an open box keeps the same pitch up to the top. Fingers may be narrower than the thickness; COPO warns when the slots become narrower than the tool. The *Dogbone reliefs* option adds an arc the size of the tool at the bottom of each slot so square fingers fit.

The preview shows the panels laid flat. **Create the box** places them on the stock, spaced for the tool: cut them with an outside profile and tabs. The panel volumes fit exactly: no overlap or gap at the corners.

Rotary graduations

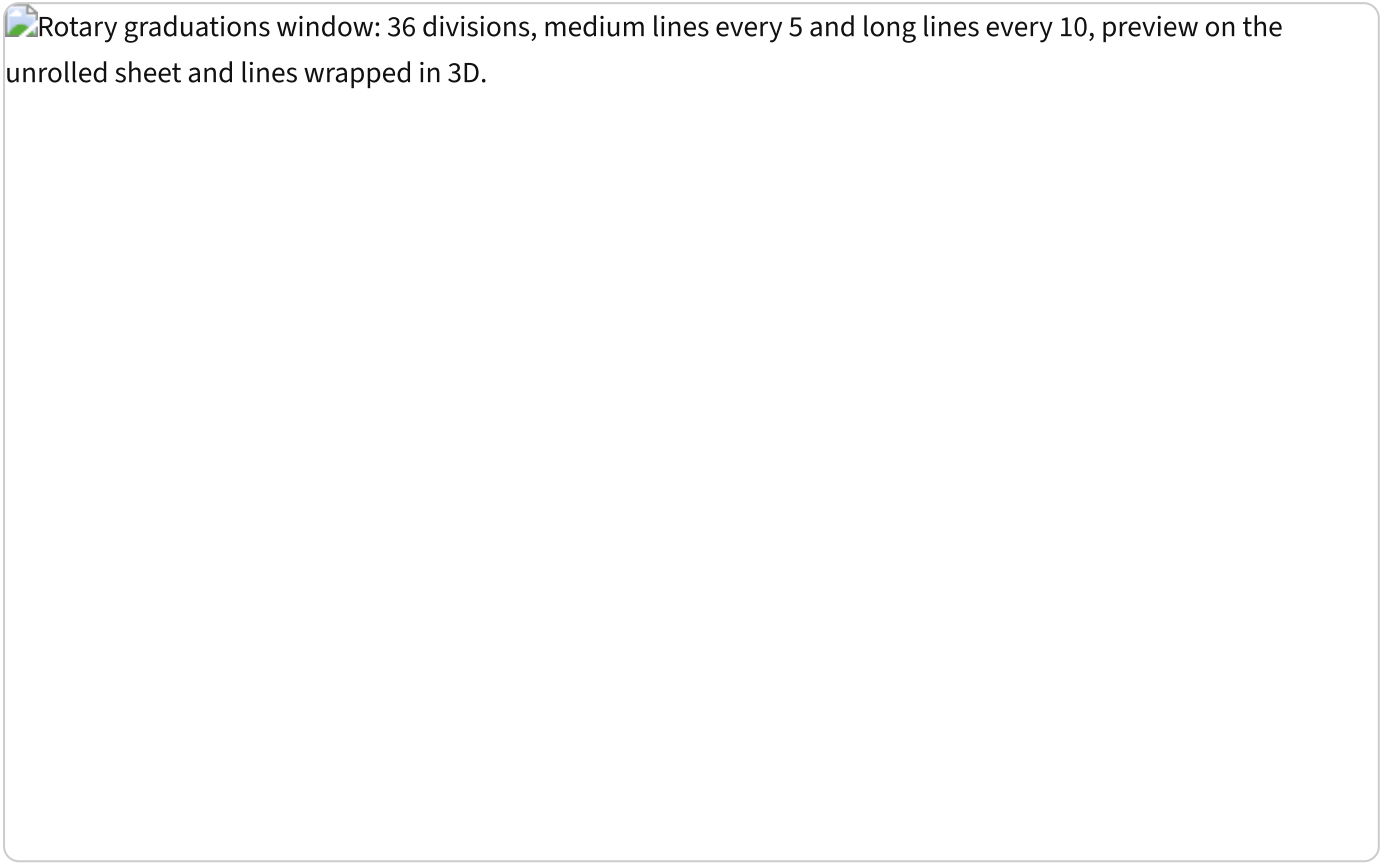


36 divisions around a Ø 90 mm cylinder: a medium line every 5, a long one every 10.

In a **rotary** project, **Extensions** › **Rotary graduations…** draws evenly spaced lines around the cylinder: graduations, verniers, flutes, gear teeth. The lines are always **parallel to the cylinder axis** chosen in the Project tab (horizontal when the cylinder lies along X, vertical along Y) and spread around the circumference (π × D).

- **Number of divisions** and **span**: at 360°, as many lines as divisions all the way round. Below 360°, the divisions cover the span with a line at each end; for a tenth vernier, for example, 10 divisions over 9°.
- **First line angle**: 0° is the origin line, like the 0°, 90°, 270° marks in the 2D view.
- **Position and length**: as in the Selection block, choose the line's reference point (start, middle or end), then its X (or Y) position relative to the origin and its length.
- **Longer lines**: a medium line every *n* lines and a long line every *m* lines, each with its own length; they start from the same reference point. *First line number* shifts this count.

The preview shows the unrolled sheet and the pitch, in degrees and in millimeters on the surface. **Create the lines** places them as a group on the active layer; machine them with V-carving or an “on the line” profile.

Nesting

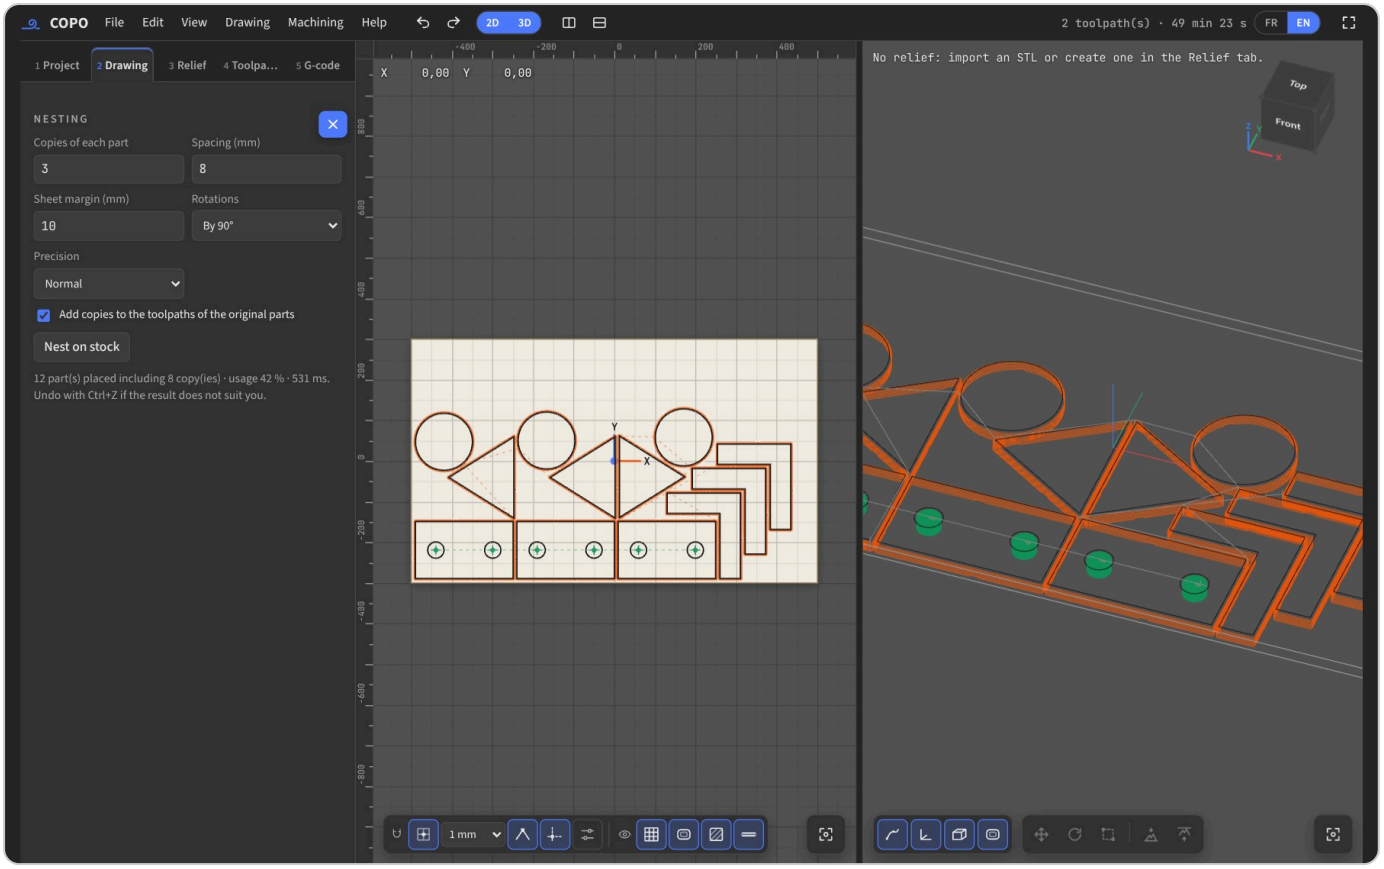

Four parts in three copies on a 1000 × 600 mm sheet. The L shapes interlock and the copies join the toolpaths of the original parts.

Drawing › Nesting… opens the block in the Drawing tab. Select the parts (with no selection, the whole drawing is used) and set the number of copies, the spacing, the sheet margin, the allowed rotations and the precision. COPO places the parts following their true shape, largest first, as far down and left as possible. A group or a text stays in one block. Parts that do not fit stay selected, and the sheet usage is shown.

> For cut-outs, use a spacing at least equal to the tool diameter. `Ctrl` + `Z` undoes the nesting if you don't like the result.

Double-sided machining

1. Put the vectors of the bottom side on a layer set to **F2** (F1/F2 button in the layer list). Draw them as seen from above, see-through.
2. Choose the flip: around the X axis (top ↔ bottom) or the Y axis (left ↔ right).

3. Side 2 toolpaths are calculated on the flipped geometry; the cut direction is kept.
4. In the G-code, side 1 is followed by an `M0` pause: turn the part over, set X0 Y0 Z0 again at the same point and resume.

The 3D preview shows both sides; the **Side 2 up** option shows the part flipped.

2D and 3D views

The **2D** and **3D** buttons at the top work as two switches: 2D only (the drawing fills the area), 3D only (the relief), or both at once. When both are shown, the buttons next to them place the views side by side or one above the other, and the **divider** between them can be dragged to enlarge either one (double-click: half and half). The Relief tab shows the 3D view automatically.

The 3D view shows the relief in the stock (wireframe), with the drawing and the axes. The view uses an orthographic projection (no perspective), handy from the front or the side. Hold the right button: orbit (around the point under the cursor, unlimited, you can go under the part); hold the middle button: pan; wheel: zoom towards the cursor; double-click: whole stock; a left click selects. As in Fusion, FreeCAD or Tinkercad; the mouse is set in Settings › 3D views. Top right: the view cube. At the bottom, icon bars like in the 2D view: on the left, show or hide the drawing, the axes, the stock and the toolpaths (cuts in their type's color, rapid moves in gray); in the middle, the transform tools; on the right, fit all on the relief. The stock and the toolpaths are shown every time COPO opens. If you hide the toolpaths, the one you hover in the Toolpaths tab list, or the one you are editing, stays visible in 3D.

Drawing vectors can also be selected in the 3D view: click a line (the cursor turns into a hand). The selection is shared by both views, in blue; Shift + click adds or removes a vector, a click on empty space deselects. Handy for picking the outline of an STL model before creating its toolpath.

When COPO opens, the 2D view and the 3D view are shown side by side. The 3D view also opens by itself with the Relief and Toolpaths tabs. If you closed it with the **3D** button, COPO respects that choice until the page is reloaded.


Transforming a relief in 3D. Click an item in the 3D view to select it (its box corners are highlighted; the selection is shared with the 2D view and the list). The bottom bar offers three tools, with dimensions shown at the top left:

- **Move**: drag the X, Y or Z arrows (Ctrl: whole millimeters). In Z, the relief top snaps to the stock top and its bottom to the stock bottom; in X and Y, its edges snap to the stock edges.

- **Rotate**: drag the blue ring (around Z); for an STL, the red and green rings also tilt it around X and Y (Ctrl: 15° steps, Ctrl + Shift: 1° steps).
- **Resize**: drag a corner to scale keeping proportions (Shift, or “Keep proportions” unticked: freely), a side to change only the width or the length, or the blue dot above for the height: the top moves, the bottom stays put. Ctrl moves in whole millimeters.
- The last two buttons **drop the relief onto the stock bottom** or **align its top with the stock top**.

Each transformation can be undone with **Ctrl+Z**; the relief panel keeps the exact values.

3D preview

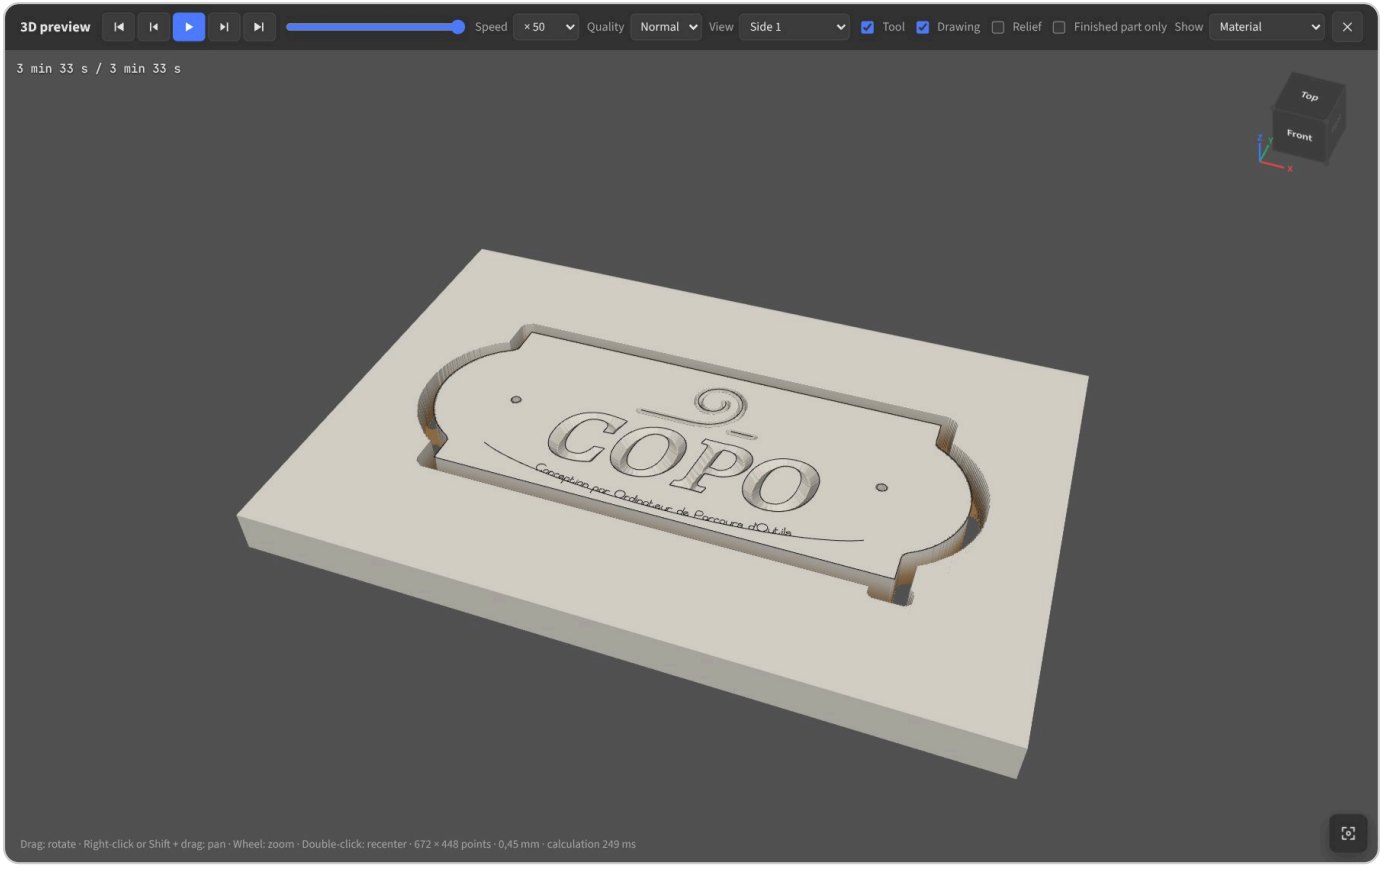

Hold the right button to orbit, hold the middle button to pan, wheel to zoom, double-click to fit all (mouse set in Settings › 3D views).

Detail: the simulation only computes the area actually machined (the rest of the stock is drawn solid); the smaller the area, the finer the result. The *Resolution* setting (Standard, High or Very high: 0.5, 1.5 or 3.5 million points) raises the detail further; the resolution used is shown at the bottom of the window. A long simulation is computed in the background: the window opens at once on the

stock (*Computing the simulation…* at the bottom) and playback becomes available when the calculation ends.


The preview simulates material removal through the real stock thickness, through-holes included. The playback buttons replay the machining: **back to start**, **step back**, **play / pause**, **step forward** and **go to end**; one step is one tool move. Keyboard: left and right arrows, Home, End and Space. The slider jumps to any moment. Elapsed and total time show at the top left of the view; the fit all button is at the bottom right, as in the other views, and the cross at the top right closes the preview.

View cube (top-right corner): it turns with the view and shows the faces (Top, Front, Right…) and the X, Y, Z axes. Click a face for that view (Top = plan view, like the drawing), or a corner for an isometric view. The tool shown keeps its shape: flat, ball nose, V-bit, drill or thread mill (60° tooth at the tip, relieved neck). Threads appear in the preview as the last pass progresses (ISO 60° profile), inside the hole or around the screw.

Relief and finished part: the **Relief** box overlays the designed relief (a line mesh at its real height) to compare it with the machined material. The **Finished part only** box hides the offcuts: material linked to the stock edge without crossing a full-thickness cut disappears, leaving only the cut-out part(s), as they come off the machine. Tabs do not link the part to the offcut (a small stub stays visible). If no part is cut out, the whole stock stays shown.


Toolpaths in 3D

The **Show** list in the preview bar offers *Material*, *Material + toolpaths* or *Toolpaths only*. The **Drawing** box shows or hides the drawing's vectors, in their layer color, on the face turned upwards: face 1 vectors in the Face 1 view, face 2 vectors in the Face 2 view. Toolpaths are drawn as lines in space, in the color of their type; rapid moves (G0) are dashed gray. During playback they are drawn as the tool moves. With a toolpath selected in the list, the **Selected toolpath only** box shows just that one. Great for checking passes, ramps, helixes and clearance heights before cutting.

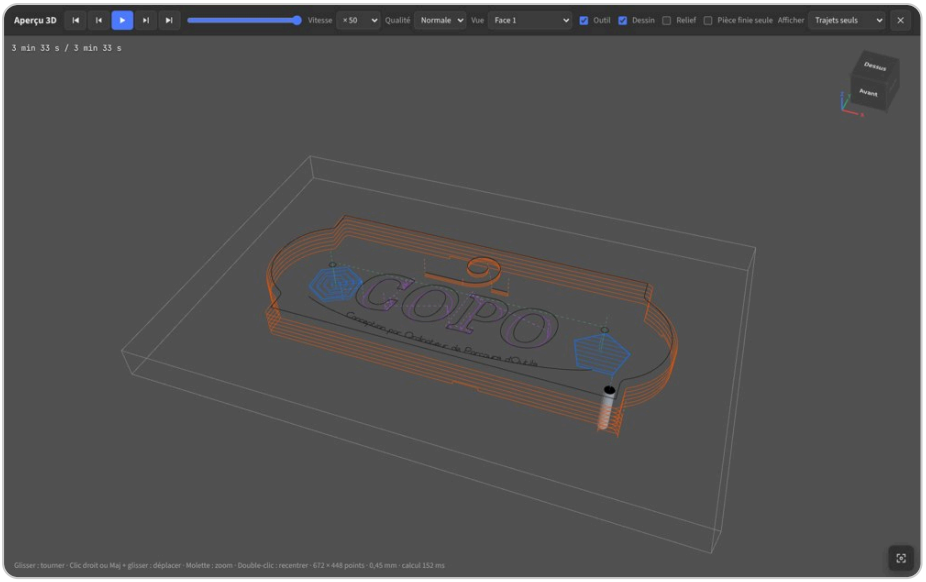

Toolpaths only mode: every cut-out pass is visible, rapids are dashed.

G-code

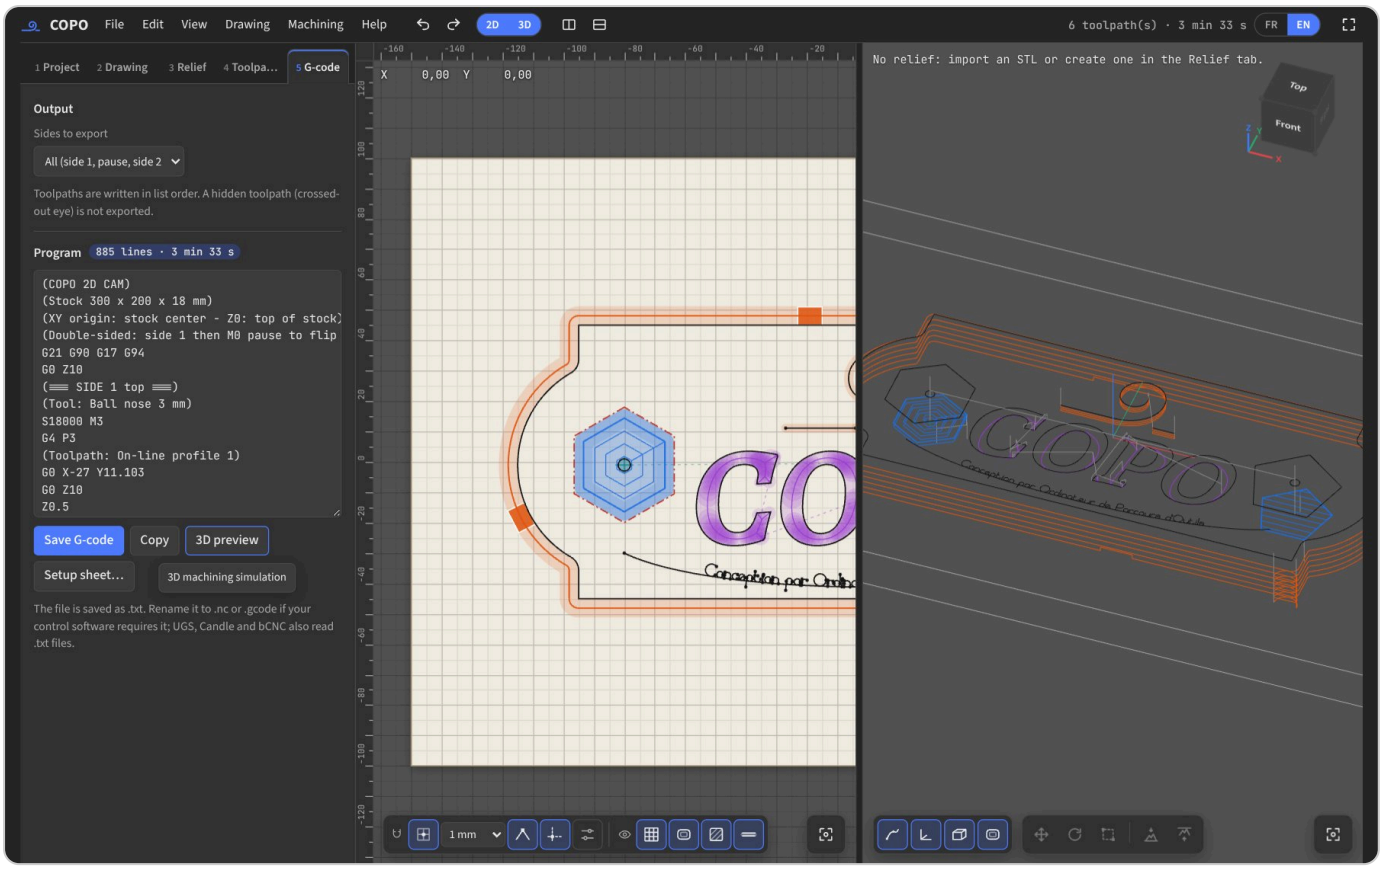

Toolpaths are written in list order; a hidden toolpath is not exported.

POST-PROCESSOR	TOOL CHANGE
GRBL	`M0` pause between two tools.
GRBL manual	Before each tool, the first one included: retract with `G53 G0 Z-10` (adjustable) and `M0` pause. Also a `G53` retract at the end of the program.
Carbide Motion, Onefinity	`M6 T…` : the control software asks you to change the tool.
LinuxCNC, Mach3/4, UCCNC, MASSO	`T… M6` with the tool number, `G40 G49 G80` header, arcs with `G91.1` . `.ngc` file (LinuxCNC), `.tap` (Mach, UCCNC) or `.nc` .
Custom	You write the header, tool change and program end, with variables: `{UNITS}` , `{SAFEZ}` , `{TCZ}` , `{T}` , `{S}` , `{D}` , `{TOOL}` . File extension and `G91.1` are up to you.

Other machines (.pp format). The list also offers, in a separate group, industrial and special machines: Advanced Laser, Axyz, Bridgeport EZTRACK, Busellato GEN J6000, DeskCNC, Haas (with or without arcs), ISEL NCP, Kuka (robot), Lasercomb, Mach2/3 ATC, Biesse Rover, Pacer, Precix, ShopBot (routing, head 2, GC and PRS air drills), Torchmate 2, Turbo CNC, Tormach PathPilot (mm and inch: G30 before each tool change, G43 H…, G91.1 arcs), Vision Series 3, WaterJet PRO, rotary-axis machines (Mach2/3 Wrap, CAMaster, CNC Shark, WinCNC, WinPC-NC, ShopBot Indexer), an HPGL plotter / vinyl cutter and a readable text listing of the toolpath (for checking). They follow the logic of Aspire and VCarve .pp post-processors: each sets its units (mm or inches), number format, line numbering, header, tool change, program end and file extension. If your machine is not there and you have its .pp file (PostP folder of Aspire, VCarve or Cut2D), the **Import a post-processor (.pp)…** button loads it: it joins the “Imported” group, is kept in your browser and saved with the project. The usual blocks are handled (header, end, tool change, new toolpath, rapids, feeds, plunges, retracts, IJ or R arcs, helical arcs, dwell, laser / plasma / water jet on and off, feed change), as well as the usual variables: `[TOOL_DIA]` tool diameter, `[TOOLNAME]`, `[DATE]`, `[TIME]`, stock size (`[XLENGTH]`, `[XMIN]`…), liste des parcours et des outils (`[TOOLPATHS_OUTPUT]`, `[TOOLS_USED]`). COPO lists the blocks it ignores. Post-processors that turn the tool on at the plunge (laser, water jet) need toolpaths with a “Straight plunge” entry: COPO reminds you in the Machine block and the G-code tab. Always do a dry run with a post-processor you have not used yet.

```
(Load tool: End mill 6 mm D6 - set Z zero again then resume)
G21 G90 G17 G94
G53 G0 Z-10
M0
S18000 M3
G4 P3
G0 X10 Y10
G0 Z10
…
M5
G53 G0 Z-10
G0 X0 Y0
M30
```

The post-processor, rapid speed (for the time estimate), safe Z, clearance Z, comments and G2/G3 arcs are set in the Project tab, Machine block. The file gets the extension the post-processor expects (`.nc`, `.tap`, `.ngc`).

Curves and G2/G3 arcs. COPO does not send Bézier curves to the machine as they are: toolpaths are computed as short segments, then, when “G2/G3 arcs” is

checked, circular portions are recognised and written as true G2/G3 arcs (shorter file, smoother motion). A circle drawn with the Circle tool or a vector smoothed in *Arcs* mode gives exact arcs; a free-form curve is approximated by a series of arcs and lines, within tolerance.

> Always check the G-code with a dry run, tool above the stock, before cutting.

Units: millimeters or inches

In the Project tab, Units block, choose the **Length units** (millimeters or inches) and the **Feed units** (mm/min, mm/s or in/min). The choice applies everywhere: drawing, rulers, grid (1/16, 1/8, 1/4 and 1 inch), coordinates, dimensions, tools, toolpaths and setup sheet. In inches, one option shows values as fractions (to 1/64) and another writes the G-code in inches (`G20`) for controllers set up that way.

The project is always saved in millimeters: you can switch units at any time without distorting anything, and a project opens correctly for someone working in the other unit. The choice is remembered in the browser.

Setup sheet

The **Setup sheet…** button in the G-code tab (also in the Machining menu) prepares a two-page setup sheet for the workshop. Enter the part name, the material and your notes; the sheet contains:

- the stock, X0 Y0 origin, Z zero, flip and post-processor;
- a summary: estimated time, maximum depth, machined extent from the origin, cutting length and removed material volume;
- the 2D view of each side with toolpaths, origin and stock dimensions, and two dimetric views of the simulation (side 1 and side 2);
- the tool loading order, then the toolpath table: operation, tool, depth, passes, allowance, entry, tabs, feed, plunge and time;
- the points to watch it detects (cut through the stock, cut-out without tabs, pass too deep, job outside the stock, hidden toolpaths);
- a checklist before starting, a notes area and sign-off boxes.

Save as PDF (in the sheet window, or straight from **File** › **Save the setup sheet as PDF** without opening it) creates an A4 PDF file, split into pages without cutting tables or pictures, ready to print or send. The PDF is a picture of the sheet (text not selectable); for a PDF with text, use **Print** then the browser's “Save as PDF”. You can also keep the HTML file with the G-code. The sheet settings are saved with the project.

Install and use offline

- **Online**: open the GitHub Pages site of the COPO repository. Nothing to install.
- **As an app** (Chrome, Edge, Brave, Vivaldi… on Windows, macOS and Linux): **Help** › **Install COPO as an app…** or the install icon in the address bar. If the icon does not appear, use the browser menu: in Chrome, ⋮ › **Cast, save and share** › **Install page as app…**; in Edge, **…** › **Apps** › **Install this site as an app**. If COPO is already installed, the browser offers “Open in COPO” instead. COPO then opens in its own window with its icon in the app menu, works **offline** once loaded, and **double-clicking a .copo file** opens it directly (the file icon depends on the system). Updates arrive automatically when online. Firefox and Safari do not offer this install: COPO works normally there in a tab.
- **Offline**: download the complete COPO folder (“Code › Download ZIP” on GitHub) and unzip it. Open `index.html` with a double-click: everything is already in the `lib` folder (calculation libraries and interface fonts) and in the `fonts` folder. Nothing else to install or download.
- **Interface fonts**: the `lib/fonts` folder holds the COPO fonts (Source Sans 3, JetBrains Mono, Barlow Condensed). Offline, the interface, the setup sheet and this guide keep the same look.
- **Engraving fonts**: put your `.ttf`, `.otf` or `.woff` files in a `fonts` folder and open it once with the **Open a fonts folder…** button of the Text block.

COPO runs on Windows, macOS and Linux, in a recent Chrome, Edge or Firefox. The list of installed fonts is only available in Chrome and Edge.

Keyboard shortcuts

KEY	ACTION	KEY	ACTION
`V`	Select	`Ctrl` + `Z` / `Y`	Undo / Redo
`N`	Nodes	`Ctrl` + `S` / `O`	Save / Open a project
`H` or `Space`	Pan the view	`Ctrl` + `D`	Duplicate
`R` `E` `C`	Rectangle, ellipse, circle	`Ctrl` + `A`	Select all
`O`	Polygon and star	`Ctrl` + `G`	Group (`Shift` : ungroup)
`P` `A` `T`	Pen, arc, text	`Esc` / right-click	Back to selection, deselect
`K` `F`	Chamfer, fillet	`Del`	Delete the selection or node
`X` `U`	Trim, cut	Arrows	Move by 1 mm (`Shift` : 10 mm)
`M` `D`	Measure, dimension	`Esc`	Cancel the current path, deselect

On a Mac, `Cmd` replaces `Ctrl`.

Report a bug

Help › Report a bug… menu: describe the problem, then click **Open the report on GitHub**. The report arrives pre-filled with technical information (browser, units, stock, toolpaths, recent errors). The 2D view screenshot is copied to the clipboard: paste it into the report with `Ctrl` + `V`. If you check “Attach the project”, drag the downloaded file into the report. A free GitHub account is enough. Ideas for improvements are welcome too at github.com/gbulleryahen-hash/copo/issues.

Help › Suggest an improvement… opens the same window for an idea: describe the feature you want and what it would be used for; it reaches GitHub with the *enhancement* label. Both carry the COPO **version number** (also shown in **Help › About**): 1.*n*, where *n* goes up with every published update.

Licence

COPO is free software © 2026 g.bulleryahen, released under the GNU GPL version 3. You may use, study, modify and redistribute it, including for commercial use.

Any modified version you distribute must stay under the same licence, with its source code. COPO comes with no warranty.

Libraries used, bundled in the `lib` folder: Clipper (Boost Software License), opentype.js (MIT), d3-delaunay and delaunator (ISC), acorn (MIT, for background calculations).

COPO 1.331 · User guide · © 2026 g.bulleryahen · GPL v3