

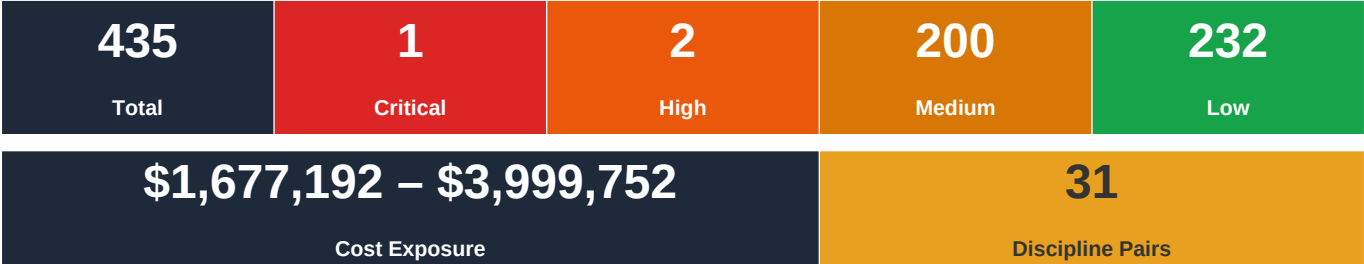
FLIKT.AI

AI-Powered Plan Coordination

Plan Conflict & Coordination Report

Project Name:	Eastside Lofts
Report Date:	April 19, 2026
Analyst:	Flikt.AI Automated Analysis

Executive Summary



Severity Distribution



Top Priority Actions

1. Building Height Exceeds Geotech Assumptions (4 instances)

Severity: Critical | Civil ↔ General

If building program has changed since geotech investigation, request supplemental geotech review for revised loads.

2. Geotechnical Report PVM Requirements Differ Between Multi-Family Buildings and Townhomes but Structural Notes Reference Single Set of PTI Parameters

Severity: High | Specifications ↔ Structural

Add explicit notes to the civil grading plans identifying which building pads require moisture conditioning (Buildings I, II, and Clubhouse) versus those that do not (townhome buildings III and IV). Coordinate with ECS geotechnical engineer to confirm pad improvement extents are shown on grading plans. Include a building pad improvement schedule on the civil plans cross-referencing the geotechnical report requirements.

3. Fire Alarm System Design Deferred to FASD Professional but No Fire Alarm Drawings Included in Document Set

Severity: High | Architectural ↔ Fire-Protection

Require the fire alarm system designer (FASD professional) to submit preliminary fire alarm device layout plans for coordination review before construction begins. Verify that the performance specification Section 267200 includes requirements for all NFPA 72 required devices including duct smoke detectors, waterflow switches, tamper switches, elevator recall, and HVAC shutdown. Ensure the fire alarm monitoring includes waterflow alarm signal transmission per NFPA 72.

Detailed Findings

Critical

ID: GEO530

Building Height Exceeds Geotech Assumptions (4 instances)


Disciplines: Civil ↔ General

Type: Building Program Mismatch

Location: Building

Sheets: AD1, AD3

Description: Sheet A-AD1 SCUPPER & OVERFLOW DRAIN DETAILS AT BRICK references 5-story construction. Geotech report assumes maximum 4 stories. Foundation recommendations may be inadequate for taller buildings. AGGREGATED FINDING: 4 individual instances detected across sheets: A-AD1 SCUPPER & OVERFLOW DRAIN DETAILS AT BRICK, A-AD3 BRICK DETAILS. Equipment/element tags: .



Cost Exposure: \$7,070 – \$14,774

Schedule Impact: High

Recommended Action: If building program has changed since geotech investigation, request supplemental geotech review for revised loads.

High

ID: C007

Geotechnical Report PVM Requirements Differ Between Multi-Family Buildings and Townhomes but Structural Notes Reference Single Set of PTI Parameters


Disciplines: Specifications ↔ Structural

Type: Specification Mismatch

Location: All building foundations — Buildings I, II, III, IV, and Clubhouse

Sheets: 5.3_Material_Specifications, FD1, 4.2_Foundations

Description: The geotechnical report (ECS Project No. 63:, June 2, 2022) specifies different PVM requirements: multi-family buildings and clubhouse require subgrade improvements to reduce PVM to 2.0 inches or less, while townhomes require PVM of 4.5 inches or less and do not require subgrade improvements. The structural foundation notes on FD1 list two separate PTI Design Parameter tables: 'Multi-Family and Clubhouse PTI Design Parameters (PVR 2 inches or less)' with perimeter beam depth of 24 inches, and 'Townhomes PTI Design Parameters (PVR 4.5 inches or less)' with different parameters. However, the material specification Section 5.3.1 states moisture conditioning is required for 'subgrades and new fills within the building pads' to achieve 'a uniform PVM of 2.0 inches or less for the multi-family buildings and clubhouse and 4.5 inches or less for the townhomes.' The specification requires subgrade improvements to 'extend at least 5 feet beyond the edge of the building pads.' There is no explicit coordination note on the civil grading plans (C3-C3) identifying which building pads require moisture conditioning and which do not, creating risk that the earthwork contractor may not properly differentiate treatment requirements between building types.



Cost Exposure: \$17,496 – \$42,247

Schedule Impact: 7-10 days for plan coordination and resubmittal

Recommended Action: Add explicit notes to the civil grading plans identifying which building pads require moisture conditioning (Buildings I, II, and Clubhouse) versus those that do not (townhome buildings III and IV). Coordinate with ECS geotechnical engineer to confirm pad improvement extents are shown on grading plans. Include a building pad improvement schedule on the civil plans cross-referencing the geotechnical report requirements.

High

ID: C008

Fire Alarm System Design Deferred to FASD Professional but No Fire Alarm Drawings Included in Document Set

Disciplines:	Architectural ↔ Fire-Protection	Type:	Documentation Gap
Location:	All buildings — fire alarm system	Sheets:	E2, A1, Spec: 267200

Description: Multiple electrical lighting plan sheets (E2, E2, E2, etc.) contain the note: 'FIRE ALARM DEVICES ARE SHOWN FOR REFERENCE ONLY AND FOR COORDINATION WITH THE OTHER DIVISIONS OF THE WORK AND SHALL NOT BE CONSTRUED AS THE DESIGN OR PLANNING OF FIRE ALARM SYSTEMS. THE ACTUAL PLACEMENT OF THE FIRE ALARM DEVICES AND THE PROCUREMENT OF THE FIRE ALARM SYSTEMS SHALL BE BASED ON A PERFORMANCE SPECIFICATION, SECTION 267200 OF THE PROJECT SPECIFICATIONS. THE FIRE ALARM SYSTEMS SHALL BE DESIGNED AND INSTALLATION SUPERVISED BY THE FASD PROFESSIONAL AS DEFINED IN THE SPECIFICATION SECTION 267200.' The MEP specification index lists Section 267200 Fire Alarm System, but the document set provided for review does not include detailed fire alarm plans showing smoke detectors, heat detectors, pull stations, horn/strobes, duct smoke detectors, waterflow switches, tamper switches, or fire alarm control panel locations. The fire resistance and egress plans (A1-D) show fire extinguisher and standpipe locations but do not show fire alarm device locations. This means the fire alarm system is entirely deferred design with no verification possible at this stage that all required devices per NFPA 72 and IFC will be provided.



Cost Exposure: \$14,291 – \$35,664	Schedule Impact: 14-21 days for fire alarm design and coordination review
------------------------------------	---


Recommended Action: Require the fire alarm system designer (FASD professional) to submit preliminary fire alarm device layout plans for coordination review before construction begins. Verify that the performance specification Section 267200 includes requirements for all NFPA 72 required devices including duct smoke detectors, waterflow switches, tamper switches, elevator recall, and HVAC shutdown. Ensure the fire alarm monitoring includes waterflow alarm signal transmission per NFPA 72.

ID: C420

Medium

Undefined Symbol 'EC2' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** 074646 - fiber-cement siding.pdf p.3**Sheets:** fiber-cement siding

Description: The symbol/abbreviation 'EC2' appears on 1 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$7,087 – \$14,913**Schedule Impact:** 10 days


Recommended Action: Add 'EC2' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C415

Medium

Undefined Symbol 'AGS1' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** 074646 - fiber-cement siding.pdf p.4**Sheets:** Reference, 003132.01, fiber-cement siding, Appendix_C_-_Lab

Description: The symbol/abbreviation 'AGS1' appears on 1 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,952 – \$14,768**Schedule Impact:** 8 days

Recommended Action: Add 'AGS1' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C426

Medium

Undefined Symbol 'FD3' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** FD3 Forming Plan Building #1.pdf p.1**Sheets:** FD3

Description: The symbol/abbreviation 'FD3' appears on 3 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	7/10	5/10	4/10	5/10

Cost Exposure: \$6,952 – \$14,768**Schedule Impact:** 10 days

Recommended Action: Add 'FD3' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C431

Medium

Undefined Symbol 'FD8' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** FD8 Forming Plan Building #2.pdf p.1**Sheets:** FD8

Description: The symbol/abbreviation 'FD8' appears on 3 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	6/10	4/10	3/10	7/10

Cost Exposure: \$6,825 – \$14,759**Schedule Impact:** 7 days


Recommended Action: Add 'FD8' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C423

Medium

Undefined Symbol 'FD1' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** FD1 Forming Plan Building #2.pdf p.1**Sheets:** FD1

Description: The symbol/abbreviation 'FD1' appears on 3 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,760 – \$14,688**Schedule Impact:** 8 days


Recommended Action: Add 'FD1' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C421

Medium

Undefined Symbol 'FD1' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** FD1 GENERAL STRUCTURAL NOTES
FOUNDATION.pdf p.1**Sheets:** FD1

Description: The symbol/abbreviation 'FD1' appears on 2 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,817 – \$14,622**Schedule Impact:** 8 days

Recommended Action: Add 'FD1' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C432

Medium

Undefined Symbol 'FD9' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** FD9 Forming Plan Building #2.pdf p.1**Sheets:** FD9

Description: The symbol/abbreviation 'FD9' appears on 3 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	7/10	5/10	4/10	5/10

Cost Exposure: \$6,817 – \$14,622**Schedule Impact:** 10 days

Recommended Action: Add 'FD9' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C437

Medium

Undefined Symbol 'SW1' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** SW1.1a Building I.pdf p.1**Sheets:** SW1

Description: The symbol/abbreviation 'SW1' appears on 8 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	6/10	4/10	3/10	7/10

Cost Exposure: \$6,695 – \$14,615**Schedule Impact:** 7 days

Recommended Action: Add 'SW1' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C409

Medium

Undefined Symbol 'HP7' — Used in Mechanical drawings but not defined in any legend**Disciplines:** Mechanical ↔ Mechanical**Type:** Missing Coordination**Location:** M6 MECHANICAL SCHEDULES.pdf p.1**Sheets:** M6

Description: The symbol/abbreviation 'HP7' appears on 1 drawing page(s) in the Mechanical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,562 – \$14,606**Schedule Impact:** 8 days

Recommended Action: Add 'HP7' to the Mechanical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C475

Medium

Undefined Symbol 'RS1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** T400

Description: The symbol/abbreviation 'RS1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,562 – \$14,606**Schedule Impact:** 8 days

Recommended Action: Add 'RS1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C541

Medium

Undefined Symbol 'ST5' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'ST5' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,562 – \$14,606**Schedule Impact:** 8 days

Recommended Action: Add 'ST5' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C607

Medium

Undefined Symbol 'GFA8' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GFA8' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,562 – \$14,606**Schedule Impact:** 8 days

Recommended Action: Add 'GFA8' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C387

Medium

Florida Amendment Violation: Accessibility cites ADA only, missing FBC Chapter 11**Disciplines:** A ↔ A**Type:** Ahj Amendment**Location:** See sheets A3, L1, ID1 PROJECT STAN**Sheets:** A3, L1, ID1

Description: Project in FL. Plans reference 'ADA STANDARDS' without citing FBC Chapter 11 or the Florida Accessibility Code (FACBC). Florida accessibility requirements exceed federal ADA in parking ratios, corridor widths, and signage for certain occupancies.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	4/10	4/10	4/10

Cost Exposure: \$6,562 – \$14,606**Schedule Impact:** 10

Recommended Action: Verify accessibility compliance against FBC Chapter 11 / FACBC, not just federal ADA. Florida amendments include stricter parking, corridor, and signage requirements.

ID: C193

Medium

Drawing Index: Sheet FR1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** FR1

Description: Sheet FR1 ('Framing') exists in the bundle but is not listed on the cover-sheet drawing index. CROSS-SHEET AGGREGATION: this issue was detected on 8 sheets (FR1, FR1). Element tag: FR1. Original finding IDs collapsed: C1, C1.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	7/10	1/10	4/10	4/10

Cost Exposure: \$6,750 – \$14,550**Schedule Impact:** 8 days

Recommended Action: Add FR1 to the drawing index or confirm whether it should be removed from the issue set.

ID: C429

Medium

Undefined Symbol 'FD6' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** FD6 Forming Plan Building #2.pdf p.1**Sheets:** FD6

Description: The symbol/abbreviation 'FD6' appears on 3 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	6/10	8/10	3/10	5/10

Cost Exposure: \$6,630 – \$14,544**Schedule Impact:** 8 days

Recommended Action: Add 'FD6' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C005

Medium

Landscape Pool Equipment and Outdoor Kitchen Scope Boundary Ambiguity**Disciplines:** Landscape ↔ Mechanical**Type:** Missing Coordination**Location:** Pool area and outdoor amenity spaces**Sheets:** L2, A1, P1

Description: The landscape overall layout plan (L2) references several items marked 'BY OTHERS' including: Item 9 - '16' x 16' CEDAR WOOD OVERHEAD STRUCTURE. NOT IN CONTRACT, TO BE DETAILED BY POOL DESIGN BUILDER'; Item 12 - 'BBQ GAS GRILL AND OUTDOOR KITCHEN, NOT IN CONTRACT, TO BE DETAILED BY POOL DESIGN BUILDER'; Item 14 - 'POOL BUBBLER FOUNTAINS, BY POOL DESIGN/BUILDER, CONTRACTOR'; and multiple items noted as 'BY OTHERS.' The plumbing site plan (P1) shows pool equipment connections but the scope boundary between the landscape contractor, pool design/builder, and MEP contractors is ambiguous. The architectural site plan (A1) shows pool equipment location but does not clarify which contractor provides gas connections for the outdoor kitchen, electrical for pool equipment, or plumbing for pool bubblers. This creates a risk of scope gaps where no contractor includes critical items in their bid.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	2/10	4/10	6/10

Cost Exposure: \$6,500 – \$14,535**Schedule Impact:** 7-14 days

Recommended Action: 1) Create a clear scope matrix identifying which contractor is responsible for each pool and outdoor amenity item. 2) Clarify in the bid documents whether the pool design/builder is a separate contract or part of the general contractor's scope. 3) Ensure gas piping to the outdoor kitchen BBQ is included in either the plumbing or gas contractor's scope. 4) Verify that electrical circuits for pool pumps, bubblers, and outdoor kitchen equipment are included in the electrical contractor's scope. 5) Add coordination notes on landscape, MEP, and architectural plans identifying scope boundaries.

ID: C434

Medium

Undefined Symbol 'FR2' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** FR2 Framing Plan Building #2.pdf p.1**Sheets:** FR2

Description: The symbol/abbreviation 'FR2' appears on 15 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	5/10	7/10	5/10	4/10

Cost Exposure: \$6,500 – \$14,535**Schedule Impact:** 11 days

Recommended Action: Add 'FR2' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C445

Medium

Undefined Symbol 'FB2' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A4 ENLARGED AMENITY PLANS.pdf p.1**Sheets:** TRASH PLANS AND SECTIONS, 003132.01, A5, A4, ELEVATOR PLANS & SECTIONS

Description: The symbol/abbreviation 'TEX1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,500 – \$14,535**Schedule Impact:** 8 days

Recommended Action: Add 'FB2' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C511

Medium

Undefined Symbol 'WC5' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A4 CLUBHOUSE - RCP.pdf p.1**Sheets:** RCP, ID6

Description: The symbol/abbreviation 'WC5' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,500 – \$14,535**Schedule Impact:** 8 days

Recommended Action: Add 'WC5' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C577

Medium

Undefined Symbol 'GD2' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD2' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,500 – \$14,535**Schedule Impact:** 8 days

Recommended Action: Add 'GD2' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C643

Medium

Undefined Symbol 'UPF7' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES - units.pdf p.1**Sheets:** units

Description: The symbol/abbreviation 'UPF7' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,500 – \$14,535**Schedule Impact:** 8 days

Recommended Action: Add 'UPF7' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C427

Medium

Undefined Symbol 'FD4' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** FD4 Forming Plan Building #1.pdf p.1**Sheets:** FD4

Description: The symbol/abbreviation 'FD4' appears on 3 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	7/10	6/10	4/10	6/10

Cost Exposure: \$6,682 – \$14,477**Schedule Impact:** 8 days


Recommended Action: Add 'FD4' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C438

Medium

Undefined Symbol 'SW2' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** SW2.1a Building II.pdf p.1**Sheets:** SW2

Description: The symbol/abbreviation 'SW2' appears on 8 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,682 – \$14,477**Schedule Impact:** 10 days


Recommended Action: Add 'SW2' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C481

Medium

Undefined Symbol 'ST9' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1, A4, A5

Description: The symbol/abbreviation 'ST9' appears on 3 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,437 – \$14,463**Schedule Impact:** 8 days

Recommended Action: Add 'ST9' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C547

Medium

Undefined Symbol 'WC1' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'WC1' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,437 – \$14,463**Schedule Impact:** 8 days

Recommended Action: Add 'WC1' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C613

Medium

Undefined Symbol 'GW1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GW1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,437 – \$14,463**Schedule Impact:** 8 days


Recommended Action: Add 'GW1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Medium

ID: C376

Missing panel circuit for 45**Disciplines:** Civil ↔ General**Type:** Missing Coordination**Location:** Electrical Room**Sheets:** M1

Description: Equipment SHO (light_fixture) shown on Mechanical sheet M1 has no matching circuit on any panel schedule. Verify electrical service is provided.

**Cost Exposure:** \$6,300 – \$14,452**Schedule Impact:** Medium

Recommended Action: Add circuit for 45 on appropriate panel. Verify voltage, phase, and amperage requirements.

Medium

ID: C497

Undefined Symbol 'STD1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1, A4

Description: The symbol/abbreviation 'STD1' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,300 – \$14,452**Schedule Impact:** 7 days


Recommended Action: Add 'STD1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C563

Medium

Undefined Symbol 'CH4' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E2 CLUBHOUSE -ROOF -ELECTRICAL.pdf
p.1**Sheets:** E2

Description: The symbol/abbreviation 'CH4' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,300 – \$14,452**Schedule Impact:** 7 days

Recommended Action: Add 'CH4' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C629

Medium

Undefined Symbol 'RJ4' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** General Comm Requirements_Elec

Description: The symbol/abbreviation 'RJ4' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,300 – \$14,452**Schedule Impact:** 7 days

Recommended Action: Add 'RJ4' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C435

Medium

Undefined Symbol 'FR5' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** FR5 Framing Plan Clubhouse.pdf p.1**Sheets:** FR5

Description: The symbol/abbreviation 'FR5' appears on 1 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	6/10	8/10	3/10	5/10

Cost Exposure: \$6,500 – \$14,400**Schedule Impact:** 8 days

Recommended Action: Add 'FR5' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C418

Medium

Undefined Symbol 'B6' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** Reference, 003132.01, Appendix_C_-_Lab, fiber-cement siding

Description: The symbol/abbreviation 'PA1' appears on 1 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	6/10	5/10	5/10

Cost Exposure: \$6,375 – \$14,392**Schedule Impact:** 10 days

Recommended Action: Add 'B6' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C440

Medium

Undefined Symbol 'WB4' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** 051200 - Structural Steel.pdf p.3**Sheets:** Structural Steel

Description: The symbol/abbreviation 'WB4' appears on 1 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	5/10	7/10	5/10	4/10

Cost Exposure: \$6,375 – \$14,392**Schedule Impact:** 11 days

Recommended Action: Add 'WB4' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C451

Medium

Undefined Symbol 'HP1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** 123530 - residential casework.pdf p.2**Sheets:** residential casework

Description: The symbol/abbreviation 'HP1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,375 – \$14,392**Schedule Impact:** 8 days

Recommended Action: Add 'HP1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C583

Medium

Undefined Symbol 'GD8' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD8' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,375 – \$14,392**Schedule Impact:** 8 days

Recommended Action: Add 'GD8' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C649

Medium

Undefined Symbol 'WD1' — Used in Landscape drawings but not defined in any legend**Disciplines:** Landscape ↔ Landscape**Type:** Missing Coordination**Location:** ID3 REFLECTED CEILING PLAN BLDG 1 - CO-WORK.pdf p.1**Sheets:** CO-WORK, LEASING, T211A, T221B

Description: The symbol/abbreviation 'WD1' appears on 4 drawing page(s) in the Landscape set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,375 – \$14,392**Schedule Impact:** 8 days

Recommended Action: Add 'WD1' to the Landscape legend with a one-line definition, or replace the tag with a defined symbol.

ID: C401

Medium

Undefined Symbol 'EF2' — Used in Mechanical drawings but not defined in any legend**Disciplines:** Mechanical ↔ Mechanical**Type:** Missing Coordination**Location:** M1 MECHANICAL SPECIFICATIONS.pdf p.1**Sheets:** M1, Integrated AV Systems_Mech

Description: The symbol/abbreviation 'HDE1' appears on 1 drawing page(s) in the Mechanical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$6,240 – \$14,382**Schedule Impact:** 7 days

Recommended Action: Add 'EF2' to the Mechanical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C467

Medium

Undefined Symbol 'PF5' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1, LEASING & DOG WASH

Description: The symbol/abbreviation 'PF5' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$6,240 – \$14,382**Schedule Impact:** 7 days


Recommended Action: Add 'PF5' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C533

Medium

Undefined Symbol 'LM9' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** 071326 - self-adhering sheet waterproofing.pdf p.2**Sheets:** self-adhering sheet waterproofing

Description: The symbol/abbreviation 'LM9' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,240 – \$14,382**Schedule Impact:** 7 days

Recommended Action: Add 'LM9' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C599

Medium

Undefined Symbol 'GFA1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GFA1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,240 – \$14,382**Schedule Impact:** 7 days

Recommended Action: Add 'GFA1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C433

Medium

Undefined Symbol 'FR1' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** FR1 Framing Plan Building #1.pdf p.1**Sheets:** FR1

Description: The symbol/abbreviation 'FR1' appears on 20 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	7/10	6/10	4/10	6/10

Cost Exposure: \$6,547 – \$14,331**Schedule Impact:** 8 days

Recommended Action: Add 'FR1' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C190

Medium

Drawing Index: Sheet FD1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** FD1

Description: Sheet FD1 ('Post-tension Foundation') exists in the bundle but is not listed on the cover-sheet drawing index. CROSS-SHEET AGGREGATION: this issue was detected on 2 sheets (FD1, FD1). Element tag: FD1. Original finding IDs collapsed: C1, C1.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	6/10	5/10	2/10

Cost Exposure: \$6,312 – \$14,321**Schedule Impact:** 10 days

Recommended Action: Add FD1 to the drawing index or confirm whether it should be removed from the issue set.

Medium

ID: C377

Missing panel circuit for OF**Disciplines:** Civil ↔ General**Type:** Missing Coordination**Location:** Electrical Room**Sheets:** M1

Description: Equipment IND (light_fixture) shown on Mechanical sheet M1 has no matching circuit on any panel schedule. Verify electrical service is provided.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	5/10	4/10	2/10	4/10

Cost Exposure: \$6,312 – \$14,321**Schedule Impact:** Medium

Recommended Action: Add circuit for OF on appropriate panel. Verify voltage, phase, and amperage requirements.

Medium

ID: C487

Undefined Symbol 'ST1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1, A4

Description: The symbol/abbreviation 'ST1' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,312 – \$14,321**Schedule Impact:** 8 days

Recommended Action: Add 'ST1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C553

Medium

Undefined Symbol 'WC7' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'WC7' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,312 – \$14,321**Schedule Impact:** 8 days

Recommended Action: Add 'WC7' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C619

Medium

Undefined Symbol 'GW7' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GW7' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,312 – \$14,321**Schedule Impact:** 8 days

Recommended Action: Add 'GW7' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Medium

ID: D474

Plumbing fixture [TAG] requires electrical circuit not shown (3 instances: 636c, 300h)

Disciplines:

Plumbing ↔ Electrical

Type:

Missing Coordination

Location:

055213 - pipe and tube railings_Plum_p1

Sheets:

pipe and tube railings_Plum, standing-seam, roof specialties

Description: Plumbing plans show pump (636c) at 055213 - pipe and tube railings_Plum_p1, which requires electrical power (hot water circulation, instant heater, garbage disposal, etc.). No dedicated electrical circuit or receptacle is shown on Electrical plans. AGGREGATED FINDING: 3 individual instances detected across sheets: 055213 - pipe and tube railings_Plum_p1, 074113.16 - standing-seam metal roof panels_Plum_p1, 077100 - roof specialties_p4. Equipment/element tags: 636c, 300h.

Construct.

6/10

Cost

4/10

Safety

7/10

Schedule

5/10

Downstrm.

5/10

Cost Exposure: \$6,180 – \$14,311

Schedule Impact: 3-7 days

Recommended Action: Coordinate with Electrical to add dedicated 20A circuit (or per fixture requirements) near 055213 - pipe and tube railings_Plum_p1. Install appropriately rated receptacle/outlet. Verify circuit amperage against equipment specifications.

ID: C503

Medium

Undefined Symbol 'TR4' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID6 INTERIOR ELEVATIONS.pdf p.1**Sheets:** ID6, ID7


Description: The symbol/abbreviation 'TR4' appears on 8 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.**

5/10



4/10



1/10



3/10



7/10

Cost Exposure: \$6,180 – \$14,311**Schedule Impact:** 7 days

Recommended Action: Add 'TR4' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C569

Medium

Undefined Symbol 'GD1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1


Description: The symbol/abbreviation 'GD1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.**

5/10



4/10



1/10



3/10



7/10

Cost Exposure: \$6,180 – \$14,311**Schedule Impact:** 7 days

Recommended Action: Add 'GD1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C635

Medium

Undefined Symbol 'UPA4' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES - units.pdf p.1**Sheets:** units

Description: The symbol/abbreviation 'UPA4' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$6,180 – \$14,311**Schedule Impact:** 7 days

Recommended Action: Add 'UPA4' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C398

Medium

Undefined Symbol 'WDF1' — Used in Civil drawings but not defined in any legend**Disciplines:** Civil ↔ Civil**Type:** Missing Coordination**Location:** ID2 FINISH PLAN BLDG 1 - CO-WORK.pdf p.1**Sheets:** CO-WORK

Description: The symbol/abbreviation 'WDF1' appears on 1 drawing page(s) in the Civil set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$6,037 – \$14,298**Schedule Impact:** 11 days


Recommended Action: Add 'WDF1' to the Civil legend with a one-line definition, or replace the tag with a defined symbol.

ID: C442

Medium

Undefined Symbol 'CAB2' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID6 INTERIOR ELEVATIONS.pdf p.1**Sheets:** ID6

Description: The symbol/abbreviation 'CAB2' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,037 – \$14,298**Schedule Impact:** 10 days


Recommended Action: Add 'CAB2' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C464

Medium

Undefined Symbol 'PF2' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1, CO-WORK, LEASING & DOG WASH

Description: The symbol/abbreviation 'PF2' appears on 4 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,037 – \$14,298**Schedule Impact:** 11 days

Recommended Action: Add 'PF2' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C508

Medium

Undefined Symbol 'WC1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID6 INTERIOR ELEVATIONS.pdf p.1**Sheets:** ID6

Description: The symbol/abbreviation 'WC1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$6,037 – \$14,298**Schedule Impact:** 10 days

Recommended Action: Add 'WC1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C530

Medium

Undefined Symbol 'ES1' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** 077100 - roof specialties.pdf p.2**Sheets:** roof specialties

Description: The symbol/abbreviation 'ES1' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$6,037 – \$14,298**Schedule Impact:** 11 days

Recommended Action: Add 'ES1' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C574

Medium

Undefined Symbol 'GD1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$6,037 – \$14,298**Schedule Impact:** 10 days

Recommended Action: Add 'GD1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C596

Medium

Undefined Symbol 'GE9' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GE9' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$6,037 – \$14,298**Schedule Impact:** 11 days

Recommended Action: Add 'GE9' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C640

Medium

Undefined Symbol 'UPF4' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES - units.pdf p.1**Sheets:** units

Description: The symbol/abbreviation 'UPF4' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$6,037 – \$14,298**Schedule Impact:** 10 days

Recommended Action: Add 'UPF4' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C662

Medium

Undefined Symbol 'WC5' — Used in Interior Design drawings but not defined in any legend**Disciplines:** Interior Design ↔ Interior Design**Type:** Missing Coordination**Location:** ID3 REFLECTED CEILING PLAN CLUBHOUSE.pdf p.1**Sheets:** ID3, T251

Description: The symbol/abbreviation 'WC5' appears on 2 drawing page(s) in the Interior Design set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$6,037 – \$14,298**Schedule Impact:** 11 days

Recommended Action: Add 'WC5' to the Interior Design legend with a one-line definition, or replace the tag with a defined symbol.

ID: C419

Medium

Undefined Symbol 'B7' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** Reference, 003132.01, Appendix_C_-_Lab, 4.2

Description: The symbol/abbreviation 'TEX1' appears on 1 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	6/10	4/10	3/10	7/10

Cost Exposure: \$6,370 – \$14,256**Schedule Impact:** 7 days

Recommended Action: Add 'B7' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C050

Medium

Drawing Index: Sheet LP2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** GSN2, FD1, GSN1, LP2

Description: Sheet GSN1 ('General Structural Notes Framing') exists in the bundle but is not listed on the cover-sheet drawing index.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	5/10	7/10	5/10	1/10

Cost Exposure: \$6,250 – \$14,250**Schedule Impact:** 11 days

Recommended Action: Add LP2 to the drawing index or confirm whether it should be removed from the issue set.

ID: C006

Medium

Waterproofing Spec Section 071326 Filed Under Plumbing Discipline — Missing Coordination with Architectural Balcony Details**Disciplines:** Plumbing ↔ Architectural**Type:** Missing Coordination**Location:** All balconies and breezeways — Buildings I and II**Sheets:** self-adhering sheet waterproofing, AD1

Description: Section 071326 Self-Adhering Sheet Waterproofing specifies modified bituminous sheet waterproofing at 'Horizontal surfaces at Balconies and Breezeways' with a 60-mil minimum thickness Polyguard 650 basis of design. The architectural balcony flashing details on sheet A-AD1 show a detailed multi-layer waterproofing system including '2 LAYERS 80 mil SELF ADHERING WATERPROOF DECK MEMBRANE SYSTEM' plus a 'POLY-TUFF TOPSHIELD EST WATERPROOF' topcoat and drainage mat. The specification calls for a single 60-mil sheet while the architectural

detail calls for two layers of 80-mil membrane (160 mil total) plus additional topcoat — a significant difference in material thickness and system composition. This discrepancy between the specification and the architectural detail could lead to incorrect material ordering and installation.

Construct.	Cost	Safety	Schedule	Downstrm.
7/10	5/10	3/10	4/10	6/10

Cost Exposure: \$6,250 – \$14,250

Schedule Impact: 5-7 days for specification reconciliation

Recommended Action: Reconcile Section 071326 with architectural detail A-AD1. Update the specification to match the two-layer 80-mil membrane system shown in the architectural details, or update the architectural details to match the specification. Confirm with the architect which system is intended and ensure the warranty requirements are met by the selected system.

Medium

ID: C391
Undefined Symbol 'FC4' — Used in Civil drawings but not defined in any legend

Disciplines: Civil ↔ Civil

Type: Missing Coordination

Location: A-AB1 FLOOR CEILING ASSEMBLIES.pdf p.1

Sheets: under slab vapor barrier, AB1

Description: The symbol/abbreviation 'GS1' appears on 1 drawing page(s) in the Civil set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,250 – \$14,250

Schedule Impact: 8 days

Recommended Action: Add 'FC4' to the Civil legend with a one-line definition, or replace the tag with a defined symbol.

ID: C424

Medium

Undefined Symbol 'FD1' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** FD1 Forming Plan Club House.pdf p.1**Sheets:** FD1

Description: The symbol/abbreviation 'FD1' appears on 2 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	6/10	5/10	5/10

Cost Exposure: \$6,250 – \$14,250**Schedule Impact:** 10 days

Recommended Action: Add 'FD1' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C457

Medium

Undefined Symbol 'PA1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID6, ID1

Description: The symbol/abbreviation 'PA1' appears on 4 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,250 – \$14,250**Schedule Impact:** 8 days

Recommended Action: Add 'PA1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C589

Medium

Undefined Symbol 'GE2' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GE2' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,250 – \$14,250**Schedule Impact:** 8 days

Recommended Action: Add 'GE2' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C655

Medium

Undefined Symbol 'PF9' — Used in Interior Design drawings but not defined in any legend**Disciplines:** Interior Design ↔ Interior Design**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** T251

Description: The symbol/abbreviation 'PF9' appears on 1 drawing page(s) in the Interior Design set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,250 – \$14,250**Schedule Impact:** 8 days

Recommended Action: Add 'PF9' to the Interior Design legend with a one-line definition, or replace the tag with a defined symbol.

ID: R520

Medium

Engineer Note — to be coordinated: with the structural and architectural features of the buildin**Disciplines:** Structural ↔ Mechanical**Type:** Engineer Note**Location:** (See plan set for details)**Sheets:** 210000-260000_Mech.pdf p6

Description: A coordination note on sheet 210000-260000_Mech.pdf p6 requires verification: to be coordinated: with the structural and architectural features of the building. Confirm this item has been resolved with the responsible discipline before construction proceeds.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	6/10	5/10	2/10

Cost Exposure: \$6,250 – \$14,250**Schedule Impact:** 10 days

Recommended Action: Verify resolution status with the responsible discipline. Issue RFI if a design decision is still pending.

ID: D491

Medium

Architectural shows pump but Civil plan shows no site coordination (15 instances)**Disciplines:** Architectural ↔ Civil**Type:** Missing Coordination**Location:** a-ad11.2 roof & trash room details_p1**Sheets:** Thermoplastic, AD1, AD5, TPO

Description: Architectural plans show pump at a-ad11.2 roof & trash room details_p1, but Civil/Site plans do not show the location, utility connections, drainage implications, or access requirements for this equipment. This could impact site grading, drainage design, and utility routing. AGGREGATED FINDING: 15 individual instances detected across sheets: A-AD1 ROOF & TRASH ROOM DETAILS_p1, A-AD1 ROOF DETAILS - TPO_p1, A-AD5 EXTERIOR FRAMING DETAILS_p1. Equipment/element tags: .

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	4/10	4/10	6/10

Cost Exposure: \$6,120 – \$14,241**Schedule Impact:** 7-14 days

Recommended Action: Coordinate with Civil to add pump to site plan, including: equipment pad location, utilities (electric/water/gas) routing, drainage around equipment, maintenance access, and any tie-ins to site systems.

ID: C407

Medium

Undefined Symbol 'HP5' — Used in Mechanical drawings but not defined in any legend**Disciplines:** Mechanical ↔ Mechanical**Type:** Missing Coordination**Location:** M6 MECHANICAL SCHEDULES.pdf p.1**Sheets:** M6

Description: The symbol/abbreviation 'HP5' appears on 1 drawing page(s) in the Mechanical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$6,120 – \$14,241**Schedule Impact:** 7 days

Recommended Action: Add 'HP5' to the Mechanical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C539

Medium

Undefined Symbol 'ST3' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'ST3' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$6,120 – \$14,241**Schedule Impact:** 7 days

Recommended Action: Add 'ST3' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C561

Medium

Undefined Symbol 'FW1' — Used in Fire Protection drawings but not defined in any legend**Disciplines:** Fire Protection ↔ Fire Protection**Type:** Missing Coordination**Location:** A-AB1 FIRE WALL ASSEMBLIES.pdf p.1**Sheets:** AB1

Description: The symbol/abbreviation 'FW1' appears on 1 drawing page(s) in the Fire Protection set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	7/10	3/10	6/10

Cost Exposure: \$6,120 – \$14,241**Schedule Impact:** 8 days

Recommended Action: Add 'FW1' to the Fire Protection legend with a one-line definition, or replace the tag with a defined symbol.

ID: C605

Medium

Undefined Symbol 'GFA6' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GFA6' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$6,120 – \$14,241**Schedule Impact:** 7 days

Recommended Action: Add 'GFA6' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C412

Medium

Undefined Symbol 'RL1' — Used in Mechanical drawings but not defined in any legend**Disciplines:** Mechanical ↔ Mechanical**Type:** Missing Coordination**Location:** M1 MECHANICAL SPECIFICATIONS.pdf p.1**Sheets:** M1

Description: The symbol/abbreviation 'RL1' appears on 1 drawing page(s) in the Mechanical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,980 – \$14,229**Schedule Impact:** 10 days

Recommended Action: Add 'RL1' to the Mechanical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C478

Medium

Undefined Symbol 'ST6' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1, A5

Description: The symbol/abbreviation 'ST6' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,980 – \$14,229**Schedule Impact:** 10 days

Recommended Action: Add 'ST6' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C500

Medium

Undefined Symbol 'TL9' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A-AB1 INTERIOR PARTITION WALL
ASSEMBLIES.pdf p.1**Sheets:** AB1, AD1

Description: The symbol/abbreviation 'TL9' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,980 – \$14,229**Schedule Impact:** 11 days

Recommended Action: Add 'TL9' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C544

Medium

Undefined Symbol 'W3' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** [1] C6 WATER PROFILES.pdf p.1**Sheets:** C6

Description: The symbol/abbreviation 'W3' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,980 – \$14,229**Schedule Impact:** 10 days


Recommended Action: Add 'W3' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C566

Medium

Undefined Symbol 'GA2' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** 061600 - sheathing.pdf p.4**Sheets:** sheathing

Description: The symbol/abbreviation 'GA2' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$5,980 – \$14,229**Schedule Impact:** 11 days


Recommended Action: Add 'GA2' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C610

Medium

Undefined Symbol 'GT2' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GT2' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$5,980 – \$14,229**Schedule Impact:** 10 days

Recommended Action: Add 'GT2' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C632

Medium

Undefined Symbol 'UPA1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES - units.pdf p.1**Sheets:** units

Description: The symbol/abbreviation 'UPA1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,980 – \$14,229**Schedule Impact:** 11 days

Recommended Action: Add 'UPA1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C439

Medium

Undefined Symbol 'SW3' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** SW3 Club House.pdf p.1**Sheets:** SW3

Description: The symbol/abbreviation 'SW3' appears on 1 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	7/10	6/10	4/10	6/10

Cost Exposure: \$6,412 – \$14,186**Schedule Impact:** 8 days

Recommended Action: Add 'SW3' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C416

Medium

Undefined Symbol 'B4' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** Reference, 003132.01, Appendix_C_-_Lab, cold-formed metal framing

Description: The symbol/abbreviation 'GA6' appears on 1 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	5/10	7/10	5/10	4/10

Cost Exposure: \$6,187 – \$14,178**Schedule Impact:** 11 days

Recommended Action: Add 'B4' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C493

Medium

Undefined Symbol 'STD7' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1

Description: The symbol/abbreviation 'STD7' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,187 – \$14,178**Schedule Impact:** 8 days


Recommended Action: Add 'STD7' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C625

Medium

Undefined Symbol 'HP7' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E2 CLUBHOUSE -ROOF -ELECTRICAL.pdf p.1**Sheets:** E2

Description: The symbol/abbreviation 'HP7' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,187 – \$14,178**Schedule Impact:** 8 days


Recommended Action: Add 'HP7' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C443

Medium

Undefined Symbol 'CP1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** 321313 - concrete paving.pdf p.2**Sheets:** General Comm Requirements_Arch, concrete paving

Description: The symbol/abbreviation 'EIA5' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,060 – \$14,170**Schedule Impact:** 7 days

Recommended Action: Add 'CP1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C509

Medium

Undefined Symbol 'WC1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID6 INTERIOR ELEVATIONS.pdf p.1**Sheets:** ID6

Description: The symbol/abbreviation 'WC1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$6,060 – \$14,170**Schedule Impact:** 7 days

Recommended Action: Add 'WC1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C575

Medium

Undefined Symbol 'GD2' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD2' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$6,060 – \$14,170**Schedule Impact:** 7 days

Recommended Action: Add 'GD2' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C641

Medium

Undefined Symbol 'UPF5' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES - units.pdf p.1**Sheets:** units

Description: The symbol/abbreviation 'UPF5' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$6,060 – \$14,170**Schedule Impact:** 7 days

Recommended Action: Add 'UPF5' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C404

Medium

Undefined Symbol 'HP2' — Used in Mechanical drawings but not defined in any legend**Disciplines:** Mechanical ↔ Mechanical**Type:** Missing Coordination**Location:** M6 MECHANICAL SCHEDULES.pdf p.1**Sheets:** M6

Description: The symbol/abbreviation 'HP2' appears on 1 drawing page(s) in the Mechanical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,922 – \$14,159**Schedule Impact:** 11 days

Recommended Action: Add 'HP2' to the Mechanical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C448

Medium

Undefined Symbol 'FD1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** FD1 Post-tension Foundation Typical Details.pdf p.1**Sheets:** FD1

Description: The symbol/abbreviation 'FD1' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,922 – \$14,159**Schedule Impact:** 10 days

Recommended Action: Add 'FD1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C470

Medium

Undefined Symbol 'PF8' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'PF8' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,922 – \$14,159**Schedule Impact:** 11 days

Recommended Action: Add 'PF8' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C536

Medium

Undefined Symbol 'SK2' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** P4 PLUMBING RISERS.pdf p.1**Sheets:** P4

Description: The symbol/abbreviation 'SK2' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,922 – \$14,159**Schedule Impact:** 11 days

Recommended Action: Add 'SK2' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C580

Medium

Undefined Symbol 'GD5' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD5' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,922 – \$14,159**Schedule Impact:** 10 days

Recommended Action: Add 'GD5' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C602

Medium

Undefined Symbol 'GFA3' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GFA3' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,922 – \$14,159**Schedule Impact:** 11 days

Recommended Action: Add 'GFA3' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C425

Medium

Undefined Symbol 'FD2' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** FD2 Forming Plan Building #1.pdf p.1**Sheets:** FD2

Description: The symbol/abbreviation 'FD2' appears on 3 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	6/10	4/10	3/10	7/10

Cost Exposure: \$6,240 – \$14,112**Schedule Impact:** 7 days

Recommended Action: Add 'FD2' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C397

Medium

Undefined Symbol 'TIA5' — Used in Civil drawings but not defined in any legend**Disciplines:** Civil ↔ Civil**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** General Comm Requirements_Civi

Description: The symbol/abbreviation 'TIA5' appears on 1 drawing page(s) in the Civil set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,125 – \$14,107**Schedule Impact:** 8 days

Recommended Action: Add 'TIA5' to the Civil legend with a one-line definition, or replace the tag with a defined symbol.

ID: C430

Medium

Undefined Symbol 'FD7' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** FD7 Forming Plan Building #2.pdf p.1**Sheets:** FD7

Description: The symbol/abbreviation 'FD7' appears on 3 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	6/10	5/10	5/10

Cost Exposure: \$6,125 – \$14,107**Schedule Impact:** 10 days

Recommended Action: Add 'FD7' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C463

Medium

Undefined Symbol 'PF1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1, LEASING & DOG WASH

Description: The symbol/abbreviation 'PF1' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,125 – \$14,107**Schedule Impact:** 8 days

Recommended Action: Add 'PF1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C529

Medium

Undefined Symbol 'CO1' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1, P4

Description: The symbol/abbreviation 'IWH1' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,125 – \$14,107**Schedule Impact:** 8 days

Recommended Action: Add 'CO1' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C595

Medium

Undefined Symbol 'GE8' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GE8' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,125 – \$14,107**Schedule Impact:** 8 days

Recommended Action: Add 'GE8' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C661

Medium

Undefined Symbol 'TV6' — Used in Interior Design drawings but not defined in any legend**Disciplines:** Interior Design ↔ Interior Design**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** T251

Description: The symbol/abbreviation 'TV6' appears on 1 drawing page(s) in the Interior Design set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,125 – \$14,107**Schedule Impact:** 8 days

Recommended Action: Add 'TV6' to the Interior Design legend with a one-line definition, or replace the tag with a defined symbol.

ID: C413

Medium

Undefined Symbol 'SQ9' — Used in Mechanical drawings but not defined in any legend**Disciplines:** Mechanical ↔ Mechanical**Type:** Missing Coordination**Location:** M6 MECHANICAL SCHEDULES.pdf p.1**Sheets:** M6

Description: The symbol/abbreviation 'SQ9' appears on 1 drawing page(s) in the Mechanical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$6,000 – \$14,100**Schedule Impact:** 7 days

Recommended Action: Add 'SQ9' to the Mechanical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C479

Medium

Undefined Symbol 'ST7' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1, A5

Description: The symbol/abbreviation 'ST7' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$6,000 – \$14,100**Schedule Impact:** 7 days

Recommended Action: Add 'ST7' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C545

Medium

Undefined Symbol 'WC1' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1, P4


Description: The symbol/abbreviation 'WC1' appears on 2 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.**

5/10



4/10



1/10



3/10



7/10

Cost Exposure: \$6,000 – \$14,100**Schedule Impact:** 7 days

Recommended Action: Add 'WC1' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C611

Medium

Undefined Symbol 'GT3' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1


Description: The symbol/abbreviation 'GT3' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.**

5/10



4/10



1/10



3/10



7/10

Cost Exposure: \$6,000 – \$14,100**Schedule Impact:** 7 days

Recommended Action: Add 'GT3' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C484

Medium

Undefined Symbol 'ST1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1

Description: The symbol/abbreviation 'ST1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,865 – \$14,089**Schedule Impact:** 10 days

Recommended Action: Add 'ST1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C506

Medium

Undefined Symbol 'TW6' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'TW6' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,865 – \$14,089**Schedule Impact:** 11 days

Recommended Action: Add 'TW6' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C550

Medium

Undefined Symbol 'WC4' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1, P4

Description: The symbol/abbreviation 'WC4' appears on 2 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,865 – \$14,089**Schedule Impact:** 10 days

Recommended Action: Add 'WC4' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C572

Medium

Undefined Symbol 'GD1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,865 – \$14,089**Schedule Impact:** 11 days


Recommended Action: Add 'GD1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C616

Medium

Undefined Symbol 'GW4' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GW4' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$5,865 – \$14,089**Schedule Impact:** 10 days


Recommended Action: Add 'GW4' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C638

Medium

Undefined Symbol 'UPF2' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES - units.pdf p.1**Sheets:** units

Description: The symbol/abbreviation 'UPF2' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$5,865 – \$14,089**Schedule Impact:** 11 days

Recommended Action: Add 'UPF2' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Medium

ID: C373

Missing panel [TAG] for 13154 (5 instances)**Disciplines:** Civil ↔ General**Type:** Missing Coordination**Location:** Electrical Room**Sheets:** L5, M1, P5, T6

Description: Equipment 13154 (pump) shown on Civil sheet T6 has no matching circuit on any panel schedule. Verify electrical service is provided. AGGREGATED FINDING: 5 individual instances detected across sheets: L5, M1, P5, T6. Equipment/element tags: .

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	6/10	2/10	3/10	5/10

Cost Exposure: \$6,175 – \$14,040**Schedule Impact:** Medium

Recommended Action: Add circuit for 13154 on appropriate panel. Verify voltage, phase, and amperage requirements.

Medium

ID: C417

Undefined Symbol 'B5' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** Reference, 003132.01, GSN1, Appendix_C_-_Lab, GSN2

Description: The symbol/abbreviation 'GSN1' appears on 1 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	6/10	8/10	3/10	5/10

Cost Exposure: \$6,175 – \$14,040**Schedule Impact:** 8 days


Recommended Action: Add 'B5' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C422

Medium

Undefined Symbol 'FD1' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** FD1 Forming Plan Building #1.pdf p.1**Sheets:** FD1

Description: The symbol/abbreviation 'FD1' appears on 3 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,062 – \$14,036**Schedule Impact:** 11 days


Recommended Action: Add 'FD1' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C499

Medium

Undefined Symbol 'SW2' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A6 BUILDING I - STAIR 2 - PLANS & SECTION.pdf p.1**Sheets:** PLANS & SECTION, ELEVATOR PLANS & SECTIONS, TRASH PLANS AND SECTIONS

Description: The symbol/abbreviation 'SW2' appears on 4 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,062 – \$14,036**Schedule Impact:** 8 days

Recommended Action: Add 'SW2' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C565

Medium

Undefined Symbol 'EPC4' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** 210000-260000_Elec

Description: The symbol/abbreviation 'EPC4' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,062 – \$14,036**Schedule Impact:** 8 days

Recommended Action: Add 'EPC4' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C631

Medium

Undefined Symbol 'UA1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES - units.pdf p.1**Sheets:** units

Description: The symbol/abbreviation 'UA1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,062 – \$14,036**Schedule Impact:** 8 days

Recommended Action: Add 'UA1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: D477

Medium

Mechanical shows light_fixture [TAG] Civil plan shows no site coordination (7 instances: but)**Disciplines:** Mechanical ↔ Civil**Type:** Missing Coordination**Location:** 074113.16 - standing-seam metal roof panels_mech_p1**Sheets:** roof accessories, standing-seam, Thermoplastic

Description: Mechanical plans show light_fixture at 074113.16 - standing-seam metal roof panels_mech_p1, but Civil/Site plans do not show the location, utility connections, drainage implications, or access requirements for this

equipment. This could impact site grading, drainage design, and utility routing. AGGREGATED FINDING: 7 individual instances detected across sheets: 074113.16 - standing-seam metal roof panels_Mech_p1, 075423 - Thermoplastic Polyolefin (TPO) Roofing_Mech_p1, 077200 - roof accessories_p1, 077200 - roof accessories_p3, 077200 - roof accessories_p4, 077200 - roof accessories_p6. Equipment/element tags: but.

Construct.	Cost	Safety	Schedule	Downstrm.
5/10	4/10	4/10	4/10	6/10

Cost Exposure: \$5,940 – \$14,029	Schedule Impact: 7-14 days
--	-----------------------------------

Recommended Action: Coordinate with Civil to add light_fixture to site plan, including: equipment pad location, utilities (electric/water/gas) routing, drainage around equipment, maintenance access, and any tie-ins to site systems.

Medium

ID: C449

Undefined Symbol 'FR1' — Used in Architectural drawings but not defined in any legend

Disciplines:	Architectural ↔ Architectural	Type:	Missing Coordination
Location:	FR1 Framing Typical Details.pdf p.1	Sheets:	FR1

Description: The symbol/abbreviation 'FR1' appears on 8 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$5,940 – \$14,029	Schedule Impact: 7 days
--	--------------------------------

Recommended Action: Add 'FR1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C581

Medium

Undefined Symbol 'GD6' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD6' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$5,940 – \$14,029**Schedule Impact:** 7 days

Recommended Action: Add 'GD6' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C410

Medium

Undefined Symbol 'LP2' — Used in Mechanical drawings but not defined in any legend**Disciplines:** Mechanical ↔ Mechanical**Type:** Missing Coordination**Location:** 061053 - miscellaneous rough carpentry.pdf p.2**Sheets:** miscellaneous rough carpentry

Description: The symbol/abbreviation 'LP2' appears on 1 drawing page(s) in the Mechanical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,807 – \$14,019**Schedule Impact:** 11 days

Recommended Action: Add 'LP2' to the Mechanical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C454

Medium

Undefined Symbol 'IP6' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A-AB1 INTERIOR PARTITION WALL
ASSEMBLIES.pdf p.1**Sheets:** AB1

Description: The symbol/abbreviation 'IP6' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,807 – \$14,019**Schedule Impact:** 10 days

Recommended Action: Add 'IP6' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C476

Medium

Undefined Symbol 'ST1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND
PROFILES.pdf p.1**Sheets:** A5, A4, A1

Description: The symbol/abbreviation 'ST1' appears on 4 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,807 – \$14,019**Schedule Impact:** 11 days

Recommended Action: Add 'ST1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C542

Medium

Undefined Symbol 'TB1' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** 071700 - bentonite waterproofing.pdf p.2**Sheets:** bentonite waterproofing

Description: The symbol/abbreviation 'TB1' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,807 – \$14,019**Schedule Impact:** 11 days

Recommended Action: Add 'TB1' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C586

Medium

Undefined Symbol 'GE1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GE1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,807 – \$14,019**Schedule Impact:** 10 days

Recommended Action: Add 'GE1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C608

Medium

Undefined Symbol 'GFA9' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GFA9' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,807 – \$14,019**Schedule Impact:** 11 days

Recommended Action: Add 'GFA9' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C652

Medium

Undefined Symbol 'PF4' — Used in Interior Design drawings but not defined in any legend**Disciplines:** Interior Design ↔ Interior Design**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** T251

Description: The symbol/abbreviation 'PF4' appears on 1 drawing page(s) in the Interior Design set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,807 – \$14,019**Schedule Impact:** 10 days

Recommended Action: Add 'PF4' to the Interior Design legend with a one-line definition, or replace the tag with a defined symbol.

ID: C388

Medium

Florida Amendment Violation: Electrical cites NEC only, missing FBC Electrical amendments**Disciplines:** E ↔ E**Type:** Ahj Amendment**Location:** See sheets E1, 149182 - trash chute, 210000-260000_Elec**Sheets:** E1, trash chute, 210000-260000_Elec, General Com, decorative

Description: Project in FL. Plans reference 'NFPA 70' without citing Florida amendments to NEC (FBC Electrical / Ch. 27). Florida requires AFCI protection in all habitable rooms (broader than NEC base) and enhanced tamper-resistant receptacle requirements.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,807 – \$14,019**Schedule Impact:** 3

Recommended Action: Verify electrical compliance against FBC Electrical (Ch. 27) amendments to NEC. Florida extends AFCI requirements to all habitable rooms and has additional tamper-resistant receptacle requirements beyond base NEC.

ID: C403

Medium

Undefined Symbol 'HP1' — Used in Mechanical drawings but not defined in any legend**Disciplines:** Mechanical ↔ Mechanical**Type:** Missing Coordination**Location:** M6 MECHANICAL SCHEDULES.pdf p.1**Sheets:** M6, miscellaneous rough carpentry

Description: The symbol/abbreviation 'NER2' appears on 2 drawing page(s) in the Mechanical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$6,000 – \$13,965**Schedule Impact:** 8 days


Recommended Action: Add 'HP1' to the Mechanical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C469

Medium

Undefined Symbol 'PF7' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'PF7' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$6,000 – \$13,965**Schedule Impact:** 8 days


Recommended Action: Add 'PF7' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C535

Medium

Undefined Symbol 'RYC1' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'RYC1' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$6,000 – \$13,965**Schedule Impact:** 8 days


Recommended Action: Add 'RYC1' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C601

Medium

Undefined Symbol 'GFA2' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GFA2' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$6,000 – \$13,965**Schedule Impact:** 8 days


Recommended Action: Add 'GFA2' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: N472

Medium

Elevation datum mismatch: Architectural vs Interior Design**Disciplines:** Architectural ↔ Interior Design**Type:** Missing Coordination**Location:** Project-wide**Sheets:** PLANS & SECTION, T251, AD9

Description: Architectural and Interior Design appear to use different elevation datum/references. Minimum elevation difference is 6.3'. This must be reconciled.

**Cost Exposure:** \$6,000 – \$13,965**Schedule Impact:** 14-30 days

Recommended Action: Verify elevation datum is consistent across all disciplines.

ID: C001

Medium

Fire Alarm System Design Delegation Without Electrical Coordination Details**Disciplines:** Mechanical ↔ Architectural**Type:** Missing Coordination**Location:** All buildings**Sheets:** E1, M1, A1

Description: The electrical general notes on E1 state that fire alarm devices are shown 'for reference only and for coordination' and that 'the actual placement of the fire alarm devices and the procurement of the fire alarm systems SHALL BE BASED ON A PERFORMANCE SPECIFICATION, SECTION 267200.' The mechanical cover sheet M1 references commissioning requirements for mechanical and electrical systems. However, the fire alarm specification Section 267200 is listed in the MEP specification index but the actual fire alarm drawings showing device locations, wiring, and notification appliance circuits are not present in the provided document set. The architectural fire resistance

and egress plans (A1-D) show fire alarm notes requiring monitoring per IFC Section 906.1 but no coordinated fire alarm plan exists showing duct smoke detectors referenced in mechanical notes, waterflow switches for the NFPA 13R sprinkler system, or elevator recall devices. This is a partial delegation — the electrical drawings show reference locations but explicitly defer design to a fire alarm subcontractor, creating an interface gap between mechanical duct smoke detector requirements and fire alarm system design.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	8/10	5/10	7/10
Cost Exposure: \$5,880 – \$13,959		Schedule Impact: 10-14 days		

Recommended Action: 1) Confirm that fire alarm design-build scope is clearly defined in the project specifications and bid documents. 2) Require the fire alarm subcontractor to coordinate with the MEP engineer for duct smoke detector locations per mechanical notes on M1 (which reference NFPA 90A compliance). 3) Ensure waterflow switches, tamper switches, and elevator recall are included in the fire alarm scope. 4) Add a coordination note requiring the fire alarm designer to review all mechanical, plumbing, and architectural drawings for required devices before finalizing the fire alarm design.

Medium	ID: C485			
	Undefined Symbol 'ST1' — Used in Architectural drawings but not defined in any legend			
Disciplines:	Architectural ↔ Architectural		Type:	Missing Coordination
Location:	A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1		Sheets:	A1
Description: The symbol/abbreviation 'ST1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.				
Construct.	Cost	Safety	Schedule	Downstrm.
5/10	4/10	1/10	3/10	7/10
Cost Exposure: \$5,880 – \$13,959			Schedule Impact: 7 days	

Recommended Action: Add 'ST1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C551

Medium

Undefined Symbol 'WC5' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'WC5' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$5,880 – \$13,959**Schedule Impact:** 7 days

Recommended Action: Add 'WC5' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C617

Medium

Undefined Symbol 'GW5' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GW5' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$5,880 – \$13,959**Schedule Impact:** 7 days

Recommended Action: Add 'GW5' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C446

Medium

Undefined Symbol 'FC1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A5 TYPICAL WALL SECTIONS.pdf p.1**Sheets:** General Comm Requirements_Arch, A5

Description: The symbol/abbreviation 'TIA5' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,750 – \$13,950**Schedule Impact:** 11 days

Recommended Action: Add 'FC1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C490

Medium

Undefined Symbol 'STD1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1

Description: The symbol/abbreviation 'STD1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,750 – \$13,950**Schedule Impact:** 10 days

Recommended Action: Add 'STD1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C512

Medium

Undefined Symbol 'WC9' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID6 INTERIOR ELEVATIONS.pdf p.1**Sheets:** ID6

Description: The symbol/abbreviation 'WC9' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,750 – \$13,950**Schedule Impact:** 11 days

Recommended Action: Add 'WC9' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C556

Medium

Undefined Symbol 'WD1' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'WD1' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,750 – \$13,950**Schedule Impact:** 10 days

Recommended Action: Add 'WD1' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C578

Medium

Undefined Symbol 'GD3' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD3' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,750 – \$13,950**Schedule Impact:** 11 days

Recommended Action: Add 'GD3' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C622

Medium

Undefined Symbol 'HP4' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E2 CLUBHOUSE -ROOF -ELECTRICAL.pdf p.1**Sheets:** E2

Description: The symbol/abbreviation 'HP4' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,750 – \$13,950**Schedule Impact:** 10 days

Recommended Action: Add 'HP4' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C644

Medium

Undefined Symbol 'UPF8' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES - units.pdf p.1**Sheets:** units

Description: The symbol/abbreviation 'UPF8' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,750 – \$13,950**Schedule Impact:** 11 days

Recommended Action: Add 'UPF8' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C428

Medium

Undefined Symbol 'FD5' — Used in Structural drawings but not defined in any legend**Disciplines:** Structural ↔ Structural**Type:** Missing Coordination**Location:** FD5 Forming Plan Building #1.pdf p.1**Sheets:** FD5

Description: The symbol/abbreviation 'FD5' appears on 3 drawing page(s) in the Structural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	5/10	7/10	5/10	4/10

Cost Exposure: \$5,937 – \$13,893**Schedule Impact:** 11 days

Recommended Action: Add 'FD5' to the Structural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C505

Medium

Undefined Symbol 'TR6' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID6 INTERIOR ELEVATIONS.pdf p.1**Sheets:** ID6, ID7

Description: The symbol/abbreviation 'TR6' appears on 4 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$5,937 – \$13,893**Schedule Impact:** 8 days

Recommended Action: Add 'TR6' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C571

Medium

Undefined Symbol 'GD1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$5,937 – \$13,893**Schedule Impact:** 8 days

Recommended Action: Add 'GD1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C637

Medium

Undefined Symbol 'UPA6' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES - units.pdf p.1**Sheets:** units

Description: The symbol/abbreviation 'UPA6' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	7/10

Cost Exposure: \$5,937 – \$13,893**Schedule Impact:** 8 days

Recommended Action: Add 'UPA6' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C004

Medium

Geotechnical Report PVM Requirements vs Foundation Design Coordination**Disciplines:** Structural ↔ Civil**Type:** Missing Coordination**Location:** Building pads - all buildings**Sheets:** 5.3_Material_Specifications, FD1,
4.2_Foundations, C3

Description: The geotechnical report (ECS Project 63:, dated June 2, 2022) specifies that multi-family buildings and clubhouse require subgrade improvements to reduce PVM to 2.0 inches or less, with moisture conditioning extending at least 5 feet beyond building pad edges. The structural foundation notes (FD1) reference the geotechnical report and list PTI design parameters for PVR of 2 inches or less. However, the civil grading plans (C3 through C3) show finished floor elevations and pad grades but do not explicitly delineate the 5-foot subgrade improvement zone beyond building footprints. The geotechnical specification (Section 5.3.1) states that if foundation construction is not started within 60 days of pad completion, the pad must be covered with poly. This critical sequencing requirement needs to be coordinated between the civil contractor (pad preparation), structural contractor (foundation), and the general contractor's schedule. The specifications also note different PVM requirements for townhomes (4.5 inches) versus multi-family (2.0 inches), requiring different subgrade treatment depths that must be clearly delineated on civil plans.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	2/10	6/10	5/10

Cost Exposure: \$5,820 – \$13,888**Schedule Impact:** 5-10 days

Recommended Action: 1) Civil engineer should add notes on grading plans clearly delineating the 5-foot subgrade improvement zone beyond each building pad. 2) Include the 60-day poly coverage requirement as a prominent note on both civil and structural foundation plans. 3) Differentiate subgrade treatment requirements between multi-family buildings ($PVM \leq 2.0"$) and townhomes ($PVM \leq 4.5"$) on civil plans. 4) Coordinate construction sequencing to ensure foundation work begins within 60 days of pad completion or poly protection is installed.

ID: C455

Medium

Undefined Symbol 'J7' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** 321313 - concrete paving.pdf p.4**Sheets:** concrete paving

Description: The symbol/abbreviation 'J7' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$5,820 – \$13,888**Schedule Impact:** 7 days

Recommended Action: Add 'J7' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C587

Medium

Undefined Symbol 'GE1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GE1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$5,820 – \$13,888**Schedule Impact:** 7 days

Recommended Action: Add 'GE1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C653

Medium

Undefined Symbol 'PF7' — Used in Interior Design drawings but not defined in any legend**Disciplines:** Interior Design ↔ Interior Design**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** T251

Description: The symbol/abbreviation 'PF7' appears on 1 drawing page(s) in the Interior Design set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$5,820 – \$13,888**Schedule Impact:** 7 days

Recommended Action: Add 'PF7' to the Interior Design legend with a one-line definition, or replace the tag with a defined symbol.

ID: C394

Medium

Undefined Symbol 'RC2' — Used in Civil drawings but not defined in any legend**Disciplines:** Civil ↔ Civil**Type:** Missing Coordination**Location:** A-AB1 ROOF ASSEMBLIES.pdf p.1**Sheets:** AB1

Description: The symbol/abbreviation 'RC2' appears on 1 drawing page(s) in the Civil set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,692 – \$13,880**Schedule Impact:** 10 days

Recommended Action: Add 'RC2' to the Civil legend with a one-line definition, or replace the tag with a defined symbol.

ID: C460

Medium

Undefined Symbol 'PF1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'PF1' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,692 – \$13,880**Schedule Impact:** 10 days

Recommended Action: Add 'PF1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C482

Medium

Undefined Symbol 'ST1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID6 INTERIOR ELEVATIONS.pdf p.1**Sheets:** ID6, ID7

Description: The symbol/abbreviation 'ST1' appears on 3 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,692 – \$13,880**Schedule Impact:** 11 days

Recommended Action: Add 'ST1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C548

Medium

Undefined Symbol 'WC2' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1, P4

Description: The symbol/abbreviation 'WC2' appears on 2 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,692 – \$13,880**Schedule Impact:** 11 days

Recommended Action: Add 'WC2' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C592

Medium

Undefined Symbol 'GE5' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GE5' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,692 – \$13,880**Schedule Impact:** 10 days

Recommended Action: Add 'GE5' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C614

Medium

Undefined Symbol 'GW2' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GW2' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,692 – \$13,880**Schedule Impact:** 11 days

Recommended Action: Add 'GW2' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C658

Medium

Undefined Symbol 'TR5' — Used in Interior Design drawings but not defined in any legend**Disciplines:** Interior Design ↔ Interior Design**Type:** Missing Coordination**Location:** ID1 DOOR, WINDOW & TRIM SCHEDULE.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'TR5' appears on 1 drawing page(s) in the Interior Design set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,692 – \$13,880**Schedule Impact:** 10 days


Recommended Action: Add 'TR5' to the Interior Design legend with a one-line definition, or replace the tag with a defined symbol.

ID: C491

Medium

Undefined Symbol 'STD2' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1

Description: The symbol/abbreviation 'STD2' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$5,760 – \$13,818**Schedule Impact:** 7 days


Recommended Action: Add 'STD2' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C623

Medium

Undefined Symbol 'HP5' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E2 CLUBHOUSE -ROOF -ELECTRICAL.pdf p.1**Sheets:** E2

Description: The symbol/abbreviation 'HP5' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$5,760 – \$13,818**Schedule Impact:** 7 days


Recommended Action: Add 'HP5' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Medium

ID: R522

Engineer Note — To Be Coordinated: the design team**Disciplines:** Structural ↔ Architectural**Type:** Engineer Note**Location:** A3 BUILDING I - OVERALL ROOF PLAN.pdf p1**Sheets:** OVERALL ROOF PLAN.pdf p1

Description: A coordination note on sheet A3 BUILDING I - OVERALL ROOF PLAN.pdf p1 requires verification: To Be Coordinated: the design team. Confirm this item has been resolved with the responsible discipline before construction proceeds.

**Cost Exposure:** \$5,760 – \$13,818**Schedule Impact:** 7 days

Recommended Action: Verify resolution status with the responsible discipline. Issue RFI if a design decision is still pending.

Medium

ID: C452

Undefined Symbol 'IP1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A-AB1 INTERIOR PARTITION WALL ASSEMBLIES.pdf p.1**Sheets:** TRASH PLANS AND SECTIONS, AB1, A4, A5

Description: The symbol/abbreviation 'IP1' appears on 5 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$5,635 – \$13,810**Schedule Impact:** 11 days

Recommended Action: Add 'IP1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C496

Medium

Undefined Symbol 'STD1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1

Description: The symbol/abbreviation 'STD1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,635 – \$13,810**Schedule Impact:** 10 days

Recommended Action: Add 'STD1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C562

Medium

Undefined Symbol 'AX8' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** cement plastering, E2, units, 210000-260000_Elec

Description: The symbol/abbreviation 'BSR5' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,635 – \$13,810**Schedule Impact:** 10 days

Recommended Action: Add 'AX8' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C584

Medium

Undefined Symbol 'GD9' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD9' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,635 – \$13,810**Schedule Impact:** 11 days

Recommended Action: Add 'GD9' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C628

Medium

Undefined Symbol 'RG6' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'RG6' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,635 – \$13,810**Schedule Impact:** 10 days

Recommended Action: Add 'RG6' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C650

Medium

Undefined Symbol 'CO1' — Used in Interior Design drawings but not defined in any legend**Disciplines:** Interior Design ↔ Interior Design**Type:** Missing Coordination**Location:** ID2 FINISH PLAN CLUBHOUSE.pdf p.1**Sheets:** TYP CORRIDOR, T251, ID2

Description: The symbol/abbreviation 'LVT1' appears on 2 drawing page(s) in the Interior Design set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,635 – \$13,810**Schedule Impact:** 11 days

Recommended Action: Add 'CO1' to the Interior Design legend with a one-line definition, or replace the tag with a defined symbol.

ID: D486

Medium

Electrical shows transformer but Civil plan shows no site coordination**Disciplines:** Electrical ↔ Civil**Type:** Missing Coordination**Location:** e000**Sheets:** overhead coiling service doors, E1

Description: Electrical plans show light_fixture at 083300 - overhead coiling service doors_p1, but Civil/Site plans do not show the location, utility connections, drainage implications, or access requirements for this equipment. This could impact site grading, drainage design, and utility routing. AGGREGATED FINDING: 3 individual instances detected across sheets: 083300 - overhead coiling service doors_p1, 083300 - overhead coiling service doors_p3. Equipment/element tags: but.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	4/10	4/10	6/10

Cost Exposure: \$5,700 – \$13,747**Schedule Impact:** 7-14 days

Recommended Action: Coordinate with Civil to add transformer to site plan, including: equipment pad location, utilities (electric/water/gas) routing, drainage around equipment, maintenance access, and any tie-ins to site systems.

ID: C395

Medium

Undefined Symbol 'SS1' — Used in Civil drawings but not defined in any legend**Disciplines:** Civil ↔ Civil**Type:** Missing Coordination**Location:** [1] C7 SEWER PROFILES.pdf p.1**Sheets:** C7

Description: The symbol/abbreviation 'SS1' appears on 1 drawing page(s) in the Civil set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$5,700 – \$13,747**Schedule Impact:** 7 days

Recommended Action: Add 'SS1' to the Civil legend with a one-line definition, or replace the tag with a defined symbol.

ID: C461

Medium

Undefined Symbol 'PF1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'PF1' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	7/10

Cost Exposure: \$5,700 – \$13,747**Schedule Impact:** 7 days


Recommended Action: Add 'PF1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C527

Medium

Undefined Symbol 'ACS2' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** 210000-260000_Plum, 003132.01,
1671_-_Boring_logs.pdf,
1671_Regional_Geology

Description: The symbol/abbreviation 'ACS2' appears on 2 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$5,700 – \$13,747**Schedule Impact:** 7 days


Recommended Action: Add 'ACS2' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C593

Medium

Undefined Symbol 'GE6' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GE6' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$5,700 – \$13,747**Schedule Impact:** 7 days


Recommended Action: Add 'GE6' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C659

Medium

Undefined Symbol 'TR6' — Used in Interior Design drawings but not defined in any legend**Disciplines:** Interior Design ↔ Interior Design**Type:** Missing Coordination**Location:** ID1 DOOR, WINDOW & TRIM SCHEDULE.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'TR6' appears on 1 drawing page(s) in the Interior Design set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$5,700 – \$13,747**Schedule Impact:** 7 days


Recommended Action: Add 'TR6' to the Interior Design legend with a one-line definition, or replace the tag with a defined symbol.

ID: C400

Medium

Undefined Symbol 'AHU4' — Used in Mechanical drawings but not defined in any legend**Disciplines:** Mechanical ↔ Mechanical**Type:** Missing Coordination**Location:** M6 MECHANICAL SCHEDULES.pdf p.1**Sheets:** M6

Description: The symbol/abbreviation 'AHU4' appears on 2 drawing page(s) in the Mechanical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$5,577 – \$13,740**Schedule Impact:** 10 days

Recommended Action: Add 'AHU4' to the Mechanical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C466

Medium

Undefined Symbol 'PF4' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1, CO-WORK, LEASING & DOG WASH

Description: The symbol/abbreviation 'PF4' appears on 4 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,577 – \$13,740**Schedule Impact:** 10 days

Recommended Action: Add 'PF4' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C488

Medium

Undefined Symbol 'ST1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1, A4

Description: The symbol/abbreviation 'ST1' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,577 – \$13,740**Schedule Impact:** 11 days

Recommended Action: Add 'ST1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C532

Medium

Undefined Symbol 'HR2' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** standing-seam

Description: The symbol/abbreviation 'HR2' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.**


4/10




3/10



3/10



5/10



5/10

Cost Exposure: \$5,577 – \$13,740**Schedule Impact:** 10 days

Recommended Action: Add 'HR2' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C554

Medium

Undefined Symbol 'WC8' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'WC8' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.**

5/10



3/10



2/10



5/10



5/10

Cost Exposure: \$5,577 – \$13,740**Schedule Impact:** 11 days


Recommended Action: Add 'WC8' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C598

Medium

Undefined Symbol 'GFA1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GFA1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$5,577 – \$13,740**Schedule Impact:** 10 days


Recommended Action: Add 'GFA1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C620

Medium

Undefined Symbol 'GW8' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GW8' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$5,577 – \$13,740**Schedule Impact:** 11 days

Recommended Action: Add 'GW8' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C392

Medium

Undefined Symbol 'I3' — Used in Civil drawings but not defined in any legend**Disciplines:** Civil ↔ Civil**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET.pdf p.1**Sheets:** Cast-In-Place Concrete_Civi, C1

Description: The symbol/abbreviation 'RX1' appears on 1 drawing page(s) in the Civil set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,520 – \$13,671**Schedule Impact:** 11 days

Recommended Action: Add 'I3' to the Civil legend with a one-line definition, or replace the tag with a defined symbol.

ID: C458

Medium

Undefined Symbol 'PA5' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1, ID6

Description: The symbol/abbreviation 'PA5' appears on 4 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,520 – \$13,671**Schedule Impact:** 11 days

Recommended Action: Add 'PA5' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C502

Medium

Undefined Symbol 'TR2' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID6 INTERIOR ELEVATIONS.pdf p.1**Sheets:** ID6

Description: The symbol/abbreviation 'TR2' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$5,520 – \$13,671**Schedule Impact:** 10 days

Recommended Action: Add 'TR2' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C568

Medium

Undefined Symbol 'GD1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$5,520 – \$13,671**Schedule Impact:** 10 days

Recommended Action: Add 'GD1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C590

Medium

Undefined Symbol 'GE3' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GE3' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,520 – \$13,671**Schedule Impact:** 11 days

Recommended Action: Add 'GE3' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C634

Medium

Undefined Symbol 'UPA3' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES - units.pdf p.1**Sheets:** units

Description: The symbol/abbreviation 'UPA3' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,520 – \$13,671**Schedule Impact:** 10 days


Recommended Action: Add 'UPA3' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C656

Medium

Undefined Symbol 'RBF1' — Used in Interior Design drawings but not defined in any legend**Disciplines:** Interior Design ↔ Interior Design**Type:** Missing Coordination**Location:** ID2 FINISH PLAN CLUBHOUSE.pdf p.1**Sheets:** T251, ID2

Description: The symbol/abbreviation 'RBF1' appears on 2 drawing page(s) in the Interior Design set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$5,520 – \$13,671**Schedule Impact:** 11 days


Recommended Action: Add 'RBF1' to the Interior Design legend with a one-line definition, or replace the tag with a defined symbol.

ID: C406

Medium

Undefined Symbol 'HP4' — Used in Mechanical drawings but not defined in any legend**Disciplines:** Mechanical ↔ Mechanical**Type:** Missing Coordination**Location:** M6 MECHANICAL SCHEDULES.pdf p.1**Sheets:** M6

Description: The symbol/abbreviation 'HP4' appears on 1 drawing page(s) in the Mechanical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$5,462 – \$13,601**Schedule Impact:** 10 days

Recommended Action: Add 'HP4' to the Mechanical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C472

Medium

Undefined Symbol 'RC1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A7 RADON - RC1.pdf p.1**Sheets:** RC1

Description: The symbol/abbreviation 'RC1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,462 – \$13,601**Schedule Impact:** 10 days

Recommended Action: Add 'RC1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C494

Medium

Undefined Symbol 'STD9' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1

Description: The symbol/abbreviation 'STD9' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,462 – \$13,601**Schedule Impact:** 11 days

Recommended Action: Add 'STD9' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C538

Medium

Undefined Symbol 'ST2' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'ST2' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,462 – \$13,601**Schedule Impact:** 10 days

Recommended Action: Add 'ST2' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C560

Medium

Undefined Symbol 'FB1' — Used in Fire Protection drawings but not defined in any legend**Disciplines:** Fire Protection ↔ Fire Protection**Type:** Missing Coordination**Location:** A-AB1 FIRE BARRIER ASSEMBLIES.pdf p.1**Sheets:** AB1, manufactured fireplaces

Description: The symbol/abbreviation 'FF7' appears on 2 drawing page(s) in the Fire Protection set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	6/10	5/10	5/10

Cost Exposure: \$5,462 – \$13,601**Schedule Impact:** 11 days

Recommended Action: Add 'FB1' to the Fire Protection legend with a one-line definition, or replace the tag with a defined symbol.

ID: C604

Medium

Undefined Symbol 'GFA5' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GFA5' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	5/10

Cost Exposure: \$5,462 – \$13,601**Schedule Impact:** 10 days

Recommended Action: Add 'GFA5' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C626

Medium

Undefined Symbol 'I5' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** thermal insulation_Elec

Description: The symbol/abbreviation 'I5' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	3/10	2/10	5/10	5/10

Cost Exposure: \$5,462 – \$13,601**Schedule Impact:** 11 days

Recommended Action: Add 'I5' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Medium

ID: T461

Equipment spec mismatch for WIT: amperage: 17A vs 125A

Disciplines:

Architectural ↔ Electrical

Type:

Specification Mismatch

Location:

Equipment WIT

Sheets:

door hardware_Arch, L1, E1, M1, E2, 210000-260000_Arch, 210000-260000_Elec, E6, E3, units (+1 more)

Description:

Equipment 1B has conflicting specifications: horsepower: 235 HP vs 4 HP. Must be coordinated between Architectural and Electrical.

Construct.

Cost

Safety

Schedule

Downstrm.

5/10

6/10

2/10

5/10

5/10

Cost Exposure:

\$6,142 – \$13,283

Schedule Impact:

5-10 days

Recommended Action:

Verify correct specs for WIT and update documents.

Medium

ID: T459

Material mismatch at windows across 3 disciplines

Disciplines:

Architectural ↔ Electrical

Type:

Specification Mismatch

Location:

windows

Sheets:

A5, A6, AD1, glazing, A3, aluminum-framed

Description:

Multiple disciplines specify different materials for windows: Architectural (A-AD1 STOREFRONT DETAILS_p1, A-AD1 STUCCO DETAILS_p1, A3, A3, A5, A6): brick, glass, stucco, vinyl, wood; Electrical (084113 - aluminum-framed entrances and storefronts_Elec_p1): aluminum; Landscape (088000 - glazing_p1, 088000 - glazing_p4): glass. These materials must be coordinated before bidding.

Construct.

Cost

Safety

Schedule

Downstrm.

5/10

6/10

2/10

4/10

5/10

Cost Exposure:

\$5,967 – \$13,089

Schedule Impact:

7-14 days

Recommended Action:

Confirm the correct material for windows with the design team. Update all conflicting disciplines' documents to match.


Medium

ID: T457

Material mismatch at fencing across 6 disciplines

Disciplines:	Architectural ↔ Civil	Type:	Specification Mismatch
Location:	fencing	Sheets:	fluid-applied membrane air barriers, L2, 210000-260000_Mech, A1, thermal insulation_Civi, fire protection cabinets, under slab vapor barrier, TPO, manufactured fireplaces, M1 (+6 more)

Description: Multiple disciplines specify different materials for fencing: Architectural (015639 - temporary tree and plant protection_p2, 015713 - erosion and sedimentation control_Arch_p1, A-AD1 ROOF DETAILS - TPO_p1, A-AD7 FLASHING DETAILS_p1, A1, L2): insulation, shingles, steel; Civil (072100 - thermal insulation_Civi_p1, 072600 - under slab vapor barrier_p2, 072726 - fluid-applied membrane air barriers_p2, 072726 - fluid-applied membrane air barriers_p3, 072726 - fluid-applied membrane air barriers_p5, 072726 - fluid-applied membrane air barriers_p6): concrete, glass, insulation, waterproofing; Electrical (323119 - decorative metal fences and gates_Elec_p1): concrete; Fire Protection (103100 - manufactured fireplaces_p2, 104413 - fire protection cabinets_p1): glass, steel; Landscape (L1, L2, L2, L2): aluminum, vinyl; Mechanical (015000 - temporary facilities and controls_p2, 210000-260000_Mech_p32, 210000-260000_Mech_p37, M1): insulation, steel, vinyl. These materials must be coordinated before bidding.



Cost Exposure: \$5,791 – \$12,895	Schedule Impact: 7-14 days
-----------------------------------	----------------------------

Recommended Action: Confirm the correct material for fencing with the design team. Update all conflicting disciplines' documents to match.

Medium

ID: C003

Elevator Specification Requires Ambulance Stretcher Accommodation but Car Dimensions Not Verified

Disciplines:	Electrical-Lighting ↔ Architectural	Type:	Specification Mismatch
Location:	Elevator shafts - Buildings I and II	Sheets:	A1, electric traction elevators, A6

Description: The elevator specification Section 142100 (1.4.B) requires that 'The elevator car, is required to be sized and arranged to accommodate an ambulance stretcher 24 inches by 84 inches with not less than 5-inch radius corners, in the horizontal position.' The elevator is specified as a Schindler 3300 MRL with 3500 lb capacity and 3'-6" wide x 7'-0" high door opening. However, the architectural elevator plans on sheet A6 show shaft dimensions and car configurations that need to be verified against the stretcher accommodation requirement. A standard 3500 lb MRL elevator car interior is typically approximately 5'-8" wide x 4'-3" deep, which may not accommodate an 84-inch (7'-0") stretcher diagonally without specific car configuration. The specification also references ASME A1.1a-2002 Addenda and A1.1b-2003 Addenda, which are outdated — the project should reference the edition applicable to the 2021 IBC. Additionally, the structural drawings must accommodate the machine-room-less configuration with adequate overhead and pit dimensions.

Construct.	Cost	Safety	Schedule	Downstrm.
				
6/10	5/10	7/10	5/10	6/10
Cost Exposure: \$5,681 – \$12,889			Schedule Impact: 14-21 days	

Recommended Action: 1) Verify with Schindler that the specified 3300 MRL car configuration can accommodate a 24"x84" stretcher in the horizontal position per code. 2) Update the elevator specification to reference the ASME A1 edition applicable to the 2021 IBC. 3) Coordinate pit depth (shown as 5'-0" on A6) and overhead clearance with the elevator manufacturer's requirements. 4) Confirm structural adequacy of guide rail mounting for MRL configuration with structural engineer.

Medium	ID: T458			
	Material mismatch at pool area across 8 disciplines			
Disciplines:	Architectural ↔ Civil		Type:	Specification Mismatch
Location:	pool area		Sheets:	AD3, A3, AD1, A5, penetration firestopping, self-adhering sheet waterproofing, L5, L2, insulated, A6 (+11 more)

Description: Multiple disciplines specify different materials for pool area: Architectural (075423 - Thermoplastic Polyolefin (TPO) Roofing_Arch_p1, 081423 - prehung wood door and frame units_p2, A-AD1 ACOUSTIC DETAILS_p1, A-AD1 BALCONY FLASHING DETAILS_p1, A-AD1 ROOF & TRASH ROOM DETAILS_p1, A-AD1 ROOF DETAILS - TPO_p1, A-AD3 BRICK DETAILS_p1, A-AD7 FLASHING DETAILS_p1, A1, A1, A3, A3, A4, A5 ...E5): concrete, insulation, metal roof, steel, waterproofing, wood; Civil (L5): waterproofing; Electrical (072100 - thermal insulation_Elec_p2, 081425 - insulated steel door and frame units_Elec_p1, E8): concrete, insulation, pavers; Fire Protection (078413 - penetration firestopping_p6): concrete; Landscape (L2, L2, L2): aluminum, concrete, wood; Mechanical (075423 - Thermoplastic Polyolefin (TPO) Roofing_Mech_p1): insulation; Plumbing (071326 - self-adhering sheet waterproofing_p4, P6): cast iron, waterproofing; Structural (092216 - non-structural metal framing_p6): steel. These materials must be coordinated before bidding.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	6/10	2/10	4/10	5/10
Cost Exposure: \$5,557 – \$12,636			Schedule Impact: 7-14 days	

Recommended Action: Confirm the correct material for pool area with the design team. Update all conflicting disciplines' documents to match.

Low


ID: C145

Drawing Index: Sheet A4 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A4**Description:** Sheet A4 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost

5/10

Safety

1/10

Schedule

4/10


Downstrm.

4/10

Cost Exposure: \$2,033 – \$4,856**Schedule Impact:** 8 days**Recommended Action:** Add A4 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C156

Drawing Index: Sheet A6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A6**Description:** Sheet A6 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost


5/10

Safety

2/10

Schedule

4/10

Downstrm.

2/10

Cost Exposure: \$2,033 – \$4,856**Schedule Impact:** 10 days**Recommended Action:** Add A6 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C211

Drawing Index: Sheet ID7 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** ID7


Description: Sheet ID7 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.
CROSS-SHEET AGGREGATION: this issue was detected on 8 sheets (ID7, ID7). Element tag: ID7. Original finding IDs collapsed: C2, C2.

Construct.

4/10

Cost

5/10

Safety

1/10

Schedule

4/10

Downstrm.

4/10


Cost Exposure: \$2,033 – \$4,856**Schedule Impact:** 8 days**Recommended Action:** Add ID7 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C222


Drawing Index: Sheet M2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** M2**Description:** Sheet M2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.

CROSS-SHEET AGGREGATION: this issue was detected on 3 sheets (M2, M2, M2). Element tag: M2. Original finding IDs collapsed: C2, C2, C2.

**Cost Exposure:** \$2,033 – \$4,856**Schedule Impact:** 10 days**Recommended Action:** Add M2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C277


Drawing Index: Sheet T2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** T2**Description:** Sheet T2 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.**Cost Exposure:** \$2,033 – \$4,856**Schedule Impact:** 8 days**Recommended Action:** Add T2 to the drawing index or confirm whether it should be removed from the issue set.

ID: C486

Low

Undefined Symbol 'ST1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1, A4

Description: The symbol/abbreviation 'ST1' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$2,033 – \$4,856**Schedule Impact:** 10 days


Recommended Action: Add 'ST1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C552

Low

Undefined Symbol 'WC6' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'WC6' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$2,033 – \$4,856**Schedule Impact:** 10 days

Recommended Action: Add 'WC6' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C618

Undefined Symbol 'GW6' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GW6' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$2,033 – \$4,856**Schedule Impact:** 10 days

Recommended Action: Add 'GW6' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C115

Drawing Index: Sheet M3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** M3

Description: Sheet M3 ('A2') exists in the bundle but is not listed on the cover-sheet drawing index.


Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	4/10

Cost Exposure: \$2,014 – \$4,832**Schedule Impact:** 8 days

Recommended Action: Add M3 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C126

Drawing Index: Sheet A5 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A5**Description:** Sheet A5 ('A3') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost


5/10

Safety

2/10

Schedule

4/10

Downstrm.

2/10

Cost Exposure: \$2,014 – \$4,832**Schedule Impact:** 10 days**Recommended Action:** Add A5 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C181

Drawing Index: Sheet E2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** E2**Description:** Sheet E2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.


CROSS-SHEET AGGREGATION: this issue was detected on 3 sheets (E2, E2). Element tag: E2. Original finding IDs collapsed: C1, C1, C1.

Construct.

4/10

Cost

5/10

Safety

1/10

Schedule

4/10

Downstrm.

4/10

Cost Exposure: \$2,014 – \$4,832**Schedule Impact:** 8 days**Recommended Action:** Add E2 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C247

Drawing Index: Sheet P2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** P2**Description:** Sheet P2 ('BUILDING II - LEVEL 1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost

5/10

Safety

1/10

Schedule

4/10

Downstrm.

4/10


Cost Exposure: \$2,014 – \$4,832**Schedule Impact:** 8 days**Recommended Action:** Add P2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C258

Drawing Index: Sheet D2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** D2

Description: Sheet D2 ('Eastside Lofts - CASE NO. SPC2-0001') exists in the bundle but is not listed on the cover-sheet drawing index.

**Cost Exposure:** \$2,014 – \$4,832**Schedule Impact:** 10 days


Recommended Action: Add D2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C390

Undefined Symbol 'CO1' — Used in Civil drawings but not defined in any legend**Disciplines:** Civil ↔ Civil**Type:** Missing Coordination**Location:** ID2 FINISH PLAN BLDG 1 - CO-WORK.pdf p.1**Sheets:** LEASING, EXH1, AB1, C3, CO-WORK

Description: The symbol/abbreviation 'EXH1' appears on 3 drawing page(s) in the Civil set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$2,014 – \$4,832**Schedule Impact:** 10 days

Recommended Action: Add 'CO1' to the Civil legend with a one-line definition, or replace the tag with a defined symbol.

ID: C456

Low

Undefined Symbol 'LD1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** flush wood doors_Arch

Description: The symbol/abbreviation 'LD1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$2,014 – \$4,832**Schedule Impact:** 10 days

Recommended Action: Add 'LD1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C588

Low

Undefined Symbol 'GE1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GE1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$2,014 – \$4,832**Schedule Impact:** 10 days

Recommended Action: Add 'GE1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C654

Low

Undefined Symbol 'PF8' — Used in Interior Design drawings but not defined in any legend**Disciplines:** Interior Design ↔ Interior Design**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** T251

Description: The symbol/abbreviation 'PF8' appears on 1 drawing page(s) in the Interior Design set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$2,014 – \$4,832**Schedule Impact:** 10 days

Recommended Action: Add 'PF8' to the Interior Design legend with a one-line definition, or replace the tag with a defined symbol.

ID: C151

Low

Drawing Index: Sheet A5 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A5

Description: Sheet A5 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.


Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	4/10

Cost Exposure: \$1,995 – \$4,809**Schedule Impact:** 8 days

Recommended Action: Add A5 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C162


Drawing Index: Sheet A7 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A7**Description:** Sheet A7 ('RADON - R1-03') exists in the bundle but is not listed on the cover-sheet drawing index.**Cost Exposure:** \$1,995 – \$4,809**Schedule Impact:** 10 days**Recommended Action:** Add A7 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C228


Drawing Index: Sheet M2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** M2**Description:** Sheet M2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.

CROSS-SHEET AGGREGATION: this issue was detected on 3 sheets (M2, M2, M2). Element tag: M2. Original finding IDs collapsed: C2, C2, C2.

**Cost Exposure:** \$1,995 – \$4,809**Schedule Impact:** 10 days**Recommended Action:** Add M2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C283


Drawing Index: Sheet P3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** E3, P3**Description:** Sheet P3 ('PLUMBING ENLARGED') exists in the bundle but is not listed on the cover-sheet drawing index.**Cost Exposure:** \$1,995 – \$4,809**Schedule Impact:** 8 days**Recommended Action:** Add P3 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C294

Drawing Index: Sheet ID3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** ID3

Description: Sheet ID3 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.
 CROSS-SHEET AGGREGATION: this issue was detected on 2 sheets (ID3, ID3). Element tag: ID3. Original finding IDs collapsed: C2, C2.

**Cost Exposure:** \$1,995 – \$4,809**Schedule Impact:** 10 days


Recommended Action: Add ID3 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C492

Undefined Symbol 'STD3' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1

Description: The symbol/abbreviation 'STD3' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$1,995 – \$4,809**Schedule Impact:** 10 days

Recommended Action: Add 'STD3' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C624

Undefined Symbol 'HP6' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E2 CLUBHOUSE -ROOF -ELECTRICAL.pdf p.1**Sheets:** E2

Description: The symbol/abbreviation 'HP6' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,995 – \$4,809**Schedule Impact:** 10 days

Recommended Action: Add 'HP6' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: R523

Engineer Note — Coordinate with: paint manufacturer**Disciplines:** Architectural ↔ Architectural**Type:** Engineer Note**Location:** 099100 - painting.pdf p3**Sheets:** painting.pdf p3

Description: A coordination note on sheet 099100 - painting.pdf p3 requires verification: Coordinate with: paint manufacturer. Confirm this item has been resolved with the responsible discipline before construction proceeds.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	2/10

Cost Exposure: \$1,995 – \$4,809**Schedule Impact:** 10 days

Recommended Action: Verify resolution status with the responsible discipline. Issue RFI if a design decision is still pending.

Low

ID: C123

Drawing Index: Sheet A3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A3**Description:** Sheet A3 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost

4/10

Safety

5/10

Schedule

3/10

Downstrm.

2/10

Cost Exposure: \$1,942 – \$4,802**Schedule Impact:** 8 days**Recommended Action:** Add A3 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C167

Drawing Index: Sheet A7 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A7**Description:** Sheet A7 ('RADON - R2-03') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**


5/10

Cost

4/10

Safety

1/10

Schedule

3/10


Downstrm.

4/10

Cost Exposure: \$1,942 – \$4,802**Schedule Impact:** 7 days**Recommended Action:** Add A7 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C189

Drawing Index: Sheet E2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** E2, M2**Description:** Sheet E2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**


3/10

Cost


4/10

Safety

5/10

Schedule

3/10

Downstrm.

2/10


Cost Exposure: \$1,942 – \$4,802**Schedule Impact:** 8 days**Recommended Action:** Add E2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C233


Drawing Index: Sheet M2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** M2**Description:** Sheet M2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.

CROSS-SHEET AGGREGATION: this issue was detected on 2 sheets (M2, M2). Element tag: M2. Original finding IDs collapsed: C2, C2.

**Cost Exposure:** \$1,942 – \$4,802**Schedule Impact:** 7 days**Recommended Action:** Add M2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C255


Drawing Index: Sheet T6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** T6**Description:** Sheet T6 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.**Cost Exposure:** \$1,942 – \$4,802**Schedule Impact:** 8 days**Recommended Action:** Add T6 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C453

Undefined Symbol 'IP5' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A-AB1 INTERIOR PARTITION WALL ASSEMBLIES.pdf p.1**Sheets:** AB1, A4

Description: The symbol/abbreviation 'IP5' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$1,942 – \$4,802**Schedule Impact:** 8 days


Recommended Action: Add 'IP5' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C585

Undefined Symbol 'GE1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GE1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$1,942 – \$4,802**Schedule Impact:** 8 days

Recommended Action: Add 'GE1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C651

Low

Undefined Symbol 'PF1' — Used in Interior Design drawings but not defined in any legend**Disciplines:** Interior Design ↔ Interior Design**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** T251

Description: The symbol/abbreviation 'PF1' appears on 1 drawing page(s) in the Interior Design set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,942 – \$4,802**Schedule Impact:** 8 days

Recommended Action: Add 'PF1' to the Interior Design legend with a one-line definition, or replace the tag with a defined symbol.

ID: GEO529

Low

Detention Geotextile Specification Not Found**Disciplines:** Civil ↔ General**Type:** Detention Geotextile Missing**Location:** Detention Facility**Sheets:** EXH1, C3

Description: Geotech report requires AASHTO M2 Class 2 for detention facilities. No geotextile specification found on civil sheets.


Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	4/10

Cost Exposure: \$1,942 – \$4,802**Schedule Impact:** Low

Recommended Action: Add geotextile specification to detention design per geotech Section 4.7.


Low

ID: C121

Drawing Index: Sheet A3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A3**Description:** Sheet A3 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Cost Exposure:** \$1,975 – \$4,785**Schedule Impact:** 8 days**Recommended Action:** Add A3 to the drawing index or confirm whether it should be removed from the issue set.


Low

ID: C132

Drawing Index: Sheet A6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A6**Description:** Sheet A6 ('A3') exists in the bundle but is not listed on the cover-sheet drawing index.**Cost Exposure:** \$1,975 – \$4,785**Schedule Impact:** 10 days**Recommended Action:** Add A6 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C187

Drawing Index: Sheet E2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** E2**Description:** Sheet E2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.**Cost Exposure:** \$1,975 – \$4,785**Schedule Impact:** 8 days**Recommended Action:** Add E2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C253

Drawing Index: Sheet T6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** T6**Description:** Sheet T6 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost

5/10

Safety

1/10

Schedule

4/10


Downstrm.

4/10

Cost Exposure: \$1,975 – \$4,785**Schedule Impact:** 8 days**Recommended Action:** Add T6 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C396

Undefined Symbol 'SS3' — Used in Civil drawings but not defined in any legend**Disciplines:** Civil ↔ Civil**Type:** Missing Coordination**Location:** [1] C7 SEWER PROFILES.pdf p.1**Sheets:** C7**Description:** The symbol/abbreviation 'SS3' appears on 1 drawing page(s) in the Civil set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.**Construct.**

3/10

Cost

5/10

Safety

2/10

Schedule

4/10

Downstrm.

5/10

Cost Exposure: \$1,975 – \$4,785**Schedule Impact:** 10 days**Recommended Action:** Add 'SS3' to the Civil legend with a one-line definition, or replace the tag with a defined symbol.

ID: C462

Low

Undefined Symbol 'PF1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'PF1' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,975 – \$4,785**Schedule Impact:** 10 days

Recommended Action: Add 'PF1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C528

Low

Undefined Symbol 'BT1' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** P4 PLUMBING RISERS.pdf p.1**Sheets:** P4, ID1

Description: The symbol/abbreviation 'CAB1' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,975 – \$4,785**Schedule Impact:** 10 days

Recommended Action: Add 'BT1' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C594

Low

Undefined Symbol 'GE7' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GE7' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.**

3/10



5/10



2/10



4/10



5/10

Cost Exposure: \$1,975 – \$4,785**Schedule Impact:** 10 days

Recommended Action: Add 'GE7' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C660

Low

Undefined Symbol 'TV5' — Used in Interior Design drawings but not defined in any legend**Disciplines:** Interior Design ↔ Interior Design**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** T251

Description: The symbol/abbreviation 'TV5' appears on 1 drawing page(s) in the Interior Design set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.**

3/10



5/10



2/10



4/10




5/10

Cost Exposure: \$1,975 – \$4,785**Schedule Impact:** 10 days

Recommended Action: Add 'TV5' to the Interior Design legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C137

Drawing Index: Sheet A3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A3**Description:** Sheet A3 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.****Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$1,924 – \$4,778**Schedule Impact:** 7 days**Recommended Action:** Add A3 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C159

Drawing Index: Sheet A6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A6**Description:** Sheet A6 ('4') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.****Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$1,924 – \$4,778**Schedule Impact:** 8 days**Recommended Action:** Add A6 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C225

Drawing Index: Sheet M2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** M2**Description:** Sheet M2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.

CROSS-SHEET AGGREGATION: this issue was detected on 3 sheets (M2, M2, M2). Element tag: M2. Original finding IDs collapsed: C2, C2, C2.

Construct.**Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$1,924 – \$4,778**Schedule Impact:** 8 days**Recommended Action:** Add M2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C269

Drawing Index: Sheet L3 present in bundle but missing from index

Disciplines:	General ↔ General	Type:	Missing Coordination
Location:	[1] C1 COVER SHEET (cover, p.1)	Sheets:	L3

Description: Sheet L3 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.
CROSS-SHEET AGGREGATION: this issue was detected on 4 sheets (L3, L3, L3, L3). Element tag: L3. Original finding IDs collapsed: C2, C3, C3, C3.

Construct.	Cost	Safety	Schedule	Downstrm.
5/10	4/10	1/10	3/10	4/10

Cost Exposure: \$1,924 – \$4,778	Schedule Impact: 7 days
----------------------------------	-------------------------

Recommended Action: Add L3 to the drawing index or confirm whether it should be removed from the issue set.

ID: C489

Low

Undefined Symbol 'ST5' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID6 INTERIOR ELEVATIONS.pdf p.1**Sheets:** ID6, P5

Description: The symbol/abbreviation 'ST5' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$1,924 – \$4,778**Schedule Impact:** 8 days

Recommended Action: Add 'ST5' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C555

Low

Undefined Symbol 'WC9' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'WC9' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$1,924 – \$4,778**Schedule Impact:** 8 days

Recommended Action: Add 'WC9' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C621

Low

Undefined Symbol 'GW9' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GW9' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,924 – \$4,778**Schedule Impact:** 8 days

Recommended Action: Add 'GW9' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: R519

Low

Engineer Note — to be determined: according to wind/storm for building location**Disciplines:** Civil ↔ Mechanical**Type:** Engineer Note**Location:** (See plan set for details)**Sheets:** ventilated

Description: A coordination note on sheet 076220 - ventilated rainscreen drainage mat_Mech.pdf p1 requires verification: to be determined: according to wind/storm for building location. Confirm this item has been resolved with the responsible discipline before construction proceeds.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	5/10	3/10	2/10

Cost Exposure: \$1,924 – \$4,778**Schedule Impact:** 8 days

Recommended Action: Verify resolution status with the responsible discipline. Issue RFI if a design decision is still pending.

Low

ID: C372

Missing panel [TAG] for 921 (5 instances)**Disciplines:** Civil ↔ General**Type:** Missing Coordination**Location:** Electrical Room**Sheets:** M1, 210000-260000_Civi, fluid-applied membrane air barriers, earthwork_Civi, T6, L5, P5

Description: Equipment of (light_fixture) shown on Civil sheet 072726 - fluid-applied membrane air barriers_p1 has no matching circuit on any panel schedule. Verify electrical service is provided. AGGREGATED FINDING: 4 individual instances detected across sheets: 072726 - fluid-applied membrane air barriers_p1, 210000-260000_Civi_p1, 210000-260000_Civi_p2, 312000 - earthwork_Civi_p1. Equipment/element tags: .

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	6/10	5/10	3/10	2/10

Cost Exposure: \$2,004 – \$4,766**Schedule Impact:** Medium

Recommended Action: Add circuit for 921 on appropriate panel. Verify voltage, phase, and amperage requirements.

Low

ID: C157

Drawing Index: Sheet A6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A6

Description: Sheet A6 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	4/10

Cost Exposure: \$1,956 – \$4,761**Schedule Impact:** 8 days

Recommended Action: Add A6 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C168

Drawing Index: Sheet A7 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A7**Description:** Sheet A7 ('RADON - R2-04') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost

5/10

Safety

2/10

Schedule

4/10

Downstrm.

2/10

Cost Exposure: \$1,956 – \$4,761**Schedule Impact:** 10 days**Recommended Action:** Add A7 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C498

Undefined Symbol 'SW1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A6 BUILDING I - STAIR 1 - PLANS & SECTION.pdf p.1**Sheets:** PLANS & SECTION, STAIR 1 -PLANS & SECTION**Description:** The symbol/abbreviation 'SW1' appears on 7 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.**Construct.**

3/10

Cost

5/10

Safety

2/10

Schedule

4/10

Downstrm.

5/10


Cost Exposure: \$1,956 – \$4,761**Schedule Impact:** 10 days**Recommended Action:** Add 'SW1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C564

Undefined Symbol 'CH5' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E2 CLUBHOUSE -ROOF -ELECTRICAL.pdf
p.1**Sheets:** E2

Description: The symbol/abbreviation 'CH5' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$1,956 – \$4,761**Schedule Impact:** 10 days


Recommended Action: Add 'CH5' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C630

Undefined Symbol 'RK5' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** 210000-260000_Elec


Description: The symbol/abbreviation 'RK5' appears on 2 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$1,956 – \$4,761**Schedule Impact:** 10 days

Recommended Action: Add 'RK5' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C107

Drawing Index: Sheet A1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** P1, A1, E1**Description:** Sheet E1 ('NOT IN SCOPE') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.****Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$1,905 – \$4,755**Schedule Impact:** 7 days**Recommended Action:** Add A1 to the drawing index or confirm whether it should be removed from the issue set.


Low

ID: C129

Drawing Index: Sheet A5 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A5**Description:** Sheet A5 ('A3') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.****Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$1,905 – \$4,755**Schedule Impact:** 8 days**Recommended Action:** Add A5 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C239


Drawing Index: Sheet M2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** M2**Description:** Sheet M2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.**CROSS-SHEET AGGREGATION:** this issue was detected on 2 sheets (M2, M2). Element tag: M2. Original finding IDs collapsed: C2, C2.**Construct.****Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$1,905 – \$4,755**Schedule Impact:** 7 days**Recommended Action:** Add M2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C261


Drawing Index: Sheet L1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** L1, L2, L7**Description:** Sheet L1 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.

CROSS-SHEET AGGREGATION: this issue was detected on 3 sheets (L1, L2, L7). Element tag: L1. Original finding IDs collapsed: C2, C2, C3.

**Cost Exposure:** \$1,905 – \$4,755**Schedule Impact:** 8 days**Recommended Action:** Add L1 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C305

Drawing Index: Sheet ISO3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** ISO3**Description:** Sheet ISO3 ('072100 - 6') exists in the bundle but is not listed on the cover-sheet drawing index.**Cost Exposure:** \$1,905 – \$4,755**Schedule Impact:** 7 days**Recommended Action:** Add ISO3 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C393

Undefined Symbol 'LVT1' — Used in Civil drawings but not defined in any legend**Disciplines:** Civil ↔ Civil**Type:** Missing Coordination**Location:** ID2 FINISH PLAN BLDG 1 - CO-WORK.pdf p.1**Sheets:** CO-WORK, LEASING

Description: The symbol/abbreviation 'LVT1' appears on 2 drawing page(s) in the Civil set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,905 – \$4,755**Schedule Impact:** 8 days

Recommended Action: Add 'LVT1' to the Civil legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C459

Undefined Symbol 'PF1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1, CO-WORK, LEASING & DOG WASH

Description: The symbol/abbreviation 'PF1' appears on 4 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,905 – \$4,755**Schedule Impact:** 8 days

Recommended Action: Add 'PF1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C591

Undefined Symbol 'GE4' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GE4' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,905 – \$4,755**Schedule Impact:** 8 days

Recommended Action: Add 'GE4' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C657

Undefined Symbol 'TR1' — Used in Interior Design drawings but not defined in any legend**Disciplines:** Interior Design ↔ Interior Design**Type:** Missing Coordination**Location:** ID1 DOOR, WINDOW & TRIM SCHEDULE.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'TR1' appears on 1 drawing page(s) in the Interior Design set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,905 – \$4,755**Schedule Impact:** 8 days


Recommended Action: Add 'TR1' to the Interior Design legend with a one-line definition, or replace the tag with a defined symbol.

Low


ID: C112

Drawing Index: Sheet LS1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** LS1**Description:** Sheet LS1 ('A1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost


3/10

Safety

3/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,850 – \$4,748**Schedule Impact:** 10 days**Recommended Action:** Add LS1 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C134

Drawing Index: Sheet A3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A3**Description:** Sheet A3 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost


3/10

Safety

2/10

Schedule

5/10

Downstrm.

2/10

Cost Exposure: \$1,850 – \$4,748**Schedule Impact:** 11 days**Recommended Action:** Add A3 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C178

Drawing Index: Sheet E2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** E2**Description:** Sheet E2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.


CROSS-SHEET AGGREGATION: this issue was detected on 3 sheets (E2, E2). Element tag: E2. Original finding IDs collapsed: C1, C1, C1.

Construct.

4/10

Cost


3/10

Safety

3/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,850 – \$4,748**Schedule Impact:** 10 days**Recommended Action:** Add E2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C200


Drawing Index: Sheet ID1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** ID1**Description:** Sheet ID1 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.

CROSS-SHEET AGGREGATION: this issue was detected on 5 sheets (ID1, ID1). Element tag: ID1. Original finding IDs collapsed: C2, C3.

**Cost Exposure:** \$1,850 – \$4,748**Schedule Impact:** 11 days**Recommended Action:** Add ID1 to the drawing index or confirm whether it should be removed from the issue set.


Low

ID: C244

Drawing Index: Sheet P2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** P2**Description:** Sheet P2 ('BUILDING I - LEVEL 3') exists in the bundle but is not listed on the cover-sheet drawing index.**Cost Exposure:** \$1,850 – \$4,748**Schedule Impact:** 10 days**Recommended Action:** Add P2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C310

Drawing Index: Sheet L1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** L1**Description:** Sheet L1 ('Eastside Lofts - CASE NO. SPC2-0001 - NOT FOR CONSTRUCTION') exists in the bundle but is not listed on the cover-sheet drawing index.**Cost Exposure:** \$1,850 – \$4,748**Schedule Impact:** 10 days**Recommended Action:** Add L1 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C127

Drawing Index: Sheet L9 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** L9**Description:** Sheet L9 ('A3') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost

5/10

Safety

1/10

Schedule

4/10


Downstrm.

4/10

Cost Exposure: \$1,937 – \$4,738**Schedule Impact:** 8 days**Recommended Action:** Add L9 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C138

Drawing Index: Sheet A6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A6**Description:** Sheet A6 ('A3') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost


5/10

Safety

2/10

Schedule

4/10

Downstrm.

2/10


Cost Exposure: \$1,937 – \$4,738**Schedule Impact:** 10 days**Recommended Action:** Add A6 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C270

Drawing Index: Sheet L4 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** L4


Description: Sheet L4 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.
CROSS-SHEET AGGREGATION: this issue was detected on 3 sheets (L4, L4, L4). Element tag: L4. Original finding IDs collapsed: C2, C3, C3.

Construct.

3/10

Cost


5/10

Safety

2/10

Schedule

4/10

Downstrm.

2/10

Cost Exposure: \$1,937 – \$4,738**Schedule Impact:** 10 days**Recommended Action:** Add L4 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C336

Drawing Index: Sheet ID8 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** ID8**Description:** Sheet ID8 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost

5/10

Safety

2/10

Schedule

4/10


Downstrm.

2/10

Cost Exposure: \$1,937 – \$4,738**Schedule Impact:** 10 days**Recommended Action:** Add ID8 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C402

Undefined Symbol 'ESD6' — Used in Mechanical drawings but not defined in any legend**Disciplines:** Mechanical ↔ Mechanical**Type:** Missing Coordination**Location:** M6 MECHANICAL SCHEDULES.pdf p.1**Sheets:** M6**Description:** The symbol/abbreviation 'ESD6' appears on 1 drawing page(s) in the Mechanical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.**Construct.**

3/10

Cost

5/10

Safety

2/10

Schedule

4/10

Downstrm.

5/10

Cost Exposure: \$1,937 – \$4,738**Schedule Impact:** 10 days**Recommended Action:** Add 'ESD6' to the Mechanical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C468

Low

Undefined Symbol 'PF6' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1, LEASING & DOG WASH

Description: The symbol/abbreviation 'PF6' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,937 – \$4,738**Schedule Impact:** 10 days

Recommended Action: Add 'PF6' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C534

Low

Undefined Symbol 'RBF2' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'RBF2' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,937 – \$4,738**Schedule Impact:** 10 days

Recommended Action: Add 'RBF2' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C600

Undefined Symbol 'GFA1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GFA1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,937 – \$4,738**Schedule Impact:** 10 days

Recommended Action: Add 'GFA1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C143

Drawing Index: Sheet A4 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A4

Description: Sheet A4 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	4/10

Cost Exposure: \$1,887 – \$4,731**Schedule Impact:** 7 days

Recommended Action: Add A4 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C165

Drawing Index: Sheet A7 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A7**Description:** Sheet A7 ('RADON - R2-01') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost

4/10

Safety

5/10

Schedule

3/10

Downstrm.

2/10

Cost Exposure: \$1,887 – \$4,731**Schedule Impact:** 8 days**Recommended Action:** Add A7 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C231

Drawing Index: Sheet M2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** M2**Description:** Sheet M2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.

CROSS-SHEET AGGREGATION: this issue was detected on 2 sheets (M2, M2). Element tag: M2. Original finding IDs collapsed: C2, C2.

Construct.

3/10

Cost

4/10

Safety

5/10

Schedule

3/10

Downstrm.

2/10

Cost Exposure: \$1,887 – \$4,731**Schedule Impact:** 8 days**Recommended Action:** Add M2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C275

Drawing Index: Sheet T2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** T2**Description:** Sheet T2 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost

4/10

Safety

1/10

Schedule

3/10

Downstrm.

4/10


Cost Exposure: \$1,887 – \$4,731**Schedule Impact:** 7 days**Recommended Action:** Add T2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C297


Drawing Index: Sheet E6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** E6**Description:** Sheet E6 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.

CROSS-SHEET AGGREGATION: this issue was detected on 5 sheets (E6, E6). Element tag: E6. Original finding IDs collapsed: C2, C2, C2, C3, C3.

**Cost Exposure:** \$1,887 – \$4,731**Schedule Impact:** 8 days**Recommended Action:** Add E6 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C374


Missing panel circuit for 23**Disciplines:** Civil ↔ General**Type:** Missing Coordination**Location:** Electrical Room**Sheets:** 210000-260000_Civi, Cast-In-Place Concrete_Civi, thermal insulation_Civi, C1**Description:** Equipment sha (light_fixture) shown on Civil sheet 033000 - Cast-In-Place Concrete_Civi_p1 has no matching circuit on any panel schedule. Verify electrical service is provided.**Cost Exposure:** \$1,887 – \$4,731**Schedule Impact:** Medium**Recommended Action:** Add circuit for 23 on appropriate panel. Verify voltage, phase, and amperage requirements.

Low

ID: C495

Undefined Symbol 'STD1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1

Description: The symbol/abbreviation 'STD1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$1,887 – \$4,731**Schedule Impact:** 8 days


Recommended Action: Add 'STD1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C627

Undefined Symbol 'NER2' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** 061600 - sheathing.pdf p.3**Sheets:** sheathing

Description: The symbol/abbreviation 'NER2' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$1,887 – \$4,731**Schedule Impact:** 8 days


Recommended Action: Add 'NER2' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C038

Drawing Index: Sheet ID2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** ID2, T3, T4, T5

Description: Sheet ID2 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.
CROSS-SHEET AGGREGATION: this issue was detected on 5 sheets (ID2, T3, T4, T5). Element tag: ID2. Original finding IDs collapsed: C3, C3.


**Cost Exposure:** \$1,832 – \$4,725**Schedule Impact:** 11 days**Recommended Action:** Add ID2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C148

Drawing Index: Sheet A4 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A4

Description: Sheet A4 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.


**Cost Exposure:** \$1,832 – \$4,725**Schedule Impact:** 10 days**Recommended Action:** Add A4 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C170

Drawing Index: Sheet A7 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A7

Description: Sheet A7 ('RADON - RC1') exists in the bundle but is not listed on the cover-sheet drawing index.

**Cost Exposure:** \$1,832 – \$4,725**Schedule Impact:** 11 days**Recommended Action:** Add A7 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C280

Drawing Index: Sheet T2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** T2**Description:** Sheet T2 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost

3/10

Safety

3/10

Schedule

5/10

Downstrm.

2/10

Cost Exposure: \$1,832 – \$4,725**Schedule Impact:** 10 days**Recommended Action:** Add T2 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C302

Drawing Index: Sheet ID5 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** ID5


Description: Sheet ID5 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index. CROSS-SHEET AGGREGATION: this issue was detected on 3 sheets (ID5, ID5, ID5). Element tag: ID5. Original finding IDs collapsed: C3, C3, C3.

Construct.

5/10

Cost


3/10

Safety

2/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,832 – \$4,725**Schedule Impact:** 11 days**Recommended Action:** Add ID5 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C378

Missing panel circuit for WIT**Disciplines:** Civil ↔ General**Type:** Missing Coordination**Location:** Electrical Room**Sheets:** M1

Description: Equipment WIT (light_fixture) shown on Mechanical sheet M1 has no matching circuit on any panel schedule. Verify electrical service is provided.

Construct.


3/10

Cost


6/10

Safety

5/10

Schedule

3/10

Downstrm.

2/10

Cost Exposure: \$1,964 – \$4,718**Schedule Impact:** Medium**Recommended Action:** Add circuit for WIT on appropriate panel. Verify voltage, phase, and amperage requirements.

Low

ID: C108

Drawing Index: Sheet G2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** G2**Description:** Sheet G2 ('A1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost

5/10

Safety

2/10

Schedule

4/10

Downstrm.

2/10

Cost Exposure: \$1,917 – \$4,714**Schedule Impact:** 10 days**Recommended Action:** Add G2 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C163

Drawing Index: Sheet A7 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A7**Description:** Sheet A7 ('RADON - R1-04') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost

5/10

Safety

1/10

Schedule

4/10


Downstrm.

4/10

Cost Exposure: \$1,917 – \$4,714**Schedule Impact:** 8 days**Recommended Action:** Add A7 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C306

Drawing Index: Sheet OF9 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** OF9**Description:** Sheet OF9 ('accordance with UL Standard 1569. The insulated conductors shall have a minimum operating temperature') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost

5/10

Safety

2/10

Schedule

4/10

Downstrm.

5/10

Cost Exposure: \$1,917 – \$4,714**Schedule Impact:** 10 days**Recommended Action:** Add OF9 to the drawing index or confirm whether it should be removed from the issue set.

ID: C504

Low

Undefined Symbol 'TR5' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID6 INTERIOR ELEVATIONS.pdf p.1**Sheets:** ID6, ID7

Description: The symbol/abbreviation 'TR5' appears on 4 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,917 – \$4,714**Schedule Impact:** 10 days

Recommended Action: Add 'TR5' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C570

Low

Undefined Symbol 'GD1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,917 – \$4,714**Schedule Impact:** 10 days

Recommended Action: Add 'GD1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C636

Undefined Symbol 'UPA5' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES - units.pdf p.1**Sheets:** units

Description: The symbol/abbreviation 'UPA5' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,917 – \$4,714**Schedule Impact:** 10 days

Recommended Action: Add 'UPA5' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C113

Drawing Index: Sheet A1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A1

Description: Sheet A1 ('10') exists in the bundle but is not listed on the cover-sheet drawing index.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	4/10

Cost Exposure: \$1,868 – \$4,708**Schedule Impact:** 7 days

Recommended Action: Add A1 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C135

Drawing Index: Sheet A3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A3**Description:** Sheet A3 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost

4/10

Safety

5/10

Schedule

3/10

Downstrm.

2/10


Cost Exposure: \$1,868 – \$4,708**Schedule Impact:** 8 days**Recommended Action:** Add A3 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C201

Drawing Index: Sheet ID1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** ID1

Description: Sheet ID1 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.
 CROSS-SHEET AGGREGATION: this issue was detected on 10 sheets (ID1, ID1, ...+2 more). Element tag: ID1.
 Original finding IDs collapsed: C2, C3, C3.

Construct.


3/10

Cost


4/10

Safety

5/10

Schedule

3/10

Downstrm.

2/10

Cost Exposure: \$1,868 – \$4,708**Schedule Impact:** 8 days**Recommended Action:** Add ID1 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C245

Drawing Index: Sheet P2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** P2**Description:** Sheet P2 ('BUILDING I - LEVEL 4') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**


5/10

Cost

4/10

Safety

1/10

Schedule

3/10

Downstrm.

4/10


Cost Exposure: \$1,868 – \$4,708**Schedule Impact:** 7 days**Recommended Action:** Add P2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C333

Drawing Index: Sheet ID4 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** ID4

Description: Sheet ID4 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index. CROSS-SHEET AGGREGATION: this issue was detected on 3 sheets (ID4, ID4, ID4). Element tag: ID4. Original finding IDs collapsed: C3, C3, C3.

**Cost Exposure:** \$1,868 – \$4,708**Schedule Impact:** 8 days


Recommended Action: Add ID4 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C399

Undefined Symbol 'AHC1' — Used in Mechanical drawings but not defined in any legend**Disciplines:** Mechanical ↔ Mechanical**Type:** Missing Coordination**Location:** M1 MECHANICAL SPECIFICATIONS.pdf p.1**Sheets:** M1, M6

Description: The symbol/abbreviation 'AHC1' appears on 1 drawing page(s) in the Mechanical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$1,868 – \$4,708**Schedule Impact:** 8 days

Recommended Action: Add 'AHC1' to the Mechanical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C465

Low

Undefined Symbol 'PF3' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1, CO-WORK, LEASING & DOG WASH

Description: The symbol/abbreviation 'PF3' appears on 4 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,868 – \$4,708**Schedule Impact:** 8 days

Recommended Action: Add 'PF3' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C531

Low

Undefined Symbol 'GS3' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** closeout procedures_Plum

Description: The symbol/abbreviation 'GS3' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,868 – \$4,708**Schedule Impact:** 8 days

Recommended Action: Add 'GS3' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C597

Low

Undefined Symbol 'GFA1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GFA1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,868 – \$4,708**Schedule Impact:** 8 days

Recommended Action: Add 'GFA1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C663

Low

Undefined Symbol 'WDF1' — Used in Interior Design drawings but not defined in any legend**Disciplines:** Interior Design ↔ Interior Design**Type:** Missing Coordination**Location:** ID2 FINISH PLAN CLUBHOUSE.pdf p.1**Sheets:** ID2, T251

Description: The symbol/abbreviation 'WDF1' appears on 2 drawing page(s) in the Interior Design set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,868 – \$4,708**Schedule Impact:** 8 days

Recommended Action: Add 'WDF1' to the Interior Design legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C118

Drawing Index: Sheet A3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A3**Description:** Sheet A3 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost

3/10

Safety

3/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,814 – \$4,702**Schedule Impact:** 10 days**Recommended Action:** Add A3 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C140

Drawing Index: Sheet P1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** P1**Description:** Sheet P1 ('A3') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost


3/10

Safety

2/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,814 – \$4,702**Schedule Impact:** 11 days**Recommended Action:** Add P1 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C184

Drawing Index: Sheet E2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** E2, M2**Description:** Sheet E2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost


3/10

Safety

3/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,814 – \$4,702**Schedule Impact:** 10 days**Recommended Action:** Add E2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C206

Drawing Index: Sheet ID6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** ID6

Description: Sheet ID6 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index. CROSS-SHEET AGGREGATION: this issue was detected on 5 sheets (ID6, ID6). Element tag: ID6. Original finding IDs collapsed: C2, C2.


**Cost Exposure:** \$1,814 – \$4,702**Schedule Impact:** 11 days**Recommended Action:** Add ID6 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C250

Drawing Index: Sheet P2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** P2

Description: Sheet P2 ('BUILDING II - LEVEL 4') exists in the bundle but is not listed on the cover-sheet drawing index.

**Cost Exposure:** \$1,814 – \$4,702**Schedule Impact:** 10 days**Recommended Action:** Add P2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C002

Landscape Irrigation Controller Missing Electrical Power Circuit**Disciplines:** Landscape ↔ Architectural**Type:** Missing Coordination**Location:** Site - irrigation controller location**Sheets:** L4, E1, E6

Description: The landscape irrigation plan (L4) specifies a Hunter A2-75D-M irrigation controller requiring 24 VAC power and shows an irrigation meter connection. The irrigation schedule notes the system requires a 'DYNAMIC WATER PRESSURE OF 53 PSI AT A MINIMUM RATE OF 40 GPM.' However, reviewing the electrical site plan (E1) and panel schedules (E6, E6), there is no clearly identified dedicated circuit for the irrigation controller. The landscape specifications on L1 reference 'AUTOMATIC CONTROL SYSTEM' with electrical components but the electrical drawings do not show a corresponding power feed to the irrigation controller location. The irrigation controller requires a reliable power source for automated scheduling and the landscape plan notes reference 'REFER TO ELECTRICAL PLANS FOR SITE ELECTRICAL' but the electrical site plan does not clearly identify this connection.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	2/10	1/10	3/10	5/10

Cost Exposure: \$1,758 – \$4,694

Schedule Impact: 2-3 days

Recommended Action: 1) Add a dedicated 120V circuit on the appropriate house panel (HP2 or HP2 based on proximity) for the irrigation controller. 2) Show conduit routing from the nearest electrical panel to the irrigation controller location on the electrical site plan. 3) Coordinate the exact controller mounting location between landscape and electrical contractors. 4) Verify that the irrigation controller transformer (if separate) is included in the electrical scope.

Low

ID: C133

Drawing Index: Sheet A6 present in bundle but missing from index

Disciplines: General ↔ General

Type: Missing Coordination

Location: [1] C1 COVER SHEET (cover, p.1)

Sheets: A6

Description: Sheet A6 ('A3') exists in the bundle but is not listed on the cover-sheet drawing index.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	5/10	1/10	4/10	4/10

Cost Exposure: \$1,898 – \$4,690

Schedule Impact: 8 days

Recommended Action: Add A6 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C144

Drawing Index: Sheet A4 present in bundle but missing from index

Disciplines: General ↔ General

Type: Missing Coordination

Location: [1] C1 COVER SHEET (cover, p.1)

Sheets: A4

Description: Sheet A4 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	2/10

Cost Exposure: \$1,898 – \$4,690

Schedule Impact: 10 days

Recommended Action: Add A4 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C276

Drawing Index: Sheet T2 present in bundle but missing from index

Disciplines:	General ↔ General	Type:	Missing Coordination
Location:	[1] C1 COVER SHEET (cover, p.1)	Sheets:	T2

Description: Sheet T2 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.

Construct.	Cost	Safety	Schedule	Downstrm.
3/10	5/10	2/10	4/10	2/10

Cost Exposure: \$1,898 – \$4,690	Schedule Impact: 10 days
----------------------------------	--------------------------

Recommended Action: Add T2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C375

Missing panel [TAG] for 522 (4 instances)

Disciplines:	Civil ↔ General	Type:	Missing Coordination
Location:	Electrical Room	Sheets:	P5

Description: Equipment 522 (pump) shown on Civil sheet P5 has no matching circuit on any panel schedule. Verify electrical service is provided. AGGREGATED FINDING: 4 individual instances detected across sheets: P5.
Equipment/element tags: .

Construct.	Cost	Safety	Schedule	Downstrm.
3/10	5/10	4/10	2/10	4/10

Cost Exposure: \$1,898 – \$4,690	Schedule Impact: Medium
----------------------------------	-------------------------

Recommended Action: Add circuit for 522 on appropriate panel. Verify voltage, phase, and amperage requirements.

ID: C408

Low

Undefined Symbol 'HP6' — Used in Mechanical drawings but not defined in any legend**Disciplines:** Mechanical ↔ Mechanical**Type:** Missing Coordination**Location:** M6 MECHANICAL SCHEDULES.pdf p.1**Sheets:** M6

Description: The symbol/abbreviation 'HP6' appears on 1 drawing page(s) in the Mechanical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,898 – \$4,690**Schedule Impact:** 10 days

Recommended Action: Add 'HP6' to the Mechanical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C474

Low

Undefined Symbol 'RC4' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A6 BUILDING I & II - ELEVATOR PLANS & SECTIONS.pdf p.1**Sheets:** ELEVATOR PLANS & SECTIONS

Description: The symbol/abbreviation 'RC4' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,898 – \$4,690**Schedule Impact:** 10 days

Recommended Action: Add 'RC4' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C540

Low

Undefined Symbol 'ST4' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'ST4' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,898 – \$4,690**Schedule Impact:** 10 days

Recommended Action: Add 'ST4' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C606

Low

Undefined Symbol 'GFA7' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GFA7' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,898 – \$4,690**Schedule Impact:** 10 days

Recommended Action: Add 'GFA7' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low


ID: C149

Drawing Index: Sheet A4 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A4**Description:** Sheet A4 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost

4/10

Safety

1/10

Schedule

3/10

Downstrm.

4/10

Cost Exposure: \$1,850 – \$4,685**Schedule Impact:** 7 days**Recommended Action:** Add A4 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C171

Drawing Index: Sheet A7 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A7**Description:** Sheet A7 ('RADON - RE- 01') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost

4/10

Safety

5/10

Schedule

3/10

Downstrm.

2/10

Cost Exposure: \$1,850 – \$4,685**Schedule Impact:** 8 days**Recommended Action:** Add A7 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C237

Drawing Index: Sheet M2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** M2**Description:** Sheet M2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.

CROSS-SHEET AGGREGATION: this issue was detected on 2 sheets (M2, M2). Element tag: M2. Original finding IDs collapsed: C2, C2.

Construct.

3/10

Cost

4/10

Safety

5/10

Schedule

3/10

Downstrm.

2/10

Cost Exposure: \$1,850 – \$4,685**Schedule Impact:** 8 days**Recommended Action:** Add M2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C281

Drawing Index: Sheet T2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** T2**Description:** Sheet T2 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost

4/10

Safety

1/10

Schedule

3/10


Downstrm.

4/10

Cost Exposure: \$1,850 – \$4,685**Schedule Impact:** 7 days**Recommended Action:** Add T2 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C501

Undefined Symbol 'TR1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID6 INTERIOR ELEVATIONS.pdf p.1**Sheets:** ID6**Description:** The symbol/abbreviation 'TR1' appears on 5 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.**Construct.**


3/10

Cost

4/10

Safety

3/10

Schedule

3/10

Downstrm.

6/10

Cost Exposure: \$1,850 – \$4,685**Schedule Impact:** 8 days**Recommended Action:** Add 'TR1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C567

Low

Undefined Symbol 'GD1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,850 – \$4,685**Schedule Impact:** 8 days

Recommended Action: Add 'GD1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C633

Low

Undefined Symbol 'UPA2' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES - units.pdf p.1**Sheets:** units

Description: The symbol/abbreviation 'UPA2' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,850 – \$4,685**Schedule Impact:** 8 days


Recommended Action: Add 'UPA2' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C110

Drawing Index: Sheet A1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A1

Description: Sheet A1 ('UNIT DOOR, WINDOW &') exists in the bundle but is not listed on the cover-sheet drawing index.

**Cost Exposure:** \$1,797 – \$4,679**Schedule Impact:** 11 days


Recommended Action: Add A1 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C154

Drawing Index: Sheet A5 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A5

Description: Sheet A5 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.

**Cost Exposure:** \$1,797 – \$4,679**Schedule Impact:** 10 days

Recommended Action: Add A5 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C242

Drawing Index: Sheet P2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** P2

Description: Sheet P2 ('BUILDING I - LEVEL 1') exists in the bundle but is not listed on the cover-sheet drawing index.

**Cost Exposure:** \$1,797 – \$4,679**Schedule Impact:** 11 days

Recommended Action: Add P2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C308

Drawing Index: Sheet UPA1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** UPA1**Description:** Sheet UPA1 ('SCHEME A') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost

3/10

Safety

2/10

Schedule

5/10


Downstrm.

2/10

Cost Exposure: \$1,797 – \$4,679**Schedule Impact:** 11 days**Recommended Action:** Add UPA1 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C114

Drawing Index: Sheet L1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** L1**Description:** Sheet L1 ('A2') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost


5/10

Safety

2/10

Schedule

4/10

Downstrm.

2/10

Cost Exposure: \$1,878 – \$4,666**Schedule Impact:** 10 days**Recommended Action:** Add L1 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C169

Drawing Index: Sheet A7 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A7**Description:** Sheet A7 ('RADON - R2-05') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost

5/10

Safety

1/10

Schedule

4/10

Downstrm.

4/10


Cost Exposure: \$1,878 – \$4,666**Schedule Impact:** 8 days**Recommended Action:** Add A7 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C235


Drawing Index: Sheet M2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** M2**Description:** Sheet M2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.

CROSS-SHEET AGGREGATION: this issue was detected on 2 sheets (M2, M2). Element tag: M2. Original finding IDs collapsed: C2, C2.

**Cost Exposure:** \$1,878 – \$4,666**Schedule Impact:** 8 days**Recommended Action:** Add M2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C246

Drawing Index: Sheet P2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** P2**Description:** Sheet P2 ('BUILDING II - UNDERFLOOR') exists in the bundle but is not listed on the cover-sheet drawing index.**Cost Exposure:** \$1,878 – \$4,666**Schedule Impact:** 10 days**Recommended Action:** Add P2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C444

Undefined Symbol 'DV3' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A-AD1 SCUPPER & OVERFLOW DRAIN
DETAILS AT BRICK.pdf p.1**Sheets:** AD1, ID1

Description: The symbol/abbreviation 'NL1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,878 – \$4,666**Schedule Impact:** 10 days

Recommended Action: Add 'DV3' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C510

Undefined Symbol 'WC3' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID6 INTERIOR ELEVATIONS.pdf p.1**Sheets:** ID6

Description: The symbol/abbreviation 'WC3' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,878 – \$4,666**Schedule Impact:** 10 days

Recommended Action: Add 'WC3' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C576

Undefined Symbol 'GD2' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD2' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.

3/10

Cost

5/10

Safety

2/10

Schedule

4/10

Downstrm.

5/10

Cost Exposure: \$1,878 – \$4,666**Schedule Impact:** 10 days

Recommended Action: Add 'GD2' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C642

Undefined Symbol 'UPF6' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES - units.pdf p.1**Sheets:** units

Description: The symbol/abbreviation 'UPF6' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.

3/10

Cost

5/10

Safety

2/10

Schedule

4/10

Downstrm.

5/10

Cost Exposure: \$1,878 – \$4,666**Schedule Impact:** 10 days


Recommended Action: Add 'UPF6' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C009

Drawing Index: Sheet EXH1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** EXH1, T1, C1

Description: Sheet EXH1 ('DETENTION POND GRADING') exists in the bundle but is not listed on the cover-sheet drawing index.

**Cost Exposure:** \$1,831 – \$4,661**Schedule Impact:** 8 days


Recommended Action: Add EXH1 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C119

Drawing Index: Sheet A5 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A5

Description: Sheet A5 ('A3') exists in the bundle but is not listed on the cover-sheet drawing index.

**Cost Exposure:** \$1,831 – \$4,661**Schedule Impact:** 7 days


Recommended Action: Add A5 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C141

Drawing Index: Sheet L1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** L1

Description: Sheet L1 ('A3') exists in the bundle but is not listed on the cover-sheet drawing index.

**Cost Exposure:** \$1,831 – \$4,661**Schedule Impact:** 8 days

Recommended Action: Add L1 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C185

Drawing Index: Sheet E2 present in bundle but missing from index

Disciplines:

General ↔ General

Type:

Missing Coordination

Location:

[1] C1 COVER SHEET (cover, p.1)

Sheets:

E2

Description:

Sheet E2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.

Construct.

Cost

Safety

Schedule

Downstrm.

5/10

4/10

1/10

3/10

4/10

Cost Exposure: \$1,831 – \$4,661

Schedule Impact: 7 days

Recommended Action:

Add E2 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C251

Drawing Index: Sheet P5 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** P5**Description:** Sheet P5 ('PLUMBING DETAILS') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**


5/10

Cost

4/10

Safety

1/10

Schedule

1/10


Downstrm.

4/10

Cost Exposure: \$1,831 – \$4,661**Schedule Impact:** 3 days**Recommended Action:** Add P5 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C273

Drawing Index: Sheet T2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** T2**Description:** Sheet T2 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**


3/10

Cost


4/10

Safety

5/10

Schedule

3/10

Downstrm.

2/10

Cost Exposure: \$1,831 – \$4,661**Schedule Impact:** 8 days**Recommended Action:** Add T2 to the drawing index or confirm whether it should be removed from the issue set.

ID: C405

Low

Undefined Symbol 'HP3' — Used in Mechanical drawings but not defined in any legend**Disciplines:** Mechanical ↔ Mechanical**Type:** Missing Coordination**Location:** M6 MECHANICAL SCHEDULES.pdf p.1**Sheets:** M6

Description: The symbol/abbreviation 'HP3' appears on 1 drawing page(s) in the Mechanical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,831 – \$4,661**Schedule Impact:** 8 days

Recommended Action: Add 'HP3' to the Mechanical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C471

Low

Undefined Symbol 'PF9' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'PF9' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,831 – \$4,661**Schedule Impact:** 8 days

Recommended Action: Add 'PF9' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C537

Low

Undefined Symbol 'ST1' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'WDF1' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,831 – \$4,661**Schedule Impact:** 8 days

Recommended Action: Add 'ST1' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C603

Low

Undefined Symbol 'GFA4' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GFA4' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,831 – \$4,661**Schedule Impact:** 8 days

Recommended Action: Add 'GFA4' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C124

Drawing Index: Sheet A3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A3**Description:** Sheet A3 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost

3/10

Safety

3/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,779 – \$4,656**Schedule Impact:** 10 days**Recommended Action:** Add A3 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C146

Drawing Index: Sheet A4 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A4**Description:** Sheet A4 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost


3/10

Safety

2/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,779 – \$4,656**Schedule Impact:** 11 days**Recommended Action:** Add A4 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C256

Drawing Index: Sheet T6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** T6**Description:** Sheet T6 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost


3/10

Safety

3/10

Schedule

5/10


Downstrm.

2/10

Cost Exposure: \$1,779 – \$4,656**Schedule Impact:** 10 days**Recommended Action:** Add T6 to the drawing index or confirm whether it should be removed from the issue set.





Low

ID: C278

Drawing Index: Sheet T2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** T2**Description:** Sheet T2 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.****Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$1,779 – \$4,656**Schedule Impact:** 11 days**Recommended Action:** Add T2 to the drawing index or confirm whether it should be removed from the issue set.




Low

ID: C139

Drawing Index: Sheet A5 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A5**Description:** Sheet A5 ('A3') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.****Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$1,859 – \$4,643**Schedule Impact:** 8 days**Recommended Action:** Add A5 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C150

Drawing Index: Sheet A5 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A5**Description:** Sheet A5 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.****Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$1,859 – \$4,643**Schedule Impact:** 10 days**Recommended Action:** Add A5 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C271

Drawing Index: Sheet A4 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A4**Description:** Sheet A4 ('081113 - 4') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost

5/10

Safety

1/10

Schedule

4/10


Downstrm.

4/10

Cost Exposure: \$1,859 – \$4,643**Schedule Impact:** 8 days**Recommended Action:** Add A4 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C282

Drawing Index: Sheet P2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** P2**Description:** Sheet P2 ('CLUBHOUSE - UNDERFLOOR') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost


5/10

Safety

2/10

Schedule

4/10

Downstrm.

2/10

Cost Exposure: \$1,859 – \$4,643**Schedule Impact:** 10 days**Recommended Action:** Add P2 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C337

Drawing Index: Sheet T2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** T2**Description:** Sheet T2 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost

5/10

Safety

1/10

Schedule

4/10

Downstrm.

4/10


Cost Exposure: \$1,859 – \$4,643**Schedule Impact:** 8 days**Recommended Action:** Add T2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C480

Undefined Symbol 'ST8' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1

Description: The symbol/abbreviation 'ST8' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$1,859 – \$4,643**Schedule Impact:** 10 days


Recommended Action: Add 'ST8' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C546

Undefined Symbol 'WC1' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1

Description: The symbol/abbreviation 'WC1' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$1,859 – \$4,643**Schedule Impact:** 10 days

Recommended Action: Add 'WC1' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C612

Undefined Symbol 'GW1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GW1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	5/10	2/10	4/10	5/10

Cost Exposure: \$1,859 – \$4,643**Schedule Impact:** 10 days

Recommended Action: Add 'GW1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C111

Drawing Index: Sheet A1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A1

Description: Sheet A1 ('PUBLIC DOOR SCHEDULES') exists in the bundle but is not listed on the cover-sheet drawing index.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	5/10	3/10	2/10

Cost Exposure: \$1,813 – \$4,638**Schedule Impact:** 8 days

Recommended Action: Add A1 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C155

Drawing Index: Sheet A6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A6**Description:** Sheet A6 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost

4/10

Safety

1/10

Schedule

3/10


Downstrm.

4/10

Cost Exposure: \$1,813 – \$4,638**Schedule Impact:** 7 days**Recommended Action:** Add A6 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C243

Drawing Index: Sheet P2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** P2**Description:** Sheet P2 ('BUILDING I - LEVEL 2') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost


4/10

Safety

5/10

Schedule

3/10


Downstrm.

2/10

Cost Exposure: \$1,813 – \$4,638**Schedule Impact:** 8 days**Recommended Action:** Add P2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C309

Drawing Index: Sheet T1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** T1**Description:** Sheet T1 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**


3/10

Cost


4/10

Safety

5/10

Schedule

3/10

Downstrm.

2/10

Cost Exposure: \$1,813 – \$4,638**Schedule Impact:** 8 days**Recommended Action:** Add T1 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C441

Undefined Symbol 'AB2' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A-AB2 2-HR FIRE WALL DETAILS.pdf p.1**Sheets:** T214B, AB2, ID6, T222B, T213B, T212B, brick unit masonry_Arch, ID1, T211B

Description: The symbol/abbreviation 'CAB1' appears on 7 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,813 – \$4,638**Schedule Impact:** 8 days

Recommended Action: Add 'AB2' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C507

Undefined Symbol 'W1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** 055000 - metal fabrications.pdf p.6**Sheets:** metal fabrications

Description: The symbol/abbreviation 'W1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,813 – \$4,638**Schedule Impact:** 8 days

Recommended Action: Add 'W1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C573

Low

Undefined Symbol 'GD1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,813 – \$4,638**Schedule Impact:** 8 days

Recommended Action: Add 'GD1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C639

Low

Undefined Symbol 'UPF3' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES - units.pdf p.1**Sheets:** units

Description: The symbol/abbreviation 'UPF3' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,813 – \$4,638**Schedule Impact:** 8 days

Recommended Action: Add 'UPF3' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C116

Drawing Index: Sheet A2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A2**Description:** Sheet A2 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost

3/10

Safety

2/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,762 – \$4,633**Schedule Impact:** 11 days**Recommended Action:** Add A2 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C160

Drawing Index: Sheet A7 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A7**Description:** Sheet A7 ('RADON - R1-01') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost


3/10

Safety

3/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,762 – \$4,633**Schedule Impact:** 10 days**Recommended Action:** Add A7 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C248

Drawing Index: Sheet P2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** P2**Description:** Sheet P2 ('BUILDING II - LEVEL 2') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost


3/10

Safety

2/10

Schedule

5/10


Downstrm.

2/10

Cost Exposure: \$1,762 – \$4,633**Schedule Impact:** 11 days**Recommended Action:** Add P2 to the drawing index or confirm whether it should be removed from the issue set.


Low

ID: C109

Drawing Index: Sheet A1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A1**Description:** Sheet A1 ('MATERIAL BOARD') exists in the bundle but is not listed on the cover-sheet drawing index.**Cost Exposure:** \$1,840 – \$4,619**Schedule Impact:** 8 days**Recommended Action:** Add A1 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C120

Drawing Index: Sheet A6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A6**Description:** Sheet A6 ('A3') exists in the bundle but is not listed on the cover-sheet drawing index.**Cost Exposure:** \$1,840 – \$4,619**Schedule Impact:** 10 days**Recommended Action:** Add A6 to the drawing index or confirm whether it should be removed from the issue set.


Low

ID: C175

Drawing Index: Sheet E2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** E2

Description: Sheet E2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.

CROSS-SHEET AGGREGATION: this issue was detected on 3 sheets (E2, E2). Element tag: E2. Original finding IDs collapsed: C1, C1, C1.

**Cost Exposure:** \$1,840 – \$4,619**Schedule Impact:** 8 days**Recommended Action:** Add E2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C186

Drawing Index: Sheet E2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** E2**Description:** Sheet E2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost

5/10

Safety

2/10

Schedule

4/10

Downstrm.

2/10

Cost Exposure: \$1,840 – \$4,619**Schedule Impact:** 10 days**Recommended Action:** Add E2 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C241

Drawing Index: Sheet P2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** P2**Description:** Sheet P2 ('BUILDING I - UNDERFLOOR') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost

5/10

Safety

1/10

Schedule

4/10


Downstrm.

4/10

Cost Exposure: \$1,840 – \$4,619**Schedule Impact:** 8 days**Recommended Action:** Add P2 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C252

Drawing Index: Sheet T4 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** T4, E4**Description:** Sheet E4 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

3/10

Cost


5/10

Safety

2/10

Schedule

4/10

Downstrm.

2/10

Cost Exposure: \$1,840 – \$4,619**Schedule Impact:** 10 days**Recommended Action:** Add T4 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C307

Drawing Index: Sheet UL1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** UL1**Description:** Sheet UL1 ('D.') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost

5/10

Safety

1/10

Schedule

4/10


Downstrm.

4/10

Cost Exposure: \$1,840 – \$4,619**Schedule Impact:** 8 days**Recommended Action:** Add UL1 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C450

Undefined Symbol 'FR1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** FR1.1B2025-1-22-revised-sheet prelim.pdf p.1**Sheets:** FR1**Description:** The symbol/abbreviation 'FR1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.**Construct.**

3/10

Cost

5/10

Safety

2/10

Schedule

4/10

Downstrm.

5/10

Cost Exposure: \$1,840 – \$4,619**Schedule Impact:** 10 days**Recommended Action:** Add 'FR1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C582

Low

Undefined Symbol 'GD7' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD7' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.**

3/10



5/10



2/10



4/10



5/10

Cost Exposure: \$1,840 – \$4,619**Schedule Impact:** 10 days

Recommended Action: Add 'GD7' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C648

Low

Undefined Symbol 'B1' — Used in Landscape drawings but not defined in any legend**Disciplines:** Landscape ↔ Landscape**Type:** Missing Coordination**Location:** (See plan set for details)**Sheets:** T211A, CO-WORK, T221B, LEASING

Description: The symbol/abbreviation 'TV6' appears on 1 drawing page(s) in the Landscape set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.**

3/10



5/10



2/10



4/10



5/10

Cost Exposure: \$1,840 – \$4,619**Schedule Impact:** 10 days

Recommended Action: Add 'B1' to the Landscape legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C125

Drawing Index: Sheet A6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A6**Description:** Sheet A6 ('A3') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost

4/10

Safety

1/10

Schedule

3/10


Downstrm.

4/10

Cost Exposure: \$1,794 – \$4,614**Schedule Impact:** 7 days**Recommended Action:** Add A6 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C147

Drawing Index: Sheet A4 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A4**Description:** Sheet A4 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**


3/10

Cost


4/10

Safety

5/10

Schedule

3/10


Downstrm.

2/10

Cost Exposure: \$1,794 – \$4,614**Schedule Impact:** 8 days**Recommended Action:** Add A4 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C279

Drawing Index: Sheet T2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** T2**Description:** Sheet T2 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**


3/10

Cost


4/10

Safety

5/10

Schedule

3/10

Downstrm.

2/10

Cost Exposure: \$1,794 – \$4,614**Schedule Impact:** 8 days**Recommended Action:** Add T2 to the drawing index or confirm whether it should be removed from the issue set.

ID: C411

Low

Undefined Symbol 'PF9' — Used in Mechanical drawings but not defined in any legend**Disciplines:** Mechanical ↔ Mechanical**Type:** Missing Coordination**Location:** M1 MECHANICAL SPECIFICATIONS.pdf p.1**Sheets:** M1

Description: The symbol/abbreviation 'PF9' appears on 1 drawing page(s) in the Mechanical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$1,794 – \$4,614**Schedule Impact:** 8 days

Recommended Action: Add 'PF9' to the Mechanical legend with a one-line definition, or replace the tag with a defined symbol.

ID: C477

Low

Undefined Symbol 'ST5' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1, A4

Description: The symbol/abbreviation 'ST5' appears on 2 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.****Cost Exposure:** \$1,794 – \$4,614**Schedule Impact:** 8 days

Recommended Action: Add 'ST5' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C543

Low

Undefined Symbol 'W1' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** [1] C6 WATER PROFILES.pdf p.1**Sheets:** C6

Description: The symbol/abbreviation 'W1' appears on 1 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,794 – \$4,614**Schedule Impact:** 8 days

Recommended Action: Add 'W1' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

ID: C609

Low

Undefined Symbol 'GT1' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GT1' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,794 – \$4,614**Schedule Impact:** 8 days

Recommended Action: Add 'GT1' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C389

Florida Amendment Violation: Energy code references IECC only, missing FECC requirements**Disciplines:** A ↔ M**Type:** Ahj Amendment**Location:** See sheets M1**Sheets:** M1

Description: Project in FL. Plans reference 'IECC 2020' without citing the Florida Energy Conservation Code (FECC). FECC has stricter U-factor, SHGC, and SEER requirements than base IECC for Climate Zone 1-2.

Construct.**Cost****Safety****Schedule****Downstrm.**

5/10

4/10

1/10

3/10

4/10

Cost Exposure: \$1,794 – \$4,614**Schedule Impact:** 7

Recommended Action: Verify energy code compliance against FECC 8th Edition, not just base IECC. Florida-specific envelope, HVAC efficiency, and cool-roof requirements may exceed IECC minimums.

Low

ID: C130

Drawing Index: Sheet A3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A3

Description: Sheet A3 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.

Construct.**Cost****Safety****Schedule****Downstrm.**

4/10

3/10

3/10

5/10

2/10

Cost Exposure: \$1,744 – \$4,609**Schedule Impact:** 10 days

Recommended Action: Add A3 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C152

Drawing Index: Sheet A5 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A5

Description: Sheet A5 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.

Construct.**Cost****Safety****Schedule****Downstrm.**

5/10

3/10

2/10

5/10

2/10

Cost Exposure: \$1,744 – \$4,609**Schedule Impact:** 11 days

Recommended Action: Add A5 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C262

Drawing Index: Sheet L2 present in bundle but missing from index

Disciplines:	General ↔ General	Type:	Missing Coordination
Location:	[1] C1 COVER SHEET (cover, p.1)	Sheets:	L2

Description: Sheet L2 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.
CROSS-SHEET AGGREGATION: this issue was detected on 10 sheets (L2, L2, ...+2 more). Element tag: L2. Original finding IDs collapsed: C2, C3, C3, C3.

Construct.	Cost	Safety	Schedule	Downstrm.
4/10	3/10	3/10	5/10	2/10

Cost Exposure: \$1,744 – \$4,609	Schedule Impact: 10 days
----------------------------------	--------------------------

Recommended Action: Add L2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C284

Drawing Index: Sheet P4 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** P4**Description:** Sheet P4 ('PLUMBING RISERS') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost

3/10

Safety

2/10

Schedule

5/10

Downstrm.

2/10

Cost Exposure: \$1,744 – \$4,609**Schedule Impact:** 11 days**Recommended Action:** Add P4 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C117

Drawing Index: Sheet A3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A3**Description:** Sheet A3 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**


3/10

Cost

4/10

Safety

5/10

Schedule

3/10

Downstrm.

2/10

Cost Exposure: \$1,776 – \$4,591**Schedule Impact:** 8 days**Recommended Action:** Add A3 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C161

Drawing Index: Sheet A7 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A7**Description:** Sheet A7 ('RADON - R1-02') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**


5/10

Cost

4/10

Safety

1/10

Schedule

3/10

Downstrm.

4/10


Cost Exposure: \$1,776 – \$4,591**Schedule Impact:** 7 days**Recommended Action:** Add A7 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C249

Drawing Index: Sheet P2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** P2

Description: Sheet P2 ('BUILDING II - LEVEL 3') exists in the bundle but is not listed on the cover-sheet drawing index.

**Cost Exposure:** \$1,776 – \$4,591**Schedule Impact:** 8 days


Recommended Action: Add P2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C293

Drawing Index: Sheet B1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** B1

Description: Sheet B1 ('Feet') exists in the bundle but is not listed on the cover-sheet drawing index.

**Cost Exposure:** \$1,776 – \$4,591**Schedule Impact:** 7 days

Recommended Action: Add B1 to the drawing index or confirm whether it should be removed from the issue set.

ID: C447

Low

Undefined Symbol 'FC4' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A5 EXTERIOR WALL SECTIONS.pdf p.1**Sheets:** A5, P5

Description: The symbol/abbreviation 'Z4' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.**

3/10

4/10

3/10

3/10

6/10

Cost Exposure: \$1,776 – \$4,591**Schedule Impact:** 8 days

Recommended Action: Add 'FC4' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

ID: C579

Low

Undefined Symbol 'GD4' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GD4' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.**Cost****Safety****Schedule****Downstrm.**

3/10

4/10

3/10

3/10

6/10

Cost Exposure: \$1,776 – \$4,591**Schedule Impact:** 8 days


Recommended Action: Add 'GD4' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C056


Drawing Index: Sheet FD1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** FD1, FD2, FD3

Description: Sheet FD1 ('Forming Plan') exists in the bundle but is not listed on the cover-sheet drawing index.
CROSS-SHEET AGGREGATION: this issue was detected on 2 sheets (FD1, FD2, FD2, FD3). Element tag: FD1.
 Original finding IDs collapsed: C5, C5.

**Cost Exposure:** \$1,726 – \$4,586**Schedule Impact:** 11 days**Recommended Action:** Add FD1 to the drawing index or confirm whether it should be removed from the issue set.


Low

ID: C122

Drawing Index: Sheet A3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A3**Description:** Sheet A3 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Cost Exposure:** \$1,726 – \$4,586**Schedule Impact:** 11 days**Recommended Action:** Add A3 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C166

Drawing Index: Sheet A7 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A7**Description:** Sheet A7 ('RADON - R2-02') exists in the bundle but is not listed on the cover-sheet drawing index.**Cost Exposure:** \$1,726 – \$4,586**Schedule Impact:** 10 days**Recommended Action:** Add A7 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C188

Drawing Index: Sheet E2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** E2**Description:** Sheet E2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost

3/10

Safety

2/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,726 – \$4,586**Schedule Impact:** 11 days**Recommended Action:** Add E2 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C254

Drawing Index: Sheet T6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** T6**Description:** Sheet T6 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost


3/10

Safety

2/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,726 – \$4,586**Schedule Impact:** 11 days**Recommended Action:** Add T6 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C320

Drawing Index: Sheet TV6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** TV6**Description:** Sheet TV6 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost


3/10

Safety

2/10

Schedule

5/10

Downstrm.

2/10

Cost Exposure: \$1,726 – \$4,586**Schedule Impact:** 11 days**Recommended Action:** Add TV6 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: GEO528

Pool Missing Geotech-Required Elements**Disciplines:** Civil ↔ General**Type:** Pool Requirements Missing**Location:** Pool Area**Sheets:** A1, L2

Description: Pool plans on A1 OVERALL SITE PLAN, [1] L2 HARDSCAPE DETAILS, [1] L2 FURNISHING SPEC DETAILS do not show: pressure release valves, 4-inch perforated pipe, 6-inch over-excavation. These are required per geotech report for soil and groundwater conditions.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	3/10	5/10

Cost Exposure: \$1,726 – \$4,586**Schedule Impact:** Low

Recommended Action: Add pressure release valves, 4-inch perforated pipe, 6-inch over-excavation to pool design per geotech Section 4.8.

Low

ID: C131

Drawing Index: Sheet A3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A3

Description: Sheet A3 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.

Construct.	Cost	Safety	Schedule	Downstrm.
				
5/10	4/10	1/10	3/10	4/10

Cost Exposure: \$1,757 – \$4,567**Schedule Impact:** 7 days

Recommended Action: Add A3 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C153

Drawing Index: Sheet A5 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A5

Description: Sheet A5 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	5/10	3/10	2/10

Cost Exposure: \$1,757 – \$4,567**Schedule Impact:** 8 days


Recommended Action: Add A5 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C219

Drawing Index: Sheet M2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** M2

Description: Sheet M2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index. CROSS-SHEET AGGREGATION: this issue was detected on 3 sheets (M2, M2, M2). Element tag: M2. Original finding IDs collapsed: C2, C2, C2.

**Cost Exposure:** \$1,757 – \$4,567**Schedule Impact:** 8 days


Recommended Action: Add M2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C285

Drawing Index: Sheet C6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** C6

Description: Sheet C6 ('Eastside Lofts - CASE NO. SPC2-0001') exists in the bundle but is not listed on the cover-sheet drawing index. CROSS-SHEET AGGREGATION: this issue was detected on 8 sheets (C6, C6). Element tag: C6. Original finding IDs collapsed: C2, C2.

**Cost Exposure:** \$1,757 – \$4,567**Schedule Impact:** 8 days


Recommended Action: Add C6 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C483

Undefined Symbol 'ST1' — Used in Architectural drawings but not defined in any legend**Disciplines:** Architectural ↔ Architectural**Type:** Missing Coordination**Location:** A1 STOREFRONT SCHEDULES AND PROFILES.pdf p.1**Sheets:** A1

Description: The symbol/abbreviation 'ST1' appears on 1 drawing page(s) in the Architectural set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$1,757 – \$4,567**Schedule Impact:** 8 days


Recommended Action: Add 'ST1' to the Architectural legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C549

Undefined Symbol 'WC3' — Used in Plumbing drawings but not defined in any legend**Disciplines:** Plumbing ↔ Plumbing**Type:** Missing Coordination**Location:** ID1 FINISH SCHEDULES.pdf p.1**Sheets:** ID1, P4

Description: The symbol/abbreviation 'WC3' appears on 2 drawing page(s) in the Plumbing set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

**Cost Exposure:** \$1,757 – \$4,567**Schedule Impact:** 8 days

Recommended Action: Add 'WC3' to the Plumbing legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C615

Undefined Symbol 'GW3' — Used in Electrical drawings but not defined in any legend**Disciplines:** Electrical ↔ Electrical**Type:** Missing Coordination**Location:** E1 ELECTRICAL GENERAL NOTES.pdf p.1**Sheets:** E1

Description: The symbol/abbreviation 'GW3' appears on 1 drawing page(s) in the Electrical set but is not defined in any LEGEND, SYMBOLS, or ABBREVIATIONS block. This forces the field team to guess at intent and typically generates an RFI.

Construct.	Cost	Safety	Schedule	Downstrm.
				
3/10	4/10	3/10	3/10	6/10

Cost Exposure: \$1,757 – \$4,567**Schedule Impact:** 8 days

Recommended Action: Add 'GW3' to the Electrical legend with a one-line definition, or replace the tag with a defined symbol.

Low

ID: C136

Drawing Index: Sheet A3 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A3

Description: Sheet A3 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.

Construct.	Cost	Safety	Schedule	Downstrm.
				
4/10	3/10	3/10	5/10	2/10

Cost Exposure: \$1,709 – \$4,563**Schedule Impact:** 10 days


Recommended Action: Add A3 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C158

Drawing Index: Sheet A6 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A6**Description:** Sheet A6 ('1') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost


3/10

Safety

2/10

Schedule

5/10


Downstrm.

2/10


Cost Exposure: \$1,709 – \$4,563**Schedule Impact:** 11 days**Recommended Action:** Add A6 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C382

Door Swing Clearance Conflict: door near panel and**Disciplines:** E ↔ A**Type:** Clearance Obstruction**Location:** Mechanical Room**Sheets:** P9, P1**Description:** Door swing detected in proximity to panel and. NEC 110.26 requires 36" clear working space. Door swing arc may encroach on required clearance zone.**Construct.**

2/10

Cost


0/10

Safety

2/10

Schedule

4/10

Downstrm.

1/10


Cost Exposure: \$1,545 – \$4,542**Schedule Impact:** 1**Recommended Action:** Verify door swing direction does not obstruct panel working space. Consider reversing door swing or relocating panel.

Low


ID: C040

Drawing Index: Sheet D1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** D1**Description:** Sheet D1 ('Reponses were estimated from the USGS website') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost


3/10

Safety

3/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,691 – \$4,540**Schedule Impact:** 10 days**Recommended Action:** Add D1 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C128

Drawing Index: Sheet A5 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A5**Description:** Sheet A5 ('A3') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost


3/10

Safety

2/10

Schedule

5/10

Downstrm.

2/10

Cost Exposure: \$1,691 – \$4,540**Schedule Impact:** 11 days**Recommended Action:** Add A5 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C172

Drawing Index: Sheet E2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** E2**Description:** Sheet E2 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.


CROSS-SHEET AGGREGATION: this issue was detected on 3 sheets (E2, E2). Element tag: E2. Original finding IDs collapsed: C1, C1, C1.

Construct.

4/10

Cost


3/10

Safety

3/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,691 – \$4,540**Schedule Impact:** 10 days**Recommended Action:** Add E2 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C260

Drawing Index: Sheet D4 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** D4**Description:** Sheet D4 ('Eastside Lofts - CASE NO. SPC2-0001') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost


3/10

Safety

2/10

Schedule

5/10

Downstrm.

2/10

Cost Exposure: \$1,691 – \$4,540**Schedule Impact:** 11 days**Recommended Action:** Add D4 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C142

Drawing Index: Sheet A5 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** M5, A5, E5**Description:** Sheet E5 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost

3/10

Safety

3/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,673 – \$4,517**Schedule Impact:** 10 days**Recommended Action:** Add A5 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C164

Drawing Index: Sheet A7 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** A7**Description:** Sheet A7 ('RADON - R1-05') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost


3/10

Safety

2/10

Schedule

5/10

Downstrm.

2/10


Cost Exposure: \$1,673 – \$4,517**Schedule Impact:** 11 days**Recommended Action:** Add A7 to the drawing index or confirm whether it should be removed from the issue set.

Low


ID: C274

Drawing Index: Sheet T2 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** T2**Description:** Sheet T2 ('Eastside Lofts') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

4/10

Cost


3/10

Safety

3/10

Schedule

5/10

Downstrm.

2/10

Cost Exposure: \$1,673 – \$4,517**Schedule Impact:** 10 days**Recommended Action:** Add T2 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: C296

Drawing Index: Sheet E1 present in bundle but missing from index**Disciplines:** General ↔ General**Type:** Missing Coordination**Location:** [1] C1 COVER SHEET (cover, p.1)**Sheets:** E1**Description:** Sheet E1 ('PRELIMINARY') exists in the bundle but is not listed on the cover-sheet drawing index.**Construct.**

5/10

Cost

3/10

Safety

2/10

Schedule

5/10

Downstrm.

2/10

Cost Exposure: \$1,673 – \$4,517**Schedule Impact:** 11 days**Recommended Action:** Add E1 to the drawing index or confirm whether it should be removed from the issue set.

Low

ID: R512

Scope Change per CO1: T1 T6 T5**Disciplines:** Civil ↔ Civil**Type:** Specification Mismatch**Location:** ID2 FINISH PLAN BLDG 2 - LEASING.pdf p1**Sheets:** thermal insulation_Elec.pdf p3, LEASING.pdf p1, P4**Description:** CO2 indicates a scope change affecting Unknown, Electrical: 3.5%, Max CO 0.3%. Verify all affected disciplines have been updated to reflect this change.**Construct.**

1/10

Cost

4/10

Safety

3/10

Schedule

1/10

Downstrm.

3/10


Cost Exposure: \$1,748 – \$4,321**Schedule Impact:** 4 days**Recommended Action:** Review CO1 and confirm all disciplines reflect the scope change. Cross-check related sheets for coordination.

Low

ID: T465
Equipment [TAG] Mismatch: HP2 horsepower (3 instances: Spec)

Disciplines:	Civil ↔ General	Type:	Specification Mismatch
Location:	Sheet E2 BUILDING II -ROOF SECTION B -ELECTRICAL	Sheets:	E2, E1, units, E6

Description: HP2 shows horsepower=21 on Architectural plans (Sheet E2 BUILDING II -ROOF SECTION B -ELECTRICAL) but horsepower=43 on Electrical plans (Sheet E6 ELECTRICAL SCHEDULES). Verify correct horsepower value across disciplines. AGGREGATED FINDING: 3 individual instances detected across sheets: . Equipment/element tags: Spec.



Cost Exposure: \$1,681 – \$4,237	Schedule Impact: 9 days
----------------------------------	-------------------------

Recommended Action:

Low

ID: N466
Mixed scales detected in Architectural plans

Disciplines:	Architectural ↔ Architectural	Type:	Specification Mismatch
Location:	Multiple sheets	Sheets:	FR1, T400

Description: Architectural plans use 4 different scales: Scale: 3/4" = 1'-0", SCALE 1 : 3, SCALE 1 : 2, Scale: 1/8" = 1'-0". This may cause dimension confusion during construction.



Cost Exposure: \$1,461 – \$4,060	Schedule Impact: < 7 days
----------------------------------	---------------------------

Recommended Action: Verify all scale notations are correct and consistent.

Methodology & Disclaimer

Analysis Methodology

This conflict analysis was performed using Flikt.AI's proprietary AI-powered plan coordination engine. The system analyzed architectural and engineering plans to identify potential spatial clashes, coordination issues, and conflicts that could impact project delivery. Each conflict has been evaluated across five key dimensions: constructability, cost impact, safety implications, schedule disruption, and downstream effects.

Confidence Levels

Each identified conflict includes a confidence score (0–1.0) indicating detection reliability. Scores of 0.9+ indicate high certainty; 0.7–0.9 indicate good confidence; below 0.7 warrants manual verification. Human review is recommended for all critical and major severity conflicts.

Cost & Schedule Estimates

Cost exposure ranges represent estimated rework, delay, and mitigation expenses. Schedule impact estimates indicate typical delay periods based on conflict severity and discipline involvement. Actual costs depend on project-specific factors, contractual arrangements, and resolution strategies.

Important Disclaimer

This report represents an automated analysis by Flikt.AI and should not be considered a complete or exhaustive identification of all plan conflicts. The report is intended to supplement, not replace, traditional coordination meetings and detailed plan reviews by qualified professionals. Flikt.AI makes no warranty regarding completeness or accuracy. Project teams should verify all findings before making decisions based on this analysis. Use of this report is subject to Flikt.AI's terms of service.

About Flikt.AI

Flikt.AI — AI-Powered Plan Coordination
Email: info@flikt.ai | Web: www.flikt.ai

Flikt.AI is the leading AI platform for coordinating complex construction projects, identifying conflicts early, and improving project delivery outcomes.

Report generated: 2026-04-19 14:51
© 2026 Flikt.AI. All rights reserved. CONFIDENTIAL.