
ASSEMBLY GUIDE · 20 MM

# PP Stack


A rotary encoder you can also push and pull.

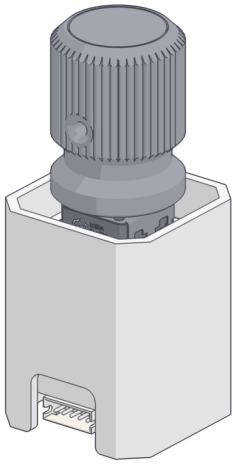

BEFORE YOU START

## The parts

Two identical PCBs, a 3D-printed frame and housing, and a handful of parts to solder.

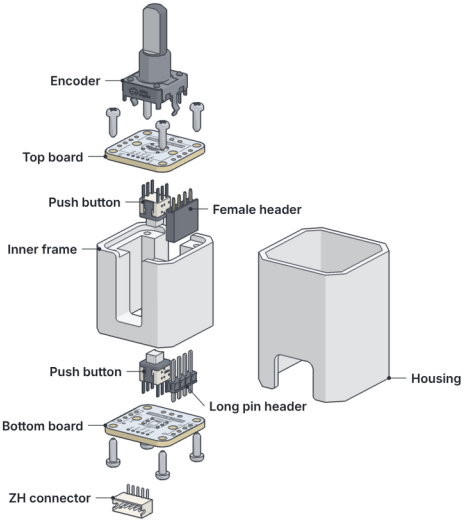



**Parts**

- **2×** PCB
- **1×** Rotary encoder EC12E
- **2×** Push button SAMZO 2010751102
- **1×** Female header 4 pin, 2.54
- **1×** Long pin header 4 pin, 21 mm
- **1×** ZH1.5 connector 5 pin
- **8×** M2 self-tapping screw
- **1×** Inner frame + housing printed

BEFORE YOU START

## One PCB, two jobs

Both boards are the same PCB. The headers decide which is which.
U4 and U5 are mirrored, so with the top board flipped on, U4 lands on U5.

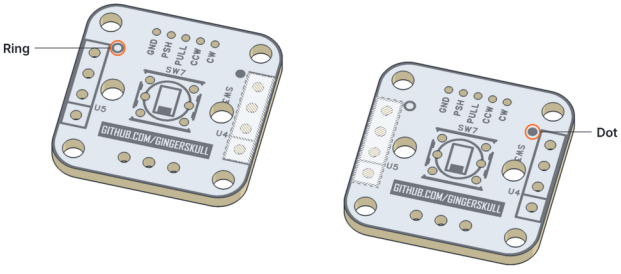


**Bottom board**
Long pins in U5, by the ring


**Top board**
Female header in U4, by the dot

! Hatched slot stays empty on each board.

BEFORE YOU START

## How it works

The boards, frame and encoder move as one stack.
A bar fixed in the housing sits between the two buttons.

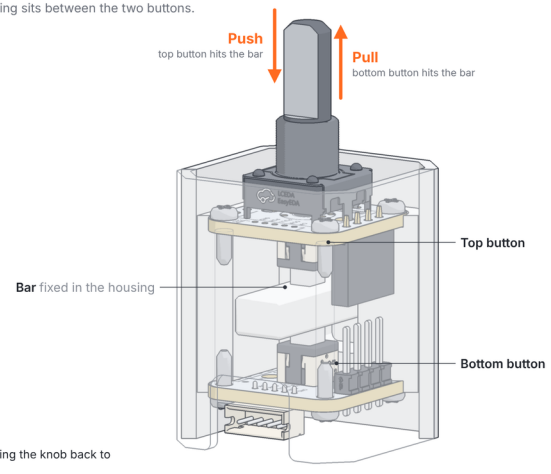


! The buttons also spring the knob back to centre.


# A Bottom board

Steps 1–3

## 1 Push button

A · Bottom board · Button side

Notch on the button goes **opposite** the filled mark in the SW7 outline.

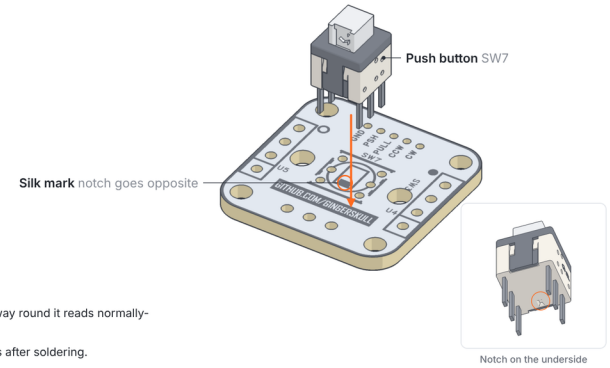



- The wrong way round it reads normally-closed.
- Trim the legs after soldering.

## 2 Long pin header

A · Bottom board · U5

Into U5, next to the ring. U4 stays empty on this board.

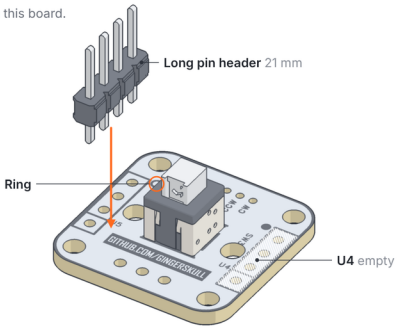



- Keep it square to the board. These pins mate with the top board later.

## 3 ZH connector

A · Bottom board · Flip

Flip the board. Opening faces the board edge.

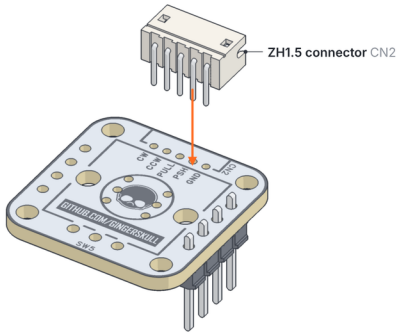



# B Top board

Steps 4–6

## 4 Push button

B · Top board · Button side

Same as step 1: notch opposite the silk mark.

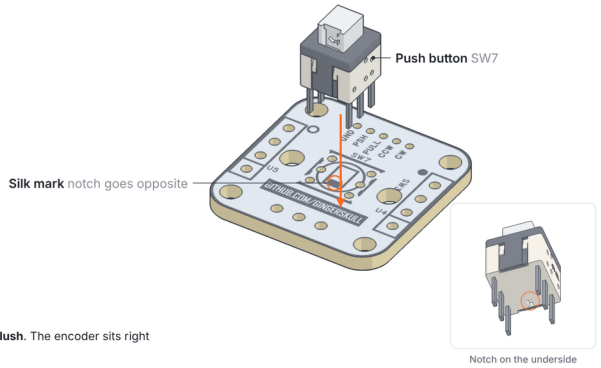



- Trim the legs **flush**. The encoder sits right over them.

## 5 Female header

B · Top board · U4

Into U4, next to the dot. U5 stays empty on this board.

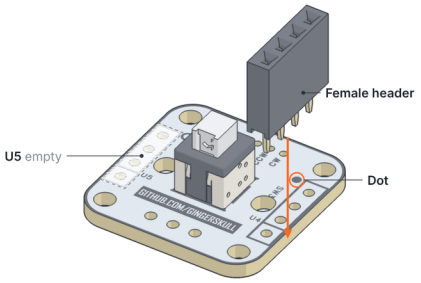



- When the boards stack, ring meets dot.

## 6 Encoder

B · Top board · Flip

Flip the board and fit the encoder.

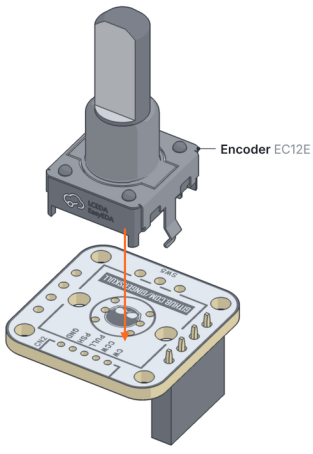


- Solder the mounting tabs too. They carry the push/pull load.


# C Assembly

Steps 7–10

## 7 Bottom board onto the frame

C · Assembly | Bottom board + frame

Button side into the frame. Four M2 self-tapping screws.

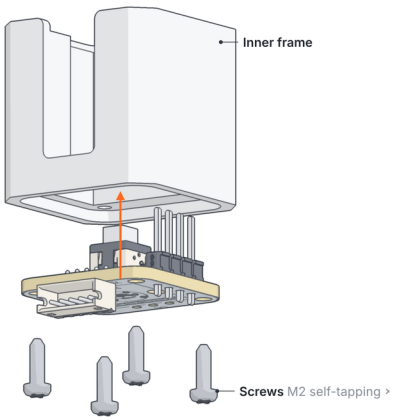



! Snug, not tight. They're cutting threads in plastic.

## 8 Into the housing

C · Assembly | From below

Slide the frame up into the housing. The slots pass over the bar, connector lines up with the cutout.

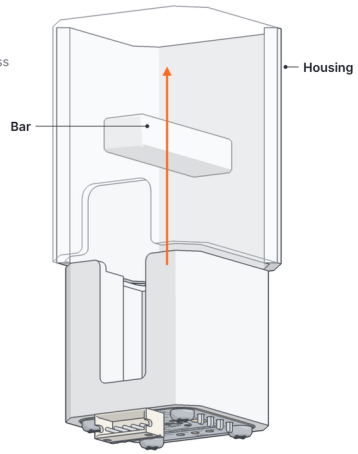



! The bar ends up between the two push buttons. That's the whole push/pull trick.

## 9 Top board

C · Assembly | Top board, from above

Female header drops onto the long pins. Dot sits over the ring. Screw it down.

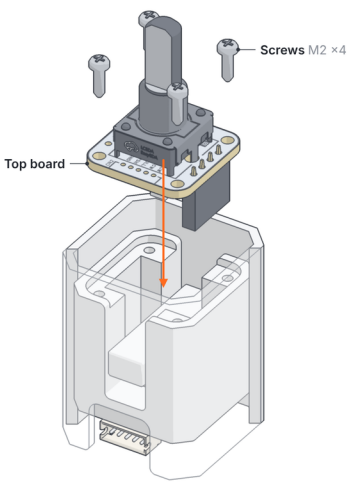



! Check the pins line up before pushing down.

## 10 Done

C · Assembly | PP Stack · 20 mm

Knob on, cable in.

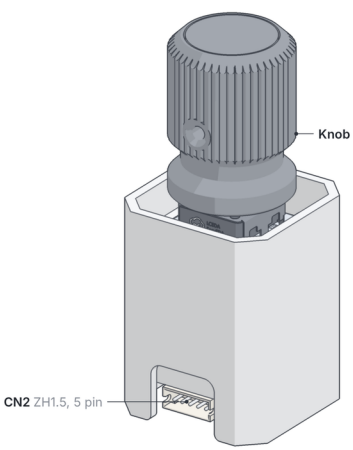


**CN2 pinout**

1. GND
2. PULL
3. PUSH
4. CCW
5. CW